

Numerical Control (CNC)

Alarm/Parameter Manual

M800V/M80V Series

Introduction

This manual describes the alarms and parameters of Mitsubishi Electric CNC.

Improper handling can cause unexpected malfunctions. To use this device correctly, be sure to read this manual before use.

Supported models of this manual are as follows:

Supported models	Abbreviations in this manual
M800VW Series	M850VW, M830VW
M800VS Series	M850VS, M830VS
M80VW Series	M80VW
M80V Series	M80V TypeA, M80V TypeB

Abbreviations for model names used in this manual are as follows:

Abbreviations	Supported models
M800V, M800V Series	M800VW Series/M800VS Series
M80V, M80V Series	M80VW Series/M80V Series
M800V/M80V, M800V/M80V Series	M800VW Series/M800VS Series/M80VW Series/M80V Series
M8V, M8V Series	

To safely use this CNC unit, thoroughly study the "Precautions for Safety" before use.

Be sure to keep this manual on hand so that users can refer to it at any time.

Also refer to the manuals on "Manual List" as necessary.

Notes on reading this manual

- (1) This manual explains general parameters which are operated on the CNC side.
For information about each machine tool, refer to manuals issued by the machine tool builder.
If the descriptions relating to "restrictions" and "allowable conditions" conflict between this manual and the machine tool builder's manual, the later has priority over the former.
- (2) This manual is intended to contain as much descriptions as possible even about special operations.
The operations to which no reference is made in this manual should be considered "impossible".

Details described in this manual

•In this manual, the following abbreviations might be used.

L system: Lathe system

M system: Machining center system

MTB: Machine tool builder

Manual List

Manuals related to M800V/M80V Series are listed as follows.

These manuals are written on the assumption that all optional functions are added to the targeted model.

Some functions or screens may not be available depending on the machine or specifications set by MTB. (Confirm the specifications before use.)

The manuals issued by MTB take precedence over these manuals.

Manual	IB No.	Purpose and Contents
M800V/M80V Series Instruction Manual	IB-1501618	<ul style="list-style-type: none">• Operation guide for NC• Explanation for screen operation, etc.
M800V/M80V Series Programming Manual (Lathe System) (1/2)	IB-1501619	<ul style="list-style-type: none">• G code programming for lathe system• Basic functions, etc.
M800V/M80V Series Programming Manual (Lathe System) (2/2)	IB-1501620	<ul style="list-style-type: none">• G code programming for lathe system• Functions for multi-part system, high-accuracy function, etc.
M800V/M80V Series Programming Manual (Machining Center System) (1/2)	IB-1501621	<ul style="list-style-type: none">• G code programming for machining center system• Basic functions, etc.
M800V/M80V Series Programming Manual (Machining Center System) (2/2)	IB-1501622	<ul style="list-style-type: none">• G code programming for machining center system• Functions for multi-part system, high-accuracy function, etc.
M800V/M80V Series Alarm/Parameter Manual	IB-1501623	<ul style="list-style-type: none">• Alarms• Parameters

Manuals for MTBs (NC)

Manual	IB No.	Purpose and Contents
M800V/M80V Series Specifications Manual (Function)	IB-1501610	<ul style="list-style-type: none"> ♦ Model selection ♦ Outline of various functions
M800V/M80V Series Specifications Manual (Hardware)	IB-1501611	<ul style="list-style-type: none"> ♦ Model selection ♦ Specifications of hardware unit
M800VW/M80VW Series Connection and Setup Manual	IB-1501612	<ul style="list-style-type: none"> ♦ Detailed specifications of hardware unit ♦ Installation, connection, wiring, setup (startup/adjustment)
M800VS/M80V Series Connection and Setup Manual	IB-1501613	<ul style="list-style-type: none"> ♦ Detailed specifications of hardware unit ♦ Installation, connection, wiring, setup (startup/adjustment)
M800V/M80V Series PLC Development Manual	IB-1501614	<ul style="list-style-type: none"> ♦ Electrical design ♦ I/O relation (assignment, setting, connection), field network ♦ Development environment (PLC on-board, peripheral development environment), etc.
M800V/M80V Series PLC Programming Manual (1/2)	IB-1501667	<ul style="list-style-type: none"> ♦ Electrical design ♦ Sequence programming ♦ Explanation for instructions, functions, and parameters
M800V/M80V Series PLC Programming Manual (2/2)	IB-1501668	<ul style="list-style-type: none"> ♦ Electrical design ♦ Sequence programming ♦ Usage examples of instructions
M800V/M80V Series PLC Interface Manual	IB-1501616	<ul style="list-style-type: none"> ♦ Electrical design ♦ Interface signals between NC and PLC
M800V/M80V Series Maintenance Manual	IB-1501617	<ul style="list-style-type: none"> ♦ Cleaning and replacement for each unit ♦ Other items related to maintenance
NC Designer2 Instruction Manual	IB-1501250	<ul style="list-style-type: none"> ♦ Explanation for handling NC NC Designer2
High Speed Processing Unit User's Manual	IB-1501714	<ul style="list-style-type: none"> ♦ Specifications for high speed processing unit (HPU)
NC Machining AI Diagnosis NC MachiningAID Instruction Manual	IB-1501762	<ul style="list-style-type: none"> ♦ Explanation for handling NC MachiningAID

Manuals for MTBs (drive section)

Manual	IB No.	Contents
MDS-E/EH Series Specifications Manual	IB-1501226	<ul style="list-style-type: none"> ♦ Specifications for power supply regeneration type
MDS-E/EH Series Instruction Manual	IB-1501229	<ul style="list-style-type: none"> ♦ Instruction for power supply regeneration type
MDS-EJ/EJH Series Specifications Manual	IB-1501232	<ul style="list-style-type: none"> ♦ Specifications for regenerative resistor type
MDS-EJ/EJH Series Instruction Manual	IB-1501235	<ul style="list-style-type: none"> ♦ Instruction for regenerative resistor type
MDS-EM/EMH Series Specifications Manual	IB-1501238	<ul style="list-style-type: none"> ♦ Specifications for multi-hybrid, power supply regeneration type
MDS-EM/EMH Series Instruction Manual	IB-1501241	<ul style="list-style-type: none"> ♦ Instruction for multi-hybrid, power supply regeneration type
DATA BOOK	IB-1501252	<ul style="list-style-type: none"> ♦ Specifications of servo drive unit, spindle drive unit, motor, etc.
MDS-EX-CVP Series Specifications and Instruction Manual	IB-1501587	<ul style="list-style-type: none"> ♦ Specifications and instruction for the power supply unit with large capacity

Manuals for MTBs (Others)

Manual	No.	Purpose and Contents
GOT2000 Series User's Manual (Hardware)	SH-081194ENG	• Outline of hardware such as part names, external dimensions, installation, wiring, maintenance, etc. of GOTs
GOT2000 Series User's Manual (Utility)	SH-081195ENG	• Outline of utilities such as screen display setting, operation method, etc. of GOTs
GOT2000 Series User's Manual (Monitor)	SH-081196ENG	• Outline of each monitor function of GOTs
GOT2000 Series Connection Manual (Mitsubishi Electric Products)	SH-081197ENG	• Outline of connection types and connection method between GOT and Mitsubishi Electric connection devices
GOT2000 Series Connection Manual (Non-Mitsubishi Electric Products 1)	SH-081198ENG	• Explanation for connection types and connection method between GOT and other company's devices
GOT2000 Series Connection Manual (Non-Mitsubishi Electric Products 2)	SH-081199ENG	
GOT2000 Series Connection Manual (Microcomputers, MODBUS/Fieldbus Products, Peripherals)	SH-081200ENG	• Explanation for connection types and connection method between GOT and microcomputers, MODBUS/fieldbus products, peripherals
GT SoftGOT2000 Version1 Operating Manual	SH-081201ENG	• Explanation for system configuration, screen configuration and operation method of monitoring software GT SoftGOT2000
GT Designer3 (GOT2000) Screen Design Manual	SH-081220ENG	• Outline of screen design method using screen creation software GT Designer3
GOT2000/GOT1000 Series CC-Link Communication Unit User's Manual	IB-0800351	• Explanation for handling CC-Link communication unit (for GOT2000 series/GOT1000 series)
GX Developer Version 8 Operating Manual (Startup)	SH-080372E	• Explanation for system configuration, installation, etc. of PLC development tool GX Developer
GX Developer Version 8 Operating Manual	SH-080373E	• Explanation for operations using PLC development tool GX Developer
GX Converter Version 1 Operating Manual	IB-0800004	• Explanation for operations using data conversion tool GX Converter
GX Works2 Installation Instructions	BCN-P5999-0944	• Explanation for the operating environment and installation method of GX Works2
GX Works2 Version 1 Operating Manual (Common)	SH-080779ENG	• Explanation for the system configuration of GX Works2 and the functions common to Simple project and Structured project such as parameter setting, operation method for the online function
GX Works2 Version 1 Operating Manual (Simple Project)	SH-080780ENG	• Explanation for methods for such as creating and monitoring programs in Simple project of GX Works2
GX Works2 Version 1 Operating Manual (Simple Project, Function Block)	SH-080984ENG	• Explanation for methods for such as creating function blocks, pasting function blocks to sequence programs, and operating FB library in Simple project of GX Works2
GX Works2 Version 1 Operating Manual (Structured Project)	SH-080781ENG	• Explanation for methods for such as creating and monitoring programs in Structured project of GX Works2
GX Works3 Installation Instructions	BCN-P5999-0391	• Explanation for the operating environment and installation method of GX Works3
MELSEC-Q/L/F Structured Programming Manual (Fundamentals)	SH-080782ENG	• Explanation for programming methods, types of programming languages, etc. required to create structured programs
MELSEC-Q/L Structured Programming Manual (Application Functions)	SH-080784ENG	• Explanation for specifications and functions related to application functions which can be used in structured programs
MELSEC-Q CC-Link System Master/Local Module User's Manual	SH-080394E	• Explanation for system configuration, installation, wiring, etc. of master/local modules for CC-Link system
MELSEC iQ-R Programming Manual (CPU Module Instructions, Standard Functions/Function Blocks)	SH-081266ENG	• Explanation for instructions, general-purpose functions, and general-purpose function blocks required for programming the sequencer MELSEC iQ-R series

Reference Manual for MTBs

Manual	No.	Purpose and Contents
M800/M80 Series Smart safety observation Specification manual	BNP-C3072-022	♦ Explanation for smart safety observation function
M800/M80 Series Interactive cycle insertion (Customization) Specification manual	BNP-C3072-121-0003	♦ Explanation for interactive cycle insertion
M800/M80 Series Synchronous Control Specifications manual	BNP-C3072-074	♦ Explanation for synchronous control
M800/M80 Series Multiple-Axis Synchronization Control Specifications manual	BNP-C3072-339	♦ Explanation for multiple-axis synchronization control
M800/M80 Series GOT Connection Specifications manual	BNP-C3072-314	♦ Explanation for GOT connection
M800/M80 Series PROFIBUS-DP Specification manual	BNP-C3072-118	♦ Explanation for PROFIBUS-DP communication function
M800/M80 Series EtherNet/IP Specifications manual	BNP-C3072-263	♦ Explanation for EtherNet/IP
M800/M80 Series FL-net Specifications manual	BNP-C3072-368	♦ Explanation for FL-net
M800/M80 Series CC-Link (Master/Local) Specification manual	BNP-C3072-089	♦ Explanation for CC-Link
M800/M80 Series CC-Link IE Field (Master/local) Specifications manual	BNP-C3072-283	♦ Explanation for CC-Link IE Field
M800/M80 Series CC-Link IE Field Basic Specifications manual	BNP-C3072-337	♦ Explanation for CC-Link IE Field Basic
M800V/M80V Series CC-Link IE TSN (Remote Station) Specifications manual	BNP-C3095-399	♦ Explanation for CC-Link IE TSN (Remote Station)

Precautions for Safety

Always read the specifications issued by the machine tool builder, this manual, related manuals and attached documents before installation, operation, programming, maintenance or inspection to ensure correct use.

Understand this numerical controller, safety items and cautions before using the unit.

This manual ranks the safety precautions into "DANGER", "WARNING" and "CAUTION".

DANGER


When the user may be subject to imminent fatalities or major injuries if handling is mistaken.

WARNING

When the user may be subject to fatalities or major injuries if handling is mistaken.

CAUTION

When the user may be subject to medium or minor injuries or when only property damage may occur, if handling is mistaken.

Note that even items ranked as " CAUTION" may lead to serious consequences depending on the situation. All the items are important and must always be observed.

The following signs indicate prohibition and compulsory.



This sign indicates prohibited behavior (must not do).

For example,  indicates "Keep fire away".



This sign indicates a thing that is compulsory (must do).

For example,  indicates "it must be grounded".

The meaning of each pictorial sign is as follows.

 CAUTION	 CAUTION rotated object	 CAUTION HOT	 Danger Electric shock risk	 Danger explosive
 Prohibited	 Disassembly is prohibited	 KEEP FIRE AWAY	 General instruction	 Earth ground

For Safe Use

Mitsubishi Electric CNC is designed and manufactured solely for applications to machine tools to be used for industrial purposes.

Do not use this product in any applications other than those specified above, especially those which are substantially influential on the public interest or which are expected to have significant influence on human lives or properties.

DANGER








Not applicable in this manual.

WARNING



Not applicable in this manual.

CAUTION



(1) Product and manual

-  For items described as "Restrictions" or "Usable State" in this manual, the instruction manual issued by the machine tool builder takes precedence over this manual.
-  Items not described in this manual must be interpreted as "not possible".
-  This manual is written on the assumption that all the applicable functions are included. Some of them, however, may not be available for your NC system. Refer to the specifications issued by the machine tool builder before use.
-  Refer to the Instruction Manual issued by each machine tool builder for details on each machine tool.
-  Some screens and functions may differ depending on the NC system (or its version), and some functions may not be possible. Please confirm the specifications before use.
-  To protect the availability, integrity and confidentiality of the NC system against cyber-attacks including unauthorized access, denial-of-service (DoS) (*1) attack, and computer virus from external sources via a network, take security measures such as firewall, VPN, and anti-virus software.
(*1) Denial-of-service (DoS) refers to a type of cyber-attack that disrupts services by overloading the system or by exploiting a vulnerability of the system.
-  Mitsubishi Electric assumes no responsibility for any problems caused to the NC system by any type of cyber-attacks including DoS attack, unauthorized access and computer virus.



(2) Adjustments

-  Do not adjust or change the parameter settings greatly as operation could become unstable.
-  In the explanation on bits, set all bits not used, including blank bits, to "0".

(3) Troubleshooting

-  If the battery low warning is issued in the controller side, save the machining programs, tool data and parameters in an input/output device, and then replace the battery. When the battery alarm is issued, the machining programs, tool data and parameters may have been destroyed. Replace the battery and then reload the data.
-  If the battery low warning is issued in the drive unit side, immediately replace the battery. Replace the batteries while applying the drive unit's control power.

(4) Maintenance, inspection and part replacement

-  Do not short-circuit, charge, heat, incinerate or disassemble the battery.
-  Dispose of the spent battery according to local laws.

Disposal



(Note) This symbol mark is for EU countries only.
This symbol mark is according to the directive 2006/66/EC Article 20 Information for end-users and Annex II.

Your MITSUBISHI ELECTRIC product is designed and manufactured with high quality materials and components which can be recycled and/or reused.

This symbol means that batteries and accumulators, at their end-of-life, should be disposed of separately from your household waste.

If a chemical symbol is printed beneath the symbol shown above, this chemical symbol means that the battery or accumulator contains a heavy metal at a certain concentration. This will be indicated as follows:

Hg: mercury (0.0005%), Cd: cadmium (0.002%), Pb: lead (0.004%)

In the European Union there are separate collection systems for used batteries and accumulators.

Please, dispose of batteries and accumulators correctly at your local community waste collection/recycling centre.

Please, help us to conserve the environment we live in!

Trademarks

MELDAS, MELSEC, EZSocket, EZMotion, iQ Platform, MELSEC iQ-R, MELSOFT, GOT, CC-Link, CC-Link/LT, CC-Link IE, CC-Link IE/field, CC-Link IE/field Basic, CC-Link IE TSN, EcoMonitorLight and SLMP are either trademarks or registered trademarks of Mitsubishi Electric Corporation in Japan and/or other countries.

Ethernet is a registered trademark of Xerox Corporation in the United States and/or other countries.

Microsoft®, Windows®, SQL Server® and Access® are either trademarks or registered trademarks of Microsoft Corporation in the United States and/or other countries.

SD logo and SDHC logo are either registered trademarks or trademarks of LLC.

UNIX is a registered trademark of The Open Group in the United States and/or other countries.

Intel® and Pentium® are either trademarks or registered trademarks of Intel Corporation in the United States and/or other countries.

MODBUS® is either a trademark or a registered trademark of Schneider Electric USA, Inc. or the affiliated companies in Japan and/or other countries.

EtherNet/IP is a trademark of Open DeviceNet Vendor Association, Inc.

PROFIBUS-DP is either a trademark or a registered trademark of PROFIBUS User Organization.

Oracle® is a registered trademark of Oracle Corporation, the subsidiaries, or the affiliated companies in the United States and /or other countries.

VNC is a registered trademark of RealVNC Ltd. in the United States and other countries.

QR Code is a registered trademark of DENSO WAVE INCORPORATED.

TRELLIX is a registered trademark or a trademark of Musarubra US LLC or its subsidiaries in the United States and other countries.

Punchtap is licensed by EMUGE.

The term HDMI and the HDMI Logo are trademarks or registered trademarks of HDMI Licensing Administrator, Inc. in the United States and other countries.

Wi-Fi is either a trademark or a registered trademark of Wi-Fi Alliance.

BiSS is a registered trademark of iC-Haus GmbH.

SPRINT™ is a trademark of Renishaw plc.

Other company and product names that appear in this manual are trademarks or registered trademarks of the respective companies.

本製品の取扱いについて

(日本語 /Japanese)

本製品は工業用 (クラス A) 電磁環境適合機器です。販売者あるいは使用者はこの点に注意し、住商業環境以外での使用をお願いいたします。

Handling of our product

(English)

This is a class A product. In a domestic environment this product may cause radio interference in which case the user may be required to take adequate measures.

본 제품의 취급에 대해서

(한국어 /Korean)

이 기기는 업무용 (A 급) 전자파적합기기로서 판매자 또는 사용자는 이 점을 주의하시기 바라며 가정외의 지역에서 사용하는 것을 목적으로 합니다 .

Contents

Alarm

1 Operation Errors (M)	3
2 Stop Codes (T)	49
3 Servo/Spindle Alarms (S)	59
3.1 Servo Errors (S01/S03/S04)	60
3.2 Initial Parameter Errors (S02)	70
3.3 Safety Function Errors (S05)	72
3.4 Parameter Errors (S51)	73
3.5 Servo Warnings (S52)	74
3.6 Safety Function Warnings (S53)	77
4 MCP Alarms (Y)	79
5 System Alarms (Z)	95
6 Absolute Position Detection System Alarms (Z7*)	117
7 Distance-coded Reference Scale Errors (Z8*)	121
8 Emergency Stop Alarms (EMG)	123
9 Computer Link Errors (L)	127
10 User PLC Alarms (U)	129
11 Network Service Errors (N)	141
12 Program Errors (P)	145
13 Smart Safety Observation Alarm (V)	187
13.1 Smart Safety Observation Error (V01/V02/V03/V04/V05/V06/V07)	188
13.2 Smart Safety Observation Warning (V50/V51/V52/V53/V54)	199

Parameter

14 User Parameters	205
14.1 Machining Parameters	206
14.2 Fixed Cycle Parameters	225
14.3 Control Parameters 1	227
14.4 Control Parameters 2	236
14.5 I/O Parameters	239
14.6 Axis Parameters	259
14.7 Ethernet Parameters	263
14.8 Computer Link Parameters	279
14.9 Subprogram Storage Location Parameters	282
14.10 Barrier Data (for L system only)	286
14.11 High-accuracy Control Parameters	289
14.12 High-accuracy Control Axis Parameters	298
14.13 Operation Parameters	300
14.14 Machining Condition Selection Parameters	321
14.15 Menu Selection Parameters	336
14.16 Tolerance Parameters	338
14.17 Wireless LAN Parameters	340

15 Machine Parameters	345
15.1 Base System Parameters	346
15.2 Base Axis Specification Parameters	377
15.3 Base Common Parameters	382
15.4 Axis Specifications Parameters	487
15.5 Zero Point Return Parameters	528
15.6 Absolute Position Detection Parameters	534
15.7 Servo Parameters	536
15.8 Spindle Specification Parameters	570
15.9 Spindle Parameters	610
15.10 Spindle-type Servo Parameters	643
15.11 Rotary Axis Configuration Parameters	644
15.12 PLC Timer	653
15.13 PLC Integrated Timer	654
15.14 PLC Counter	655
15.15 PLC Constants	656
15.16 PLC Bit Selection	657
15.17 Machine Error Compensation Parameters	660
15.18 Macro List	662
15.19 Position Switches	672
15.20 RIO Device Allocation Parameters	673
15.21 Open Parameters	685
15.22 Device Open Parameters	686
15.23 SRAM Open Parameters	687
15.24 CC-Link Parameters	688
15.25 PLC Axis Indexing Parameters	701
15.26 Machine Type Parameters	711
15.27 Machining Time Parameters	714
15.28 Safety Common Parameters	716
15.29 Safety Axis Parameters	718
15.30 Safety Spindle Parameters	724
15.31 Safety I/O Assignment Parameters	727
15.32 EtherNet/IP Parameters	729
15.32.1 EtherNet/IP Parameters Scanner 1	729
15.32.2 EtherNet/IP Parameters Scanner 2	732
15.32.3 EtherNet/IP Parameters Adapter 1	733
15.32.4 EtherNet/IP Parameters Adapter 2	736
15.33 CC-Link IE Field Parameters	738
15.33.1 CC-Link IE Field Network 1	738
15.33.2 CC-Link IE Field Network 2	742
15.33.3 CC-Link IE Field Master Parameters	746
15.33.4 CC-Link IE Field Network Basic	748
15.34 CC-Link IE TSN (Remote station) Parameters	753
15.35 PROFIBUS-DP Parameters	759
15.36 FL-net Parameters	760
15.37 Laser Parameters	771
15.38 NC Axis Switch Parameters	777
15.39 Spindle Switch Parameters	778

Alarm



Operation Errors (M)

M01	Dog overrun	0001
Details		
[Dog overrun]		
When returning to the reference position, the near-point detection limit switch did not stop over the dog, but overran the dog.		
[Aux ax dog overrun]		
When executing dog-type reference position, the zero point return speed is too fast or the dog length is too short.		
Remedy		
[Dog overrun]		
<ul style="list-style-type: none"> •Increase the length of the near-point dog. •Reduce the reference position return speed. 		
[Aux ax dog overrun]		
<ul style="list-style-type: none"> •Lower the zero point return speed or increase the dog length. 		
M01	Some ax does not pass Z phase	0002
Details		
One of the axes did not pass the Z-phase during the initial reference position return after the power was turned ON.		
Remedy		
<ul style="list-style-type: none"> •Move the encoder one rotation or more in the opposite direction of the reference position, and repeat reference position return. 		
M01	R-pnt direction illegal	0003
Details		
[R-pnt direction illegal]		
When manually returning to the reference position, the return direction differs from the axis movement direction selected with the AXIS SELECTION key.		
[Aux ax R-pnt direction illegal]		
When executing reference position return, the axis was moved in the opposite of the designated direction.		
Remedy		
[R-pnt direction illegal]		
<ul style="list-style-type: none"> •The selection of the AXIS SELECTION key's +/- direction is incorrect. The error is canceled by feeding the axis in the correct direction. 		
[Aux ax R-pnt direction illegal]		
<ul style="list-style-type: none"> •Move the axis in the correct direction. 		
M01	External interlock axis exists	0004
Details		
[External interlock axis exists]		
The external interlock function has activated (the input signal is "OFF") and one of the axes has entered the interlock state.		
[Aux ax external interlock]		
The axis interlock function is valid.		
Remedy		
[External interlock axis exists]		
<ul style="list-style-type: none"> •As the interlock function has activated, release it before resuming operation. •Check the sequence on the machine side. •Check for any broken wires in the "interlock" signal line. 		
[Aux ax external interlock]		
<ul style="list-style-type: none"> •Cancel the interlock signal. 		

M01	Internal interlock axis exists	0005
Details		
[Internal interlock axis exists]		
The internal interlock state has been entered.		
The axis with absolute encoder has been detached.		
A command for the manual/automatic simultaneous valid axis was issued from the automatic mode.		
The manual speed command was issued while the "tool length measurement 1" signal is ON.		
A travel command has been issued to an inclined axis whose basic axis is in control axis synchronization between part systems.		
Selected an axis other than the 1st axis when the manual speed command was issued.		
A travel command has been issued to an axis stopped by the collision detection function.		
Positioning or interpolation command was issued during the spindle-mode rotary axis control mode.		
[Aux ax internal interlock]		
An interlock was established by the servo OFF function.		
Remedy		
[Internal interlock axis exists]		
♦The servo OFF function is valid, so release it first.		
♦An axis that can be removed has been issued, so perform the correct operations.		
♦The command is issued in the same direction as the direction where manual skip turned ON, so perform the correct operations.		
♦During the manual/automatic simultaneous mode, the axis commanded in the automatic mode became the manual operation axis. Turn OFF the "manual/automatic valid" signal for the commanded axis.		
♦Turn ON the power again, and perform absolute position initialization.		
♦Turn OFF the "tool length measurement 1" signal to start the program by the manual speed command.		
♦Cancel the control axis synchronization between part systems, then issue a travel command to the inclined axis.		
♦Select the 1st axis of each part system when issuing the manual speed command.		
♦Cancel the collision detection alarm.		
♦Check the program after cancelling the error by reset.		
[Aux ax internal interlock]		
♦Cancel the servo OFF.		
M01	H/W stroke end axis exists	0006
Details		
The stroke end function has activated (the input signal is "OFF") and one of the axes is in the stroke end status.		
Remedy		
♦Move the machine manually.		
♦Check for any broken wires in the "stroke end" signal line.		
♦Check for any limit switch failure.		
M01	S/W stroke end axis exists	0007
Details		
[S/W stroke end axis exists]		
The stored stroke limit I, II, IIB or IB function has activated.		
[Aux ax stored stroke limit]		
The stored stroke limit was reached.		
Remedy		
[S/W stroke end axis exists]		
♦Move the machine manually.		
♦Correct any setting error of the parameters for the stored stroke limit.		
[Aux ax stored stroke limit]		
♦Check the stored stroke limit setting and machine position.		
M01	Chuck/tailstock stroke end ax	0008
Details		
The chuck/tail-stock barrier function turned ON, and an axis entered the stroke end state.		
Remedy		
♦Reset the alarm with reset, and move the machine in the reverse direction.		

M01	Ref point return No. invalid	0009
Details 2nd reference position return was performed before 1st reference position return has been completed.		
Remedy ♦Execute 1st reference position return.		
M01	Illegal op in mid pt sg block	0013
Details The operation mode was changed to MDI during single block stop at the middle point of G28/G29/G30.		
Remedy ♦Change the operation mode. ♦Reset to clear the alarm.		
M01	TLM dir. determine impossible	0017
Details The direction for Tool length measurement cannot be determined.		
Remedy ♦Turn OFF TLM signal, and move the tool away from the sensor. ♦Maintain a clearance of "#2709 TLM_approach" or more between the tool nose and the sensor. ♦Turn ON TLM signal, and execute tool length measurement again.		
M01	Sensor signal illegal ON	0019
Details The sensor signal was already ON when the tool measurement mode (TLM) signal was validated. The sensor signal turned ON when there was no axis movement after the tool measurement mode (TLM) signal was validated. The sensor signal turned ON at a position within 100 μm from the final entry start position.		
Remedy ♦Turn the tool measurement mode signal input OFF, and move the axis in a safe direction. ♦Disabling the sensor signal also clears the operation alarm. (Note) When the "tool length measurement 1" signal is disabled, the axis can be moved in either direction. Pay attention to the movement direction.		
M01	Ref point retract invalid	0020
Details Reference position retract was performed while the coordinates had not been established.		
Remedy ♦Execute reference position return.		
M01	Tool ofs invld after R-pnt	0021
Details Reference position return had been performed during the tool retract and return, which invalidated the tool compensation amount after the reference position return.		
Remedy ♦The error is cleared if the operation mode is changed to other than reference position return before the axis performs reference position return. ♦The error is cleared when the tool return is completed. ♦The error is cleared if reset 1 is input or the emergency stop button is pushed.		

M01	R-pnt ret invld at abs pos alm	0024
Details [R-pnt ret invld at abs pos alm] A zero point return signal was input during an absolute position detection alarm. [Aux ax R ret invld at abs alm] Reference position return was executed during an absolute position alarm.		
Remedy [R-pnt ret invld at abs pos alm] •Reset the absolute position detection alarm, and then perform zero point return. [Aux ax R ret invld at abs alm] •Initialize the absolute position reference point and then fix the absolute position coordinates.		
M01	R-pnt ret invld at zero pt ini	0025
Details [R-pnt ret invld at zero pt ini] A zero point return signal was input during zero point initialization of the absolute position detection system. [Aux ax R ret invld at ini] Reference position return was executed during absolute position initial setting.		
Remedy [R-pnt ret invld at zero pt ini] •Complete zero point initialization, and then perform zero point return. [Aux ax R ret invld at ini] •Initialize the absolute position reference point and then fix the absolute position coordinates.		
M01	High-accuracy skip disabled	0028
Details The drive unit's hardware or software does not conform to the high-accuracy skip.		
Remedy •The software or hardware does not conform to the function. Contact service center.		
M01	Hi-ac skip coord retrieval err	0029
Details Failed to retrieve the skip coordinate value from the drive unit.		
Remedy •Check the wiring. •Check the parameters.		
M01	Now skip on	0030
Details The "skip input" signal remains enabled when the operation has shifted from skip retract to measurement.		
Remedy •Increase the skip retract amount.		
M01	No skip	0031
Details Even though the 1st skip was to the correct position, the 2nd skip could not be found.		
Remedy •Check whether the measurement target has moved.		

M01	Rtn dir err in manual measure	0033
Details Return direction in manual measurement is the opposite of the parameter setting.		
Remedy <ul style="list-style-type: none"> • Check the setting of the parameter "#2169 Rtn dir err in manual measure" (Return direction in manual measurement). • Move the axis manually in the direction to a safe position, then reset. 		
M01	No specifications	0036
Details The specification is not supported.		
Remedy <ul style="list-style-type: none"> • Check the specifications. 		
M01	Chopping axis R-pnt incomplete	0050
Details Chopping mode has been entered while the chopping axis has not completed reference position return. All axes interlock has been applied.		
Remedy <ul style="list-style-type: none"> • Reset the NC or disable the "chopping" signal, and then carry out the reference position return. 		
M01	Synchronous error excessive	0051
Details The synchronization error of the master and slave axes exceeded the allowable value under synchronous control. A deviation exceeding the synchronization error limit value was found with the synchronization deviation detection.		
Remedy <ul style="list-style-type: none"> • Select the correction mode and move one of the axes in the direction in which the errors are reduced. • Check the parameter "#2024 synerr". • Increase the allowable value or reset it to "0" (check disabled). • When using simple C-axis synchronous control, set the contents of the R2589 register to "0". 		
M01	No spindle select signal	0053
Details Synchronous tapping command was issued when the spindle select signals (SWS) for all spindles were OFF in the multiple-spindle control II.		
Remedy <ul style="list-style-type: none"> • Turn ON the spindle select signal (SWS) responding to the tapping spindle before performing the synchronous tapping command. 		
M01	No spindle serial connection	0054
Details Synchronous tapping command was issued when the spindle that the spindle select signal (SWS) was ON was not serially connected in the multiple-spindle control II.		
Remedy <ul style="list-style-type: none"> • Make sure the spindle select signal (SWS) for the responding spindle is ON. • Consider the machine construction when issuing the command. 		
M01	Spindle fwd/rvs run para err	0055
Details Asynchronous tapping command was issued when M code of the spindle forward/reverse run command, set by the parameter "#3028 sprcmm", was one of the followings in the multiple-spindle control II. <ul style="list-style-type: none"> • M0, M1, M2, M30, M98, M99, or M198 • M code No. that commands to enable/disable the "macro interrupt" signal 		
Remedy <ul style="list-style-type: none"> • Correct the parameter "#3028 sprcmm" (Tap cycle spindle forward run/reverse run M command) setting. 		

M01	Tap pitch/thread number error	0056
Details The command for the pitch or the number of threads is not correct in the synchronous tapping command of the multiple-spindle control II. The pitch is too small for the spindle rotation speed. Thread number is too large for the spindle rotation speed.		
Remedy ♦Correct the pitch, number of threads or rotation speed of the tapping spindle.		
M01	Wait for tap retract	0057
Details The axis travel command is interlocked as the tap retract is being enabled.		
Remedy ♦If tapping is necessary, perform tapping retract in advance. However, tapping retract is not allowed during cycle start operation. Carry out tapping retract after resetting. ♦If tapping is not necessary, cancel the tap retract enabled condition by the tap retract enabled cancel signal.		
M01	Handle ratio too large	0060
Details The handle ratio is too large for the handle feed clamp speed. (The handle feed clamp speed changes according to the rapid traverse rate, external feedrate, maximum speed outside the soft limit range and etc. (or external deceleration speed when external deceleration is valid)) Too large handle ratio means the ratio with which the machine is unable to move the distance of [iunit * handle ratio] within 0.1ms at the clamp speed. Example) When iunit=B (0.001mm) and clamp speed cs (mm/min) The operation error (M01 0060) will occur if $\text{ratio } M > cs/60(s) * 0.1(ms) / 0.001(mm) = cs * 10/6.$		
Remedy ♦Change the settings of the handle feed clamp speed or the handle ratio.		
M01	R-pos offset value illegal	0065
Details At the start of reference position initial setting, the parameter "#2034 rfpofs" (Distance-coded reference position detection offset) is not set to "0".		
Remedy ♦Set the parameter "#2034 rfpofs" to "0", then turn the power ON again to perform the reference position initial setting.		
M01	R-pos scan distance exceeded	0066
Details Reference position could not be established within the maximum scan distance.		
Remedy ♦Check the scale to see if it has dirt or damage. ♦Check if the servo drive unit supports this function.		
M01	Illegal op in wk instl err cmp	0070
Details One of the following operations was attempted during workpiece installation error compensation. <ul style="list-style-type: none"> ♦Manual interruption ♦Automatic operation handle interruption ♦MDI interruption ♦PLC interruption 		
Remedy ♦Return the operation mode to the original mode to remove the cause. During workpiece installation error compensation, manual interruption, automatic operation handle interruption, MDI interruption, PLC interruption, etc. is not allowed.		

M01	Illegal op in dia/rad select	0095
Details An axis used in the following functions is also used as an axis to perform diameter/radius designation selection. •Chopping •Synchronization control Or diameter/radius designation selection (G10.9) was issued to the axis in the above mode.		
Remedy •Check the program. •Do not carry out the following functions using an axis to perform diameter/radius designation selection. - Chopping - Synchronization control		
M01	No operation mode	0101
Details [No operation mode] No operation mode [Aux ax no operation mode] The operation mode is not designated, or the operation mode was changed during axis movement.		
Remedy [No operation mode] •Check for any broken wires in the input mode signal wire. •Check for any failure of the MODE SELECT switch. •Correct the sequence program. [Aux ax no operation mode] •Correctly designate the operation mode.		
M01	Cutting override zero	0102
Details The "cutting feed override" switch on the machine operation panel is set to "0". The override was set to "0" during a single block stop.		
Remedy •Set the "cutting feed override" switch to a value other than "0" to clear the error. •If the "cutting feed override" switch has been set to a value other than "0", check for any short circuit in the signal line. •Correct the sequence program.		
M01	External feed rate zero	0103
Details [External feed rate zero] The MANUAL FEEDRATE switch on the machine operation panel is set to zero when the machine is in the jog mode or automatic dry run mode. The "Manual feedrate B speed" signal is set to zero during the jog mode when Manual feedrate B is valid. The "Each axis manual feedrate B speed" is set to zero during the jog mode when Each axis manual feedrate B is valid. [Aux ax feedrate 0] The feedrate set in the operation parameter is zero. Or the override is enabled but is set to zero.		
Remedy [External feed rate zero] •Set the MANUAL FEEDRATE switch to a value other than "0" to release the error. •If the MANUAL FEEDRATE switch has been set to a value other than "0" check for any short circuit in the signal line. •Correct the sequence program. [Aux ax feedrate 0] •Set a value other than zero in the feedrate setting or override value.		

1 Operation Errors (M)

M01	F 1-digit feed rate zero	0104
Details		
The F1-digit feedrate has been set to "0" when the F1-digit feed command was executed.		
Remedy		
♦Set the F1-digit feedrate (the parameter "#1185 spd_F1" (F1 digit feedrate F1) to "#1189 spd_F5" (F1 digit feedrate F5)).		
M01	Spindle stop	0105
Details		
The spindle stopped during the synchronous feed/thread cutting command.		
Remedy		
♦Rotate the spindle.		
♦If the workpiece is not being cut, start dry run.		
♦Check for any broken wire in the spindle encoder cable.		
♦Check the connections for the spindle encoder connectors.		
♦Check the spindle encoder pulse.		
♦Correct the program. (commands and addresses)		
M01	Handle feed ax No. illegal	0106
Details		
The axis, designated at handle feed, is out of specifications.		
No axis has been selected for handle feed.		
Multiple axes in a part system are allocated to a handle.		
Remedy		
♦Check for any broken wires in the handle feed axis selection signal line.		
♦Correct the sequence program.		
♦Check the number of axes in the specifications.		
♦Check the axis allocation to the handle.		
M01	Spindle rotation speed over	0107
Details		
Spindle rotation speed exceeded the axis clamp speed during the thread cutting command.		
Remedy		
♦Lower the commanded rotation speed.		
M01	Fixed pnt mode feed ax illegal	0108
Details		
The axis, designated in the manual arbitrary feed, is out of specifications.		
The feedrate in manual arbitrary feed mode is illegal.		
Remedy		
♦Check for any broken wires in the axis selection signal line or the feedrate line for the manual arbitrary feed mode.		
♦Check the specifications for the manual arbitrary feed mode.		
M01	Block start interlock	0109
Details		
An interlock signal has been input to lock the block start.		
Remedy		
♦Correct the sequence program.		
M01	Cutting block start interlock	0110
Details		
An interlock signal has been input to lock the cutting block start.		
Remedy		
♦Correct the sequence program.		

M01	Restart switch ON	0111
	Details Restart switch has been turned ON and manual mode has been selected before the restart search is completed.	
	Remedy <ul style="list-style-type: none"> •Search the block to restart. •Turn the restart switch OFF. 	
M01	Program check mode	0112
	Details The cycle start button was pressed during program check or in program check mode.	
	Remedy <ul style="list-style-type: none"> •Press the reset button to cancel the program check mode. 	
M01	Cycle st. in buffer correct	0113
	Details The cycle start button was pressed during buffer correction.	
	Remedy <ul style="list-style-type: none"> •Press the cycle start button after the buffer correction is completed. 	
M01	In reset process	0115
	Details The cycle start button was pressed during resetting or tape rewinding.	
	Remedy <ul style="list-style-type: none"> •When rewinding the tape, wait for the winding to end, or press the reset button to stop the winding, and then press the cycle start button. •During resetting, wait for the resetting to end, and then press the automatic start button. 	
M01	Playback not possible	0117
	Details The playback switch was turned ON during editing.	
	Remedy <ul style="list-style-type: none"> •Cancel the editing by pressing the input or previous screen key before turning ON the playback switch. 	
M01	Turn stop in normal line cntrl	0118
	Details The turning angle at the block joint exceeded the limit during normal line control. In normal line control type I: The parameter "#1523 C_feed" (Normal line control axis turning speed) has not been set. In normal line control type II: When turning in the inside of the arc, the set value for the parameter "#8041 C-rot. R" is larger than the arc radius.	
	Remedy <ul style="list-style-type: none"> •Correct the program. •Correct the parameter "#1523 C_feed" (Normal line control axis turning speed) setting. •Correct the parameter "#8041 C-rot. R" setting. 	
M01	Reverse run impossible	0119
	Details Any of the following conditions are occurring. a) There is no block to run backward b) Eight blocks without a travel command continued	
	Remedy <ul style="list-style-type: none"> •Execute forward run to clear the alarm. •Reset to clear the alarm. 	

M01	In synchronous correction mode	0120
Details		
The synchronous correction mode switch was pressed in non-handle mode.		
Remedy		
<ul style="list-style-type: none"> ♦Select the handle or manual arbitrary feed mode. ♦Turn OFF the correction mode switch. 		
M01	No synchronous control option	0121
Details		
The synchronous control operation method was set (with R2589) while no synchronous control option was provided.		
Remedy		
♦Set "0" for "synchronous control operation method".		
M01	Computer link B not possible	0123
Details		
Cycle start was attempted before resetting was completed.		
Computer link B operation was attempted at the 2nd or further part system in a multi-part system.		
Remedy		
<ul style="list-style-type: none"> ♦Perform the cycle start after resetting has been completed. ♦Set "#8109 HOST LINK" to "0" and then set to "1" before performing the cycle start. ♦Computer link B operation cannot be performed at the 2nd or further part system in a multi-part system. 		
M01	X/Z axes simultaneous prohibit	0124
Details		
The basic axis corresponding to the inclined axis was started simultaneously in the manual mode while the inclined axis control was valid.		
Remedy		
<ul style="list-style-type: none"> ♦Turn the inclined axis and basic axis start OFF for both axes. (This is also applied for manual/automatic simultaneous start.) ♦Disable the basic axis compensation, or command it to axes one by one. 		
M01	Rapid override zero	0125
Details		
♦The RAPID TRAVERSE OVERRIDE switch on the machine operation panel is set to "0".		
♦Override was set to "0" during single block stop.		
Remedy		
♦Set the RAPID TRAVERSE OVERRIDE switch to a value other than "0" to clear the error.		
♦If the RAPID TRAVERSE OVERRIDE switch has been set to a value other than "0", check for any short circuit in the signal line.		
♦Correct the sequence program.		
M01	Program restart machine lock	0126
Details		
Machine lock was applied on the return axis being manually returned to the restart position.		
Remedy		
♦Cancel the machine lock and resume the operation.		

M01	Rot axis parameter error	0127
Details		
<ul style="list-style-type: none"> •Orthogonal coordinate axis name does not exist. •Rotary axis name does not exist. •A duplicate name is used for the designated orthogonal coordinate axis. •The number of axes that were selected to change tool length compensation along the tool axis amount exceeds the maximum number of axes. •The designated orthogonal coordinate axis name is the same as the rotary axis name. •There is an invalid rotary axis setting in the rotary axis configuration parameters. •A function that cannot be commanded when the spindle end offset is set was commanded. 		
Remedy		
<ul style="list-style-type: none"> •Correct the rotary axis configuration parameters. 		
M01	Restart pos return incomplete	0128
Details		
Cycle start was performed with an axis whose return to the restart position was not complete.		
Remedy		
<ul style="list-style-type: none"> •Perform restart position return manually. •Validate the parameter "#1302 AutoRP" (Automatic return by program restart), then execute cycle start. 		
M01	PLC interruption impossible	0129
Details		
After the cycle start, the "PLC interrupt" signal was turned ON during buffer correction, program restart, arbitrary reverse run, tool retract and return, high-speed high-accuracy control II, NURBS interpolation or single block stop at the middle point of G28/G29/G30.		
Remedy		
<ul style="list-style-type: none"> •By turning OFF the "PLC interrupt" signal, or by resetting the NC the error can be cancelled. 		
M01	Restart posn return disabled	0130
Details		
Restart position return was attempted in a mode where the return is disabled.		
Remedy		
<ul style="list-style-type: none"> •Correct the program restart position. 		
M01	Zero point return interruption	0131
Details		
Compound type fixed cycle program was interrupted with manual zero point return, and cycle start was carried out without carrying out reset.		
Remedy		
<ul style="list-style-type: none"> •Cancel the program execution by reset. 		
M01	Excessive no. of reverse block	0133
Details		
During the reverse run in arbitrary reverse run, any one of the part systems reverse-ran for 20 blocks.		
Remedy		
<ul style="list-style-type: none"> •This error is cancelled by forward run. 		
M01	Illegal mode in prg check mode	0134
Details		
Any of the following modes has been turned ON during the manual arbitrary reverse run mode.		
<ul style="list-style-type: none"> •MDI interruption mode •Manual/automatic simultaneous valid (MAE1 to 8) •Arbitrary feed mode (PTP) •Arbitrary reverse control mode (RVMD) •Manual speed command enabled •High-speed simple program check mode (SMLK) 		
Remedy		
<ul style="list-style-type: none"> •The error can be cancelled by turning OFF the error-causing mode. 		

M01	Too many active axes per sys	0135
Details		
High-accuracy control has been executed in a part system which has 9 or more enabled control axes, except for a slave or synchronized axis.		
Remedy		
<ul style="list-style-type: none"> ♦Reduce the number of enabled control axes (except for a slave axis and synchronized axis) of the part system to 8 or less through synchronous control, control axis synchronization between part systems, or mixed control before executing high-accuracy control. 		
M01	Pre-intrpl variable accel err	0136
Details		
<ul style="list-style-type: none"> ♦The parameter "#12060 VblAccPreInt" (Variable-acceleration pre-interpolation acceleration/deceleration ON) is set to "1" and the parameter "#8090 SSS ON" is set to "0". 		
Remedy		
<ul style="list-style-type: none"> ♦To enable the variable acceleration pre-interpolation acceleration/deceleration, set the parameter "#8090 SSS ON" to "1". To disable the variable acceleration pre-interpolation acceleration/deceleration, set the parameter "#12060 VblAccPreInt" to "0". 		
M01	Unable to start automatic mode	0137
Details		
<ul style="list-style-type: none"> ♦Although start of automatic operation is not allowed after a machine groupwise alarm stop ("#1472 mgralmre-start"=0), start of automatic operation has been attempted after the said alarm stop. 		
Remedy		
<ul style="list-style-type: none"> ♦Remove the cause of the stop by alarm. ♦Set the parameter "#1472 mgralmrestart" to "1". 		
M01	Tool data sorting in progress	0138
Details		
Cycle start or graphic check has been attempted during sorting of tool management data.		
Remedy		
<ul style="list-style-type: none"> ♦Execute cycle start after the tool data sorting is completed. ♦Execute graphic check after the tool data sorting is completed. 		
M01	Tolerance control invalid	0139
Details		
The parameter "#12066 Tolerance ctrl ON" is set to "1", although "#8090 SSS ON" is "0".		
Remedy		
<ul style="list-style-type: none"> ♦To enable the tolerance control, set "#8090 SSS ON" to "1". To disable the tolerance control, set "#12066 Tolerance ctrl ON" to "0". 		
M01	III manualmode select in 3Dcnv	0145
Details		
The following unselectable manual mode was selected during 3-dimensional coordinate conversion.		
<ul style="list-style-type: none"> ♦manual reference position return 		
Remedy		
<ul style="list-style-type: none"> ♦Cancel the 3-dimensional coordinate conversion modal. 		
M01	Start err in PRM rot manu feed	0146
Details		
Axis start has been attempted with any of the following operations while the coordinate rotation by parameter for manual feed is enabled.		
<ul style="list-style-type: none"> ♦Tool retract and return ♦Manual tool length measurement ♦Manual skip 		
Remedy		
<ul style="list-style-type: none"> ♦Turn OFF the "Coordinate rotation by parameter: Coordinate switch for manual feed" signal. 		

M01	Multiaxes in RRM rot manu feed	0147
Details		
Two or more of the three basic axes were started at a time for the coordinate rotation by parameter for manual feed.		
Remedy		
•Disable the coordinate rotation by parameter for manual feed or start one axis at a time.		
M01	Unable to start automatic mode	0149
Details		
The searched program has been altered due to the change made to the setting of the location of the program. An attempt is being made to run a program that is not the one operation search was carried out for.		
Remedy		
•Perform operation search for the program.		
M01	Chopping override zero	0150
Details		
The override became "0" in the chopping operation.		
Remedy		
•Check the chopping override (R2503).		
•Check the rapid traverse override (R2502).		
M01	Command axis chopping axis	0151
Details		
A chopping axis movement command was issued from the program during the chopping mode. (This alarm will not occur for the command with the movement amount "0".) (All axes interlock state will be applied.)		
Remedy		
•Press the reset button or turn OFF the "chopping" signal. When the "chopping" signal is turned OFF, the axis returns to the reference position and performs the movement command in the program.		
M01	Bottom dead center pos. zero	0153
Details		
The bottom dead center position is set to the same position as the upper dead center position.		
Remedy		
•Correct the bottom dead center position.		
M01	Chopping disable for handle ax	0154
Details		
Chopping has been attempted while the chopping axis is selected as the handle axis.		
Remedy		
•Select an axis other than the chopping axis as the handle axis, or start chopping after changing the mode to the other mode.		
M01	Dir cmnd mode invalid	0157
Details		
•The drive unit's software or hardware does not conform to the direct command mode.		
•Inclined axis control is active.		
•Control axis synchronization between part systems is active.		
•Control axis superimposition was activated during direct command mode.		
Remedy		
•The software or hardware does not conform to the function. Contact service center.		
•Turn the inclined axis control valid signal OFF.		
•Turn the synchronous control request signal OFF.		
•Turn the superimposition control request signal OFF.		

1 Operation Errors (M)

M01	Dir cmnd mode restart invalid	0158
Details		
♦Cycle start was carried out without reset after the retract in direct command mode.		
Remedy		
♦Finish the machining for now by resetting the NC.		
M01	OMR-CC invalid	0159
Details		
When "#2678 OMRCC_valid" is set to "1", "#2139 omrff_off" is set to "1" or "#2313 SV113 SSF8/bit0" is set to "0".		
Remedy		
♦To enable OMR-CC, set "#2139 omrff_off" to "0", and "#2313 SV113 SSF8/bit0" to "1".		
♦To disable OMR-CC, set "#2678 OMRCC_valid" to "0".		
M01	No speed set out of soft limit	0160
Details		
[No speed set out of soft limit]		
For the axis for which the maximum speed in the outside of the soft limit range has not been specified, an attempt was made to return the axis from the outside of the soft limit range.		
[Aux ax sta No. illegal]		
The designated station number is exceeding the number of indexed divisions.		
Remedy		
[No speed set out of soft limit]		
♦Set the maximum speed for the outside of the soft limit range. (Parameter "#2021 out_f")		
♦Correct the soft limit range. (Parameters "#2013 OT-", "#2014 OT+", "#8204 OT-CHECK-N" and "#8205 OT-CHECK-P")		
[Aux ax sta No. illegal]		
♦Correctly designate the station No.		
M01	Aux ax R-pnt ret incomplete	0161
Details		
Automatic/manual operation was started before reference position return was executed with the incremental system.		
Remedy		
♦Execute the reference position return.		
M01	Aux abs position initializing	0162
Details		
The start signal was input while initializing the absolute position reference point.		
Remedy		
♦Complete the absolute position reference point initialization.		
M01	Aux ax abs position error	0163
Details		
The start signal was input during an absolute position alarm.		
Remedy		
♦Initialize the absolute position reference point and then fix the absolute position coordinates.		
M01	Aux ax arbitrary positioning	0164
Details		
The manual operation mode was started during the random positioning mode.		
Remedy		
♦Turn the random positioning mode OFF before switching to the manual operation mode.		

M01	Aux uneven index sta No. ilgl	0165
Details The commanded station No. was higher than 20 or the number of indexing stations during uneven indexing. The station No.0 was specified during uneven indexing.		
Remedy •Check the commanded station No. and the parameter "#12801 aux_station" setting.		
M01	Aux axis changeover error	0166
Details One of the following attempts was made on an axis that is switchable between NC axis and auxiliary axis. <ul style="list-style-type: none"> •A command intended for an NC axis in manual mode was issued to an auxiliary axis. •NC axis control select signal was turned OFF while the NC axis was in motion. •NC axis control select signal was turned ON while the auxiliary axis was in motion. 		
Remedy •If you wish to issue a command intended for an NC axis in manual mode, turn ON the NC axis control select signal so as to set the axis as an NC axis. •Do not change NC axis control select signal while the axis is in motion.		
M01	Aux ax torque limit value zero	0167
Details Torque limit value of the parameter group to use is "0".		
Remedy •Check the torque limit value of the parameter group to use (#12814 aux_TL1, #12824 aux_TL2, #12834 aux_TL3, or #12844 aux_TL4).		
M01	Ill. op during T tip control	0170
Details Illegal operation was attempted during tool tip center control.		
Remedy •Change the operation mode to the previous one and restart.		
M01	Illegal operation in TCPC	0172
Details An illegal operation was performed during tool cutting point control mode.		
Remedy •Revert the system to the state prior to the operation and restart the CNC.		
M01	Illegal op in spline interpol2	0180
Details Any of the following operations was performed during spline interpolation 2. <ul style="list-style-type: none"> •Change to manual mode •Change to MDI mode •PLC interruption 		
Remedy •Return to the original operation mode, and then remove the error cause.		
M01	Ill. op in 2D barcode engrave	0181
Details An illegal operation was attempted during the two-dimensional barcode engraving cycle.		
Remedy •Switch the operation back to the previous mode, and remove the error cause.		
M01	Illegal op in text engraving	0182
Details An illegal operation was attempted during Text engraving cycle.		
Remedy •Change the operation mode back to the previous one, and remove the cause of the error.		

M01	Illegal OP in tilted face cut	0185
Details		
Any of the following illegal operations was attempted during inclined surface machining mode.		
<ul style="list-style-type: none"> ♦Manual interrupt ♦Handle interrupt in automatic operation ♦MDI interrupt ♦PLC interrupt ♦Arbitrary reverse run 		
Remedy		
Switch the operation mode back to the previous to remove the cause of this failure.		
<ul style="list-style-type: none"> ♦During inclined surface machining mode, it's impossible to perform manual interrupt, handle interrupt in automatic operation, MDI interrupt, PLC interrupt, etc. 		
M01	Invalid axis configuration	0186
Details		
The operation you input cannot be executed under the axis configuration of the part system.		
<ul style="list-style-type: none"> ♦3D manual feed was attempted. ♦The rotation center error compensation has been turned ON. ♦The rotary axis is set to the spindle mode of the spindle position control. ♦An unavailable function command was given when "Select specifications of rotation direction parameter" is enabled (#1450/bit3 = 1), and the left-hand screw direction is selected by the rotation direction parameter (#7923, #7933, #7943, #7953 = 1). 		
Remedy		
<ul style="list-style-type: none"> ♦Check the rotary axis configuration parameters. ♦Correct the axis configuration of the part system. ♦Reset the NC or remove the error cause to cancel the alarm. 		
M01	Rotary axis para unswitchable	0187
Details		
The rotary axis configuration parameter switch request signal has turned ON for a part system where any of the following modes is active.		
<ul style="list-style-type: none"> ♦Tool center point control mode ♦Tool cutting point control mode ♦Inclined surface machining mode ♦Workpiece installation error compensation mode ♦Tool length compensation along the tool axis mode ♦Simple inclined surface machining mode ♦3-dimensional tool radius compensation mode ♦3-dimensional manual feed ♦Tool handle feed & interruption ♦R-Navi mode 		
Remedy		
<ul style="list-style-type: none"> ♦Cancel the alarm by CNC reset or by turning OFF the rotary axis configuration parameter switch request signal. 		
M01	Illegal op in MCR coord TF	0188
Details		
An illegal operation was performed during motion control release (coordinate transformation).		
Remedy		
<ul style="list-style-type: none"> ♦Roll back the operation that caused the error and restart the NC. 		
M01	MCR calculation error	0189
Details		
Illegal coordinate transformation during motion control release (coordinate transformation).		
Remedy		
<ul style="list-style-type: none"> ♦Report this error to the machine tool builder. 		

M01	Interference check disabled	0200
Details 3D machine interference check is disabled. This alarm is output to NC alarm 5.		
Remedy <ul style="list-style-type: none"> •Enable all the interference check settings. •If there is any axis which has not completed zero point return, establish the zero point first. 		
M01	Machine interference 1	0201
Details It was judged that an interference occurred in the No.1 step interference check and caused a deceleration stop. When machine interference is detected, the interfered part is highlighted (yellow/red) and the part's name is displayed on the 3D monitor's model display.		
Remedy <ul style="list-style-type: none"> •Move the axis in a direction which does not cause interference. •Press RESET to cancel the alarm. •(In manual operation) You can move the axis in the same travel direction as before the interference. But the axis movement is done using the 2nd step interference check distance. 		
M01	Machine interference 2	0202
Details It was judged that an interference occurred in the No.2 step interference check and caused a deceleration stop. When machine interference is detected, the interfered part is highlighted (red) and the part's name is displayed on the 3D monitor's model display.		
Remedy <ul style="list-style-type: none"> •Move the axis in a direction which doesn't cause interference. •Press RESET to cancel the alarm. 		
M01	Tool interfere. check disabled	0205
Details Tool interference check has been disabled. This alarm is output to the NC alarm 5.		
Remedy <ul style="list-style-type: none"> •Turn ON the [Tool check] menu of 3D monitor. •Set the tool data. •If you prevent an alarm from being output while the tool interference check is disabled, set "0" in "#11100 3D_MChk_ToolAlm". 		
M01	Too many simul. control axes	0211
Details The given command has caused any axis other than those commanded to move. So the total number of axes to move has exceeded the maximum number of simultaneous contour control axes.		
Remedy <ul style="list-style-type: none"> •Check the maximum number of simultaneous contour control axes of your NC. •Check the machining program to make sure the total number of axes to move will not exceed the maximum number of simultaneous contour control axes. 		
M01	Changing prg format disabled	0215
Details The PFCHR signal has been switched (from ON to OFF or OFF to ON) during automatic operation.		
Remedy <ul style="list-style-type: none"> •Use G188 to change the program format during automatic operation. * The warning display is cancelled by changing PFCHR back to the previous state. 		

1 Operation Errors (M)

M01	Rapid block overlap inv	0216
Details The following parameters are enabled while there is no option for Rapid traverse block overlap. ♦"#1442 G0ol" (Enable G00 rapid traverse block overlap) ♦"#1443 G28ol" (Enable G28 rapid traverse block overlap) ♦"#12056 I_G0ol" (Enable G00 initial rapid traverse block overlap)		
Remedy ♦Check the specification. ♦Disable the parameter.		
M01	OP invld during MTB macro prep	0217
Details NC performed automatic operation while preparing MTB macro.		
Remedy ♦Execute the program again after reset.		
M01	Too many axes in 3D interf chk	0220
Details You have set 13 or more axes as the objectives of 3D machine interference check.		
Remedy ♦Correct the setting of "#2673 3D_MChk_Ax".		
M01	Invalid cmd in 3D interf check	0221
Details The commanded function is invalid during 3D machine interference check.		
Remedy ♦Disable interference check before the command.		
M01	Multi ax for 3D manual feed	0230
Details More than one axis was designated in manual mode while the 3-dimensional manual feed was valid.		
Remedy ♦Command the manual feed to each axis one by one.		
M01	3D manual feed coord sys err	0231
Details ♦More than one of the three bits for selecting hypothetical coordinate system was turned ON. ♦Virtual coordinate system was selected while the 3-dimensional manual feed was invalidated by the parameter setting. ♦The manual tool length measurement or workpiece position measurement is being attempted.		
Remedy ♦Check the sequence program. ♦Enable 3-dimensional tool radius compensation (set the parameter "#7912 NO_MANUAL" to "0"). ♦Finish the manual tool length measurement or workpiece position measurement.		
M01	Illegal op in 3D tool R comp	0232
Details An illegal operation (such as manual interrupt) was attempted during 3-dimensional tool radius compensation (tool vertical direction compensation).		
Remedy ♦Operations such as manual interrupt are disabled while 3-dimensional tool radius compensation (tool vertical direction compensation) is being performed.		

M01	Coord select w/o 3D man. Feed	0233
Details		
Hypothetical coordinate system has been selected although 3D manual feed is not included in the specifications.		
Remedy		
Turn OFF all the 3D manual feed coordinate system selection signals (including MJCT).		
M01	No spec: Rot center error comp	0240
Details		
No option of rotation center error compensation is found.		
Remedy		
•Check the specifications.		
M01	Rot center err comp incorrect	0241
Details		
•The calculated compensation amount was excessive, thus the amount was clamped to +/- 1mm.		
•Compensation for angle deviation was executed although the preset tool length is not in the height-axis direction.		
Remedy		
•Check the values of the position deviation and the angle deviation.		
•Check the tool length value.		
M01	Unable to start measuring err	0245
Details		
You executed cycle start while measurement of rotation center error or workpiece installation error is invalid.		
Remedy		
Execute cycle start for one part system that is ready for measurement.		
Activate memory mode before executing cycle start.		
M01	Invalid op mode in err measure	0246
Details		
You switched the operation to any mode other than memory during measurement of rotation center error or workpiece installation error.		
Remedy		
Switch the operation to memory mode.		
Manual interruption, automatic operation handle interruption, MDI interruption, etc. are invalid during error measurement.		
Execute cycle start after completion or cancel of the measurement.		
M01	Machining surface operation disabled	0250
Details		
Machining surface operation (selection, indexing or cancel) was attempted while the operation is disabled.		
Remedy		
• Cancel the other modes so that the inclined surface machining command (G68.2), tool axis direction control (G53.1) and the inclined surface machining cancel command (G69) can be issued.		
•Wait until the axes stop completely (until the smoothing for all axes reaches zero).		
•Perform operation search for machining programs.		
M01	Axs travel n/a in manual index	0251
Details		
Moving a rotary axis was attempted during manual machining surface indexing, when a manual operation mode other than handle mode was selected.		
Remedy		
•Change the operation mode to a handle mode before carrying out the manual surface indexing.		

1 Operation Errors (M)

M01	Tool length compensation amt 0	0252
Details		
The tool length compensation amount for performing the R-Navi indexing type 2 is 0.		
Remedy		
♦Set the tool length compensation amount for performing the indexing type 2 to a value other than 0.		
M01	Feat coord ill w/ multi-handle	0253
Details		
Manual feed feature coordinate system was selected while two or more handles were ON.		
Remedy		
♦Manual feed on a feature coordinate system is disabled while two or more handles are enabled (*).		
♦Press [Manual coord] and select the machine coordinate system.		
♦Reduce the number of enabled handles (*) to one.		
♦(*) An enabled handle means the handle for which "Nth handle valid" signal (HSnS) is ON.		
M01	No spec: Spatial error comp	0260
Details		
The spatial error compensation option is not available.		
Remedy		
Check the specifications.		
M01	Spatial error comp excessive	0261
Details		
The compensation amount is outside the setting range.		
Due to the calculation of the excessive amount, it is clamped by +/-1mm.		
Remedy		
Set the compensation amount within the setting range.		
M01	Auto backlash adjust illegal	0270
Details		
♦A measurement condition adjustment or backlash adjustment was attempted to an axis with which automatic backlash adjustment is impossible.		
♦A measurement condition adjustment or backlash adjustment was attempted even though all the axes had not reached the 1st reference position.		
♦The operation mode is other than memory mode.		
♦The slave axis of synchronous control is selected as adjustment axis.		
♦An attempt has been made to start an adjustment by cycle start.		
Remedy		
♦Check the adjustment axis.		
♦Start the adjustment after all the axes return to the 1st reference position.		
♦Check the operation mode.		
♦Select the master axis of synchronous control as adjustment axis when adjusting the slave axis.		
♦Start the adjustment by automatic backlash adjustment start signal.		
M01	Operating auto backlash adjust	0271
Details		
An illegal operation was attempted during measurement condition adjustment or backlash adjustment.		
Remedy		
♦Continue the operation after canceling the measurement condition adjustment and backlash adjustment.		
M01	APLC password mismatch	0280
Details		
The APLC authentication password is inconsistent.		
Remedy		
♦Contact the machine tool builder.		

M01	High-cycle sampling disabled	0290
Details		
<ul style="list-style-type: none"> •The drive unit's hardware or software does not conform to the high-cycle sampling mode. •High-cycle sampling data are not used even when high-cycle sampling has been set. •High-cycle sampling was attempted while the high-cycle sampling axis was in operation. •High-cycle sampling was attempted during speed monitor mode. •High-cycle sampling was attempted during executing any of the following operations: Dog type zero point return, absolute position setting, synchronous tapping, spindle synchronization, hobbing and tool spindle synchronization IC. •High-cycle sampling was attempted while multi-step speed monitor is active. •High-cycle sampling was attempted while constant speed monitor is active. •High-cycle sampling was attempted while real-time data sampling is active. 		
Remedy		
<ul style="list-style-type: none"> •The software or hardware does not conform to the function. Contact service center. •Set data for high-cycle sampling. •Execute high-cycle sampling after stopping the high-cycle sampling axis. •Execute high-cycle sampling after canceling the speed monitor mode. •Execute high-cycle sampling after stopping the function currently executed. •Execute high-cycle sampling after disabling the multi-step speed monitor. •High-cycle sampling cannot be executed while constant speed monitor is active. •Execute high-cycle sampling after stopping the real-time data sampling. 		
M01	N/A during high-cycle sampling	0291
Details		
<ul style="list-style-type: none"> •An attempt to activate "Speed monitor mode" was made during the high-cycle sampling mode. •An attempt to change the gear signal was made during the high-cycle sampling mode. •An attempt to execute spindle orientation was made during the high-cycle sampling mode. •Spindle detach was attempted during the high-cycle sampling mode. •Any of the following operations was attempted during the high-cycle sampling mode: Dog-type zero point return, absolute position setting, spindle/C axis changeover, synchronous tapping, spindle synchronization, hobbing, or tool spindle synchronization IC. 		
Remedy		
<ul style="list-style-type: none"> •Change the speed monitor mode signal back, finish high-cycle sampling, and then select the speed monitor mode. •Change the gear signal back, finish high-cycle sampling, and then change the gear. •Change the spindle orientation signal back, finish high-cycle sampling, and then execute orientation. •Change the spindle detach signal back, finish high-cycle sampling, and then carry out spindle detachment. •Execute the operation after terminating high-cycle sampling. 		
M01	Invalid cmd during param write	0292 (Axis name)
Details		
A function which is unavailable during parameter write was commanded.		
<ul style="list-style-type: none"> •Spindle/C axis changeover •Speed observation mode signal ON •High-speed synchronous tapping •PLC axis indexing 		
Remedy		
<ul style="list-style-type: none"> •Cancel the write of the parameter. •Command the following functions after the parameter write is completed. <ul style="list-style-type: none"> - Spindle/C axis changeover - Speed observation mode signal ON - High-speed synchronous tapping - PLC axis indexing 		
M01	SP orient. Z detection error	0301
Details		
Z phase detection has failed to be completed during execution of proximity-switch orientation.		
Remedy		
<ul style="list-style-type: none"> •Check for a failure of the proximity switch. 		

M01	Mnl Arb Rvs Run NumPartSystems	0333
Details		
There is no part system for which the manual arbitrary reverse run part system selection (YC84) signal is ON.		
Remedy		
<ul style="list-style-type: none"> •Ensure that the manual arbitrary reverse run part system selection (YC84) signal is ON for at least one part system. 		
M01	Cmd invalid manual arb rev run	0334
Details		
When "#1753 cfgPR03/bit1" (Manual arbitrary reverse run: operation per part system) is set to "1", the following command was issued between the part system that selected Manual arbitrary reverse run and the part system that did not select Manual arbitrary reverse run.		
<ul style="list-style-type: none"> •Mixed control •Arbitrary axis exchange control •Control axis synchronization between part systems •Control axis superimposition •Two-part system simultaneous thread cutting 		
Remedy		
<ul style="list-style-type: none"> •Turn OFF "Manual arbitrary reverse run mode (Y73C)" signal, then perform forward run to the start position for reverse run if necessary, then end "Manual arbitrary reverse run mode". The operation is restarted when "Manual arbitrary reverse run mode ON (X715)" signal is turned OFF. •Reset the part system with the "Manual arbitrary reverse run" is enabled, and end the automatic operation. 		
M01	BiSS encoder comm error 1	0350
Details		
Communication with BiSS encoder failed.		
Remedy		
<ul style="list-style-type: none"> •Check parameters "#11376 BiSS_enc_rate" through "#11380 BiSS_enc1_CRC_init". 		
M01	BiSS encoder comm error 2	0351
Details		
Communication with BiSS encoder failed.		
Remedy		
<ul style="list-style-type: none"> •Check the cable connected with BiSS encoder. 		
M01	BiSS encoder comm error 3	0352
Details		
Communication with BiSS encoder failed.		
Remedy		
<ul style="list-style-type: none"> •Check the cable connected with BiSS encoder. 		
M01	RTDS communication error	0360
Details		
Communication error occurred between the control unit and the collector PC, and the sampling data cannot be sent.		
Remedy		
<ul style="list-style-type: none"> •Check the communication with the collector PC. 		

M01	Unable to start BrakeWear Diag	0370
Details		
The conditions for starting brake wear diagnostics are not met when the brake wear diagnostics start signal (BWDSTm) is turned on.		
The cause preventing brake wear diagnostics from starting is displayed. (If there is more than one cause, the cause with the smallest number is displayed.)		
0001: part systems in automatic operation		
0002: not in in-position		
0003: in servo OFF state		
0004: in current limit		
0005: synchronous control secondary axis		
0006: in superimposition control		
0007: in arbitrary axis exchange control		
0008: in mixed control		
0009: invalid brake wear diagnostics parameters		
000A: reference position establishment incomplete		
000B: meeting exclusion condition of brake wear diagnostics		
000C: secondary axis brake wear diagnostics invalid		
000D: secondary axis unable to start brake wear diagnostics		
000E: secondary axis in single method		
1001: unable to start due to Smart Safety observation		
1002: PLC axis unable to start brake wear diagnostics		
1003: in brake wear diagnostics alarm reset ON		
1004: in coordinate rotation		
1005: controlled as auxiliary axis		
1007: inclined axis under inclined axis control		
1008: multiple-axis synchronization control secondary axis		
1009: secondary axis brake wear diagnostics invalid		
100A: secondary axis unable to start brake wear diagnostics		
100B: axis involved in control axis synchronization between part systems		
Remedy		
Check the conditions for starting brake wear diagnostics.		
Brake wear diagnostics will be started after the cause of the alarm is resolved, and the brake wear diagnostics start signal is turned on again.		
M01	BrakeWearDiagnostics (Warning)	0371
Details		
The axis travel amount exceeded the allowable value during brake wear diagnostics.		
The axis name of the axis where the error occurred is displayed.		
Remedy		
<ul style="list-style-type: none"> •Move the axis to a safe position with manual operation, turn off the power, and take corrective action for the brake. This warning is cleared upon successful completion of brake wear diagnostics, which is performed after the power is turned back on. •This warning can be cleared by the brake wear diagnostics alarm reset signal. The brake wear diagnostics incomplete signal (BWDNFm) remains on. 		
M01	No spec: Brake wear diagnostics	0372
Details		
Specifications do not include brake wear diagnostics.		
Remedy		
<ul style="list-style-type: none"> •Check the specifications. 		

M01	No brake wear diag response	0373
Details		
There is no brake response when the drive unit internal control circuit method is selected.		
Remedy		
<ul style="list-style-type: none"> •Check the sequence program. •Upgrade the software of the drive unit. •The drive unit may have failed. Contact the service center. 		
M01	Illegal movement command during superimposition	1003
Details		
<ul style="list-style-type: none"> •A machine command was issued to the superimposed axis. •Reference position return was attempted on the superimposed axis. •Skip command was issued to the reference or superimposed axis. •Dog-type reference position return was attempted on the reference axis. 		
Remedy		
<ul style="list-style-type: none"> •Correct the program. 		
M01	Superimposition command illegal	1004
Details		
<ul style="list-style-type: none"> •Superimposition start command was issued to the axis which was in any of the following states. <ul style="list-style-type: none"> Synchronization control Milling interpolation Feed-forward thread cutting control •Superimposition start command was issued to the axis which was under superimposition control. •Superimposition start command was issued to an axis that belongs to the same part system as a reference or synchronized axis of control axis synchronization between part systems. 		
Remedy		
<ul style="list-style-type: none"> •Correct the program. •Turn OFF the feed-forward control request signal. 		
M01	G114.n command illegal	1005
Details		
<p>G114.n has been commanded during the execution of G114.n.</p> <p>G51.2 has been commanded when G51.2 spindle-spindle polygon machining mode has been already entered at another part system.</p> <p>Multiple spindle synchronization set command is illegal.</p>		
Remedy		
<ul style="list-style-type: none"> •Command G113 to cancel the operation. •Turn ON the "spindle synchronization cancel" signal (Y18B8: SPSYC) to cancel the operation. •Command G50.2 to cancel the operation. •Turn ON the "spindle-spindle polygon cancel" signal (YCD1) to cancel the operation. •Correct the program. 		
M01	Spindle in-use by synchro tap	1007
Details		
The spindle is being used in synchronized tapping.		
Remedy		
<ul style="list-style-type: none"> •Cancel the synchronized tapping. 		

M01	GB spindle synchro signal OFF	1014
Details		
<ul style="list-style-type: none"> •A forward run, reverse run, orientation, synchronous tapping, spindle synchronization, tool spindle synchronization I, tool spindle synchronization II or C-axis servo ON command was issued to the reference spindle while the guide bushing spindle synchronization signal was OFF. •The guide bushing spindle synchronization signal was turned OFF during a forward run, reverse run, orientation, synchronous tapping, spindle synchronization, tool spindle synchronization I, tool spindle synchronization II or C-axis servo ON command. •Orientation was commanded during the "guide bushing spindle synchronization" signal ON with spindle zero point detection with proximity switch and turret indexing enabled. •C axis servo ON was commanded during the "guide bushing spindle synchronization" signal ON with spindle C axis parameter change enabled. 		
Remedy		
<ul style="list-style-type: none"> •Check the ladder program. •Check the parameters. 		
M01	GB SP sync:Spindle type error	1015
Details		
<ul style="list-style-type: none"> •An analog spindle is used for the master spindle or the guide bushing spindle. •Spindle-mode servo is used for the master spindle or the guide bushing spindle. •Turret gear change control valid spindle is used for the master spindle or the guide bushing spindle. 		
Remedy		
<ul style="list-style-type: none"> •Check the parameters. •Change the reference spindle or the guide bushing spindle to spindle drive unit. •Change the reference spindle or the guide bushing spindle to turret gear change control invalid. 		
M01	GB SP sync:Phase mem sgml ilgl	1021
Details		
<ul style="list-style-type: none"> •The guide bushing spindle synchronization phase memory signal was turned ON while the master spindle or guide bushing spindle was rotating. •The guide bushing spindle synchronization phase memory signal was turned ON while the guide bushing spindle synchronization signal was OFF. 		
Remedy		
<ul style="list-style-type: none"> •Check the ladder program. 		
M01	GB SP sync:Phase set sgml ilgl	1022
Details		
<ul style="list-style-type: none"> •The guide bushing spindle synchronization phase alignment signal was turned ON while the master spindle or guide bushing spindle was stopped. 		
Remedy		
<ul style="list-style-type: none"> •Check the ladder program. 		
M01	GB SP sync:Z phase not pass	1023
Details		
<ul style="list-style-type: none"> •When the guide bushing spindle synchronization phase memory signal was ON, the master spindle or guide bushing spindle's Z-phase was not passed. 		
Remedy		
<ul style="list-style-type: none"> •Check the ladder program. 		
M01	Cmdn impsbl in spindle rtry ax	1024
Details		
<p>Toward the synchronous tapping spindle, the switch to servo-mode is commanded to the spindle-mode rotary axis.</p> <p>The spindle-mode rotary axis in servo-mode is commanded as the synchronous tapping spindle.</p>		
Remedy		
<p>Switch to the spindle-mode rotary axis.</p>		

M01	Other cmd disabled in orient.	1025
Details		
<ul style="list-style-type: none"> •Spindle superimposition control command has been given to an orientation mode spindle with the said spindle treated as either the basic or superimposed spindle. •Orientation command has been given to the basic or superimposed spindle that is under spindle superimposition control. 		
Remedy		
<ul style="list-style-type: none"> •Cancel the orientation mode. •Use G113 or the "Spindle sync cancel" signal to cancel spindle superimposition. 		
M01	SP-C ax ctrl runs independtly	1026
Details		
<p>C axis mode command has been issued for polygon machining spindle. C axis mode command has been issued for synchronized tapping spindle. Polygon command has been issued for synchronized tapping spindle. Spindle is being used as spindle/C axis.</p>		
Remedy		
<ul style="list-style-type: none"> •Cancel the C axis command. •Cancel the polygon machining command. •Cancel the C axis with servo OFF. 		
M01	Thread recutting impossible	1027
Details		
<ul style="list-style-type: none"> •The lead axis for thread recutting is not present in a thread recut enabled part system. •A variable lead thread cut command has been given in the first thread cut block of thread recutting. 		
Remedy		
<ul style="list-style-type: none"> •Thread recutting is not supported. Disable thread recutting or press RESET to cancel the alarm, and correct the program. 		
M01	Thread recutting data illegal	1028
Details		
<p>The lead axis and spindle for thread cutting are different from those predetermined.</p>		
Remedy		
<ul style="list-style-type: none"> •Disable thread recutting or press RESET to cancel the alarm, and correct the settings of lead axis and spindle. 		
M01	Variable speed thread disabled	1029
Details		
<ul style="list-style-type: none"> •"#8045 Varying spd thread" has been set to "1" to issue a variable speed thread cut command even though the function is not included in the specifications. •A variable speed thread cut command has been given while the feed axis acceleration/deceleration type is soft acceleration/deceleration. •A variable speed thread cut command has been given while the spindle encoder signal is not sent via serial input. •A variable speed thread cut command has been given even though the spindle, lead axis or plane composing axes are controlled by drive other than MDS-E Series. •The spindle intended for thread cutting is executing synchronous tapping, spindle synchronization, guide bushing spindle synchronization or spindle/C axis control. 		
Remedy		
<ul style="list-style-type: none"> •Check the specifications. •Check the parameters. •Check the program. •Check the Encoder selection signal (R register). 		

M01	Synchronization mismatch	1030
Details		
Different M codes were each commanded as synchronization M code in each of the two part systems. Synchronization with the "I" code was commanded in another part system during M code synchronization. Synchronization with the M code was commanded in another part system during synchronization with the "I" code.		
Remedy		
<ul style="list-style-type: none"> •Correct the program so that the M codes match. •Correct the program so that the same synchronization codes are commanded. 		
M01	Multiple C axes select invalid	1031
Details		
The "C axis selection" signal has been changed when the multiple C axes selection is not available. The selected axis by the "C axis selection" signal cannot be controlled for the multiple C axes selection.		
Remedy		
<ul style="list-style-type: none"> •Correct the parameter settings and program. 		
M01	Tap retract Sp select illegal	1032
Details		
Tap retract has been executed with a different spindle selected. Cutting feed is in wait state until synchronization is completed.		
Remedy		
<ul style="list-style-type: none"> •Select the spindle for which tap cycle was halted before turning ON the "tap retract" signal. 		
M01	Sp-Sp polygon cut interlock	1033
Details		
Cutting feed is in wait state until synchronization is completed.		
Remedy		
<ul style="list-style-type: none"> •Wait for the synchronization to end. 		
M01	Mixed sync ctrl prmtr illegal	1034
Details		
There is a mistake in the settings of mixed control axis parameters (crsax [1] to [8]). Mixed control was attempted within one and the same part system. Any of the parameter settings is disabling mixed control.		
Remedy		
<ul style="list-style-type: none"> •Check the parameter settings for mixed synchronization control. 		

M01	Mixed sync ctrl disable modal	1035
Details		
Mixed synchronization control was commanded for a part system in which mixed synchronization control is disabled as shown below.		
<ul style="list-style-type: none"> •During nose R compensation mode •During polar coordinate interpolation mode •During cylindrical interpolation mode •During balance cut mode •During fixed cycle machining mode •During facing turret mirror image •During constant surface speed control mode •During hobbing mode •During axis name switch •During interference check III alarm (interference detection, interference alarm area intrusion or interference warning area intrusion) 		
Mixed control was attempted even though the number of axes in the destination part system would exceed the maximum number when an axis control was shifted to another part system.		
Mixed control was attempted even though the number of axes in the source part system would be "0" when an axis control was shifted to another part system.		
Another axis exchange was attempted to the axis which was already transferred to another part system for mixed control.		
Mixed control was attempted with an axis of a part system not in automatic operation.		
Remedy		
<ul style="list-style-type: none"> •Correct the program. 		
M01	Synchro ctrl setting disable	1036
Details		
<ul style="list-style-type: none"> •The synchronous control operation method selection (R2589 register) was set while the C axis mode was inactive. •The synchronous control operation method selection (R2589 register) was set while the zero point was undetermined. •Mirror image disable state •The external mirror image or parameter mirror image was commanded during facing turret mirror image. •Synchronous control was started while either the master or slave axis is in the PLC axis mode due to NC axis/PLC axis switchover. •The synchronous control mode was switched while the PLC axis mode was active due to NC axis/PLC axis switchover. •Manual operation was attempted while the setting of the parameter "#2703 manual_acc" (Enable constant-gradient acceleration/deceleration in manual feed) is different between the master and slave axes. •Synchronous control operation method (R2589) has been set to the axis in chopping operation. 		
Remedy		
<ul style="list-style-type: none"> •Set the contents of the R2589 register to "0". •Check the program and parameters. 		
M01	Synchro start/cancel disable	1037
Details		
Synchronous control start/cancel command was issued when the start/cancel is disabled.		
Remedy		
<ul style="list-style-type: none"> •Correct the program and parameters. 		
M01	Move cmnd invld to synchro ax	1038
Details		
A travel command was issued to a synchronized axis in synchronous control.		
Remedy		
<ul style="list-style-type: none"> •Correct the program. 		

M01	No spindle speed clamp	1043
Details		
<ul style="list-style-type: none"> When "#1146 Sclamp" has been set to "1", the constant surface speed command (G96) was issued to the spindle which is not selected for the spindle speed clamp command (G92/G50) under Multiple spindle control II. When "#1146 Sclamp" has been set to "0", both the G96 (Constant surface speed control ON) modal and the spindle forward or reverse rotation signal have turned ON for the spindle, on which the speed clamp command is disabled. 		
Remedy		
Press the reset key and carry out the remedy below.		
<ul style="list-style-type: none"> Issue the G92/G50 command to the spindle that is to be used for the constant surface speed control. 		
M01	Cont ax superimpos II prm illg	1044
Details		
<ul style="list-style-type: none"> There is a mistake in the setting of the superimposition control reference axis parameter (#2089 bsax_pl). Superimposition control is not available under the current parameter settings. 		
Remedy		
<ul style="list-style-type: none"> Correct the parameter. 		
M01	Sync error btwn part systems	1045
Details		
After a single block stop or automatic operation pause was executed during single block between part systems, cycle start has not been performed on either part system.		
Remedy		
Perform cycle start for all the part systems where a single block stop or automatic operation pause was executed.		
M01	Z detect speed parameter error	1049
Details		
Phase-Z detection speed has not been set in "#3109 zdetspd".		
Remedy		
<ul style="list-style-type: none"> Set the phase-Z detection speed in "#3109 zdetspd". 		
M01	Intrf chck across sys: Set err	1050
Details		
Setting of Interference check across part systems is incorrect.		
Remedy		
<ul style="list-style-type: none"> Correct the setting of Interference check across part systems. 		
M01	Intrf chck across sys: Area AL	1051
Details		
Interference is already occurring on the set interfering object.		
Remedy		
<ul style="list-style-type: none"> Turn OFF the interference check valid signal, moving the axis to a position where the interfering objects do not collide each other, and then restart Interference check across part systems. 		
M01	Intrf check across sys: Alarm	1052
Details		
A command has been given that causes the interfering objects to collide each other.		
Remedy		
<ul style="list-style-type: none"> Correct the program. 		

M01	Interfe chk Opt return incomp	1053
Details Interference check between part systems had started while zero point return of the part system set interfering object has not completed.		
Remedy ♦Turn OFF the interference check valid signal, and complete zero point return in the all part systems set interfering object.		
M01	Hob cut in interlock state	1056
Details You attempted to execute a cutting feed block during speed- or phase-synchronization in hob machining.		
Remedy ♦The error is canceled when hob synchronization is completed. Wait until the synchronization completion.		
M01	Feed-forward control disabled	1060
Details Feed-forward control was attempted while any of the following functions was enabled. <ul style="list-style-type: none"> ♦Control axis superimposition I/II ♦Control axis synchronization between part systems I/II 		
Remedy ♦Turn OFF the feed-forward control request signal.		
M01	Invalid axis name selection No	1062
Details An out-of-range value is set for the display axis name selection number.		
Remedy ♦Correct the sequence program.		
M01	Superimposition axis param err	1070
Details ♦Cutting feed clamp rate is unspecified for a superimposition-related axis. Or the specified rate is outside the setting range. "#2091 plclamp", "#2629 pl3clamp" or "#2630 pl3clamp2" ♦Rapid traverse rate is unspecified for a superimposition-related axis. Or the specified rate is outside the setting range. "#2090 plrapid", "#2621 plrapid2", "#2626 pl3rapid", "#2627 pl3rapid2" or "#2628 pl3rapid3"		
Remedy ♦Set the cutting feed clamp rate of the superimposition-related axis within the setting range. ♦Set the rapid traverse rate of the superimposition-related axis within the setting range.		
M01	Tool retract & return disabled	1080
Details Tool retract and return command has been given in any of the following modes: <ul style="list-style-type: none"> ♦ Mixed control (Cross axis control) I ♦ Mixed control (Cross axis control) II ♦ Control axis synchronization between part systems I ♦ Control axis synchronization between part systems II ♦ Control axis superimposition I ♦ Control axis superimposition II ♦ Arbitrary axis superimposition control ♦ Tool spindle synchronization IA (spindle - spindle polygon) ♦ Tool spindle synchronization IB (spindle - spindle polygon) ♦ Tool spindle synchronization IC (spindle - NC axis polygon) ♦ Tool spindle synchronization II (hob) ♦ Spindle superimposition control 		
Remedy Turn OFF the transit point designation signal.		

M01	Not rest arb ax exch ax config	1100
Details		
When the axis exchange status by arbitrary axis exchange control is set to be retained at power off, the axis state before power off cannot be restored.		
Remedy		
•Turn the power off and on again.		
M01	Arbitrary axis unexchangeable	1101
Details		
The axis declared in the arbitrary axis exchange command is incapable of being exchanged.		
Remedy		
•Check both the program of the part system that issues the arbitrary axis exchange command and that of the part system subject to the axis exchange. Correct the program blocks in which the command is issued or the axis exchange is executed, if necessary.		
M01	Cross control axis exists	1102
Details		
A manual travel command has been given to the axis being exchanged when manual interruption is disabled under cross machining control (when "#1435 crsman" = 0).		
Remedy		
•This error can be cancelled by either one of the following operations. 1: Cancel the manual travel command 2: Reset the NC		
M01	Arbitrary ax superimp. sys err	1103
Details		
•Arbitrary axis superimposition command has been issued in any part system other than the one that contains either the reference or superimposed axis of arbitrary axis superimposition control. •Arbitrary axis superimposition cancel command has been issued in any part system other than the one that contains the superimposed axis of arbitrary axis superimposition control.		
Remedy		
•Correct the program so that the arbitrary axis superimposition command is given in an appropriate part system.		
M01	Spindle speed fluctuation	1105
Details		
The actual spindle speed has fluctuated exceeding the allowable range, while spindle speed fluctuation detection (G162) is active. The number following "S", which is output together with this alarm, indicates the spindle where speed fluctuations were detected.		
Remedy		
•Unnecessarily large load may be applied to the spindle during automatic operation. Reduce the spindle load. •To prevent this alarm from being output during spindle speed fluctuation detection (G162), set the parameter #1242 set14 BIT2 to ON.		
M01	Sp synchro phase calc illegal	1106
Details		
Spindle synchronization phase alignment command was issued while the "phase shift calculation request" signal was ON.		
Remedy		
•Correct the program. •Correct the sequence program.		

M01	Illegal cmd in SP oscillation	1108
Details		
A function that cannot be used with spindle oscillation was commanded during spindle oscillation.		
Remedy		
•Command the function after finishing spindle oscillation.		
M01	SP oscillation cmd illegal	1109
Details		
Spindle oscillation was commanded during executing a function that cannot be used with spindle oscillation.		
Remedy		
•Command spindle oscillation after finishing the function that cannot used with spindle oscillation.		
M01	SP oscillation set val illegal	1110
Details		
Spindle oscillation was commanded while a value out of range is set as spindle oscillation amplitude or spindle oscillation frequency.		
Remedy		
•Check the setting values of the amplitude and frequency.		
M01	Sub part system I call error	1111
Details		
•Sub part system control I command (G122) has been given to a part system where the sub part system I operation mode is deactivated.		
•Sub part system control I command (G122) has been given to a part system which is not reserved as the sub part system in M80.		
Remedy		
•Activate the sub part system I operation mode for the sub part system before issuing G122. Part systems marked "SUB" on the monitor screen are under the sub partsystem I operation mode.		
•Command the sub part system start to the sub part system which is reserved with "#1483 SBS1_sys num" for M80.		
M01	Sub part system II start error	1112
Details		
When the sub part system control II has been commanded, no part system is left capable of being activated as a sub part system.		
Remedy		
•Do not exceed the maximum number of simultaneously activatable sub part systems when commanding G144.		
•Set the parameter #1437 SBS2_Spec BIT0 to 0 if you wish to wait until the sub part system becomes capable of being activated.		
M01	Constant surface speed rdndnt	1113
Details		
•Constant surface speed is commanded from other part system to the spindle that is in the thread/ thread cycle or the tapping cycle/ synchronous tapping cycle.		
•To the spindle in constant surface speed control, the thread/ thread cycle or the tapping cycle/ synchronous tapping cycle are commanded from other part system.		
Remedy		
•Check the program.		

M01	Constant torque disabled	1114
Details		
<ul style="list-style-type: none"> • Constant torque control is commanded to the axis which the parameter "#2296 SV096(TQC)" (Constant torque control: Stopper-direction torque) setting is "0". • Constant or proportional torque stopper control is commanded to the axis which is in movement by automatic or manual operation. • Constant torque control is canceled to the constant torque control axis in movement by automatic or manual operation. • Constant torque control is commanded to the proportional torque stopper control axis. • Constant torque control is commanded again during the axis movement by constant torque control cancel. • Constant torque control axis is at stroke limit or H/W stroke end. 		
Remedy		
<ul style="list-style-type: none"> • Check the program. • Check the sequence program. 		
M01	P torque stopper disabled	1115
Details		
<ul style="list-style-type: none"> • Proportional torque stopper control is commanded to the axis which the parameter "#2296 SV096(TQC)" (Constant torque control: Stopper-direction torque) setting is "0". • Proportional torque stopper control is commanded to the axis which is in movement by automatic or manual operation. • The axis movement is commanded to the axis which is in the proportional torque constant control. • Proportional torque constant control is commanded again during the axis movement by proportional torque constant control cancel. • Proportional torque constant control axis is at stroke limit or H/W stroke end. 		
Remedy		
<ul style="list-style-type: none"> • Check the program. • Check the sequence program. 		
M01	Droop cancel disabled	1116
Details		
<ul style="list-style-type: none"> • Constant torque control droop cancel is commanded to the axis which is not in the constant/ proportional torque control. • Constant torque control droop cancel is commanded to the axis in movement by automatic or manual operation. 		
Remedy		
<ul style="list-style-type: none"> • Check the program. • Check the sequence program. 		
M01	Cmnd disabled in droop cancel	1117
Details		
The axis movement by automatic or manual operation is commanded to the axis which the constant torque control droop is being canceled.		
Remedy		
<ul style="list-style-type: none"> • Check the program. • Check the sequence program. 		
M01	SP equivalent load factor over	1120
Details		
The equivalent load factor of the spindle motor has exceeded the set threshold that causes the excess warning.		
Remedy		
<ul style="list-style-type: none"> • Change the operation pattern in a way that decreases the spindle motor load. 		

M01	Differential tap cmnd disabled	1131
Details		
<ul style="list-style-type: none"> •Differential speed tap command has been given although any rotation command has not been input to the reference spindle that is under spindle superimposition control. •Synchronous tap command has been given to the reference spindle that is under spindle superimposition control. 		
Remedy		
<ul style="list-style-type: none"> •Cancel the synchronous tapping cycle. 		
M01	Spd clamp in differential tap	1132
Details		
<ul style="list-style-type: none"> •A tap cycle or synchronous tap cycle command given to the superimposed spindle has caused the spindle's actual rotation speed to exceed the spindle clamp speed. 		
Remedy		
<ul style="list-style-type: none"> •Correct the spindle rotation speed in synchronous tap cycle. 		
M01	Constant surface spd disabled	1133
Details		
<ul style="list-style-type: none"> •A constant surface speed control command has been given to the reference or superimposed spindle during differential speed tapping under spindle superimposition control. •A differential speed tapping command has been issued while constant surface speed control is executed on the reference or superimposed spindle that is under spindle superimposition control. 		
Remedy		
<ul style="list-style-type: none"> •Cancel the synchronous tap cycle or constant surface speed control. 		
M01	Spindle sync cancel error	1135
Details		
<ul style="list-style-type: none"> •Spindle synchronization cancel command has been issued during rotation of C axis under spindle sync C axis control. •G113 (without the address H or D) has been issued during the spindle synchronization for two or more sync sets. 		
Remedy		
<ul style="list-style-type: none"> •This operation error is cancelled when C axis stops. Issue a spindle sync cancel command after C axis has stopped. •Use G113D or G113H to cancel the spindle synchronization. 		
M01	GB SP sync:Cancel sgnl illegal	1137
Details		
<p>The guide bushing spindle synchronization temporary cancel signal was turned ON/OFF when the master spindle and the guide bushing spindle were in one of the following modes.</p> <ul style="list-style-type: none"> •During rotation (when not stopped) •During tap cycle synchronization mode •During spindle synchronization mode •During tool-spindle synchronization I (polygon machining) mode •During tool-spindle synchronization II (hobbing) mode •During spindle C axis control C axis mode •During orientation/indexing 		
Remedy		
<ul style="list-style-type: none"> •Check the ladder program. 		
M01	GB SP sync runs independently	1138
Details		
<ul style="list-style-type: none"> •The reference spindle was commanded as a spindle related to tool spindle synchronization IC (polygon). •The guide bushing spindle was commanded as a synchronous tapping spindle. •The guide bushing spindle was commanded as a spindle related to spindle synchronization/tool spindle synchronization I (polygon)/tool spindle synchronization II (hobbing). 		
Remedy		
<ul style="list-style-type: none"> •Check the program. 		

M01	Cmds illegal in spindle synchr	1139
	Details Synchronous tapping was issued for the reference spindle or the synchronized spindle during spindle synchronization.	
	Remedy •Cancel the synchronous tapping cycle by reset.	
M01	Operation non-continuable(STO)	1151
	Details An axis in STO state exists in the part system.	
	Remedy •Release the STO state and reset the NC.	
M01	Operation non-continuable(SOS)	1152
	Details An axis in SOS state exists in the part system.	
	Remedy •Release the SOS state and reset the NC.	
M01	Prog check: work posn error	1215
	Details When the NC reset signal is input with the High-speed simple program check: Coordinate position check ON signal (Y76B) set to ON, the workpiece coordinate position is different from the position at the program start.	
	Remedy •Correct the machining program.	
M01	Prog check: machine posn error	1216
	Details When the NC reset signal is input with the High-speed simple program check: Coordinate position check ON signal (Y76B) set to ON, the machine coordinate position is different from the position at the program start.	
	Remedy •Correct the machining program.	
M01	NC/PLC axis switch illegal	1250
	Details The following operation was performed to an axis which can be switched over between NC axis and PLC axis.	
	•PLC axis switchover signal was turned ON or OFF when it was prohibited to switch over the axis.	
	Remedy •Make sure the axis switchover status signal is OFF and change the ON/OFF of the axis switchover signal.	
M01	No spec: Multi axis synch ctrl	1254
	Details You have set the R register for selecting synchronous control operation method, although the option of multiple axis synchronization control is OFF.	
	Remedy •Set 0 in R2589 (Synchronous control operation method selection).	
M01	Multiple secondary ax selected	1255
	Details For the multiple axis synchronization control, you selected two or more slave axes without selecting any master axis.	
	Remedy •Correct the setting of R2589 (Synchronous control operation method selection).	

M01	NC axis not switchable	1260
Details		
<ul style="list-style-type: none"> •The trigger for NC axis switchover was activated for an axis not in a state where NC axis switchover is permissible. •The trigger for NC axis switchover was activated specifying a number outside the range for the setting of NC-axis switchover. 		
Remedy		
<ul style="list-style-type: none"> •Cancel the error by turning off the signal for requesting NC axis switchover (AXCHGCMD/bit8) for the corresponding axis, and modify the state of the axis before turning on the signal again. •Correct the number for the setting of NC-axis switchover (AXCHGCMD/LO 8bit), and turn on the signal for requesting NC axis switchover (AXCHGCMD/bit8) again. 		
M01	Spindle not switchable	1261
Details		
<ul style="list-style-type: none"> •The trigger for spindle switchover was activated for a spindle not in a state where spindle switchover is permissible. •The trigger for spindle switchover was activated specifying a number outside the range for the setting of spindle switchover. 		
Remedy		
<ul style="list-style-type: none"> •Cancel the error by turning off the signal for requesting spindle switchover (SPCHGCMD/bit8) for the corresponding spindle, and modify the state of the spindle before turning on the signal again. •Correct the number for the setting of spindle switchover (SPCHGCMD/LO 8bit), and turn on the signal for requesting spindle switchover (SPCHGCMD/bit8) again. 		
M01	Sync ctrl op method chg dsbl	1270
Details		
Synchronous control operation method (R2589) has been changed for the axis in which Synchronous control and chopping are used together.		
Remedy		
<ul style="list-style-type: none"> •Change the axis bits of Synchronous control operation method (R2589) back to the previous settings. 		
M01	Independent op ax chop invld	1271
Details		
Chopping has been started up for the axis in Independent operation.		
Remedy		
<ul style="list-style-type: none"> •Reset or turn OFF "Chopping" signal (CHPS). 		
M01	Slave ax set as chopping ax	1272
Details		
Chopping has been started up for the slave axis in Synchronous control operation.		
Remedy		
<ul style="list-style-type: none"> •Reset or turn OFF "Chopping" signal (CHPS). •Specify the master axis as the chopping axis. 		
M01	Cmnd invalid during VCC mode	1300
Details		
The issued command is disabled during the vibration cutting mode.		
Remedy		
<ul style="list-style-type: none"> •Correct the program. 		
M01	VCC mode command invalid	1301
Details		
Vibration cutting mode start command has been issued although the command is disabled during the currently active mode.		
Remedy		
<ul style="list-style-type: none"> •Correct the program. 		

M01	VCC invalid	1302	Error cause number
	Details [When error cause No. is 0001] Cutting is being performed without vibration cutting control. [When error cause No. is 0002] Vibration cutting is being performed with OMR-FF being disabled.		
	Remedy [When error cause No. is 0001] •Make sure that the "VCC: Temporary cancel of axis vibration" signal (R22532) is OFF. •Make sure that the spindle speed command is not "0" when the cutting command is issued. •Make sure that neither synchronized axis nor superimposed axis is included in the part system. [When error cause No. is 0002] •Make sure that the servo parameter "#2313 SV113" bit0 is "1" and bit1 is "0" for the VCC objective axes.		
M01	Feedrate limited during VCC	1303	
	Details The specified feedrate is being limited to the clamp feedrate during the vibration cutting mode.		
	Remedy •Correct the program.		
M01	VCC condition not found	1304	
	Details No applicable condition is found during the selection of the vibration cutting condition.		
	Remedy •Correct the program. •Check the setting of the frequency upper limit "#12131 FrqClmpSys_VCC". •Check the settings of the maximum spindle rotation speed "#3005 smax1" to "#3008 smax4" and the minimum rotation speed "#3023 smini".		
M01	Cannot change SP speed in VCC	1307	
	Details You changed the spindle rotation speed during vibration cutting control.		
	Remedy •Wait for completion of vibration cutting control, or input Reset to cancel the VCC mode.		
M01	Cannot re-run SP during VCC	1308	
	Details You stopped the spindle during vibration cutting control, and then attempted to re-run it.		
	Remedy •If you have stopped the spindle during vibration cutting control, input Reset to cancel the VCC mode before re-running the spindle.		
M01	Vib. feedrate limited in VCC	1309	
	Details The vibration feedrate is being limited during the vibration cutting mode.		
	Remedy •Correct the program. •Correct the setting of "#12586 ActualClamp_VCC" (Maximum vibration feedrate for each axis).		
M01	VCC in sp speed limitation	1411	
	Details Spindle rotation speed is limited so that vibration frequency does not exceed the Upper limit of frequency (#12131 FrqClmpSys_VCC).		
	Remedy •Reduce the number of vibration. •Reduce the spindle rotation speed. •Check the setting value of Upper limit of frequency (#12131 FrqClmpSys_VCC).		

M01	Chatter supp set ax illegal	1602
Details ♦When chatter suppression was requested, the specified spindle did not exist. ♦When chatter suppression was requested, a spindle that was under chatter suppression in another part system was specified.		
Remedy ♦Correct the setting.		
M01	No spec: Chatter suppression	1607
Details Chatter suppression is not included in the specifications.		
Remedy ♦Turn off the chatter suppression request signal.		
M01	Chatter suppression SP stop	1608
Details The spindle used in chatter suppression is stopped.		
Remedy ♦Rotate the spindle. ♦Turn off the chatter suppression request signal. ♦Check for a broken wire in the spindle encoder cable. ♦Check the connections for the spindle encoder connectors. ♦Check the spindle encoder pulse.		
M01	HPU in preparation	1620
Details HPU custom module is being registered and deleted. When this error is being displayed, HPU custom module cannot be input, restored or executed cycle start. This alarm is exported to NC alarm 5.		
Remedy ♦When the registration and deletion of the HPU custom module is completed, an error will be canceled automatically.		
M03	Interference detection	0001 yyzz
Details A command has been given that causes two or more objects to interfere with each other. yy : Interference object definition number (1) zz : Interference object definition number (2)		
Remedy ♦Cancel the alarm with reset. ♦Disable the interference check III mode first before moving the interfering object further in the interference direction.		
M03	Entry in interfere alarm area	0002 yyzz
Details Two or more interfering objects are in the interference alarm area. yy : Interference object definition number (1) zz : Interference object definition number (2)		
Remedy ♦Disable the interference check III mode before moving. ♦Check the interference definition and the interference selection.		

M03	Entry in interfere warn area	0003	yyzz
Details A command has been given that causes two or more interfering objects to enter the interference warning area. yy : Interference object definition number (1) zz : Interference object definition number (2)			
Remedy <ul style="list-style-type: none"> Interfering objects are in the interference warning area. If an operational problem is expected to occur, stop moving the axes with feed hold, cancellation of manual axis movement or reset.			
M03	Interference data unspecified	1001	
Details You attempted to turn ON the interference check III mode with the interfering object data disabled.			
Remedy <ul style="list-style-type: none"> Execute the interference data ON command to enable the interference data before turning ON the interference check III mode. 			
M03	Interf. 3D objects count error	1002	
Details The total number of solid objects used as interfering object has exceeded the maximum.			
Remedy <ul style="list-style-type: none"> The total number of interfering solid objects set in the system variable or R register has exceeded the maximum. Correct the setting. 			
M03	Interfere check III: time over	1003	
Details The allowable process time for interference check III has been exceeded.			
Remedy <ul style="list-style-type: none"> Turn OFF the interference check III mode. Correct the interfering object definition. 			
M03	Too many interfering objects	1004	
Details The total number of selected interfering objects enabled by the interfering object enable/disable designation exceeds the maximum number.			
Remedy <ul style="list-style-type: none"> The total number of interfering objects in interfering object selection specified with system variables or R registers exceeds the maximum number. Correct the settings. 			
M03	Interfere: control axis error	2001	Interference object definition number
Details In the interfering object definition, the IJK control axes have been set as follows: <ul style="list-style-type: none"> Nonexistent axis name (an axis not set in the base axis specification parameter "#1022 axname2") I, J and K axes belong to different part systems Rotary axis 			
Remedy <ul style="list-style-type: none"> Correct the setting of the IJK control axes in the interfering object definition. 			
M03	Interf:2 rot axes in cylinder	2002	Interference object definition number
Details In the interfering object definition, two or more rotary axes have been set for the cylindrical solid definition No.			
Remedy <ul style="list-style-type: none"> Correct the solid designation and the setting of the IJK axis rotation angle in the interfering object definition. 			

M03	Interfere:2 rot axes in cuboid	2003	Interference object definition number
Details In the interfering object definition, two or more rotary axes have been set for the cuboidal solid definition No.			
Remedy ♦Correct the setting of the IJK axis rotation angle in the interfering object definition.			
M03	Interfere: rotary axis error	2004	Interference object definition number
Details In the interfering object definition, the IJK rotary axes have been set as follows: ♦Nonexistent axis name (an axis not set in the base axis specification parameter (#1022 axname2)) ♦Linear axis ♦All three axes are rotary axes			
Remedy ♦Correct the setting of the IJK rotary axes in the interfering object definition.			
M03	Interfere:2 rot axes object er	2005	Interference object definition number
Details The solid object set in the interfering object definition is unavailable as an interfering object defined with two rotary axes.			
Remedy ♦Correct the setting of the solid in the interfering object definition.			
M03	Interfere:1 rot axis object er	2006	Interference object definition number
Details The solid object set in the interfering object definition is unavailable as an interfering object defined with one rotary axis.			
Remedy ♦Correct the setting of the solid in the interfering object definition.			
M03	No spec: int obj def warn area	2007	
Details The interference warning area is set with interfering object definition or interfering object selection.			
Remedy ♦Correct the settings of the configured solid specification of interfering object definition or the interfering object specification of interfering object selection.			
M03	Too many int obj config solids	2008	
Details The number of solids comprising an interfering object exceeds the maximum number.			
Remedy ♦Correct the solid designation in the interfering object definition.			
M03	Interf. selection: offset over	3001	Interference object definition number
Details In the interfering object selection, the interfering object model coordinate system offset 1 has exceeded the setting.			
Remedy ♦Correct the setting of the interfering object model coordinate system offset 1 in the interfering object selection.			

M03	Interf:rot objects comb. error	3002	Interference object definition number
Details The following selection was made for the rotary interfering objects: ♦You selected a one-rotary-axis object and two-rotary-axis object at a time. ♦You selected two or more two-rotary-axis objects.			
Remedy ♦Correct the setting of the n-th interfering object selection.			
M50	WCS offset not reflected	5000	
Details Any of the following items being selected has not been reflected in the workpiece position counter or in the program position counter: workpiece coordinate system offset, extended workpiece coordinate system offset, external workpiece coordinate system offset, workpiece coordinate system shift or workpiece base point offset.			
Remedy Perform one of the following actions to cancel the warning. ♦Cycle start ♦Reset ♦Emergency stop			
M50	Multiple key inputs invalid	5002	
Details ♦Multiple key presses were detected. 0xxx: indicates the first detected key-code. ♦Simultaneous key presses were detected. No key-code is indicated.			
Remedy ♦Go to the alarm history to check the key-codes. Clean the keys and check the performance. ♦Press one key at a time.			
M50	Continuous write of parameter	5003	
Details Parameter is being written in every PLC scan cycle using a "write window" of the PLC window function. This may affect the performance.			
Remedy ♦Correct the user PLC (ladder sequence).			
M50	Spindle/C axis displacement	5004	
Details A displacement occurred when switching axis from spindle mode to C axis mode.			
Remedy ♦Contact our service center. ♦Cancel the alarm by resetting.			
M50	Cannot start multi-axis sync	5005	
Details The bit of the register R2589 (Synchronous control operation method) that corresponds to the multiple-axis synchronization control axis has been set to "1" while multiple-axis synchronization control is disabled.			
Remedy ♦Set the bits of R2589 (Synchronous control operation method) that correspond to the multiple-axis synchronization control axes to "0".			

M50	BrakeWearDiagnostics (Caution)	5006
Details The axis travel amount exceeded the brake wear diagnostics allowable travel amount (Caution) during brake wear diagnostics. The axis name of the axis where the error occurred is displayed.		
Remedy <ul style="list-style-type: none"> •Move the axis to a safe position with manual operation, turn off the power, and take corrective action for the brake. This warning is cleared upon successful completion of brake wear diagnostics, which is performed after the power is turned back on. •This warning can be cleared by the brake wear diagnostics alarm reset signal. The brake wear diagnostics incomplete signal (BWDNFm) remains on. 		
M50	Brake wear diag param invalid	5007
Details The brake wear diagnostics parameters are incorrectly configured.		
<ul style="list-style-type: none"> •The value of "#12597 BWD_TOL(Caution)" is greater than or equal to "#12596 BWD_TOL(Warning)". The operation error (M50 5006) is not generated. 		
Remedy <ul style="list-style-type: none"> •Correct the parameter settings so that "#12597 BWD_TOL(Caution)" value is smaller than "#12596 BWD_TOL(Warning)" value. 		
M90	Parameter set mode	
Details The setup parameter lock is released. Cycle start is disabled when setup parameters can be set.		
Remedy <ul style="list-style-type: none"> •Refer to the manual issued by the machine tool builder. 		
M95	Insuf lsr proc cond in DR ctrl	9501
Details Only one or no laser processing condition has been set for DR control.		
Remedy <ul style="list-style-type: none"> •Set two or more laser processing conditions with different speeds for DR control. 		
M95	DR ctrl invalid (Laser power)	9502
Details The laser power command by DR control is less than or equal to 0.		
Remedy <ul style="list-style-type: none"> •Correct the laser processing condition for DR control. 		
M95	DR ctrl invalid (Frequency)	9503
Details The frequency command by DR control is less than or equal to 0.		
Remedy <ul style="list-style-type: none"> •Correct the laser processing condition for DR control. 		
M95	DR ctrl invalid (Duty)	9504
Details The duty command by DR control is less than or equal to 0.		
Remedy <ul style="list-style-type: none"> •Correct the laser processing condition for DR control. 		
M95	Excess max stop time w beam ON	9505
Details There has been no axis movement with laser being ON for a longer period than specified with "#90005 lsr_max_stop_t" (Maximum stop time with beam ON).		
Remedy <ul style="list-style-type: none"> •Correct the machining program. 		

M95	Laser prcsg initial set error	9506
Details		
The parameters required for enabling laser processing control have not been configured.		
Remedy		
Correct the parameters.		
<ul style="list-style-type: none"> ♦ "#1026 base_I" (Base axis I) to "#1028 base_K" (Base axis K) ♦ "#8090 SSS ON" = 1 ♦ "#12066 Tolerance ctrl ON" = 1 		
M95	Laser prcsg parameter error	9507
Details		
A function that cannot be used in the part system where laser processing is active has been enabled.		
Remedy		
Correct the parameter.		
<ul style="list-style-type: none"> ♦ "#12060 VblAccPreInt" (Variable-acceleration pre-interpolation acceleration/deceleration control while high-accuracy control) = 0 ♦ "#1190 s_xcnt" (Inclined-axis control) = 0 		
M95	Beam ON impossible	9508
Details		
Laser beam was turned on when beam ON was not permissible.		
<ul style="list-style-type: none"> ♦ The "Laser beam irradiation ready" signal is not on. ♦ Miscellaneous function strobe 1 to 4 are ON. ♦ The laser condition change strobe (X1CA6) is ON. ♦ The laser processing function is not included in the specifications. 		
Remedy		
<ul style="list-style-type: none"> ♦ Perform the preparatory operation required for beam ON, and turn on the "Laser beam irradiation ready" signal. ♦ When the laser processing condition is switched using an M code, turn on the "M function finish" signal. ♦ When the current laser processing condition was changed using the laser processing condition selection screen or the laser processing condition setting screen, turn on the "Laser condition change complete" (Y1-CA6). ♦ Check the specifications. 		
M95	Ax stop time w beam ON mon OFF	9509
Details		
Monitoring of axis stop time with beam ON has been disabled.		
Remedy		
<ul style="list-style-type: none"> ♦ After power calibration has completed, turn off the "Axis stop time with beam ON monitoring OFF" signal. 		
M95	Hgt ctrl ax travel impossible	9510
Details		
<ul style="list-style-type: none"> ♦ An attempt was made to execute a travel command for the height control axis during height control. ♦ An attempt was made to move the height control axis manually during height control. 		
Remedy		
<ul style="list-style-type: none"> ♦ Correct the program. ♦ Turn off height control before moving the height control axis. 		
M95	Power calibration data invalid	9511
Details		
The power calibration data contains a value outside the allowable range.		
Remedy		
<ul style="list-style-type: none"> ♦ Correct the power calibration data in "#90121 lsr_calib_cmd01" through "#90180 lsr_calib_meas30". 		

M95	Fast retract ctrl: Inv retract	9512
Details		
The specified retraction amount for fast retraction control exceeds the parameter "#90107 lsr_HEvac_rise_lim" (Height control_Fast retraction control lift upper limit).		
Remedy		
♦Correct address R for fast retraction control or the parameter "#90107 lsr_HEvac_rise_lim" (Height control_Fast retraction control lift upper limit).		
M97	Maintenance part activated	
Details		
Activated maintenance part has not completed the product procedures.		
Remedy		
♦Contact our service center.		

Stop Codes (T)

2 Stop Codes (T)

T01	Axis in motion	0101
Details		
Automatic start is not possible as one of the axes is moving.		
Remedy		
♦Try automatic start again after all axes have stopped.		
T01	NC not ready	0102
Details		
Automatic start is not possible as the NC is not ready.		
Remedy		
♦Another alarm has occurred. Check the details and remedy.		
T01	Reset signal ON	0103
Details		
Automatic start is not possible as the "reset" signal has been input.		
Remedy		
♦Turn OFF the "reset" signal.		
♦Check for any failure of the reset switch which has caused the switch's continuous ON.		
♦Correct the sequence program.		
T01	Auto operation pause signal ON	0104
Details		
The feed hold switch on the machine operation panel is ON (valid).		
Remedy		
♦Correct the feed hold switch setting.		
♦The feed hold switch is B contact switch.		
♦Fix any broken wires in the feed hold signal line.		
♦Correct the sequence program.		
T01	H/W stroke end axis exists	0105
Details		
Automatic start is not possible as one of the axes is at the stroke end.		
Remedy		
♦Manually move any axis whose end is at the stroke end.		
♦Check for any broken wires in the stroke end signal line.		
♦Check for any failure in the stroke end limit switch.		
T01	S/W stroke end axis exists	0106
Details		
Automatic start is not possible as one of the axes is at the stored stroke limit.		
Remedy		
♦Move the axis manually.		
♦If the axis's end is not at the stroke end, check the parameters.		
T01	No operation mode	0107
Details		
The operation mode has not been selected.		
Remedy		
♦Select automatic operation mode.		
♦Check for any broken wires in the signal line for automatic operation mode (memory, tape, MDI).		

2 Stop Codes (T)

T01	Operation mode duplicated	0108
Details Two or more automatic operation modes have been selected.		
Remedy <ul style="list-style-type: none"> ♦Check for any short circuit in the mode (memory, tape, MDI) selection signal line. ♦Check for any failure in the switch. ♦Correct the sequence program. 		
T01	Operation mode changed	0109
Details The automatic operation mode has changed to another automatic operation mode.		
Remedy <ul style="list-style-type: none"> ♦Return to the original automatic operation mode, and execute automatic start. 		
T01	Tape search execution	0110
Details Automatic start is not possible as tape search is being executed.		
Remedy <ul style="list-style-type: none"> ♦Wait for the tape search to be completed and then execute the automatic start. 		
T01	Cycle start prohibit	0111
Details Automatic start is disabled because restart search is in execution.		
Remedy <ul style="list-style-type: none"> ♦Execute automatic start after the restart search is completed. 		
T01	CNC overheat	0113
Details Automatic start is not possible because a thermal alarm (Z53 CNC overheat) has occurred.		
Remedy <ul style="list-style-type: none"> ♦Temperature of the control unit has exceeded the specified temperature. ♦Take appropriate measures to cool the unit. 		
T01	Cycle st. prohibit(Host comm.)	0115
Details Automatic start cannot is not possible because the NC is communicating with the host computer.		
Remedy <ul style="list-style-type: none"> ♦Wait for the communication with host computer to be ended and then execute the automatic start. 		
T01	Cycle st prohibit(Battery alm)	0116
Details Automatic start is not possible because the voltage of the battery in the NC control unit has dropped.		
Remedy <ul style="list-style-type: none"> ♦Replace the battery of the NC control unit. ♦Contact the service center. 		
T01	R-pnt offset value not set	0117
Details Automatic operation is not possible because no reference position offset value has been set.		
Remedy <ul style="list-style-type: none"> ♦Perform the reference position initialization setting, then set "#2034 rfpofs(Distance-coded reference position detection offset)". 		

2 Stop Codes (T)

T01	In absolute position alarm	0138
Details ♦A start signal was input during an absolute position detection alarm.		
Remedy ♦Clear the absolute position detection alarm, and then input the start signal.		
T01	In abs posn initial setting	0139
Details ♦A start signal was input during zero point initialization in the absolute position detection system.		
Remedy ♦Complete zero point initialization before inputting the start signal.		
T01	In manual measurement	0143
Details Automatic start is disabled because manual measurement is in execution.		
Remedy ♦Execute automatic start after the manual measurement is completed.		
T01	Sub part sys I mode is active	0146
Details Cycle start signal was input for the part system that has applied Sub-part system I operation mode.		
Remedy ♦Use Sub-part system I operation mode signal to switch whether to start the operation as Sub-part system control or to execute cycle start as Main-part system.		
T01	Mach. interrupt non-startable	0147
Details Machining interruption related functions cannot be started up.		
Remedy ♦To resume the operation from the state of being stopped at the selected point, set the automatic operation mode to the memory mode. ♦To perform the retraction, confirm that retraction is enabled (the "Retraction executable" signal is ON). ♦To resume the operation from the state of being stopped at a certain block of the retraction program, activate the memory mode and turn ON the "Retraction start" signal. ♦Check the sequence program to make sure that multiple start signals are not input at the same time. (Note) The remedies stated above apply not only to retraction but also to the other machining interruption-related functions. (The start signals and ready states are replaced with those for each function.)		
T01	APLC password mismatch	0160
Details Automatic start is disabled because the APLC authentication password is inconsistent.		
Remedy ♦Contact the machine tool builder.		
T01	Cycle st. prohibit(safe speed)	0165
Details An automatic operation was started in one of the following machining modes during the safe speed clamp: thread cutting, synchronous tapping, cross machining, superimposition control, tool center point control or SSS control.		
Remedy ♦Turn ON the safely-limited speed monitoring request signal and press the cycle start button. ♦Close the door and press the cycle start button.		

2 Stop Codes (T)

T01	Cannot start Cyc OP (BWD WARN)	0166
	Details Cycle operation cannot be started because of the operation error "M01 0371 BrakeWearDiagnostics (Warning)". Remedy ♦Clear the operation error (M01 0371), and then start cycle operation.	
T01	Cannot start Cyc OP (in BWD)	0167
	Details Cycle operation cannot be started because there is an axis under brake wear diagnostics in the system. Remedy ♦After the completion of brake wear diagnostics, start cycle operation.	
T01	Cycle start prohibit (AL Z83)	0172
	Details Cycle start is disabled while the system alarm Z83 (NC started during SP rotation) is occurring. Remedy ♦Turn OFF the power and make sure that the spindle is at a standstill. And then turn the power ON again.	
T01	In interference check alarm	0173
	Details Cycle start cannot be operated because interference check alarm is in progress. Remedy ♦Release the interference check alarm before operating the cycle start.	
T01	Cycle st forbid (measuring err)	0176
	Details Cycle start cannot be executed for other part systems during measurement of rotation center error or workpiece installation error. Remedy Execute cycle start for one part system that is ready for measurement. Cancel measurement when error measurement is not executed.	
T01	Cycle start prohibit (OP error)	0177
	Details Cycle start was executed during operation error where cycle start cannot be executed. Remedy After canceling operation error, execute cycle start.	
T01	Cycle start prohibit(SBT warn)	0185
	Details Cycle start is disabled because the axis in SBT warning exists in the system. Remedy After cancelling the SBT warning, execute the cycle start.	
T01	Cycle start prohibit	0190
	Details Automatic start is not possible because the setting of setup parameters is enabled. Remedy ♦Refer to the manual issued by the machine tool builder.	
T01	Cycle start prohibit	0191
	Details Automatic start was attempted while a file was being deleted/written. Remedy ♦Wait for the file to be deleted/written and then execute the automatic start.	

2 Stop Codes (T)

T01	Cycle st. prohibit (Term exp'd)	0193
Details Automatic start is not possible because the valid term has been expired.		
Remedy •Obtain a decryption code from the machine tool builder and input it in the NC, then turn the power ON again.		
T01	Cycle start disabled (in SBT)	0194
Details Cycle start is disabled because the break test is being executed for some axes in the system.		
Remedy •Execute cycle start after the break test is completed.		
T01	Cycle start prohibit (HD mode)	0196
Details Cycle start is disabled because the HD operation option is OFF.		
Remedy •If you store user programs in the memory, set "#11053 UserProgramStorage" (User program storage destination) to "0" and then restart the NC. •If you store user programs in the hard disk, add the HD operation option.		
T01	Cycle start prohibit(in SBT)	0197
Details Cycle start is disabled because the axis in brake test exists in the system.		
Remedy After the brake test completed, execute the cycle start.		
T02	EMG stop	0200
Details An emergency stop occurred during automatic operation.		
Remedy •After the emergency stop is canceled, the operation can be continued.		
T02	H/W stroke end axis exists	0201
Details An axis is at the stroke end.		
Remedy •Manually move the axis away from the stroke end limit switch. •Correct the machining program.		
T02	S/W stroke end axis exists	0202
Details An axis is at the stored stroke limit.		
Remedy •Manually move the axis. •Correct the machining program.		
T02	Reset signal ON	0203
Details The reset has been entered.		
Remedy •The program execution position has returned to the start of the program. Execute automatic operation from the start of the machining program.		

2 Stop Codes (T)

T02	Auto operation pause signal ON	0204
	Details The "feed hold" switch is ON.	
	Remedy ♦Press the CYCLE START switch to resume the automatic operation.	
T02	Operation mode changed	0205
	Details The operation mode has changed to another mode during automatic operation.	
	Remedy ♦Return to the original automatic operation mode, and press the CYCLE START switch to resume the automatic operation.	
T02	Acc/dec time cst too large	0206
	Details The acceleration and deceleration time constants are too large. (This alarm occurs with the system alarm Z59.)	
	Remedy ♦Set a larger value for "#1206 G1bF(Maximum speed)". ♦Set a smaller value for "#1207 G1btL(Time constant)". ♦Set a lower cutting speed.	
T02	Abs posn detect alarm occurred	0215
	Details An absolute position detection alarm occurred.	
	Remedy ♦Clear the absolute position detection alarm.	
T02	Aux axis changeover error	0220
	Details A travel command was issued to an auxiliary axis.	
	Remedy ♦Turn ON the "NC axis control selection" signal and press the CYCLE START switch to restart the automatic operation with.	
T02	FEED HOLD: SOS axis	0221
	Details SOS axis exists in the system.	
	Remedy Cancel SOS state and execute cycle start, and you can continue automatic operation from the stop point.	
T03	Single block stop signal ON	0301
	Details The SINGLE BLOCK switch on the machine operation panel is ON. The SINGLE BLOCK or MACHINE LOCK switch changed.	
	Remedy ♦Press the CYCLE START switch to resume the automatic operation.	
T03	Block stop cmnd in user macro	0302
	Details A block stop command was issued in the user macro program.	
	Remedy ♦Press the CYCLE START switch to resume the automatic operation.	

2 Stop Codes (T)

T03	Operation mode changed	0303
	Details Automatic mode changed to another automatic mode. Remedy •Return to the original automatic operation mode, and press the CYCLE START switch to resume the automatic operation.	
T03	MDI completed	0304
	Details MDI operation has ended the last block. Remedy •Set the MDI operation again, and press the CYCLE START switch to start the MDI operation.	
T03	Block start interlock	0305
	Details The interlock signal, which locks the block start, is ON. Remedy •Correct the sequence program.	
T03	Cutting blk start interlock	0306
	Details The interlock signal, which locks the block cutting start, is ON. Remedy •Correct the sequence program.	
T03	Safe speed clamp is ON	0308
	Details One of the following commands was issued during the safe speed clamp: thread cutting, synchronous tapping, cross machining, superimposition control, tool center point control or SSS control. Remedy •Turn ON the safely-limited speed monitoring request signal before performing the operation. •Perform the operation with the door closed.	
T03	Inclined Z offset change	0310
	Details The "inclined axis control: No Z axis compensation" signal has turned ON or OFF during the program operation. Remedy •Press the CYCLE START switch to resume the automatic operation.	
T03	Stop at selected point	0320
	Details Operation has stopped at the selected point. Remedy •Perform the automatic start to execute the program from the block.	
T03	Aux axis changeover error	0330
	Details The "NC axis control selection" signal was turned OFF while a NC axis was traveling. Remedy •Turn the "NC axis control selection" signal ON and press the CYCLE START switch to resume the automatic operation.	

T04	Collation stop	0401
Details Collation stop occurred.		
Remedy •Execute the automatic start to resume the automatic operation.		
T10	Fin wait	(Factors for waiting completion)
Details The following Nos. are shown during the operation of the corresponding completion wait factor. The numbers will disappear when the operation is completed. The completion wait factor is indicated with four digits (in hexadecimal). Display format of completion wait factor 0 _ _ _ _ (a)(b)(c)		
Each of the hexadecimal numbers (a), (b) and (c) indicates the following details.		
(a) bit0: In dwell execution bit3: Unclamp signal wait (Note 1)		
(b) bit0: Waiting for spindle position to be looped bit3: Door open (Note 2)		
(c) bit0: Waiting for MSTB completion bit1: Waiting for rapid traverse deceleration bit2: Waiting for cutting speed deceleration bit3: Waiting for spindle orientation completion		
(Note 1) For type A (#1282 ext18/bit3 = 0) •Waiting for turning ON or OFF of the unclamp finish signal for the index table indexing.		
For type B (#1282 ext18/bit3 = 1) •Waiting for turning ON of the unclamp finish signal for the index table indexing. •Waiting for turning ON of the clamp finish signal for the index table indexing.		
(*) The complete standby status is established when the unclamp finish and clamp finish signals are both turned ON. Set the clamp finish signal to OFF after performing required process with the PLC.		
(Note 2) This shows the door open state caused by the door interlock function.		


T11	Fin wait	(Factors for waiting completion)
<p>Details</p> <p>The following Nos. are shown during the operation of the corresponding completion wait factor. The numbers will disappear when the operation is completed. The completion wait factor is indicated with four digits (in hexadecimal).</p> <p>Display format of completion wait factor</p> <p>0 _ _ _</p> <p>(a)(b)(c)</p> <p>Each of the hexadecimal numbers (a), (b) and (c) indicates the following details.</p> <p>(b) bit0: Operation alarm display being postponed</p> <p>Remedy</p> <ul style="list-style-type: none"> • The parameter "#1342 AlmDly" may be able to postpone displaying a part of an operation alarm, depending on the setting. This stop code will remain displayed while any alarm is being postponed. And it will disappear if the postponed alarm is displayed or canceled. 		

Servo/Spindle Alarms (S)

3 Servo/Spindle Alarms (S)

3.1 Servo Errors (S01/S03/S04)

Servo alarm is displayed in the following format.

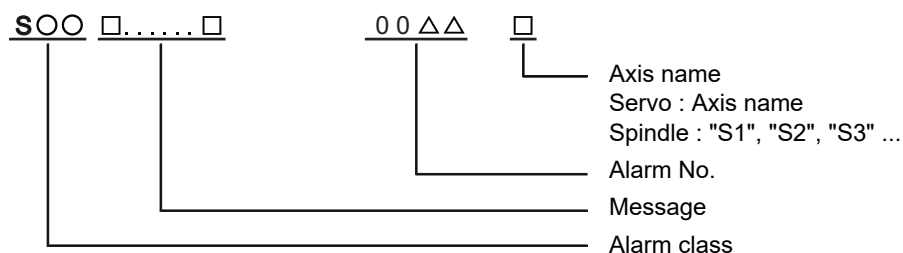

Alarm class	Message	Reset method	Resetting methods
S01	Name or "Servo alarm"	PR	After removing the cause of the alarm, reset the alarm by turning the NC power ON again.
S03	Name or "Servo alarm"	NR	After removing the cause of the alarm, reset the alarm by inputting the NC RESET key.
S04	Name or "Servo alarm"	AR	After removing the cause of the alarm, reset the alarm by turning the NC and drive unit power ON again.

The numerical value in the column of "No." in the table after the following page is the double-digit number displayed on the LED which is on the front-side of the drive unit.

At the time of the occurrence of the servo errors (S01/S03/S04), this number will be displayed in the last two digits of the "alarm number".

(Note 1) For the troubleshooting at the time of the occurrence of the servo errors, refer to your drive unit's instruction manual.

(Note 2) When multiple servo alarms have occurred, only an alarm which occurred first is displayed on the alarm screen. Refer to the alarm history on the drive monitor screen as necessary.

3 Servo/Spindle Alarms (S)

3.1 Servo Errors (S01/S03/S04)

(1) Drive unit alarm

No.	Name	Details	Reset method	Servo stop method	Spindle stop method
10	Insufficient voltage	A drop of bus voltage was detected in main circuit.	PR	Dynamic stop	Coast to a stop
11	Axis selection error	The axis selection rotary switch has been incorrectly set.	AR	Initial error	Initial error
12	Memory error 1	A hardware error was detected during the power ON self-check.	AR	Initial error	Initial error
13	Software processing error 1	An error was detected for the software execution state.	PR	Dynamic stop	Coast to a stop
14	Software processing error2	The current processor is not operating correctly.	AR	Dynamic stop	Coast to a stop
16	Initial magnetic pole position detection error	In the built-in motor which uses the absolute position encoder, the servo ON has been set before the magnetic pole shift amount is set. The magnetic pole position, detected in the initial magnetic pole position detection control, is not correctly set.	PR	Dynamic stop	Coast to a stop
17	A/D converter error	A current feedback error was detected.	PR	Dynamic stop	Coast to a stop
18	Main side encoder: Initial communication error	An error was detected in the initial communication with the motor side encoder.	PR	Initial error	Initial error
19	Encoder communication error in synchronous control	An error of the shared encoder on the machine side was detected on the secondary axis of the speed command synchronization control.	PR	Dynamic stop	-
1A	Sub side encoder: Initial communication error	An error was detected in the initial communication with the machine side encoder.	PR	Initial error	Initial error
1B	Sub side encoder: Error 1	An error was detected by the encoder connected to the machine side. The error details are different according to the encoder type. Refer to "Encoder alarm" for details.		Dynamic stop	Coast to a stop
1C	Sub side encoder: Error 2				
1D	Sub side encoder: Error 3				
1E	Sub side encoder: Error 4				
1F	Sub side encoder: Communication error	An error was detected in the communication with the machine side encoder.	PR	Dynamic stop	Coast to a stop
21	Sub side encoder no signal 2	In the machine side encoder, ABZ-phase feedback cannot be returned even when the motor moves.	PR	Dynamic stop	Coast to a stop
22	Encoder data error	An error was detected in the feedback data from the position encoder.	AR	Dynamic stop	Coast to a stop
23	Excessive speed error	The state that there is a difference between the actual speed and command speed continued for longer than the excessive speed deviation timer setting.	NR	-	Coast to a stop
24	Grounding	The motor power cable is in contact with FG (Frame Ground).	PR	Dynamic stop	Coast to a stop
25	Absolute position data lost	The absolute position data was lost in the encoder.	AR	Initial error	-
26	Unused axis error	In the multiaxis drive unit, there is an axis set to free, and the other axis detected a power module error.	PR	Dynamic stop	Coast to a stop

(Note 1) Definitions of terms in the table are as follows.

Main side encoder: Encoder connected to CN2

Sub side encoder: Encoder connected to CN3

(Note 2) Resetting methods

NR: Reset with the NC RESET button. This alarm can also be reset with the PR and AR resetting conditions.

PR: Reset by turning the NC power ON again. This alarm can also be reset with the AR resetting conditions. When the control axis is removed, this alarm can be reset with the NC RESET button. (Excluding alarms 32 and 37.)

AR: Reset by turning the NC and servo drive unit power ON again.

3 Servo/Spindle Alarms (S)

3.1 Servo Errors (S01/S03/S04)

No.	Name	Details	Reset method	Servo stop method	Spindle stop method
27	Sub side encoder: Error 5	An error was detected by the encoder connected to the machine side. The error details are different according to the encoder type. Refer to "Encoder alarm" for details.		Dynamic stop	Coast to a stop
28	Sub side encoder: Error 6				
29	Sub side encoder: Error 7				
2A	Sub side encoder: Error 8				
2B	Main side encoder: Error 1	An error was detected by the encoder connected to the motor side. The error details are different according to the encoder type. Refer to "Encoder alarm" for details.		Dynamic stop	Coast to a stop
2C	Main side encoder: Error 2				
2D	Main side encoder: Error 3				
2E	Main side encoder: Error 4				
2F	Main side encoder: Communication error	An error was detected in the communication with the motor side encoder.	PR	Dynamic stop	Coast to a stop
30	Over regeneration	Over-regeneration level exceeded 100%. The regenerative resistor is overloaded.	PR	Dynamic stop	Coast to a stop
31	Overspeed	The motor speed exceeded the allowable speed.	PR	Deceleration stop	Deceleration stop
32	Power module error (overcurrent)	The power module detected the overcurrent.	PR	Dynamic stop	Coast to a stop
33	Overvoltage	The bus voltage in main circuit exceeded the allowable value.	PR	Dynamic stop	Coast to a stop
34	NC communication: CRC error	The data received from the NC was outside the setting range.	PR	Deceleration stop	Deceleration stop
35	NC command error	The travel command data received from the NC was excessive.	PR	Deceleration stop	Deceleration stop
36	NC communication: Communication error	The communication with the NC was interrupted.	PR	Deceleration stop	Deceleration stop
37	Initial parameter error	An incorrect set value was detected among the parameters send from the NC at the power ON. In the SLS(Safely Limited Speed) function, an error was detected in the relation between the safety speed and safety rotation number in the speed observation mode.	PR	Initial error	Initial error
38	NC communication: Protocol error 1	An error was detected in the communication frames received from the NC. Or, removing an axis or changing an axis was performed in the synchronous control.	PR	Deceleration stop	Deceleration stop
39	NC communication: Protocol error 2	An error was detected in the axis data received from the NC. Or, in changing an axis, the parameter setting of the synchronous control was applied when the axis was installed.	PR	Deceleration stop	Deceleration stop
3A	Overcurrent	Excessive motor drive current was detected.	PR	Dynamic stop	Coast to a stop
3B	Power module error (overheat)	The power module detected an overheat.	PR	Dynamic stop	Coast to a stop
3C	Regeneration circuit error	An error was detected in the regenerative transistor or in the regenerative resistor.	PR	Dynamic stop	-
3D	Power supply voltage error at acceleration/deceleration	A motor control error during acceleration/deceleration, due to a power voltage failure, was detected.	PR	Dynamic stop	-
3E	Magnetic pole position detection error	The magnetic pole position, detected in the magnetic pole position detection control, is not correctly detected.	AR	Dynamic stop	Coast to a stop

(Note 1) Definitions of terms in the table are as follows.

Main side encoder: Encoder connected to CN2

Sub side encoder: Encoder connected to CN3

(Note 2) Resetting methods

NR: Reset with the NC RESET button. This alarm can also be reset with the PR and AR resetting conditions.

PR: Reset by turning the NC power ON again. This alarm can also be reset with the AR resetting conditions. When the control axis is removed, this alarm can be reset with the NC RESET button. (Excluding alarms 32 and 37.)

AR: Reset by turning the NC and servo drive unit power ON again.

3 Servo/Spindle Alarms (S)

3.1 Servo Errors (S01/S03/S04)

No.	Name	Details	Reset method	Servo stop method	Spindle stop method
41	Feedback error 3	Either a missed feedback pulse in the motor side encoder or an error in the Z-phase was detected in the full closed loop system.	PR	Dynamic stop	Coast to a stop
42	Feedback error 1	Either a missed feedback pulse in the position detection or an error in the Z-phase was detected. Or the distance-coded reference check error exceeded the allowable value when the distance-coded reference scale was used.	PR	Dynamic stop	Coast to a stop
43	Feedback error 2	An excessive difference in feedback was detected between the machine side encoder and the motor side encoder.	PR	Dynamic stop	Coast to a stop
45	Fan stop	An overheat of the power module was detected during the cooling fan stopping.	PR	Dynamic stop	Coast to a stop
46	Motor overheat / Thermal error	Either the motor or the motor side encoder detected an overheat. Or, the thermistor signal receiving circuit of the linear motor or direct-drive motor was disconnected. Or, the thermistor signal receiving circuit was short-circuited.	NR	Deceleration stop	Deceleration stop
48	Main side encoder: Error 5	An error was detected by the encoder connected to the main side. The error details are different according to the connected encoder. Refer to "Encoder alarm".		Dynamic stop	Coast to a stop
49	Main side encoder: Error 6				
4A	Main side encoder: Error 7				
4B	Main side encoder: Error 8				
4C	Current error at initial magnetic pole estimate	Current detection failed at the initial magnetic pole estimation.	NR	Dynamic stop	Coast to a stop
4D	Dual signal error	An error was detected in the signal related to the dual signal. Refer to "Dual signal error (4D)" for details.			
4E	NC command mode error	An error was detected in the control mode send from the NC.	NR	Deceleration stop	Deceleration stop
4F	Instantaneous power interrupt	The control power supply has remained shut down.	NR	Deceleration stop	Deceleration stop
50	Overload 1	Overload detection level became 100% or more. The motor or the drive unit is overloaded.	NR	Deceleration stop	Deceleration stop
51	Overload 2	In a servo system, current command of 95% or more of the unit's max. current was given continuously for 1 second or longer. In a spindle system, current command of 95% or more of the motor's max. current was given continuously for 1 second or longer.	NR	Deceleration stop	Deceleration stop
52	Excessive error 1	A position tracking error during servo ON was excessive.	NR	Deceleration stop	Deceleration stop
53	Excessive error 2	A position tracking error during servo OFF was excessive.	NR	Dynamic stop	-
54	Excessive error 3	There was no motor current feedback when the alarm "Excessive error 1" was detected.	NR	Dynamic stop	Coast to a stop
56	Commanded speed error	The encoder has detected that the commanded speed exceeded 1.15 times of the rapid traverse rate (rapid), or the motor rotation speed exceeded the maximum speed.	NR	Deceleration stop	Deceleration stop
58	Collision detection 1: G0	A disturbance torque exceeded the allowable value in rapid traverse modal (G0).	NR	Max cap dec stop	-
59	Collision detection 1: G1	A disturbance torque exceeded the allowable value in the cutting feed modal (G1).	NR	Max cap dec stop	-
5A	Collision detection 2	A current command with the maximum drive unit current value was detected.	NR	Max cap dec stop	-

(Note 1) Definitions of terms in the table are as follows.

Main side encoder: Encoder connected to CN2

Sub side encoder: Encoder connected to CN3

(Note 2) Resetting methods

NR: Reset with the NC RESET button. This alarm can also be reset with the PR and AR resetting conditions.

PR: Reset by turning the NC power ON again. This alarm can also be reset with the AR resetting conditions. When the control axis is removed, this alarm can be reset with the NC RESET button. (Excluding alarms 32 and 37.)

AR: Reset by turning the NC and servo drive unit power ON again.

3 Servo/Spindle Alarms (S)

3.1 Servo Errors (S01/S03/S04)

No.	Name	Details	Reset method	Servo stop method	Spindle stop method
5B	Safely limited: Commanded speed monitoring error	A commanded speed exceeding the safely limited speed was detected in the safely limited mode.	PR	Deceleration stop	Deceleration stop
5D	Safely limited: Door state error	The door state signal input in the NC does not coincide with the door state signal input in the drive unit in the safely limited mode. Otherwise, door open state was detected in normal mode.	PR	Deceleration stop	Deceleration stop
5E	Safely limited: Speed feed-back monitoring error	A motor speed exceeding the safely limited speed was detected in the safely limited mode.	PR	Deceleration stop	Deceleration stop
5F	External contactor error	A contact of the external contactor is welding.	NR	Deceleration stop	Deceleration stop
60, 61, 63 to 77	Power supply alarm	The power supply unit detected an error. The error details are different according to the connected power supply unit. Refer to "Power supply alarm" for details.		Dynamic stop	Coast to a stop
62	Power supply: Frequency error			Deceleration stop	Deceleration stop
80	Main side encoder cable error	The cable type of the motor side encoder cable is for rectangular wave signal.	AR	Initial error	-
81	Sub side encoder cable error	The cable type of the machine side encoder cable does not coincide with the encoder type which is set by the parameter.	AR	Initial error	-
87	Drivers communication error	The communication frame between drive units was aborted.	PR	Dynamic stop	Coast to a stop
88	Watchdog	The drive unit does not operate correctly. LED display is fixed as "88". "888" is displayed for MDS-EJ/EJH Series.	AR	Dynamic stop	Coast to a stop
8A	Drivers communication data error 1	The communication data 1 between drivers exceeded the tolerable value in the communication between drive units.	PR	Dynamic stop	Coast to a stop
8B	Drivers communication data error 2	The communication data 2 between drivers exceeded the tolerable value in the communication between drive units.	PR	Dynamic stop	Coast to a stop

(Note 1) Definitions of terms in the table are as follows.

Main side encoder: Encoder connected to CN2

Sub side encoder: Encoder connected to CN3

(Note 2) Resetting methods

NR: Reset with the NC RESET button. This alarm can also be reset with the PR and AR resetting conditions.

PR: Reset by turning the NC power ON again. This alarm can also be reset with the AR resetting conditions. When the control axis is removed, this alarm can be reset with the NC RESET button. (Excluding alarms 32 and 37.)

AR: Reset by turning the NC and servo drive unit power ON again.

3 Servo/Spindle Alarms (S)

3.1 Servo Errors (S01/S03/S04)

Encoder alarm (Servo drive unit)

Alarm number when the encoder is connected to CN2 side		2B	2C	2D	2E	48	49	4A	4B
Alarm number when the encoder is connected to CN3 side		1B	1C	1D	1E	27	28	29	2A
OSA405 OSA676 OSA24RS	Mitsubishi Electric	Memory alarm	LED alarm	Data alarm	Encoder thermal error	-	-	-	-
OSA405ET2AS OSA676ET2AS		Memory alarm	LED alarm	Data alarm	Encoder thermal error	-	-	-	-
MDS-EX-HR		Memory error	-	Data error	-	Scale not connected	-	-	-
CSW26KS		Memory alarm	LED alarm	Data alarm	Encoder thermal error	-	-	-	-
AT343 AT543 AT545 AT1143 ST748	Mitsutoyo	Initialization error (bit0)	EEPROM error (bit5)	Photoelectric type, static capacity type data mismatch (bit1)	ROM/RAM error (bit6)	CPU error (bit4)	Photoelectric type overspeed (bit7)	Static capacity type error (bit3)	Photoelectric type error (bit2)
LC195M, LC495M, LC291M, LIC2197M, LIC2199M MC15 RCN2590M, RCN5390M, RCN5590M, RCN8390M ROC425M, ROC2390M ECA4000Series EIB Series	HEIDENHAIN	Initialization error (bit0)	EEPROM error (bit5)	Relative/absolute position data mismatch (bit1)	ROM/RAM error (bit6)	CPU error (bit4)	Overspeed (bit7)	Absolute position data error (bit3)	Relative position data error (bit2)
MPRZ scale	NIDEC MACHINE TOOL	Installation accuracy fault (bit4)	-	Detection position deviation (bit1)	Scale breaking (bit0)	Absolute position detection fault (bit5)	-	Gain fault (bit3)	Phase fault (bit2)
SR67A, SR75, SR85 SR74, SR77 SR87, SR84 RU77 RS87	Magnescale	Laser diode error (bit0)	System memory error (bit5)	Encoder mismatch error (bit1)	-	-	Over speed (bit7)	Absolute position data error (bit3)	Relative position data error (bit2)
SAM/SVAM/ GAM/G2AM/ LAM/G3BM/ HAM/H2AM Series	FAGOR	-	-	Absolute value detection error (bit3)	H/W error (bit1)	CPU error (bit0)	-	-	-
RL40N/RA/FORTiS Series	Renishaw	Initialization error (bit0)	-	Absolute position data error (bit3)	-	-	Over speed (bit7)	-	-
WMFA/WMBA/ WMRA/LMFA/ LMBA Series (Note)	AMO	Initialization error (bit0)	-	Relative/absolute position data mismatch (bit2)	-	-	Over speed (bit5)	Absolute position data error (bit6)	-
AMS-ABS-3B Series	Schneeberger	- (bit0)	-	-	Absolute position data error (bit3)	-	-	-	-
MHS-04B Series	GUBOA	H/W error (bit0)	Waveform error (bit1)	-	Power voltage warning (bit3)	-	-	-	-

(Note 1) A drive unit processes all reset types of alarms as "PR". However, "AR" will be applied according to the encoder.

(Note 2) Bit No. in the table refers to a bit assignment for encoder side alarm management data.

3 Servo/Spindle Alarms (S)

3.1 Servo Errors (S01/S03/S04)

Encoder alarm (Spindle drive unit)

Alarm number when the encoder is connected toCN2 side		2B	2C	2D	2E	48	49	4A	4B
Alarm number when the encoder is connected to CN3 side		1B	1C	1D	1E	27	28	29	2A
TS5690 TS5691	Mitsubishi Electric	Memory error	Waveform error	-	-	-	Overspeed	-	Relative position data error
MDS-EX-HR		Initialization error	-	Data error	-	Connection error	-	-	-
OSA24RS		CPU error	Waveform error	Data alarm	Encoder thermal error	-	-	-	-
EIB Series	HEIDENHAIN	Initialization error (bit0)	EEPROM error (bit5)	-	-	CPU error (bit4)	Overspeed (bit7)	-	Relative position data error (bit2)
ADB-K70M	NIDEC MACHINE TOOL	Installation accuracy fault (bit4)	-	Detection position deviation (bit1)	Scale breaking (bit0)	-	-	Gain fault (bit3)	Phase fault (bit2)
GEL2449M	LE-NORD+BAUER	Waveform error (bit0)	Analog signal warning (bit1)	EEPROM error (bit2)	Power voltage warning (bit3)	H/W error (bit4)	Overspeed warning (bit5)	Count error (bit6)	Overheat warning (bit7)
MHS-04B Series	GUBOA	H/W error (bit0)	Waveform error (bit1)	-	Power voltage warning (bit3)	-	-	-	-

(Note 1) A drive unit processes all reset types of alarms as "PR". However, "AR" will be applied according to the encoder.

(Note 2) Bit No. in the table refers to a bit assignment for encoder side alarm management data.

3 Servo/Spindle Alarms (S)

3.1 Servo Errors (S01/S03/S04)

Dual signal error (4D)

No.	Name	Sub info	Details
004D.xxx	Dual signal error	-	An error was detected in the signal related to the dual signal. The name of the axis with an error is displayed. The number "xxx" in the decimal place indicates the sub-number.

(Note) Resetting method may be "PR" depending on the sub-number in the decimal place.

004D.xxx : Alarm number.Sub-number						
Sub-No.	Name	Details	Reset method	Axis type	Servo stop method	Spindle stop method
1	Power shutoff error	Either of the STO signals entered an input state while the STO function is disabled.	NR	Each axis	Dynamic stop	Coast to a stop
2	Illegal power shutoff error	Either of the STO signals entered an input state during servo ON command or during deceleration and stop with the STO function enabled.	NR	Each axis	Dynamic stop	Coast to a stop
3	STO signal mismatch error	Input states of two STO signals were mismatched while the STO function is enabled.	NR	Each axis	Dynamic stop	Coast to a stop
15	Safety communication: Communication error 1	A receiving error was detected in the safety communication.	NR	Each axis	Dynamic stop	Coast to a stop
16	Safety communication: Initial communication error 1	A receiving error was detected in the initial communication for the safety communication.	PR	Each axis	Dynamic stop	Coast to a stop
17	Voltage diagnosis error	A power error was detected in the safety function.	NR	Each axis	Dynamic stop	Coast to a stop
19	DRAM diagnosis error	A DRAM error was detected in the safety function.	PR	Each axis	Dynamic stop	Coast to a stop
21	Control process error	An error was detected in the status of software execution for the safety function.	PR	Each axis	Dynamic stop	Coast to a stop
23	Safety encoder: Initial communication error 1	An error was detected in the initial communication with a safety encoder.	PR	Each axis	Initial error	Initial error
24	PCB error	A PCB error was detected in the safety function.	PR	Each axis	Initial error	Initial error
25	Synchronization error	A synchronization error was detected in the safety function.	PR	Each axis	Dynamic stop	Coast to a stop
26	Flash ROM diagnosis error	A Flash ROM error was detected in the safety function.	PR	Each axis	Initial error	Initial error
33	Safety encoder: Communication error 1	An error was detected in the communication with a safety encoder.	PR	Each axis	Dynamic stop	Coast to a stop
34	Safety encoder: Diagnosis error 1	A power supply voltage error was detected in the safety encoder.	PR	Each axis	Dynamic stop	Coast to a stop
35	Safety encoder: Diagnosis error 2	A H/W error was detected in the safety encoder.	PR	Each axis	Dynamic stop	Coast to a stop
36	Safety encoder: Diagnosis error 3	A process error was detected in the safety encoder.	PR	Each axis	Dynamic stop	Coast to a stop
37	Safety encoder: Diagnosis error 4	An A/D conversion error was detected in the safety encoder.	PR	Each axis	Dynamic stop	Coast to a stop
39	Non-safety encoder: Position feedback fixation diagnosis error	The position feedback from the non-safety encoder remains unchanged.	PR	Each axis	Dynamic stop	Coast to a stop
40	Safety encoder: Thermal error	The safety encoder detected a thermal error.	PR	Each axis	Dynamic stop	Coast to a stop
53	Safety communication: Transmission interval mismatch error	An error was detected in the transmission interval setting.	NR	Each axis	Initial error	Initial error
54	Safety communication: Initial communication error 2	A receiving error was detected in the initial communication for the safety communication.	NR	Each axis	Initial error	Initial error
55	Safety communication: Communication error 2	A receiving error was detected in the safety communication.	NR	Each axis	Dynamic stop	Coast to a stop
56	Safety parameter setting range error	A setting error was detected in the safety parameter.	PR	Each axis	Initial error	Initial error

3 Servo/Spindle Alarms (S)

3.1 Servo Errors (S01/S03/S04)

004D.xxx : Alarm number.Sub-number						
Sub-No.	Name	Details	Reset method	Axis type	Servo stop method	Spindle stop method
57	Safety parameter combination error	A combination error was detected in the safety parameter.	PR	Each axis	Initial error	Initial error
65	Register diagnosis error	A register diagnosis error was detected in the safety function.	PR	Each axis	Initial error	Initial error
66	Calculation device diagnosis error	An error was detected in the calculation device diagnosis for the safety function.	PR	Each axis	Initial error	Initial error
67	Sequence diagnosis error	An error was detected in the sequence diagnosis for the safety function.	PR	Each axis	Dynamic stop	Coast to a stop
68	Stack diagnosis error	An error was detected in the stack diagnosis for the safety function.	PR	Each axis	Dynamic stop	Coast to a stop
69	Temperature diagnosis error	Overheat was detected in the safety function.	NR	Each axis	Dynamic stop	Coast to a stop
71	Watchdog error	The safety function is not operating correctly.	PR	Each axis	Dynamic stop	Coast to a stop
72	Clock diagnosis error	An error was detected in the clock diagnosis for the safety function.	PR	Each axis	Dynamic stop	Coast to a stop
74	DO output compare error	An error was detected in the status of DO output for the safety function.	PR	Each axis	Dynamic stop	Coast to a stop
75	ISC communication error	An error was detected in the inter-system communication for the safety function.	PR	Each axis	Dynamic stop	Coast to a stop
78	Safety communication: Initial communication error 3	A receiving error was detected in the initial communication for the safety communication.	PR	Each axis	Dynamic stop	Coast to a stop
88	Safety circuit: STO error	An error was detected in the read-back diagnosis for STO.	PR	Each axis	Dynamic stop	Coast to a stop
91	Safety circuit: SBC error	An error was detected in the read-back diagnosis for SBC.	PR	Each axis	Dynamic stop	Coast to a stop
126	Safety communication: Communication error 3	A receiving error was detected in the safety communication.	PR	Each axis	Dynamic stop	Coast to a stop

3 Servo/Spindle Alarms (S)

3.1 Servo Errors (S01/S03/S04)

(2) Power supply alarm

No.	Name	Details	Reset method
61	Power supply: Power module overcurrent	Overcurrent protection function in the power module has started its operation.	PR
62	Power supply: Frequency error	The input power supply frequency increased above the specification range.	PR
66	Power supply: Process error	An error occurred in the process cycle.	PR
67	Power supply: Phase interruption	An open-phase condition was detected in input power supply circuit.	PR
68	Power supply: Watchdog	The system does not operate correctly. LED display is fixed as "8".	AR
69	Power supply: Grounding	The motor power cable is in contact with FG (Frame Ground).	PR
6A	Power supply: External contactor welding	A contact of the external contactor is welding.	PR
6B	Power supply: Rush circuit error	An error was detected in the rush circuit.	PR
6C	Power supply: Main circuit error	An error was detected in charging operation of the main circuit capacitor.	PR
6D	Parameter setting error	An error was detected in the parameter sent from the drive unit.	PR
6E	Power supply: H/W error	An error was detected in the internal memory.	AR
	A/D error	An error was detected in the A/D converter.	
	Unit ID error	An error was detected in the unit identification.	
6F	Power supply error	No power supply is connected to the drive unit, or a communication error was detected.	AR (Note 4)
70	Power supply: External emergency stop error	A mismatch of the external emergency stop input and NC emergency stop input continued for 30 seconds.	PR
71	Power supply: Instantaneous power interruption	The power was momentarily interrupted.	NR
72	Power supply: Fan stop	A cooling fan built in the power supply unit stopped, and overheat occurred in the power module.	PR
73	Power supply: Over regeneration	Over-regeneration detection level became over 100%. The regenerative resistor is overloaded. This alarm cannot be reset for 15 min from the occurrence to protect the regeneration resistor. Leave the drive system energized for more than 15 min, then turn the power ON to reset the alarm.	NR
74	Power supply: Option unit error	An alarm was detected in the power backup unit (power supply option unit).	NR (Note 3)
75	Power supply: Overvoltage	L+ and L- bus voltage in main circuit exceeded the allowable value. As the voltage between L+ and L- is high immediately after this alarm, another alarm may occur if this alarm is reset in a short time. Wait more than 5 min before resetting so that the voltage drops.	NR
76	Power supply: Function setting error	The rotary switch setting of external emergency stop is not correct, or a wrong external emergency stop signal is input.	AR
	Power supply: Function selection error	Undefined area for the rotary switch is selected	
77	Power supply: Power module overheat	Thermal protection function in the power module has started its operation.	PR

(Note 1) If a power supply alarm (60 to 77) occurs, all servos will stop with the dynamic brakes, and all spindles will coast to a stop.

(Note 2) "b", "C" and "d" displayed on the power supply unit's LED as a solid light (not flickering) do not indicate an alarm.

(Note 3) Check the LED display of the power backup unit to identify what alarm is occurring to the power backup unit.

** Refer to your drive unit's instruction manual for details.

(Note 4) When the power supply alarm (6F) is detected in the 2nd part system, the reset method differs depending on the detected power supply alarm.

3 Servo/Spindle Alarms (S)

3.2 Initial Parameter Errors (S02)

3.2 Initial Parameter Errors (S02)

S02	Initial parameter error	2201-2264	(Axis name)
Details The servo parameter setting data is illegal. The alarm No. is the No. of the servo parameter where the error occurred.			
Remedy Check the descriptions for the appropriate servo parameters and correct them. Refer to "Parameter Numbers during Initial Parameter Error" of each drive unit instruction manual for details.			
S02	Initial parameter error	2301	(Axis name)
Details The number of constants to be used in the following functions is too large: Electronic gears. Position loop gain. Speed feedback conversion.			
Remedy Check that all the related parameters are specified correctly. sv001: PC1, sv002: PC2, sv003: PGN1 sv018: PIT, sv019: RNG1, sv020: RNG2			
S02	Initial parameter error	2302	(Axis name)
Details When high-speed serial incremental encoder (OSE104, OSE105) is connected, parameters for absolute position are set to ON. Set the parameters for absolute position detection to OFF. To detect an absolute position, replace the incremental specification encoder with an absolute encoder.			
Remedy Check that all the related parameters are specified correctly. sv017: SPEC, sv025: MTYP			
S02	Initial parameter error	2303	(Axis name)
Details No servo option is found. The closed loop (including the ball screw-end detection) or dual feedback control is an optional function.			
Remedy Check that all the related parameters are specified correctly. sv025: MTYP/pen sv017: SPEC/dfbx			
S02	Initial parameter error	2304	(Axis name)
Details No servo option is found. The SHG control is an optional function.			
Remedy Check that all the related parameters are specified correctly. sv057: SHGC sv058: SHGCsp			
S02	Initial parameter error	2305	(Axis name)
Details No servo option is found. The adaptive filtering is an optional function.			
Remedy Check that all the related parameters are specified correctly. sv027: SSF1/aflt			

3 Servo/Spindle Alarms (S)

3.2 Initial Parameter Errors (S02)

S02	Initial parameter error:PR	13001-13256	(Axis name)
Details			
Parameter error			
The spindle parameter setting data is illegal.			
The alarm No. is the No. of the spindle parameter where the error occurred.			
Remedy			
Check the descriptions for the appropriate spindle parameters and correct them.			
Even when the parameter is set to a value within the setting range, an error is occurring due to the hardware compatibility or specifications or in relation to several other parameters.			
Refer to "Parameter Numbers during Initial Parameter Error" of each drive unit instruction manual for details.			

3 Servo/Spindle Alarms (S)

3.3 Safety Function Errors (S05)

3.3 Safety Function Errors (S05)


S05	Safety function error	0001	(Axis name)
Details The STO signal has been input through the CN8 connector.			
Remedy Make sure that a short-circuiting connector has been inserted into CN8.			
S05	Safety function error	0002	(Axis name)
Details STO signal is input by dedicated wiring STO function during servo ON.			
Remedy Refer to the manual of drive unit.			
S05	Safety function error	0004	(Axis name)
Details STO signal is illegally input by dedicated wiring STO function during servo OFF. (Illegal input : Signal input state for STO1 and STO2 is mismatched.)			
Remedy Refer to the manual of drive unit.			
S05	Safety function error	0006	(Axis name)
Details STO signal is illegally input by dedicated wiring STO function during servo ON. (Illegal input : Signal input state for STO1 and STO2 is mismatched.)			
Remedy Refer to the manual of drive unit.			

3 Servo/Spindle Alarms (S)**3.4 Parameter Errors (S51)****3.4 Parameter Errors (S51)**

S51	Parameter error	2201-2264	(Axis name)
Details			
Servo parameter setting data is illegal. The alarm No. is the No. of the servo parameter where the warning occurred.			
Remedy			
Check the descriptions for the appropriate servo parameters and correct them.			
S51	Parameter error	13001-13256	(Axis name)
Details			
Spindle parameter setting data is illegal.			
The alarm No. is the No. of the spindle parameter where the warning occurred.			
Remedy			
Check the descriptions for the appropriate spindle parameters and correct them.			
Even when the parameter is set to a value within the setting range, an error is occurring due to the hardware compatibility or specifications or in relation to several other parameters.			
Refer to "Parameter Numbers during Initial Parameter Error" of each drive unit instruction manual for details.			

3 Servo/Spindle Alarms (S)**3.5 Servo Warnings (S52)****3.5 Servo Warnings (S52)**

Servo warning is displayed in the following format.

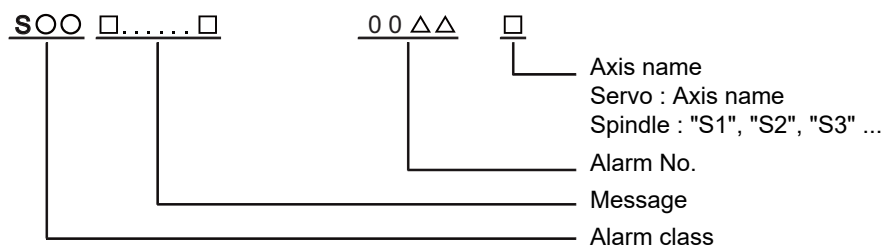

Alarm class	Message
S52	Name or "Servo warning"

The numerical value in the column of "No." in the table after the following page is the double-digit number displayed on the LED which is on the front-side of the drive unit.

At the time of the occurrence of the servo warnings (S52), this number will be displayed in the last two digits of the "alarm number".

(Note 1) For the troubleshooting at the time of the occurrence of the servo warnings, refer to your drive unit's instruction manual.

(Note 2) When multiple servo alarms have occurred, only an alarm which occurred first is displayed on the alarm screen. Refer to the alarm history on the drive monitor screen as necessary.

3 Servo/Spindle Alarms (S)

3.5 Servo Warnings (S52)

(1) Drive unit warning

No.	Name	Details	Reset method	Stop method
96	Scale feedback error	An excessive difference in feedback amount was detected between the main side encoder and the MPI scale in MPI scale absolute position detection system.	*	-
97	Scale offset error	An error was detected in the offset data that is read at the NC power-ON in MPI scale absolute position detection system.	PR	-
9B	Incremental encoder/ magnetic pole shift warning	The difference between the magnetic pole position after the phase Z has been passed (magnetic pole shift amount:SV028) and the initially detected position is excessive in the built-in motor's incremental control system.The magnetic pole is controlled by the initial detection value.	PR	-
9E	Absolute position encoder: Revolution counter error	An error was detected in the revolution counter data of the absolute position encoder. The accuracy of absolute position is not guaranteed.	*	-
9F	Battery voltage drop	The battery voltage to be supplied to the absolute position encoder is dropping.	NR	-
A3	In initial setup of ABS position	This warning is detected until the axis reaches the reference position during the initial setup of the distance-coded reference check function. This warning turns OFF after the axis has reached the position, thus set the value displayed on the drive monitor to the parameter.	PR	-
A4	Dual signal warning	An input was detected in the signal related to the dual signal. Refer to "Dual signal warning (A4)" for details.	*	-
A6	Fan stop warning	A cooling fan in the drive unit stopped.	*	-
E0	Overregeneration warning	Over-regeneration detection level exceeded 80%.	*	-
E1	Overload warning	A level of 80% of the Overload 1 alarm state was detected.	*	-
E4	Parameter warning	An incorrect set value was detected among the parameters send from the NC in the normal operation.	*	-
E6	Control axis detachment warning	A control axis is being detached. (State display)	*	-
E7	NC emergency stop	In NC emergency stop. (State display)	*	Dec stop enabled
E8 to EF	Power supply warning	The power supply unit detected a warning. The error details are different according to the connected power supply unit. Refer to "Power supply warning".	*	- *EA: Dec stop enabled

(Note1) Definitions of terms in the table are as follows.

Main side encoder: Encoder connected to CN2

Sub side encoder: Encoder connected to CN3

(Note 2) Resetting methods

* : Automatically reset once the cause of the warning is removed.

NR: Reset with the NC RESET button. This warning can also be reset with the PR and AR resetting conditions.

PR: Reset by turning the NC power ON again. This warning can also be reset with the AR resetting conditions. When the control axis is removed, this warning can be reset with the NC RESET button. (Excluding warning 93.)

AR: Reset by turning the NC and servo drive unit power ON again.

(Note 3) Servo and spindle motor do not stop when the warning occurs.

(Note 4) When an emergency stop is input, servo and spindle motor decelerate to a stop. (When SV048, SV055 or SV056 is set for servo and when SP055 or SP056 is set for spindle.)

Dual signal warning (A4)

No.	Name	Sub info	Details
00A4.00	Dual signal warning	Axis name	The system has been set in the STO state. The STO state is also entered at the time of emergency stop, but in this case, this warning will not appear because the emergency stop has priority.

3 Servo/Spindle Alarms (S)**3.5 Servo Warnings (S52)****(2) Power supply warning**

No.	Name	Details	Reset method
E9	Instantaneous power interruption warning	The power was momentarily interrupted.	NR
EA	In external emergency stop state	External emergency stop signal was input.	*
EB	Power supply: Over regeneration warning	Over-regeneration detection level exceeded 80%.	*
EE	Power supply: Fan stop warning	A cooling fan built in the power supply unit stopped.	*
EF	Power supply: Option unit warning	A warning was detected in the power backup unit (power supply option unit).	* (Note 3)

(Note 1) Resetting methods

* : Automatically reset once the cause of the warning is removed.

NR: Reset with the NC RESET button. This warning can also be reset with the PR and AR resetting conditions.

PR: Reset by turning the NC power ON again. This warning can also be reset with the AR resetting conditions. When the control axis is removed, this warning can be reset with the NC RESET button. (Excluding warning 93.)

AR: Reset by turning the NC and servo drive unit power ON again.

(Note 2) Servo and spindle motor do not stop when the warning occurs.

(Note 3) Check the LED display of the power backup unit to identify what warning is occurring to the power backup unit.

** Refer to your drive unit's instruction manual for details.

3 Servo/Spindle Alarms (S)

3.6 Safety Function Warnings (S53)

3.6 Safety Function Warnings (S53)

S53	Safety function warning	0001	(Axis name)
-----	-------------------------	------	-------------

Details

The system has been set in the STO state.
The STO state is also entered at the time of emergency stop, but in this case, this warning will not appear because the emergency stop has priority.

3 Servo/Spindle Alarms (S)

3.6 Safety Function Warnings (S53)

MCP Alarms (Y)

Y02	System alm: Process time over	0050	
Details System alarm: Process time is over.			
Remedy The software or hardware may be damaged. Contact the service center. (Note) When two or more alarms (Y02 0051) occur at the same time, only the alarm which has occurred first is displayed.			
Y02	SV commu er: Data ID error	0051	xy03
Details A communication error has occurred between controller and drive unit. x: Channel No. (0 to) y: Drive unit rotary switch No. (0 to)			
Remedy <ul style="list-style-type: none"> •Take measures against noise. •Check for any failure of the communication cable connectors between controller and drive unit or between two drive units. •Check for any failure of the communication cables between controller and drive unit or between two drive units. •A drive unit may be faulty. Take a note of the 7-segment LED contents of each drive unit and contact the Service Center. •Update the drive unit software version. (Note) When two or more alarms (Y02 0051) occur at the same time, only the alarm which has occurred first is displayed.			
Y02	SV commu er: Recv frame No.	0051	xy04
Details A communication error has occurred between controller and drive unit. x: Channel No. (from 0) y: Drive unit rotary switch No. (from 0)			
Remedy <ul style="list-style-type: none"> •Take measures against noise. •Check for any failure of the communication cable connectors between controller and drive unit or between two drive units. •Check for any failure of the communication cables between controller and drive unit or between two drive units. •A drive unit may be faulty. Take a note of the 7-segment LED contents of each drive unit and contact the Service Center. •Update the drive unit software version. (Note) When two or more alarms (Y02 0051) occur at the same time, only the alarm which has occurred first is displayed.			
Y02	SV commu er: Commu error	0051	x005
Details A communication error has occurred between controller and drive unit. x: Channel No. (from 0)			
Remedy <ul style="list-style-type: none"> •Take measures against noise. •Check for any failure of the communication cable connectors between controller and drive unit or between two drive units. •Check for any failure of the communication cables between controller and drive unit or between two drive units. •A drive unit may be faulty. Take a note of the 7-segment LED contents of each drive unit and contact the Service Center. •Update the drive unit software version. (Note) When two or more alarms (Y02 0051) occur at the same time, only the alarm which has occurred first is displayed.			

Y02	SV commu er: Connect error	0051	x006
Details A communication error has occurred between controller and drive unit. x: Channel No. (from 0)			
Remedy <ul style="list-style-type: none"> ♦Take measures against noise. ♦Check for any failure of the communication cable connectors between controller and drive unit or between two drive units. ♦Check for any failure of the communication cables between controller and drive unit or between two drive units. ♦A drive unit may be faulty. Take a note of the 7-segment LED contents of each drive unit and contact the Service Center. ♦Update the drive unit software version. (Note) When two or more alarms (Y02 0051) occur at the same time, only the alarm which has occurred first is displayed.			
Y02	SV commu er: Safe posn FB err	0051	x007
Details A communication error has occurred between controller and drive unit. x: Channel No. (from 0)			
Remedy <ul style="list-style-type: none"> ♦Take measures against noise. ♦Check for any failure of the communication cable connectors between controller and drive unit or between two drive units. ♦Check for any failure of the communication cables between controller and drive unit or between two drive units. ♦A drive unit may be faulty. Take a note of the 7-segment LED contents of each drive unit and contact the Service Center. ♦Update the drive unit software version. (Note) When two or more alarms (Y02 0051) occur at the same time, only the alarm which has occurred first is displayed.			
Y02	SV commu er : Init commu error	0051	xy20
Details A communication error has occurred between controller and drive unit. A drive unit stopped due to transition failure from initial communication to runtime. x: Channel No. (from 0) y: Drive unit rotary switch No. (from 0)			
Remedy <ul style="list-style-type: none"> ♦Take measures against noise. ♦Check for any failure of the communication cable connectors between controller and drive unit or between two drive units. ♦Check for any failure of the communication cables between controller and drive unit or between two drive units. ♦A drive unit may be faulty. Take a note of the 7-segment LED contents of each drive unit and contact the Service Center. ♦Update the drive unit software version. (Note) When two or more alarms (Y02 0051) occur at the same time, only the alarm which has occurred first is displayed.			

Y02	SV commu er: Node detect err	0051	xy30
Details A communication error has occurred between controller and drive unit. No response from drive unit to the request from NC when setting network configuration. x: Channel No. (from 0) y: Station No. (from 0)			
Remedy ♦Take measures against noise. ♦Check for any failure of the communication cable connectors between controller and drive unit or between two drive units. ♦Check for any failure of the communication cables between controller and drive unit or between two drive units. ♦A drive unit may be faulty. Take a note of the 7-segment LED contents of each drive unit and contact the Service Center. ♦Update the drive unit software version. (Note) When two or more alarms (Y02 0051) occur at the same time, only the alarm which has occurred first is displayed.			
Y02	SV commu er: Commu not support	0051	xy31
Details A communication error has occurred between controller and drive unit. Drive unit's software version doesn't support the communication mode that the controller requires. x: Channel No. (from 0) y: Station No. (from 0)			
Remedy ♦Take measures against noise. ♦Check for any failure of the communication cable connectors between controller and drive unit or between two drive units. ♦Check for any failure of the communication cables between controller and drive unit or between two drive units. ♦A drive unit may be faulty. Take a note of the 7-segment LED contents of each drive unit and contact the Service Center. ♦Update the drive unit software version. (Note) When two or more alarms (Y02 0051) occur at the same time, only the alarm which has occurred first is displayed.			
Y03	Drive unit unequipped	axis name	
Details The drive unit is not properly connected. Axis name: NC axis drive unit not mounted Pn: PLC axis drive unit not mounted (n = axis No.) Sn: Spindle axis drive unit not mounted (n = spindle No. or Sp disp name "#43107 S_disp_name")			
Remedy Check the drive unit mounting state. ♦Check the end of the cable wiring. ♦Check for any broken wires. ♦Check the connector insertion. ♦The drive unit input power has not been ON. ♦The drive unit axis No. switch is illegal.			

Y05	Initial parameter error	(Parameter No.)
	Details There is a problem in the value set for the number of axes or the number of part systems.	
	Remedy Correct the value set for the following corresponding parameters: "#1001 SYS_ON (System validation setup)", "#1002 axisno (Number of axes)", "#1039 spinno (Number of spindles)", etc. "#2187 chgPLCax (PLC axis switchover axis No.)", etc. ♦Make sure that the parameters unavailable for a switchover axis (#1068 slavno, #12800 chgauxno, etc.) are OFF.	
Y05	Initial parameter error	2674 (Sub-number)
	Details The parameter setting of the multiple axis synchronization control is incorrect. The sub-number is displayed after the error number. 0002: More than three sets combining the synchronization control and the multiple axis synchronization control are set. 0003: The slave axis of multiple axis synchronization control overlaps with the synchronization control axis. 0004: The master axis of multiple axis synchronization control overlaps with the synchronization control axis. 0005: The master axis is set to the axis which crosses the part system. 0006: The slave axis setting is also set to the master axis. 0007: The function which cannot be used with the multiple axis synchronization control is enabled.	
	Remedy Correct the parameter setting.	
Y05	Too many teach data points	12107
	Details The total number of points after summing the value set in "#12107 Teaching-DataNum" (Number of teaching data points to be allocated to each part system) for all part systems exceeds the maximum number.	
	Remedy ♦Make sure that the total number of points does not exceed the maximum number.	
Y05	Initial parameter error	90102
	Details The axis specified as the height control axis is not valid. ♦The axis name does not exist. ♦The axis is a rotary axis. ♦The axis is the reference axis or the synchronized axis of synchronization control or multiple-axis synchronization control. ♦The axis is the sub axis of simple synchronous control. ♦The drive unit is not Ver.B9 or newer version of MDS-E/EH-V1 Series (servo). ♦The axis is being used in NC axis/PLC axis switchover.	
	Remedy Correct the value of "#90102 lsr_high_ax" (Height control axis).	
Y06	mcp_no setting error	0001
	Details There is a skipped number in the channels.	
	Remedy Check the values set for the following parameters. "#1021 mcp_no (Drive unit I/F channel No. (servo))" "#3031 smcp_no (Drive unit I/F channel No. (spindle))"	

Y06	mcp_no setting error	0002
Details There is a duplicate setting for random layout.		
Remedy Check the values set for the following parameters. "#1021 mcp_no (Drive unit I/F channel No. (servo))" "#3031 smcp_no (Drive unit I/F channel No. (spindle))"		
Y06	mcp_no setting error	0003
Details The drive unit fixed setting "0000" and random layout setting "*****" are both set.		
Remedy Check the values set for the following parameters. "#1021 mcp_no (Drive unit I/F channel No. (servo))" "#3031 smcp_no (Drive unit I/F channel No. (spindle))"		
Y06	mcp_no setting error	0004
Details The spindle/C axis "#1021 mcp_no (Drive unit I/F channel No. (servo))" and "#3031 smcp_no (Drive unit I/F channel No. (spindle))" are not set to the same values.		
Remedy Check the values set for the following parameters. "#1021 mcp_no (Drive unit I/F channel No. (servo))" "#3031 smcp_no (Drive unit I/F channel No. (spindle))"		
Y06	mcp_no setting error	0005
Details A random layout has been set while "#1154 pdoor" has been set to "1" in two-part system.		
Remedy Check the values set for the following parameters. "#1021 mcp_no (Drive unit I/F channel No. (servo))" "#3031 smcp_no (Drive unit I/F channel No. (spindle))"		
Y06	mcp_no setting error	0006
Details The channel No. parameter is not within the setting range.		
Remedy Check the values set for the following parameters. "#1021 mcp_no (Drive unit I/F channel No. (servo))" "#3031 smcp_no (Drive unit I/F channel No. (spindle))"		

Y07	Too many axes connected	00xy
Details		
<p>The drive units more than the number of axes specified with the parameter are connected. Or the number of axes connected to each channel exceeds the maximum number of connectable axes. The exceeded number of axes per channel is displayed as alarm No.</p> <p>x: Exceeded number of axes at drive unit interface channel 2 (0 to F) y: Exceeded number of axes at drive unit interface channel 1 (0 to F)</p> <p>This alarm also occurs when the drive unit is connected only with the 2nd channel without connecting with the 1st channel.</p>		
Remedy		
<p>For the channel whose alarm No. is other than "0", detach the connected axes by the number of indicated alarm No.</p> <p>The number of connected axes should be less than or equal to the number specified with the parameter or the maximum number of connections.</p> <p>(Note 1) The number of axes is limited per each drive unit interface channel.</p> <p>(Note 2) Maximum number of axes that can be connected differs depending on whether or not an expansion unit is available or the setting of "#11012 16 axes for 1ch" (Connecting 16 axes for 1ch). With the expansion unit, up to eight axes can be connected to a channel. Without the expansion unit, up to eight axes are allowed when "#11012 16 axes for 1ch" (Connecting 16 axes for 1ch) is set to "0", sixteen axes when set to "1".</p> <p>(Note 3) If this alarm occurs, the alarm "Y03 Message: Drive unit unequipped" will not occur.</p> <p>(Note 4) This alarm is displayed taking precedence over the alarm "Y08 Too many drive units connected" and "Y09 Too many axisno connected".</p>		
Y08	Too many drive units connected	00xy
Details		
<p>The number of drive units connected to each channel exceeds 8. The exceeded number of drive units per channel is displayed as alarm No.</p> <p>x: Exceeded number of drive units at drive unit interface channel 2 (0 to F) y: Exceeded number of drive units at drive unit interface channel 1 (0 to F)</p>		
Remedy		
<p>Remove drive units from the channel whose alarm No. is other than "0" for the number displayed as the alarm No. Keep the number of connected drive units to 8 or less.</p> <p>(Note 1) The drive unit is not counted when all the axes connected to it are invalid.</p> <p>(Note 2) If this alarm occurs, the alarm "Y03 Message: Drive unit unequipped" will not occur.</p> <p>(Note 3) The alarm "Y07 Too many axes connected" and "Y09 Too many axisno connected" are displayed taking precedence over this alarm.</p>		
Y09	Too many axisno connected	00xy
Details		
<p>The No. of the axis (drive unit's rotary switch No.) connected to each channel is bigger than the No. allowed. If the axis No. of each channel is bigger than the No. allowed, "1" is displayed for the alarm No.</p> <p>x: "1" when the axis No. at drive unit interface channel 2 is too big y: "1" when the axis No. at drive unit interface channel 1 is too big</p>		
Remedy		
<p>For the channel whose alarm No. is "1", keep the axis No. (drive unit's rotary switch No.) not bigger than the No. allowed.</p> <p>(Note 1) The axis No. is limited per each drive unit interface channel.</p> <p>(Note 2) The biggest allowed connected axis No. differs depending on whether or not an expansion unit is available or the setting of "#11012 16 axes for 1ch (Connecting 16 axes for 1ch)". The biggest connectable axis No. is as shown below. With the expansion unit, axes No. '0' to '7' can be connected. Without the expansion unit, axes No. '0' to '7' are allowed when '#11012 16 axes for 1ch (Connecting 16 axes for 1ch)' is set to '0', axes No. '0' to 'F' when set to '1'.</p> <p>(Note 3) If this alarm occurs, the alarm "Y03 Message: Drive unit unequipped" will not occur.</p> <p>(Note 4) This alarm is displayed taking precedence over the alarm "Y08 Too many drive units connected".</p> <p>(Note 5) The alarm "Y07 Too many axes connected" is displayed taking precedence over this alarm.</p>		

Y12	No commu. with axis drv unit		
Details			
Although the high-speed synchronous tapping option is valid, the connected drive unit doesn't support the option.			
Remedy			
<ul style="list-style-type: none"> • Replace the drive unit with that supports the option. • Set "High-speed synchronous tapping disabled axis" parameter as disabled for the axis to which you don't use the high-speed synchronous tapping. 			
Y13	No commu. with sp drv unit		
Details			
Although the high-speed synchronous tapping option is valid, the connected drive unit doesn't support the option.			
Remedy			
<ul style="list-style-type: none"> • Replace the drive unit with that supports the option. • Set "High-speed synchronous tapping disabled axis" parameter as disabled for the spindle to which you don't use the high-speed synchronous tapping. 			
Y15	RIO connection error	0001	(Error channel)
Details			
RIO station number is too large			
Although a non-RIO2.0 unit is connected, 9 or a greater number is set as a station No.			
Remedy			
<ul style="list-style-type: none"> • If a non-RIO2.0 unit is connected, set the station No. to be 8 or smaller. • If you use 9 or a greater station No., do not connect a non-RIO2.0 unit. 			
Y15	RIO connection error	0002	(Error channel)
Details			
RIO3 connection error			
A non-RIO2.0 unit is connected to RIO3.			
Remedy			
<ul style="list-style-type: none"> • Connect a RIO2.0-compatible or RIO2.0-dedicated unit. 			
Y15	RIO connection error	0003	(Error channel)
Details			
RIO communication processing time exceeded (PC medium speed)			
Due to too short DI/DO refresh cycle, the control may not refresh all the DI/DOs connected to one RIO channel at a time.			
Remedy			
<ul style="list-style-type: none"> • Correct the setting of "#1334 DI/DO refresh cycl(DI/DO refresh cycle)". • Connect the remote IO units to RIO1, RIO2 and RIO3 dispersedly to reduce the number of RIO stations connected per RIO channel. 			
Y15	RIO connection error	0004	(Error channel)
Details			
RIO communication processing time exceeded (PC high speed)			
Due to too short DI/DO refresh cycle, the control may not refresh all the DI/DOs connected to one RIO channel at a time.			
Remedy			
<ul style="list-style-type: none"> • Connect the remote IO units to RIO1, RIO2 and RIO3 dispersedly to reduce the number of RIO stations (which perform high-speed input/output) per RIO channel. 			

Y15	Laser I/F unit connect error	0005	
Details An error was detected for the connection of the laser I/F unit. <ul style="list-style-type: none"> ♦The laser I/F unit and another RIO device have been connected to the same channel. ♦The laser I/F unit has been connected to the station connected to the operation panel. ♦More than one laser I/F unit is connected. ♦Laser I/F unit has been failed. Remedy <ul style="list-style-type: none"> ♦Check the connection of the laser I/F unit. ♦Replace the laser I/F unit. 			
Y15	Too many RIO channels in use	0006	
Details Five or more RIO connectors of the NC are in use. Remedy <ul style="list-style-type: none"> ♦Modify the RIO configuration so that up to four RIO connectors are in use. 			
Y20	Parameter compare error	0001	(Axis name)
Details The speed monitoring parameter in the NC does not correspond to the parameter transmitted to the drive unit. The name of the axis with an error is displayed. Remedy The NC or the servo drive unit may be damaged. Contact the service center.			
Y20	Sfty obsrvation: Cmd spd err	0002	(Axis name)
Details The speed exceeding the speed set with the parameter was commanded during the speed monitoring mode. The name of the axis with an error is displayed. Remedy Check the speed monitoring parameter and the sequence program. Restart the NC.			
Y20	Sfty obsrvation: FB pos err	0003	(Axis name)
Details The commanded position, transmitted to the servo drive unit from NC, is totally different from the feedback position received from the servo drive unit during the speed monitoring mode. The name of the axis with an error is displayed. Remedy The NC or the servo drive unit may be damaged. Contact the service center.			
Y20	Sfty obsrvation: FB speed err	0004	(Axis name)
Details Actual rotation speed of the motor is exceeding the speed that has been set with speed monitoring parameter during the speed monitoring mode. The name of the axis with an error is displayed. Remedy Correct the speed observation parameter and the sequence program. Restart the NC.			

Y20	Door signal: Input mismatch	0005	Door No.
Details Door state signals on the NC side and the drive side do not match. It may be caused by the followings: <ul style="list-style-type: none"> •Cable disconnection •Damaged door switch •Damaged NC or servo drive unit Remedy Check the cable. Check the door switch. Restart the NC.			
Y20	No speed observation mode in door open	0006	Door No.
Details The door open state was detected when the speed monitoring mode was invalid. The causes may be same as the ones for 0005 (Door signal: Input mismatch). Also the sequence program may not be correct. Remedy Correct the sequence program. Restart the NC.			
Y20	Speed obsv: Para incompatible	0007	(Axis name)
Details Two speed monitoring parameters are not matched at the rising edge of the "speed monitor mode" signal. The name of the axis with an error is displayed. Remedy Correct the relevant parameters so that the two speed monitoring parameters match. Restart the NC.			
Y20	Contactor welding detected	0008	Contactor info
Details Contactor welding was detected. Displays the bit corresponding to the No. of the abnormal contactor for the contactor information. Some contactors take a while to be shutdown after the servo ready is turned OFF, and the servo ready was turned ON in the meantime. Remedy <ul style="list-style-type: none"> •Make sure that contactor's auxiliary b contact signal is output correctly to the device set on "#1330 MC_dp1(Contactor weld detection device 1)" and "#1331 MC_dp2(Contactor weld detection device 2)". •If welding, replace the contactor. •Restart the NC. 			
Y20	No spec: Safety observation	0009	
Details "#2313 SV113 SSF8/bitF (ssc SLS (Safely Limited Speed) function)" and "#13229 SP229 SFNC9/bitF (ssc SLS (Safely Limited Speed) function)" are set for a system with no safety observation option. Remedy Disable "#2313 SV113 SSF8/bitF (ssc SLS (Safely Limited Speed) function)" and "#13229 SP229 SFNC9/bitF (ssc SLS (Safely Limited Speed) function)". Then, restart the NC.			
Y20	SDIO connector input volt err	0010	
Details 24VDC power is not supplied to SDIO connector correctly. (SDIO 4A pin supply voltage was dropped to 16V or less, or 1ms or more instant power interrupt was detected.) In this case, "Pw sply:Inst pw interpt(DC24V)" alarm occurs because the contactor control output signal cannot be controlled. This state remains until restarting the NC even if the cause of the alarm has been removed. Remedy Check the wiring. Supply 24VDC power to the SDIO connector. Restart the NC.			

Y20	Device setting illegal	0011	Contactor info
Details <ul style="list-style-type: none"> •The device set in the parameter "#1353 MC_ct1" (Contactor shutoff output 1 device) does not exist. •The device set in the parameter "#1353 MC_ct1" (Contactor shutoff output 1 device) is used as an output device in PLC program. Remedy <ul style="list-style-type: none"> •In the parameter "#1353 MC_ct1" (Contactor shutoff output 1 device), set the device to which a remote I/O is connected. Use the device to control the contactor. •Confirm that the devices set by the parameter "#1353 MC_ct1" (Contactor shutoff output 1 device) are not used as an output device in PLC program. •Restart the NC. 			
Y20	Contactor operation abnormal	0012	Contactor info
Details Contactor's operation is not following the NC's commands. Displays the No. of the abnormal contactor for the contactor information. Remedy <ul style="list-style-type: none"> •Check and correct "#1353 MC_ct1" (Contactor shutoff output 1 device) setting. •Check the wiring for contactor shutoff. •Check for contactor's welding. •Restart the NC. 			
Y20	STO function operation illegal	0013	
Details The drive unit's STO function has failed to work properly. Remedy If this alarm has occurred alone, a drive unit failure can be suspected. If other alarms have been generated at the same time, it is also possible that there is communication problem. Check the optical cable wiring.			
Y20	STO function illegal at pwr ON	0014	
Details The motor power has not been shut down with the STO function when the NC power was turned ON. Remedy If this alarm has occurred alone, a drive unit failure can be suspected. If other alarms have been generated at the same time, it is also possible that there is communication problem. Check the optical cable wiring.			
Y20	Dual signal: parameter setting error	0027	
Details A setting of #2118 SscDrSel, #3071 SscDrSelSp, #2180 S_DIN, or #3140 S_DINSp is not correct. Remedy - Correct the parameter setting.			
Y20	Safety observation: parameter memory error	0031	(Parameter No.)
Details The following parameters are not consistent with the check data. #2180 S_DIN, #3140 S_DINSp Remedy <ul style="list-style-type: none"> •Correct the parameter setting. •Restore the backup data, as the parameter or check data may be corrupted. 			
Y21	Speed obsv signal: Speed over	0001	(Axis name)
Details The speed exceeds the safety speed limit when the "speed monitor mode" signal is ON. The name of the axis with an error is displayed. Remedy Decelerate the speed to reset the warning and start the speed monitor.			

Y40	Machine group-based stop	
	Details A machine group-based alarm stop has occurred, or the machine group-based PLC interlock signal has been input.	
	Remedy •Remove the cause of the stop by alarm.Turn OFF the machine group-based PLC interlock signal.	
Y51	Parameter G0tL illegal	0001
	Details The time constant has not been set or exceeded the setting range.	
	Remedy Correct "#2004 G0tL (G0 time constant (linear))".	
Y51	Parameter G1tL illegal	0002
	Details The time constant has not been set or exceeded the setting range.	
	Remedy Correct "#2007 G1tL (G1 time constant (linear))".	
Y51	Parameter G0t1 illegal	0003
	Details The time constant has not been set or exceeded the setting range.	
	Remedy Correct "#2005 G0t1 (G0 time constant (primary delay) / Second-step time constant for soft acceleration/deceleration)".	
Y51	Parameter G1t1 illegal	0004
	Details The time constant has not been set or exceeded the setting range.	
	Remedy Correct "#2008 G1t1 (G1 time constant (primary delay)/Second-step time constant for soft acceleration/deceleration)".	
Y51	Parameter grid space illegal	0009
	Details The grid space is illegal.	
	Remedy Correct "#2029 grspc(Grid interval)".	
Y51	Parameter stapt1-4 illegal	0012
	Details The time constant has not been set or exceeded the setting range.	
	Remedy Correct the parameters from "#3017 stapt1(Tap time constant (Gear: 00))" to "#3020 stapt4(Tap time constant (Gear: 11))".	
Y51	Slave axis No. illegal	0014
	Details In the axis synchronization, parameter settings for slave axis have been attempted in different part system from that of master axis.	
	Remedy Correct the "#1068 slavno (Slave axis number)" setting.	

Y51	Parameter skip_tL illegal	0015
Details The time constant has exceeded the setting range.		
Remedy Correct "#2102 skip_tL (Skip time constant linear)".		
Y51	Parameter skip_t1 illegal	0016
Details The time constant has exceeded the setting range.		
Remedy Correct "#2103 skip_t1 (Skip time constant primary delay / Second-step time constant for soft acceleration/deceleration)".		
Y51	Parameter G0bdcc illegal	0017
Details "#1205 G0bdcc (Acceleration and deceleration before G0 interpolation)" for the 2nd part system is set to acceleration/deceleration before G0 interpolation.		
Remedy Correct "#1205 G0bdcc (Acceleration and deceleration before G0 interpolation)".		
Y51	OMR-II parameter error	0018
Details An illegal setting was found in the OMR-II-related parameters. OMR-II has been disabled.		
Remedy Correct the related parameter settings.		
Y51	PLC indexing stroke length err	0019
Details "#12804 aux_tleng (Linear axis stroke length)" has not been set or exceeded the setting range while the linear axis equal indexing is enabled for the PLC indexing axis.		
Remedy Correct "#12804 aux_tleng (Linear axis stroke length)".		
Y51	Hi-acc time const unextendable	0020
Details High-accuracy acceleration/deceleration time constant extension option is unavailable.		
Remedy <ul style="list-style-type: none"> Adjust the setting of "#1207 G1btL" to be within the range of when the high-accuracy control time constant extension option is OFF. High-accuracy acceleration/deceleration time constant extension option is unavailable for a system configured with multiple part systems. Change the system to be made up of a single part system, or set the said option to OFF. 		
Y51	Superimpos linear G0 error	0022
Details The time constant has not been set or exceeded the setting range.		
Remedy Check "#2092 pLG0tL G0 time constant for superimposition control (linear)".		
Y51	Superimpos linear G1 error	0023
Details The time constant has not been set or exceeded the setting range.		
Remedy Check "#2094 pLG1tL G1 time constant for superimposition control (linear)".		

Y51	Primary delay G0time const err	0028
Details The time constant has not been set or the set time constant is out of the specified range.		
Remedy Correct "#2093 plG0t1 G0 time constant for superimposition (primary delay)/2nd step of soft acceleration/deceleration".		
Y51	Primary delay G1time const err	0029
Details The time constant has not been set or the set time constant is out of the specified range.		
Remedy Correct "#2095 plG1t1 G1 time constant for superimposition (primary delay)/2nd step of soft acceleration/deceleration".		
Y51	Jerk filter time constant err	0030
Details Setting of "#12051 Jerk_filtG1" is greater than that of "#1568 SfiltG1". Or setting of "#12052 Jerk_filtG0" is greater than that of "#1569 SfiltG0".		
Remedy Change the setting of "#12051 Jerk_filtG1" to be smaller than "#1568 SfiltG1". Or change the setting of "#12052 Jerk_filtG0" to be smaller than "#1569 SfiltG0".		
Y51	Unable to alloc. hi-acc buffer	0031
Details The high-accuracy acceleration/deceleration buffer has failed to be allocated.		
Remedy The software or hardware may be damaged. Contact the service center.		
Y51	Too many hi-speed/accu systems	0032
Details The parameter "#8040 High-speed high-accuracy control-enabled part system" is set to 1 for three or more part systems.		
Remedy Set the parameter "#8040 High-speed high-accuracy control-enabled part system" to 1 for up to two part systems.		
Y51	Parameter G0tL_2 illegal	0033
Details The time constant is out of the specified range.		
Remedy Correct "#2598 G0tL_2 (G0 time constant 2 (linear))".		
Y51	Parameter G0t1_2 illegal	0034
Details The time constant is out of the specified range.		
Remedy Correct "#2599 G0t1_2 (G0 time constant 2 (primary delay)/Second-step time constant for soft acceleration/deceleration)".		
Y51	3ax line accel G0time const er	0035
Details The time constant has not been set or the set time constant is out of the specified range.		
Remedy Correct "#2622 pl3G0tL G0 time constant (linear) for 3-axis serial superimposition control".		

Y51	3ax line accel G1time const er	0036
Details The time constant has not been set or the set time constant is out of the specified range.		
Remedy Correct "#2624 pl3G1tL G1 time constant (linear) for 3-axis serial superimposition control".		
Y51	3ax prim delay G0time const er	0037
Details The time constant has not been set or the set time constant is out of the specified range.		
Remedy Correct "#2623 pl3G0t1 G0 time constant (primary delay) for 3-axis serial superimposition control/2nd step of soft acceleration/deceleration".		
Y51	3ax prim delay G1time const er	0038
Details The time constant has not been set or the set time constant is out of the specified range.		
Remedy Correct "#2625 pl3G1t1 G1 time constant (primary delay) for 3-axis serial superimposition control/2nd step of soft acceleration/deceleration".		
Y51	Machine group No. discrepancy	0039
Details The machine group Nos. that are used for the machine groupwise alarm stop function are different among the axes related to inclined axis control and synchronous control.		
Remedy Give an identical machine group No. to all the axes related to inclined axis control and synchronous control.		
Y51	M-group alarm stop disabled	0040
Details The machine group-based alarm stop function has been disabled, because both the machine group-based alarm stop and collision detection functions were enabled.		
Remedy ♦Disable the collision detection function if you wish to use the machine group-based alarm stop function.		
Y51	Basic axes I, J, K error	0045
Details The 1st letter of name extension axis for 2-letter axis (#1013 axname) is specified to the basic axes I, J, and K (parameter #1026 to #1028).		
Remedy ♦Set the letter other than the 1st letter of name extension axis for 2-letter axis (#1013 axname) to the basic axes I, J and K (parameter #1026 to #1028).		
Y51	Values of PC1/PC2 too large	0101
Details The PC1 and PC2 settings for the rotary axis are too large.		
Remedy Correct "#2201 SV001 PC1 (Motor side gear ratio)" and "#2202 SV002 PC2 (Machine side gear ratio)".		
Y51	ABS/INC same axis name	0104
Details In the absolute/incremental command method using the axis address (L system and when "#1076 AbsInc" = 1), the axis that the same axis address is set in "#1013 axname" and "#1014 incax" exists.		
Remedy Correct the settings so that the same axis address is not set in "#1013 axname" and "#1014 incax".		

Y51	Axis name initial setting err	0105
Details		
The axis address that is out of the setting range (other than X, Y, Z, U, V, W, A, B, C, H) is set in "#1013 ax-name" or "#1014 incax".		
Remedy		
Set the axis address within the setting range to "#1013 axname" and "#1014 incax".		
Y51	Invalid parameter combination	0108
Details		
Combination of parameter settings is invalid.		
Functions that cannot be used together are set to be enabled at the same time.		
Remedy		
Correct the parameter settings.		
Disable one of the settings within the following combinations.		
<ul style="list-style-type: none"> ♦ "#1268 ext04/bit6" (Tool length compensation behavior (M system only)) "#1255 set27/bit5" (Tool length offset for multiple axis synchronization control) ♦ "#1274 ext10/bit3" (Tool offset number H stand-alone command (M system only)) "#1247 set19/bit0" (Movement by tool length compensation command (M system only)) ♦ "#1274 ext10/bit3" (Tool offset number H stand-alone command (M system only)) "#1255 set27/bit5" (Tool length offset for multiple axis synchronization control) ♦ "#1292 ext28/bit3" (Operation at changing tool length compensation amount (M system only)) "#1247 set19/bit0" (Movement by tool length compensation command (M system only)) ♦ "#1292 ext28/bit3" (Operation at changing tool length compensation amount (M system only)) "#1255 set27/bit5" (Tool length offset for multiple axis synchronization control) 		
Y60	Encoder communication error	0001
Details		
An error was detected in the spindle encoder during spindle control with pulse train output.		
Remedy		
♦ Check for spindle encoder problems such as disconnection.		
Y90	No spindle signal	0001-0007
Details		
There is an error in the spindle encoder signal.		
The data transmission to the drive unit is stopped when this error occurs.		
Remedy		
Check the spindle encoder's feedback cable and the encoder.		

System Alarms (Z)

Z02	System error	
Details		
The operation result is illegal.		
Remedy		
•Contact the service center.		
Z11	CC-L IE F communication error	n1 n2
Details		
A communication error has occurred in the communication that uses a CC-Link IE field network unit.		
n1: Indicates the No. of slot to which the expansion unit with the communication error or diagnostic alarm is mounted (in hexadecimal format).		
n2: Indicates the alarm No. of the slot where the communication error or diagnostic alarm is occurring (in hexadecimal format).		
Remedy		
For details of the alarm number, refer to the list of messages in "CC-Link IE field network specification manual".		
Z13	CC-L IE F parameter error	(Parameter No.)
Details		
There is an incorrect parameter setting.		
Parameter setting of #[Parameter No.] is incorrect.		
Remedy		
Correct the setting.		
Refer to the list of messages in "CC-Link IE field network specification manual".		
Z14	CC-Link IE F H/W test status	n1 n2
Details		
H/W test is completed for the CC-Link IE field network unit.		
Check the test result.		
n1: Indicates the H/W test result of slot 1 (in hexadecimal format).		
n2: Indicates the H/W test result of slot 2 (in hexadecimal format).		
0: H/W test is normally completed or not performed		
2: External self-loopback test is completed with connection error		
3: External self-loopback test is completed with communication error		
FFFF: H/W test is underway		
Remedy		
Take the following measures according to the test result.		
0: Check the communication mode.		
If the mode is H/W test, switch it to online, and turn OFF and ON the NC power.		
If a mode other than H/W test is active, check the result of the other slot and take the measures.		
2: Make sure the connection of Ethernet cable, or exchange the cable. And then perform the test again.		
If the error occurs again, exchange the H/W.		
3: Exchange the Ethernet cable, and perform the test again.		
If the error occurs again, exchange the H/W.		
FFFF: Turn OFF and ON the NC power.		
If the result is unchanged, exchange the H/W.		

Z15	CC-L IE F Basic(M) comm. error	n1 n2
Details A communication error has occurred in the master station of CC-Link IE Field Network communication. n1: indicates the No. of station where a communication error is occurring (in decimal notation). 0: Local station (master station) Other than 0: Station No. of communication error n2: indicates the alarm No. of the station where a communication error is occurring (in hexadecimal notation).		
Remedy For details of the alarm number, refer to the list of messages in "CC-Link IE Field Network Basic specifications manual".		
Z16	CC-L IE F Basic(R) comm. error	n1
Details A communication error has occurred in the remote station of CC-Link IE Field Network communication. n1: indicates the alarm No. (in hexadecimal notation).		
Remedy For details of the alarm number, refer to the list of messages in "CC-Link IE Field Network Basic specifications manual".		
Z17	CC-L IE F Basic parameter err.	#[Parameter No.]
Details There is an incorrect parameter setting. Parameter setting of #[Parameter No.] is incorrect.		
Remedy Correct the setting. Refer to the list of messages in "CC-Link IE Field Network Basic specifications manual".		
Z18	Network expansion card error	n1 n2
Details An abnormality has occurred on the field network communication expansion unit. n1: Error slot No. n2: Error No.		
Remedy 0 99: Two Fieldbus communication expansion units which cannot be used simultaneously are mounted simultaneously. Remove either of Fieldbus communication expansion unit. Other than 0 99: Hardware may be faulty. Replace the field network communication expansion unit.		
Z21	PROFIBUS parameter error	(Parameter No.)
Details The parameter #[Parameter #] is incorrect.		
Remedy Correct the setting.		
Z23	AXIS EX-ADR. ERROR	
Details The axis not extending the address (1 character axis) exists at the back of the axis extending the address (2 character axis) in the same system.		
Remedy ♦Improve the axis composition. The axis not extending the address can not exist at the back of the axis extending the address in the same system.		

Z25	Unable to start safe spd clamp	
Details		
The SLS observation request signal has been turned OFF in any of the following machining modes: Thread cutting, synchronous tapping, cross machining, superimposition control, tool center point control or SSS control		
Remedy		
<ul style="list-style-type: none"> •Perform the operation with the SLS observation request signal ON. •Perform the operation with the door closed. 		
Z26	NC unit replacement illegal	
Details		
NC unit is replaced to the FCU8-MU541, FCU8-MA541, FCU8-MU501, or FCU8-MU502.		
Remedy		
<ul style="list-style-type: none"> •Contact to your service center. •Press the reset to cancel the warning and continue the operations. 		
Z27	FncntlSafetyExpnsCard MountErr	
Details		
A functional safety expansion card is mounted to the NC unit (FCU8-MU501 or FCU8-MU50).		
Remedy		
<ul style="list-style-type: none"> •Contact to your service center. •Press the reset to cancel the warning and continue the operations. 		
Z28	EtherNet/IP parameter error	(Parameter No.)
Details		
Parameter setting of #[Parameter No.] is incorrect.		
Refer to the list of messages in "EtherNet/IP specification manual".		
Remedy		
Correct the setting.		
Z29	EtherNet/IP communication err	n1 n2 n3 n4
Details		
A communication error has occurred in the communication that uses an EtherNet/IP expansion unit.		
[n1: Output the device Number (in hexadecimal format)]		
FF: Simultaneously mounting two EtherNet/IP expansion units error		
Other than FF: Device No. of the connected device		
[n2: Output the position No. (in hexadecimal format)]		
FF: Simultaneously mounting two EtherNet/IP expansion units error		
Other than FF: Device No. of the connected device		
[n3: Output the device communication status (IN) (in hexadecimal format)]		
[n4: Output the device communication status (OUT) (in hexadecimal format)]		
Remedy		
For details, refer to "EtherNet/IP Specifications manual".		
Z31	Socket open error(socket)	0001
Details		
Socket open error (socket)		
Remedy		
Set the parameter then turn the power OFF and ON again.		
Z31	Socket bind error(bind)	0002
Details		
Socket bind error (bind)		
Remedy		
Set the parameter then turn the power OFF and ON again.		

Z31	Connection wait queue error(listen)	0003
	Details Connection wait queue error (listen)	
	Remedy Set the parameter then turn the power OFF and ON again.	
Z31	Connection request error(accept)	0004
	Details Connection request error (accept)	
Z31	Data recv error(socket error)	0005
	Details Data receive error (socket error)	
Z31	Data recv error(data error)	0006
	Details Data receive error (data error)	
Z31	Data send error(socket error)	0007
	Details Data send error (socket error)	
Z31	Data send error(data error)	0008
	Details Data send error (data error)	
Z31	Socket close error(close)	000A
	Details Socket close error (close)	
	Remedy Set the parameter then turn the power OFF and ON again.	
Z34	DeviceNet error	
	Details Any of the following errors has occurred in the DeviceNet unit. ♦Master function error (X03 is ON) ♦Slave function error (X08 is ON) ♦Message communication error (X05 is ON) If the errors have occurred in more than one unit, the error No. of the unit with the smallest slot No. is displayed. If the master function, slave function and message communication errors have occurred at the same time, the error is displayed in the following priority order. 1. Master function error 2. Slave function error 3. Message communication error	
	Remedy ♦Select the [Ext. PLC link control] menu on the maintenance screen to open the unit confirmation screen, and check the unit in error and details to cancel the error.	
Z35	Direct Socket connection error	0001
	Details ♦Connection has failed. ♦Five or more clients attempted a connection.	
	Remedy ♦Check the connection of the network cables, and check for broken wires and a failure of the network connection devices such as hub. ♦When using the Direct Socket communication I/F, connect up to four clients.	

Z35	Direct Socket receive error	0002
Details Receiving data from a client has failed.		
Remedy <ul style="list-style-type: none"> • Check the connection of the network cables, and check for broken wires and a failure of the network connection devices such as hub. 		
Z35	Direct Socket send error	0003
Details Sending data to a client has failed.		
Remedy <ul style="list-style-type: none"> • Check the connection of the network cables, and check for broken wires and a failure of the network connection devices such as hub. 		
Z35	Direct Socket timeout error	0004
Details There was no response from client computers, and a timeout error occurred.		
Remedy <ul style="list-style-type: none"> • Check the connection of the network cables, and check for broken wires and a failure of the network connection devices such as hub. 		
Z35	Direct Socket comm OFF	0005
Details The direct Socket communication I/F is OFF.		
Remedy <ul style="list-style-type: none"> • Check the parameter "#11051 Direct Socket ON". 		
Z36	EcoMonitorLight comm. error	
Details An error has occurred in the communication with EcoMonitorLight.		
Remedy Make sure that the CNC has the same communication settings (station No., baud rate, parity and stop bit) as the EcoMonitorLight in error. Make sure that there are no problems with the serial cable connected to the EcoMonitorLight. Make sure to place the serial cable in a low-noise environment.		
Z37	EcoMonitorLight qty discrepant	
Details The number of EcoMonitorLight units connected is inconsistent with the setting of the parameter #11061.		
Remedy Make sure that the value set in the parameter #11061 coincides with the number of EcoMonitorLight units connected to the CNC. Also make sure all the EcoMonitorLight units connected are powered ON and the station No. is not duplicated.		

Z38	Insulation deterioration wrn	
Details		
The motor insulation has been deteriorated.		
0001: Motor insulation deterioration: Caution		
0002: Motor insulation deterioration: Replacement required		
0003: Motor insulation deterioration: Relay welding detected		
Remedy		
0001: The insulation resistance value of the motor has dropped. Contact the service center.		
0002: The insulation resistance value of the motor is less than or equal to the reference value. Contact the service center. When measuring the insulation resistance of the motor and the measured resistance value is less than or equal to the specified value, the motor may be damaged.		
0003: The drive unit may be damaged. Contact the service center.		
Z39	E-mail send error	
Details		
E-mail sending with the email notification to operator function failed.		
Remedy		
♦Check the e-mail environment setting.		
♦Check the registered e-mail address.		
♦Set "0" in "#8134 E-mail send disabled".		
Z40	Format mismatch	
Details		
Although SRAM open parameters were changed, formatting has not been performed yet.		
Remedy		
♦Perform formatting and restart the NC.		
Z41	Decryption code is missing	
Details		
Decryption code for the system lock function is not yet entered, though the encryption key has been entered.		
Remedy		
♦If you want to enable system lock, enter the decryption code. If you do not want, simply turn the power OFF and ON.		
Z45	HD mode disabled	
Details		
You have set "#11053 UserProgramStorage" (User program storage destination) to "1" although the HD operation option is OFF.		
Remedy		
♦If you store user programs in the memory, set "#11053 UserProgramStorage" to "0" and then restart the NC.		
♦If you store user programs in the hard disk, add the HD operation option.		
Z49	RIO watchdog error	0001
Details		
An error has occurred in the remote I/O unit.		
Remedy		
♦Turn the power ON again.		
♦If this error remains active after the power ON, replace the remote I/O unit.		

Z51	E2PROM error	001x
Details [Type] Z51 E2PROM error 0011: Read error Z51 E2PROM error 0012: Write error		
Remedy <ul style="list-style-type: none"> • If the same alarm is output by the same operation, the cause is an H/W fault. Contact the Service Center. 		
Z52	Low battery	00xy
Details Low battery voltage has been detected in the control unit or the personal computer unit. (The battery for retaining internal data) x: Personal computer unit y: Control unit 1: Battery warning 3: Battery alarm (Note) The message "Battery warning" disappears on CNC reset, but the warning remains active until the battery is replaced.		
Remedy <ul style="list-style-type: none"> • Replace the battery of the control unit or the personal computer unit. • Check for disconnection of the battery cable. • After treating the battery, check the machining program. 		
Z53	CNC overheat	
Details The controller or operation board temperature has risen above the designated value. (Note) Temperature warning When an overheat alarm is detected, the alarm is displayed and the overheat signal is output simultaneously. Automatic operation will be continued, while restarting after resetting or stopping with M02/M30 is not possible. (Restarting after block stop or feed hold is possible.) The alarm will be cleared and the overheat signal will turn OFF when the temperature drops below the specified temperature. Z53 CNC overheat 000x [000x] (For all models) 0001: The temperature in the control unit is high. The ambient temperature must be lowered immediately when a "Z53 CNC overheat" alarm occurs. However, if the machining needs to be continued, set "#6449/bit7 Control unit temperature alarm ON" to "0". Then the alarm will be invalidated.		
Remedy <ul style="list-style-type: none"> • Cooling measures are required. • Turn OFF the controller power, or lower the temperature with a cooler, etc. 		

Z55	RIO communication stop
Details	
An error occurs in the communication between the control unit and remote I/O unit.	
♦Disconnection of a cable ♦Fault in remote I/O unit ♦Fault of power supply to remote I/O unit	
The communication interrupted station is displayed in hexadecimal for each RIO channel when an error occurs in the communication between the control unit and remote I/O unit.	
When the control displays a communication stop station, it divides the RIO channel stations (up to 64 stations) into groups of 8 stations. If any of the 8 stations has the communication stop error, the number is displayed with the alarm.	
Z55 RIO communication stop — — — — — — — —	
(a) (b) (c) (d) (e) (f) (g) (h)	
(a)(b): RIO1	
(c)(d): RIO2	
(e)(f): RIO3	
(g)(h): RIO4	
(a)(b), (c)(d), (e)(f), and (g)(h) indicate the following stations in hexadecimal.	
bit0: 1st to 8th stations	
bit1: 9th to 16th stations	
bit2: 17th to 24th stations	
bit3: 25th to 32nd stations	
bit4: 33rd to 40th stations	
bit5: 41st to 48th stations	
bit6: 49th to 56th stations	
bit7: 57th to 64th stations	
(Example) Stations #1 and #8 of RIO1 and stations #24 and #64 of RIO3 have the communication error.	
Z55 RIO communication stop 0100 8400	
The RIO error status can be monitored through the R registers on the self diagnostic or I/F diagnostic screen.	
Remedy	
♦Check and replace the cables. ♦Replace the remote I/O unit. ♦Check the power supply (existence of supply and voltage).	

Z57	System warning	
Details		
Program memory capacity has been set over the value that can be formatted.		
An expansion device/expansion cassette has not mounted after formatting.		
The mounted expansion device/expansion cassette is different from the one that was mounted at formatting.		
Remedy		
Check the followings.		
♦Program memory capacity ♦Mounting of an expansion device/expansion cassette ♦APLC release option		

Z57	System warning	1000
Details		
♦Invalid function table name for motion control release.		
♦Required function is missing from the function table for motion control release.		
♦The add-on module for motion control release cannot be decoded.		
Remedy		
Check the states of the following items.		
♦Motion control release definition file ♦Add-on module		

Z58	ROM write not completed	
Details		
The machine tool builder macro program has not been written to ROM after being edited or input.		
Remedy		
♦Write the machine tool builder macro program to ROM.		
(*) If the changes made by editing, etc. can be discarded when the NC is powered off, writing to ROM is not necessary.		
Z59	Acc/dec time cnst too large	
Details		
Acceleration and deceleration time constants are too large. (This alarm occurs with the stop code (T02 0206).)		
Remedy		
♦Set the larger value for "#1206 G1bF(Maximum speed)".		
♦Set the smaller value for "#1207 G1btL(Time constant)".		
♦Set the lower feedrate.		
Z60	Fieldbus communication error	n1 n2 n3 n4
Details		
A communication error has occurred on the Fieldbus communication with FCU8-WN563.		
[n1: denotes the master station status (in the hexadecimal form).]		
00: Offline: In initialization		
40: Stop: I/O communication stopped		
80: Clear: Resetting the output data of each slave by sending zero data		
C0: In operation: In I/O communication		
FF: Two Fieldbus expansion units are mounted.		
[n2: denotes the error condition (in the hexadecimal form).]		
bit0: Control error: Parameter error		
bit1: Auto clear error: Communication with all the slave stations was cut because a communication with one slave station had an error.		
bit2: Non-exchange error: A slave station has communication error.		
bit3: Fatal error: Communication cannot be continued because of severe network failure.		
bit4: Not ready: CNC communication is not ready.		
bit5: Timeout error: Timeout is detected in communication with each station.		
bit6: Not used		
bit7: Not used		
FF: Two Fieldbus expansion units are mounted.		
[n3: denotes the slave station where communication error has occurred(in the hexadecimal form).]		
(*) FF is indicated when two Fieldbus expansion units are mounted.		
[n4: denotes the error number (in the hexadecimal form).]		
This shows the communication state with slave station where error is occurring.		
Remedy		
For details, refer to "PROFIBUS-DP Specification manual".		
Z64	Valid term soon to be expired	xx
Details		
The valid term will be expired in less than a week. Remaining valid term is xx days.		
Remedy		
♦Obtain a decryption code from the machine tool builder and input it in the NC, then turn the power ON again.		
Z65	Valid term has been expired	
Details		
The valid term has been expired with no decryption code input.		
Remedy		
♦Obtain a decryption code from the machine tool builder and input it in the NC, then turn the power ON again.		

Z67	CC-Link communication error	
Details		
A communication error occurred during CC-Link communication using CC-Link unit.		
Remedy		
•Refer to the list of messages in "CC-Link (Master/Local) Specification manual".		
Z68	CC-Link unconnected	
Details		
A cable between CC-Link unit and a device is disconnected or broken.		
Remedy		
•Find the unconnected cable by checking SW0080 to SW0083 and connect it.		
Z69	External link error	2
Details		
A FROM/TO instruction was used while the MELSEC-Q interface expansion module is not installed.		
Remedy		
Install the MELSEC-Q interface expansion module.		
Z69	External link error	3
Details		
A negative value was set for an I/O No. in the FROM/TO instruction.		
Remedy		
Correct the I/O No.		
Z69	External link error	4
Details		
A negative value was set for transfer size in the FROM/TO instruction.		
Remedy		
Correct the transfer size.		
Z69	External link error	5
Details		
The number of FROM/TO instructions within one scan has exceeded 50.		
Remedy		
Correct the user PLC (ladder sequence) so that the number of FROM/TO instructions per scan is 50 or less.		
Z69	External link error	6
Details		
The access to the buffer memory by the FROM/TO instruction has exceeded 12K words per scan.		
Remedy		
Correct the user PLC (ladder sequence) so that the buffer memory access by the FROM/TO instruction won't exceed 12K words per scan. (The total size of FROM/TO is up to 12K words.)		
Z69	External link error	7
Details		
A FROM/TO instruction was used in high-speed processing.		
Remedy		
Delete the FROM/TO instruction from high-speed processing.		
Z69	External link error	8
Details		
The bit device number designated in the FROM/TO instruction is not a multiple of 16.		
Remedy		
Correct the bit device number designated in the FROM/TO instruction to be a multiple of 16.		

Z69	External link error	9
Details With a FROM/TO instruction, a value out of the address range (negative value, or 0x8000 or over) was set as the head address of the buffer memory.		
Remedy Correct the head address of the buffer memory.		
Z69	External link error	10
Details An alarm occurred in the MELSEC module mounted on the extension base.		
Remedy Check for any disconnection of the MELSEC module and the cables on the extension base. Then turn the CNC's power ON again.		
Z69	External link error	11
Details The I/O No. designated in the FROM/TO instruction is different from the mounted location of the intelligent function module on the extension base (the module's I/O No.).		
Remedy Correct the I/O No. Then turn the CNC's power ON again.		
Z82	3D machine interference/No machine model	0001
Details Machine model is not registered.		
Remedy <ul style="list-style-type: none"> • Press RESET to cancel the alarm. Movement can be resumed after the cancellation. However, the 3D machine interference check will become invalid. • Inform the machine tool builder if an alarm occurs. 		
Z82	3D machine interference/Machine model illegal	0002
Details Machine model is illegal.		
Remedy <ul style="list-style-type: none"> • Press RESET to cancel the alarm. Movement can be resumed after the cancellation. However, the 3D machine interference check will become invalid. • Inform the machine tool builder if an alarm occurs. 		
Z82	3D machine Interference check load excess	0003
Details The calculation of the interference check took time and caused a deceleration.		
Remedy <ul style="list-style-type: none"> • Inform the machine tool builder. • Restart the axis in case of a manual operation. • In case of an automatic operation, the operation will automatically resume when the processing load of the interference check decreases. 		
Z82	3D machine Interference check error	0004
Details The interference check failed.		
Remedy <ul style="list-style-type: none"> • Take a note of the failed status and contact the service center. • Press RESET to cancel the alarm. Invalidate the 3D machine interference check to continue the operation. 		

Z84	Unable to save all the history	
Details		
The system is unable to store the data due to lack of free space on the internal memory.		
Remedy		
♦Ensure sufficient free space on the internal memory.		
Z85	OP panel I/O not connected	0001
Details		
No operation panel I/O is connected.		
Remedy		
♦Make sure that an operation panel I/O unit is connected.		
♦Make sure that power is supplied to the operation panel I/O unit.		
♦Check for any cable disconnection between the CNC unit and operation panel I/O unit.		
(*) If you connect no operation panel I/O unit to the CNC unit, set the parameter "#1261 set33/bit1" to "1".		
Z85	No display conn. to panel I/O	0002
Details		
No display unit is connected to the operation panel I/O unit.		
Remedy		
♦Make sure an operation panel I/O unit for M800VW/M80VW Series is connected.		
♦Make sure the display unit is being powered.		
♦Check for any cable disconnection between operation panel I/O and display units.		
(*) If operation panel I/O is not connected to display unit in your system configuration, set the parameter "#1261 set33/bit2" to "0".		
Z85	Power ON sequence error	0003
Details		
Power ON sequence has not been executed correctly.		
Remedy		
♦Make sure an operation panel I/O unit for M800VW/M80VW Series is connected.		
♦Make sure the operation panel I/O unit is being powered.		
♦Check the power-off wiring of the display unit.		
♦Check for any cable disconnection between CNC and operation panel I/O units.		
♦Make sure the operation panel I/O and display units are connected.		
(*) If no operation panel I/O is connected in your system configuration, set the parameter "#1261 set33/bit1" to "1" and "#1261 set33/bit2" to "0".		
(*) If operation panel I/O is not connected to display unit in your system configuration, set the parameter "#1261 set33/bit2" to "0".		
Z85	Power OFF sequence error	0004
Details		
Power OFF sequence has not been executed correctly.		
Remedy		
♦Make sure an operation panel I/O unit for M800VW/M80VW Series is connected.		
♦Make sure the operation panel I/O unit is being powered.		
♦Check the power-off wiring of the display unit.		
♦Check for any cable disconnection between CNC and operation panel I/O units.		
♦Make sure the operation panel I/O and display units are connected.		
(*) If no operation panel I/O is connected in your system configuration, set the parameter "#1261 set33/bit1" to "1" and "#1261 set33/bit2" to "0".		
(*) If operation panel I/O is not connected to display unit in your system configuration, set the parameter "#1261 set33/bit2" to "0".		

Z85	Display unit shutoff timeout	0005
Details Timeout has occurred during wait for the display power shutdown when automatic power OFF is being executed.		
Remedy <ul style="list-style-type: none"> • Make sure an operation panel I/O unit for M800VW/M80VW Series is connected. • Make sure the operation panel I/O unit is being powered. • Check for any cable disconnection between CNC and operation panel I/O units. • Make sure the operation panel I/O and display units are connected. (*) If no operation panel I/O is connected in your system configuration, set the parameter "#1261 set33/bit1" to "1" and "#1261 set33/bit2" to "0". (*) If operation panel I/O is not connected to display unit in your system configuration, set the parameter "#1261 set33/bit2" to "0".		
Z86	Overvoltage detection warning	0001
Details Overvoltage was detected in hardware voltage.		
Remedy <ul style="list-style-type: none"> • If this alarm occurs frequently, check the power supply voltage. 		
Z86	Overvoltage detection alarm	0002
Details Overvoltage was detected in hardware voltage.		
Remedy <ul style="list-style-type: none"> • Turn OFF and ON the NC power. • If this alarm occurs frequently, check the power supply voltage. 		
Z92	Memory ECC error	0004
Details Incorrect data has been read out from the internal memory.		
Remedy <ul style="list-style-type: none"> • Contact the service center. 		
Z95	Image input ex. card sync lost	0001
Details Synchronization of the image input signal has been lost.		
Remedy <ul style="list-style-type: none"> • Check the HDMI cable for any disconnection. • If synchronization loss occurs frequently, exchange the image input expansion card. 		
Z95	Image input ex. card illegal	0002
Details The image input expansion card for M80/M800S is installed.		
Remedy <ul style="list-style-type: none"> • Install the image input expansion card for M80V/M800VS. 		
Z95	Image input ex. slot illegal	0003
Details The image input expansion card is installed in the expansion slot EXT2.		
Remedy <ul style="list-style-type: none"> • Install the image input expansion card in the expansion slot EXT1. 		

Z96	Power OFF prohibit process ON	0001
Details Power OFF prohibition process is in execution. 0001: Machine tool builder macro program is being saved.		
Remedy <ul style="list-style-type: none"> Do not turn OFF the power while the message is displayed. 		
Z102	FL-net parameter error	(Parameter No.)
Details The setting of #[Parameter No.] is incorrect.		
Remedy <ul style="list-style-type: none"> Correct the setting. For details, refer to the list of messages in "FL-net specifications manual". 		
Z103	FL-net communication error	(Error code)
Details A communication error has occurred in FL-net communication. Error code: indicates the status of CNC (FL-net) (in hexadecimal)		
Remedy <ul style="list-style-type: none"> For details of the alarm number, refer to the list of messages in "FL-net specifications manual". 		
Z104	FL-net node warning	(Node No.) (Error code)
Details An error has occurred on the other node that is participating in FL-net. Node No.: indicates the number of the node in error (in decimal with three digits) Error code: indicates the status of the node in error (in hexadecimal)		
Remedy <ul style="list-style-type: none"> For details of the alarm number, refer to the list of messages in "FL-net specifications manual". 		
Z105	End-user parameter error	
Details The value of end-user parameter is incorrect. The value is inconsistent with the multi-project parameter of the built-in PLC, or the sum of the initial device number and the quantity of the devices has exceeded the upper limit.		
Remedy <ul style="list-style-type: none"> Correct the value of the end-user parameter displayed. 		
Z106	VCC card authentication error	0001
Details Failed to authenticate the vibration cutting expansion unit.		
Remedy <ul style="list-style-type: none"> Contact the service center. Press the reset to cancel the warning and continue the operations. 		
Z107	NC-HPU optical comm. warning	0001
Details A communication error occurred in the NC-HPU optical communication while parameter "#1762 cfgPR12/bit1" is set to "0". bit0: Communication start error bit1: Initial communication error bit2: Communication error		
Remedy <ul style="list-style-type: none"> Check that the cable is properly connected. Check that the HPU power is turned ON. 		

Z107	NC-HPU optical comm. alarm	0002
Details		
A communication error occurred in the NC-HPU optical communication while parameter "#1762 cfgPR12/bit1" is set to "1".		
bit0: Communication start error		
bit1: Initial communication error		
bit2: Communication error		
Remedy		
•Check that the cable is properly connected.		
•Check that the HPU power is turned ON.		
•Turn OFF/ON the NC power.		
Z108	HPU error	0001
Details		
An error has arisen in the HPU.		
bit0: E0 System/HW/SD/optical communication error		
bit1: E1 RIO/AI/DI/SIO error		
bit2: E2 Network error		
bit3: E3 Analyzing process error		
bit4: E4 (spare)		
bit5: E5 (spare)		
bit6: E6 User customization		
bit7: E7 User customization		
Remedy		
•Check the HPU status.		
Z109	HPU preparation error	
Details		
Registration and deletion of the HPU custom module has been failed.		
[Error details]		
0001: The total size of the HPU custom module exceeded 5 MB.		
0002: Failed to load the HPU custom module.		
0003: Failed to load the HPU custom module in the HPU.		
0004: The HPU custom module was transferred and deleted while the HPU custom module is already loaded.		
0005: The HPU custom module to be deleted did not exist in the HPU.		
0006: An error has occurred with the SD card in the HPU.		
0020 to 00FF: An internal error has occurred.		
Remedy		
Take the following procedures depending on the details of the error.		
0001: Correct the HPU custom module.		
0002: Re-register the HPU custom module.		
0003: Correct the HPU custom module.		
0004: Restart the NC and HPU.		
0005: Initialize the MTB password of the HPU.		
Re-register the HPU custom module.		
0006: Contact the service center.		
0020 to 00FF: Restart the NC and HPU.		
If the problem persists, contact the service center.		
Z111	Laser I/F unit not connected	0001
Details		
The laser I/F unit FCU8-DX522 is not connected.		
Remedy		
•Connect the laser I/F unit FCU8-DX522, and then reboot the NC.		

Z111	Laser I/F unit has no software	0002
Details		
There is no software on the laser I/F unit FCU8-DX522.		
Remedy		
<ul style="list-style-type: none"> ♦Set the type of laser oscillator to be connected in parameter "#90001 LASER_UNIT_TYPE", and then reboot the NC. ♦Set "1" in parameter "#90002 LASER_UNIT_WRITE", and then reboot the NC. 		
Z111	Laser I/F unit S/W mismatch	0003
Details		
The software of the laser I/F unit FCU8-DX522 does not match parameter "#90001 LASER_UNIT_TYPE".		
Remedy		
<ul style="list-style-type: none"> ♦After setting the type of the laser oscillator to be connected in parameter "#90001 LASER_UNIT_TYPE", set "1" in parameter "#90002 LASER_UNIT_WRITE", and reboot the NC. 		
Z111	Laser I/F unit H/W error	0004
Details		
An error was detected on the laser I/F unit FCU8-DX522.		
Remedy		
<ul style="list-style-type: none"> ♦Write the firmware to the laser I/F unit. ♦A failure of the firmware or hardware is suspected. Contact the service center. 		
Z111	No spec: Laser processing ctrl	0005
Details		
Laser processing control is not included in the specifications.		
Remedy		
<ul style="list-style-type: none"> ♦Check the specifications. 		
Z113	MCR init process error	
Details		
The initialization of motion control release was not processed correctly.		
Remedy		
<ul style="list-style-type: none"> ♦Report this error to the machine tool builder. 		
Z115	HPU I/F unsupported	
Details		
The NC, the high speed processing unit or the edge PC does not support the high speed processing unit I/F.		
[n1: Displays the function for which the request failed. (DEC)]		
2: HPU custom module 1		
3: HPU custom module 2		
4: HPU custom module 3		
5: HPU custom module 4		
6: HPU custom module 5		
[n2: Displays the system that does not support the high speed processing unit I/F. (DEC)]		
0: NC		
1: High speed processing unit		
2: Edge PC		
Remedy		
<ul style="list-style-type: none"> ♦Upgrade the system. 		

Z116	HPU I/F request failed	
Details		
An error occurred in the edge PC for the request by the high speed processing unit I/F.		
[n1: Displays the function for which the request failed. (DEC)]		
2: HPU custom module 1		
3: HPU custom module 2		
4: HPU custom module 3		
5: HPU custom module 4		
6: HPU custom module 5		
[n2: Displays the error number detected in the RT Processing unit or the edge PC. (DEC)]		
If the error number is between 1 and 9999, look it up in the relevant errors in Edge PC App Specification Manual.		
If the error number is between 10001 and 19999, look it up in the manual issued by the machine tool builder.		
Remedy		
•Check the state of the RT Processing unit or the edge PC.		
Z117	Ext com var alloc prmtr invalid	
Details		
The parameter for allocating extended common variables is incorrect.		
Remedy		
•Correct the parameter that designates allocation of the extended common variables.		
When this alarm is caused by more than one parameter, the last parameter number is indicated.		
Z118	Can't create ext com var file	
Details		
Creating the extended common variable data file failed.		
Remedy		
•Ensure that sufficient space is left on the SD card in the control unit (M800VW/M80VW) or on the SD card inserted in the SD card slot on the back of the display unit (M800VS/M80V).		
•Set the parameter "#11829 exComVar3FileN" to be the same as or smaller than [the number of creatable files].		
Z119	12V power error	Error code
Details		
NC unit detected low 12V power voltage.		
Error code: 24V power voltage measurement value (V)		
Remedy		
•Cancel the alarm by resetting.		
•If this alarm occurs frequently, the hardware may be damaged. Contact our service center.		
Z120	Cloud communication error	
Details		
Communication with the cloud server failed.		
Remedy		
•Correct the remote service-related parameters.		
•Set "0" in parameter "#8170 Remote Service".		
Z121	Dign. report config file error	
Details		
The contents of the diagnosis report configuration file are incorrect.		
Remedy		
•Correct the contents of the diagnosis report configuration file.		
•Set "0" in parameter "#8170 Remote Service".		
•Set "0" in parameter "#8171 Diag Report Enable".		

Z123	CCIETSN (remote) comm. error	n1
Details A communication error has occurred in the communication that uses a CC-Link IE TSN remote module. n1: indicates the alarm No. (in hexadecimal notation). Alarm No. indicates the details of the communication error. Refer to the list of messages in "CC-Link IE TSN (remote station) specification manual".		
Remedy •Take measures described in the list of messages in "CC-Link IE TSN (remote station) specification manual".		
Z124	CCIETSN (remote) param. error	Parameter No.
Details The parameter setting is incorrect. Parameter setting of #[Parameter No.] is incorrect. Refer to the list of messages in "CC-Link IE TSN (remote station) specification manual".		
Remedy •Take measures described in the list of messages in "CC-Link IE TSN (remote station) specification manual".		
Z125	WLAN_DHCP server error	0001
Details The DHCP server setting is invalid. •A value larger than 254 is assigned to the 4th octet of the IP addresses provided by the DHCP server. (The 4th octet is the last portion in an IP address separated by a dot.)		
Remedy •Correct the setting of "#75052 StartIP DHCPserver" or "#75053 IP num DHCPserver" so that a number larger than 254 is not included in the 4th octet of the IP addresses provided by the DHCP server.		
Z125	WLAN_DHCP IP address invalid	0002
Details The DHCP server setting is invalid. •The IP address of the NC unit and the IP address provided by the DHCP are not in the same network. •"#75052 StartIP DHCPserver" is set to "0.0.0.0" or "255.255.255.255".		
Remedy •Correct the setting of "#75001 WLAN IP address" or "#75052 StartIP DHCPserver".		
Z125	WLAN_SSID not set	0003
Details The connect SSID or SSID is not entered.		
Remedy •Set "#75003 connect SSID" or "#75005 SSID".		
Z125	WLAN_Encryption key not set	0004
Details The encryption key is not entered.		
Remedy •Set "#75007 Encryption key".		
Z125	WLAN_STA/AP mode invalid	0005
Details The STA/AP mode setting is invalid.		
Remedy •Correct the setting of "#75000 STA/AP mode".		

Z125	WLAN_Frequency band invalid	0006
Details The frequency band setting is invalid.		
Remedy ♦Correct the setting of "#75009 Frequency band".		
Z125	WLAN_Encryption mode invalid	0007
Details The encryption mode setting is invalid.		
Remedy ♦Correct the setting of "#75006 Encryption mode".		
Z125	WLAN_Channel invalid	0014
Details The wireless LAN channel setting is invalid. ♦The channel you set cannot be used in the country corresponding to the country code. ♦The frequency band corresponding to "#75008 WLAN channel" does not match "#75009 Frequency band".		
Remedy ♦Correct the setting of "#75008 WLAN channel" to match the country. ♦Correct the setting of "#75008 WLAN channel" or "#75009 Frequency band".		
Z125	WLAN_Country code invalid	0015
Details The country code setting is invalid. ♦Wireless LAN has not been approved in the country corresponding to the country code. ♦A nonexistent country code is set. ♦No country code is entered.		
Remedy ♦Reboot the NC. If the alarm continues to occur after reboot, have the machine tool builder set the country code, and then reboot the NC. ♦Set "#75000 STA/AP mode" to "0" to disable wireless LAN.		
Z125	WLAN_Setting illegal	0050
Details There is an error in the wireless LAN setting.		
Remedy ♦Correct the setting of wireless LAN.		
Z125	WLAN_Startup error	0051
Details Wireless LAN failed to start.		
Remedy ♦Reboot the NC. ♦If the alarm continues to occur after reboot, contact your local service center.		
Z125	WLAN_Internal error	0x00C8 to 0x00FF
Details An internal error occurred in wireless LAN.		
Remedy ♦Contact the service center. ♦Set "#75000 STA/AP mode" to "0" to disable wireless LAN.		

Z128	ROM write error
Details <ul style="list-style-type: none"> ♦The machine tool builder macro program has not been successfully written to ROM. ♦Formatting of the machine tool builder macro program area has not been successfully completed. [Type] 0001: Open error 0002: Erase error 0003: Write error 0004: Verify error	
Remedy <ul style="list-style-type: none"> ♦Write the program to ROM again. ♦Format the area again. (*) If the alarm is not cleared, the hardware may be broken. Contact the service center.	
Z130	MTB macro file invalid
Details <ul style="list-style-type: none"> ♦The machine tool builder macro file was entered into an NC that has a different passcode than the NC from which the file was output. ♦You tried to enter a machine tool builder macro file that is larger than the storage capacity. 	
Remedy <ul style="list-style-type: none"> ♦Verify the passcode and size, and enter the machine tool builder macro file again. 	
Z131	OMR-CC dr unit not spt
Details <p>A drive unit that does not support OMR-CC is connected to the axis with "#2678 OMRCC_valid" set to "1".</p>	
Remedy <ul style="list-style-type: none"> ♦To enable OMR-CC, the drive units for all axes with "1" set in "#2678 OMRCC_valid" must be OMR-CC compatible MDS-E series version B3 or later. ♦To disable OMR-CC, set "#2678 OMRCC_valid" to "0". 	

Absolute Position Detection System Alarms (Z7*)

Z70	Abs posn base set incomplete	0001	(Axis name)
Details Zero point initialization is incomplete. Otherwise, the spindle was removed.			
Remedy Complete zero point initialization.			
Z70	Absolute position lost	0002	(Axis name)
Details [Absolute position lost] The absolute position basic point data saved in the NC has been damaged. [Absolute position lost due to replacement of encoder] The batteryless encoder has been replaced.			
Remedy [Absolute position lost] Set the parameters. If the basic point data is not restored by setting the parameters, perform zero point initialization. [Absolute position lost due to replacement of encoder] Initialize the zero point.			
Z70	Abs posn param changed	0003	(Axis name)
Details Any of the parameters for absolute position detection has been changed. #1003 iunit #1017 rot #1018 ccw #1040 M_inch #2049 type #2201 PC1 #2202 PC2 #2218 PIT #2219 RNG1 #2220 RNG2 #2225 MTYP			
Remedy Correct the parameter settings. Then turn the power ON again and perform zero point initialization.			
Z70	Abs posn initial set illegal	0004	(Axis name)
Details The zero point initialization point is not at the grid position.			
Remedy Perform the zero point initialization again.			
Z70	Abs posn param restored	0005	(Axis name)
Details The data has been restored by inputting the parameters during the alarm No.0001, 0002, and 0003.			
Remedy Turn the power ON again to start the operation.			
Z70	Abs data error	0006	
Details Deviation of the servo axis with scale when the power is OFF exceeds the set value in "#2051 check" (Check).			
Remedy Search for the factor which led the deviation of the servo axis at the power OFF.			

Z70	Abs posn data lost	0080	(Axis name)
Details The absolute position data has been lost. An error of the multi-rotation counter data in the encoder and so on may be the cause. (Liquid penetrates into encoder connector, etc.)			
Remedy Replace the encoder and complete zero point initialization.			
Z70	Abs posn error(servo alm 25)	0101	(Axis name)
Details The servo alarm No. 25 was displayed and the power was turned ON again.			
Remedy Perform zero point initialization again.			
Z70	Abs posn error(servo alm E3)	0106	(Axis name)
Details The servo alarm No. E3 was displayed and the power was turned ON again.			
Remedy Perform zero point initialization again.			
Z71	AbsEncoder:Backup voltage drop	0001	(Axis name)
Details Backup voltage in the absolute encoder dropped.			
Remedy Replace the battery, check the cable connections, and check the encoder. Turn the power ON again and perform zero point initialization.			
Z71	AbsEncoder: Commu error	0003	(Axis name)
Details Communication with the absolute encoder has been disabled.			
Remedy Check and replace the cables, card or encoder. Turn the power ON again and perform zero point initialization.			
Z71	AbsEncoder: Abs data changed	0004	(Axis name)
Details Absolute position data has been changed at the absolute position establishment.			
Remedy Check and replace the cables, card or encoder. Turn the power ON again and perform zero point initialization.			
Z71	AbsEncoder: Serial data error	0005	(Axis name)
Details An error of the serial data was found in the absolute encoder.			
Remedy Check and replace the cables, card or encoder. Turn the power ON again and perform zero point initialization.			
Z71	AbsEncoder: Abs/inc posn diffr	0006	(Axis name)
Details Servo alarm E3 Absolute position counter warning			
Remedy Operation is possible until the power is turned OFF.			
Z71	AbsEncoder: Initial commu er	0007	(Axis name)
Details Initial communication with the absolute encoder is not possible.			
Remedy Check and replace the cables, card or encoder. Turn the power ON again and perform zero point initialization.			

Z72	Position check error	(Axis name)
Details		
This alarm is displayed if an error is detected when comparing the encoder's absolute position and controller coordinate values in the absolute position system.		
Z73	Battery for abs data fault	0001
Details		
Low backup battery		
Servo alarm 9F		
Low battery voltage		
Remedy		
If the battery voltage is low or the cable is damaged, there is no need to initialize the absolute position.		

Distance-coded Reference Scale Errors (Z8*)

Z80	Basic position lost	0001
Details The basic point data saved in the NC has been damaged.		
Remedy •Set the parameters. If the basic point data is not restored by setting the parameters, perform zero point initialization.		
Z80	Basic position restore	0002
Details The basic point data has been restored by setting the parameters.		
Remedy •Turn the power ON again to start the operation.		
Z80	No spec: Distance-coded scale	0003
Details The distance-coded reference scale has been set available although this function is out of the specifications.		
Remedy •Check the specifications. •If you do not use this function, correct the encoder type with the servo parameter.		
Z81	R-pos adjustment data lost	0001
Details Reference position adjustment value data saved in the CNC has been damaged.		
Remedy •Set the parameter. If the data is not restored by setting the parameter, establish the reference position again.		
Z81	R-pos adjustment data restored	0002
Details After the 'Z81 R-pos adjustment data lost 0001', the data has been recovered by setting the parameter.		
Remedy •Establish the reference position to start the operation.		
Z83	NC started during SP rotation	0001
Details The NC was started while the spindle was rotating.		
Remedy •Turn OFF the power once, and make sure that the spindle is stopped before turning ON the power again. •You can select whether or not to stop the spindle forcibly at the occurrence of this alarm by the setting of the base common parameter "#1284 ext20/bit1" (Spindle control selected in response to Z83 (NC started during SP rotation)). •If this alarm occurs frequently, check the power supply voltage.		

Emergency Stop Alarms (EMG)

EMG	Emergency stop	PLC
Details		
The "PLC emergency stop" signal is turned ON during the sequence processing of the user PLC.		
Remedy		
<ul style="list-style-type: none"> • Check the conditions to turn the "Emergency stop" signal ON and remove the cause of the alarm during the sequence processing of the user PLC. 		
EMG	Emergency stop	EXIN
Details		
The "emergency stop" signal is significant (open).		
Remedy		
<ul style="list-style-type: none"> • Cancel the "emergency stop" signal. • Check for any broken wires. 		
EMG	Emergency stop	SRV
Details		
An alarm occurred in the servo system causing an emergency stop.		
Remedy		
<ul style="list-style-type: none"> • Investigate and remove the cause of the servo alarm. 		
EMG	Emergency stop	STOP
Details		
The user PLC (ladder sequence) is not running.		
Remedy		
<ul style="list-style-type: none"> • Check the setting of the control unit rotary switch CS2. Correct it if set to "1". • Check the [RUN/SP] (run/stop) switch on the PLC edit file save screen (onboard function). Turn it OFF if ON. 		
EMG	Emergency stop	SPIN
Details		
Spindle drive unit is not mounted.		
Remedy		
<ul style="list-style-type: none"> • Cancel the causes of the other emergency stop. • Check the "emergency stop" signal input in the spindle drive unit. 		
EMG	Emergency stop	PC_H
Details		
Failure in the high-speed PC processing abnormal		
Remedy		
<ul style="list-style-type: none"> • Correct the sequence program. (To stop monitoring the high-speed PC processing temporarily, set "1" in "#1219 aux03/bit1 (Stop high-speed PC monitoring function)". Disable the monitoring function only as a temporary measure.) 		
EMG	Emergency stop	PARA
Details		
Setting of the door open II fixed device is illegal.		
Setting of the parameters for dog signal random assignment is illegal.		
Remedy		
<ul style="list-style-type: none"> • Correct the "#1155 DOOR_m" and "#1156 DOOR_s" settings. (When the door open II fixed device is not used, set "#1155 DOOR_m" and "#1156 DOOR_s" to "100".) • Correct the "#2073 zrn_dog (Origin dog Random assignment device)", "#2074 H/W_OT+ (H/W OT+ Random assignment device)", "#2075 H/W_OT- (H/W OT- Random assignment device)" and "#1226 aux10/bit5 (Arbitrary allocation of dog signal)" settings. 		

8 Emergency Stop Alarms (EMG)

EMG	Emergency stop	LINK
	Details An emergency stop occurs when the FROM/TO instruction is not executed within 500ms.	
	Remedy <ul style="list-style-type: none"> •Execute the FROM/TO instruction one or more times every 500ms. The time in which no interrupt request is issued from MELSEC is measured and stored in the following R registers: R10190: Current timeout counter R10191: Maximum timeout counter after power ON R10192: Maximum timeout counter after system is started up (this is backed up)	
	Details MELSEC is in error and reset states.	
	Remedy <ul style="list-style-type: none"> •Check the MELSEC states. 	
	Details The contents of MELSEC-specific code area in buffer memory have been damaged.	
	Remedy <ul style="list-style-type: none"> •Check the MELSEC states. 	
	Details PLC serial link communication has stopped.	
	Remedy <ul style="list-style-type: none"> •Check the CC-Link card wiring and the external sequencer transmission. •Check the link communication errors shown on the diagnostic screen. 	
EMG	Emergency stop	WAIT
	Details The preparation sequence is not sent from the master station. Otherwise, the contents of the received preparation sequence are inconsistent with those of the parameters, so that the usual sequence cannot be started.	
	Remedy <ul style="list-style-type: none"> •Check that the CC-Link card switch setting and wiring as well as the external sequencer transmission are normal. •Check the diagnostic screen for link communication errors. 	
EMG	Emergency stop	XTEN
	Details The CC-Link card is operating incorrectly. Switch/parameter settings for the CC-Link card are incorrect.	
	Remedy <ul style="list-style-type: none"> •Replace the CC-Link card. •Correct the switch/parameter settings for the CC-Link card. 	
EMG	Emergency stop	LAD
	Details The sequence program has an illegal code.	
	Remedy <ul style="list-style-type: none"> •Correct any illegal device Nos. or constants in the sequence program. 	
EMG	Emergency stop	CVIN
	Details The "emergency stop" signal for power supply is significant (open) because the external emergency stop function for power supply is enabled.	
	Remedy <ul style="list-style-type: none"> •Cancel the "emergency stop" signal. •Check for any broken wires. 	

8 Emergency Stop Alarms (EMG)

EMG	Emergency stop	MCT
	Details The contactor shutoff test is being executed.	
	Remedy <ul style="list-style-type: none"> •The emergency stop is reset automatically after the contactor shutoff is confirmed. •If the contactor shutoff is not confirmed within 5 seconds after the "contactor shutoff test" signal has been input, the "contactor welding detected" alarm occurs and the emergency stop status remains. •Make sure that the contactor's auxiliary b contact signal is correctly output to the device that is set in "#1330 MC_dp1" and "#1331 MC_dp2" (Contactor weld detection device 1 and 2), and then turn the power ON again. 	
EMG	Emergency stop	IPWD
	Details The data backup for power failure might not have been executed successfully at the previous power failure.	
	Remedy <ul style="list-style-type: none"> •If this message appears frequently, the power supply may be deteriorated. Contact the service center. 	
EMG	Emergency stop	ENC
	Details The encoder replacement operation is in progress.	
	Remedy <ul style="list-style-type: none"> •Complete the encoder replacement operation on the "ABS. POSITION SET" screen. 	

Computer Link Errors (L)

L01	Timeout error	0004
Details Communication ended with timeout. (CNC has a 248-byte receive buffer. The time during which CNC receives 248 bytes exceeds the "TIME-OUT" value set in the I/O device parameter.)		
Remedy <ul style="list-style-type: none"> ♦Set a greater timeout value in the input/output device parameter. ♦Check the software in HOST and make sure that the HOST transmits data in response to DC1 (data request) from CNC. ♦Set "#9614 START CODE" to "0". 		
L01	Host ER signal OFF	0010
Details ER signal in HOST (or DR signal in CNC) is not turned ON.		
Remedy <ul style="list-style-type: none"> ♦Check for any disconnected cable. ♦Check for any broke wire. ♦Make sure that the HOST power is turned ON. 		
L01	Parity H error	0015
Details Communication ended with parity H.		
Remedy <ul style="list-style-type: none"> ♦Check the software in HOST and make sure that the data to be transmitted to CNC is ISO code. 		
L01	Parity V error	0016
Details Communication ended with parity V.		
Remedy <ul style="list-style-type: none"> ♦Correct the data to transmit to CNC. 		
L01	Overrun error	0017
Details CNC received 10 bytes or more data from HOST in spite of DC3 (request to stop data transfer) transmission from CNC to the HOST, which terminated the communication. CNC received 10 bytes or more data from HOST during the data transmission from CNC to the HOST.		
Remedy <ul style="list-style-type: none"> ♦Check the software in HOST and make sure that the HOST stops transmitting data within 10 bytes after receiving DC3. ♦Correct the software in HOST not to transmit data such as a command or header to CNC during receiving a machining program. 		

User PLC Alarms (U)

(Note) U10 Illegal PLC (User PLC is illegal)

- "xx" in the lower 16 bits of the sub-status 1 indicates the program No. (0x01 to 0x78(in the hexadecimal form))
- The sub-alarm No. "yy" of sub- status 1 indicates the project No. ("yy" is not displayed when the maximum number of projects is 1)

(Note) For details of user PLC alarms, refer to "PLC Development Manual".

U01	No user PLC	-	-
Details No sequence program is included in the built-in ROM or temporary memory area. (1) Sequence program is not stored in the built-in ROM. (2) Sequence program is not written from the GX Developer/GX Works2 or internal PLC edit function. (3) Sequence program cannot be read due to broken built-in ROM. (4) No large capacity PLC additional specifications.			
Remedy (1) Write the sequence program from the GX Developer/GX Works2 or internal PLC edit function, and then execute the built-in ROM writing. (2) Check the presence of additional specification "Large PLC capacity" and reconsider the storable size. (3) If (1) or (2) does not solve the problem, there is a possibility that built-in ROM is broken.			
U10	Illegal PLC	0x04xx.yy	Step No.
Details Software instruction interruption illegal An error was found in data for the sequence program in execution. (1) Sequence program stored in the built-in ROM is broken. (2) Sequence program under development (before writing into F-ROM) is broken.			
Remedy Contact Mitsubishi Electric.			
U10	Illegal PLC	0x100*	-
Details A H/W error was detected during the PLC execution.			
Remedy Contact Mitsubishi Electric.			
U10	Illegal PLC	0x110*	-
Details The PLC system execution preparation failed.			
Remedy Contact Mitsubishi Electric.			
U10	Illegal PLC	0x120*	-
Details Number of ladder over (at PLC system startup) The total number of "ladder files" stored in built-in ROM exceeded the maximum.			
Remedy Write "sequence program", "comment file", "PLC message file", and "symbolic information file" again.			

U10	Illegal PLC	0x130*	-
Details Number of data over (at PLC system startup) The total number of "comment files", "PLC message files", and "symbolic information files" stored in built-in ROM exceeded the maximum.			
Remedy Remedy the error in either of the following methods. (1) Select [Format PLC memory] with GX Developer/GX Works2 and format the memory after setting [Target memory] to [Memory card(RAM)]. After that, write "comment file", "PLC message file", and "symbolic information file" again. (2) Create a ladder with [Add New Data] in built-in PLC editing function and execute "Format". After that, write "sequence program", "comment file", "PLC message file", and "symbolic information file" again.			
U10	Illegal PLC	0x20xx.yy	Step No.
Details Label branching error (Before executing PLC) Occurs only when the bit selection parameter (#6452 bit6) "branch destination label check valid" is set to "1". (1) The CJ and CALL instructions were placed to a nonexistent label. (2) The CJ instruction was placed to the global label. (Branching is possible only with the CALL instruction.)			
Remedy Check the branch destination of the CJ and CALL instructions existing in the steps occurred.			
U10	Illegal PLC	0x21xx.yy	Step No.
Details Label duplication error (Before executing PLC) (1) When using the multi-programming method: - Labels of common pointer are duplicated. - Labels of local pointer are duplicated within the same file. (2) When using the independent program method, labels are duplicated.			
Remedy Correct the duplication of the labels existing in the steps occurred.			
U10	Illegal PLC	0x22xx.yy	-
Details Local label over (Before executing PLC) (*) "Local label" is as "labels of local pointer". The boundary value set with the PC parameter (common pointer boundary value) has been exceeded by the total number of labels of local pointer.			
Remedy (1) Reduce the number of local labels used. - Use as sequentially as possible from P0. (2) Reset the PC parameter (common pointer boundary value).			
U10	Illegal PLC	0x230*.yy	-
Details Global label boundary value error (Before executing PLC) (*) "Global label" is as "labels of common pointer". The content of PC parameter (common pointer boundary value) is not normal. (1) When using the multi-programming method, a value greater than the maximum value is set. (2) When using the independent program method, the label boundary value of common pointer is set.			
Remedy (1) When using the multi-programming method, correct the common pointer boundary value to an appropriate value. (2) When using the independent program method, delete the common pointer boundary value.			

U10	Illegal PLC	0x24xx.yy	Step No.
Details Reserved label error (Before executing PLC) (1) When using the multi-programming method, disabled reserved label exists. (2) When using the independent program method, reserved labels are duplicated.			
Remedy (1) When using the multi-programming method, delete the reserved label. (2) When using the independent program method: - Delete the PC parameter program settings. - Correct the duplication of reserved labels.			
U10	Illegal PLC	0x25xx.yy	-
Details Program setting error (Before executing PLC) (1) When using the multi-programming method, PC parameter setting is not correct. - PC parameter (program setting) is not set. - Unstored program name is set. - The contents of the program name is abnormal. - More than the maximum number of programs that can be set (120 programs) are set. (2) When using the independent program method, multiple programs are stored. (3) When the multi-project is valid, the sum of all projects exceeds the number of the programs which can be set (120 programs).			
Remedy (1) When using the multi-programming method, check the PC parameter program settings. - Check the program settings. - Check the program name stored in the NC. - Review the program name and rename it if necessary. e.g. The program name and the M device number in the PLC program are overlapped. - Set the number to 120 or less. (2) When using the independent program method: - Store only one program file. (3) When the multi-project is valid, set the number of programs that can be set to be less than 120 programs as the sum of all projects.			
U10	Illegal PLC	0x26xx.yy	-
Details RET instruction error (1) RET instruction was not executed at the branch destination of the CALL instruction. (2) RET instruction was executed without execution of CALL instruction.			
Remedy Check the following matters for the entire sequence program to be executed. (1) Check if RET instruction is programmed at the end of sub-routine. (2) Check if diverged to the other operation in the middle of sub-routine and RET instruction is not executed. (3) Check if jumped to the END reservation label (P4005) in the middle of sub-routine. (4) Check if there is delimiter (FEND instruction) between adjacent program and sub-routine program.			

U10	Illegal PLC	0x27xx.yy	Step No.
Details Ladder code error (Before executing PLC) An error was found in data for the sequence program to be executed. (1) Disabled PLC instruction is used. (2) Devices/labels are used for indexes in array labels. (3) Sequence program stored in the built-in ROM is broken. (4) Sequence program under development (before writing into the built-in ROM) is broken.			
Remedy (1) Check the sequence programs and delete disabled PLC commands. (2) When devices/labels are used for indexes in array labels, set "#4671/bit1" to "1". (3)(4) Transferring, storing and ROM writing of the sequence program must be re-executed with the GX Developer or PLC onboard edit function.			
U10	Illegal PLC	0x280*	-
Details No main processing ladders (Before executing PLC) Main processing program to be executed cannot be identified. (1) When using the multi-programming method, main processing "scan" is not set in the PC parameter (program setting). (2) When using the independent program method, no reservation ladder for the main processing ladder is available.			
Remedy (1) When using the multi-programming method, check the PC parameter program settings. (2) When using the independent program method, add the reservation label (P4002) for the medium speed ladder.			
U10	Illegal PLC	0x29xx.yy	-
Details Execution area over (Before executing PLC) The total number of steps for the ladder to be executed has exceeded the size of PLC processor execution area.			
Remedy Check the PC parameter (program setting) and set so that the total number of steps for the ladder to be executed does not exceed the PLC processor execution area.			
U10	Illegal PLC	0x30xx.yy	Step No.
Details FOR instruction nesting over 17th level of nesting for FOR instruction was executed.			
Remedy Check the number of FOR instruction's nesting depth in the steps to which the error occurred, and limit the number to 16 or less.			
U10	Illegal PLC	0x31xx.yy	Step No.
Details NEXT instruction error (1) NEXT instruction was executed before FOR instruction. (2) After FOR instruction, END (FEND) was executed before NEXT instruction.			
Remedy (1) Check and correct the NEXT instruction in the step to which the error occurred. (2) Check and correct the ladder circuit of the program to which the error occurred. (Note that the step No. at the error position is displayed as "0".) - Check if JMP, CALL, CJ instructions were executed between FOR and NEXT instruction, and NEXT instruction was jumped. - Check if FOR instruction and NEXT instruction are all paired.			

U10	Illegal PLC	0x32xx.yy	Step No.
Details BREAK instruction error BREAK was executed outside the range between FOR and NEXT instruction.			
Remedy Check and correct the BREAK instruction in the step to which the error occurred.			
U10	Illegal PLC	0x33xx.yy	-
Details Structured ladder error When sequence programs created using structured project are executed.			
Remedy Check if the target sequence program is not created using structured project.			
U10	Illegal PLC	0x34xx.yy	Step No.
Details Data command range error Description of specified device exceeds command range set on each instruction.			
Remedy Check and correct the usage of instructions existing in the steps occurred.			
U10	Illegal PLC	0x35xx.yy	Step No.
Details Real number calculation data error When descriptions of specified device are the following values. <ul style="list-style-type: none"> •Outside the range of the following <ul style="list-style-type: none"> [single float] $2 \text{ to the power of } -126 \leq \text{Specified device} < 2 \text{ to the power of } 128$ [double float] $2 \text{ to the power of } -1022 \leq \text{Specified device} < 2 \text{ to the power of } 1024$ •-0, Denormalized number, Non-number, $\pm \infty$ 			
Remedy Check and correct the usage of instructions existing in the steps occurred.			
U10	Illegal PLC	0x36xx.yy	Step No.
Details Real number calculation data error When the real number calculation result exceeds the following range. <ul style="list-style-type: none"> [single float] Calculation result $< 2 \text{ to the power of } 128$ [double float] Calculation result $< 2 \text{ to the power of } 1024$ 			
Remedy Check and correct the usage of instructions existing in the steps occurred.			
U10	Illegal PLC	0x400*	-
Details PLC system error			
Remedy Contact Mitsubishi Electric.			

U10	Illegal PLC	0x500*	-
Details Maximum project No. illegal (at PLC system startup) Multi-project parameter setting is illegal (due to the following reason). ♦The value outside the setting range (1 to number of usable project) was detected.			
Remedy (1) Check the presence of the expansion project additional specification and reconsider the setting range. (2) The multi-project parameter (maximum project No.) setting is illegal. Set the multi-project parameter again. (3) If (1) or (2) does not solve the problem, there is a possibility that the NC system is broken. Contact Mitsubishi Electric.			
U10	Illegal PLC	0x510*	-
Details Project ratio illegal Multi-project parameter setting is illegal (due to the following reason). ♦It was detected that the total of ratios of all projects was outside the range from 0 to 100.			
Remedy (1) The multi-project parameter (project ratio) setting is illegal. Set the multi- project parameter again. (2) If (1) does not solve the problem, there is a possibility that the NC system is broken. Contact Mitsubishi Electric.			
U10	Illegal PLC	0x520*	-
Details Temporary memory area over (at the PLC system startup) Multi-project parameter setting is illegal (due to the following reason). ♦The ratio to which the area after the project ratio setting is smaller than the size of ladder stored in the temporary memory area was detected.			
Remedy (1) Check the presence of the large-capacity PLC additional specification and reconsider the size that can be stored. (2) The multi-project parameter (project ratio) setting is illegal. Set the multi- project parameter again. (3) If (1) or (2) does not solve the problem, there is a possibility that the NC system is broken. Contact Mitsubishi Electric.			
U10	Illegal PLC	0x530*	-
Details Built-in ROM area over (at the PLC system startup) Multi-project parameter setting is illegal (due to the following reason). ♦The ratio to which the area after the project ratio setting is smaller than the size of ladder stored in the built-in ROM area was detected.			
Remedy (1) Check the presence of the large-capacity PLC additional specification and reconsider the size that can be stored. (2) The multi-project parameter (project ratio) setting is illegal. Set the multi- project parameter again. (3) If (1) or (2) does not solve the problem, there is a possibility that the NC system is broken. Contact Mitsubishi Electric.			

U10	Illegal PLC	0x540*	-
Details Comment area over (at the PLC system startup) Multi-project parameter setting is illegal (due to the following reason). ♦The ratio to which the area after the project ratio setting is smaller than the size of comment and message stored in the built-in ROM area.			
Remedy (1) The multi-project parameter (project ratio) setting is illegal. Set the multi- project parameter again. (2) If (1) does not solve the problem, there is a possibility that the NC system is broken. Contact Mitsubishi Electric.			
U10	Illegal PLC	0x550*	-
Details Execution project illegal (at the PLC system startup) Multi-project parameter setting is illegal (due to the following reasons). ♦The value outside the setting range (ON/OFF) was detected. ♦All execution projects are OFF.			
Remedy (1) The multi-project parameter (execution project) setting is illegal. Set the multi-project parameter again. (2) If (1) does not solve the problem, there is a possibility that the NC system is broken. Contact Mitsubishi Electric.			
U10	Illegal PLC	0x560*	-
Details Project execution order illegal (at the PLC system startup) Multi-project parameter setting is illegal (due to the following reasons). ♦The value outside the setting range (1 to 6) was detected. ♦The redundant project execution order number was detected.			
Remedy (1) The multi-project parameter (project execution order) setting is illegal. Set the multi-project parameter again. (2) If (1) does not solve the problem, there is a possibility that the NC system is broken. Contact Mitsubishi Electric.			
U10	Illegal PLC	0x570*	-
Details Parameter setting illegal for the number of common device points (at PLC system startup) Multi-project parameter setting is illegal (due to the following reasons). ♦The value outside the setting range (0 to the minimum number of points in all projects) was detected. ♦It was detected that the number of points was not a multiple of 16.			
Remedy (1) Check the presence of the expansion project additional specification and reconsider the setting range. (2) The multi-project parameter setting is illegal. Set the multi-project parameter again. (3) If (1) or (2) does not solve the problem, there is a possibility that the NC system is broken. Contact Mitsubishi Electric.			

U10	Illegal PLC	0x580*.yy	-
Details Parameter setting illegal for number of device points (at PLC system startup) The parameter setting for the number of device points is illegal (due to the following reasons). <ul style="list-style-type: none"> ♦The total number of points in one project 29K or more was set. ♦The illegal value (-1 point or less, or 61441 points or more) for the number of device points was detected. ♦It was detected that the number of device points was not a multiple of 16. ♦The number outside the usable number of device points in whole projects was detected. 			
Remedy (1) The parameter setting for the number of device points is illegal. Set the parameter of the number of device points again and reboot the system. (2) If (1) does not solve the problem, there is a possibility that the NC system is broken. Contact Mitsubishi Electric.			
U10	Illegal PLC	0x700*.yy	-
Details Caution; Ladder program writing during RUN is disabled (In independent program method) With RUN write ON, sequence program is operated in independent program method. Run write is not available with this condition.			
Remedy The ladder program writing (RUN write) can not be used in independent program method. Disable RUN write, or change the method into multi-program one.			
U10	Illegal PLC	0x71xx.yy	Step No.
Details Caution; Ladder program writing during RUN is disabled (common pointer is used in high-speed processing) With RUN write is ON, high-speed program with common pointer is running. RUN write is not available with this condition.			
Remedy RUN write is not available when high-speed processing with common pointer is running. Change the high-speed processing program to the one without common pointer.			
U10	Illegal PLC	0x720*	-
Details Caution; Ladder program writing during RUN is disabled (high-speed processing size is exceeding) With RUN write ON, the execution size of high-speed processing program has exceeded 4000 steps. RUN write is not available with this condition.			
Remedy RUN write is not available when execution size of high-speed processing program exceeds 4000 steps. Edit the high-speed processing program to reduce the execution size to 4000 steps or less. (When multi-project is valid, edit the program to reduce the execution size to 4000 steps or less in total of all the project.)			
U10	Illegal PLC	0x730*.yy	-
Details Caution; Ladder program writing during RUN is disabled (number of labels in high-speed processing is beyond the capacity) (*) "Local label" is as "labels of local pointer". With RUN write ON, the number of labels of local pointer in high-speed processing program has exceeded 256. RUN write is not available with this condition.			
Remedy RUN write is not available when the number of labels of local pointer in high-speed processing program exceeds 256. Edit the high-speed program to reduce the number of labels of local pointer to less than 256. (When multi-project is valid, edit the program to reduce the number of labels of local pointer to less than 256 per project.)			

U10	Illegal PLC	0x80xx.yy	Step No.
	Details Software exceptional interruption (BCD instruction error) has occurred. With BCD and DBCD instructions, BIN value outside its input range was attempted to be converted into BCD.		
	Remedy Check the usage of BCD, DBCD instructions existing in the steps occurred.		
U10	Illegal PLC	0x81xx.yy	Step No.
	Details Software exceptional interruption (BIN instruction error) has occurred. With BIN and DBIN instructions, BCD value outside its input range was attempted to be converted into BIN.		
	Remedy Check the usage of BIN, DBIN instructions existing in the steps occurred.		
U10	Illegal PLC	0x82xx.yy	Step No.
	Details Software exceptional interruption (Bus error) has occurred. When the specified device exceeds the range of the device		
	Remedy (1) Check and correct the device range that the instruction in the step of which the error occurred accesses. (2) Contact Mitsubishi Electric.		
U10	Illegal PLC	0x83xx.yy	Step No.
	Details Software exceptional interruption (Unmounted instruction error) has occurred. (1) When the bit selection parameter (#6452 bit6) "branch destination label check valid" is set to "0", jumped to an undefined label. (2) Sequence program in execution is broken.		
	Remedy (1) Set the bit selection parameter (#6452 bit6) "branch destination label check valid" to "1" and check the branching step to the undefined label. (2) Contact Mitsubishi Electric.		
U10	Illegal PLC	0x84xx.yy	Step No.
	Details Software exceptional interruption (Instruction format error) has occurred.		
	Remedy Contact Mitsubishi Electric.		
U10	Illegal PLC	0x85xx.yy	Step No.
	Details Software exceptional interruption (Instruction bus error) has occurred. (1) When the bit selection parameter (#6452 bit6) "branch destination label check valid" is set to "0", jumped to an undefined label. (2) Sequence program in execution is broken.		
	Remedy (1) Set the bit selection parameter (#6452 bit6) "branch destination label check valid" to "1" and check the branching step to the undefined label. (2) Contact Mitsubishi Electric.		
U10	Illegal PLC	0x86xx.yy	Step No.
	Details Software exceptional interruption (CALL/RET instruction error) has occurred.		
	Remedy Contact Mitsubishi Electric.		

U10	Illegal PLC	0x87xx.yy	Step No.
Details Software exceptional interruption (memory area error) has occurred.			
Remedy Contact Mitsubishi Electric.			
U10	Illegal PLC	0x8Bxx.yy	Step No.
Details Software exceptional interruption (ASYNC BUS error) has occurred.			
Remedy Contact Mitsubishi Electric.			
U50	PLC stopped		
Details The ladder is stopped.			
Remedy Run the PLC.			
U55	PLC stopped / is not saved		
Details The ladder is stopped and the edited sequence program is not stored in the built-in ROM. (The contents of temporary memory area and sequence program in the built-in ROM are mismatched.)			
Remedy Run the PLC. Use GX Developer/GX Works2 or the built-in PLC edit function to perform write to the built-in ROM.			
U60	Ladder is not saved		
Details The edited sequence program is not stored in the built-in ROM. (The contents of temporary memory area and sequence program in the built-in ROM are mismatched.)			
Remedy Use GX Developer/GX Works2 or the built-in PLC edit function to perform write to the built-in ROM.			

Network Service Errors (N)

N001	Modem initial error
	Details An error occurred in the modem connection at the power ON. Remedy ♦Check the connection between the NC and modem, connection port and power supply to modem.
N002	Redial over
	Details ♦The number of redials exceeded due to the dial transmission failure. Remedy ♦Wait a while, and then dial again.
N003	TEL unconnect
	Details ♦The phone line is not connected. Remedy ♦Check for any disconnection in the modem's phone line.
N004	Net communication error
	Details ♦An error other than the above occurred during communication. Remedy ♦Note down how the error occurred and contact the service center.
N005	Invalid net communication
	Details ♦The modem connection port is being used for another function such as input/output. ♦The modem connection port settings are incorrect. Remedy ♦Stop using the modem connection port with the other function, and then turn the power ON again. ♦Correct the settings of the modem connection port.
N006	Received result of diagnosis
	Details ♦A diagnosis data file has been received. Remedy ♦Clear the message.
N007	Send data size over
	Details ♦A file larger than Anshin-net server capacity (64Kbyte) has been transmitted in machining data sharing. Remedy ♦Reduce the size of machining program file so that it won't exceed the capacity of Anshin-net server.
N008	No file on server
	Details ♦The file reception failed in machining data sharing because no file exists on Anshin-net server. Remedy ♦Confirm that a machining program file exists on Anshin-net server before receiving it.

N009	Password error
Details <ul style="list-style-type: none">♦The file reception failed in machining data sharing due to a wrong password.	
Remedy <ul style="list-style-type: none">♦Input the password again.	
N010	Customer number error
Details <ul style="list-style-type: none">♦The file reception failed in machining data sharing due to a wrong customer number.	
Remedy <ul style="list-style-type: none">♦Input the customer number again.	
N011	Storage capacity over
Details <ul style="list-style-type: none">♦The file reception failed in machining data sharing because the size of the file to be received is bigger than free space in the NC.	
Remedy <ul style="list-style-type: none">♦Ensure sufficient free space in the NC.	
N012	File deletion error
Details <ul style="list-style-type: none">♦A file on Anshin-net server cannot be deleted in machining data sharing.	
Remedy <ul style="list-style-type: none">♦Confirm that the file exists on Anshin-net server.♦Note down how the error occurred and contact the service center.	

Program Errors (P)

These alarms occur during automatic operation, and the causes of these alarms are mainly program errors which occur, for instance, when mistakes have been made in the preparation of the machining programs or when programs which conform to the specification have not been prepared.

P10	No. of simultaneous axes over	
Details		
The number of axis addresses programmed in a block exceeds the specified maximum.		
Remedy		
<ul style="list-style-type: none"> ♦Divide the command programmed in the block into two blocks. ♦Check the specifications. 		
P11	Illegal axis address	
Details		
The axis address commanded by the program does not match any of the ones set by the parameter.		
Remedy		
<ul style="list-style-type: none"> ♦Correct the axis names in the program. 		
P20	Division error	
Details		
<ul style="list-style-type: none"> ♦The issued axis command cannot be divided by the command unit. ♦A cutting feed command has been issued to the index table indexing axis when the parameter "#2580 index_Gcmd" is set to "1". 		
Remedy		
<ul style="list-style-type: none"> ♦Correct the program. 		
P29	Not accept command	
Details		
The command has been issued when it is impossible.		
<ul style="list-style-type: none"> ♦The normal line control command (G40.1, G41.1, G42.1) has been issued during the modal in which the normal line control is not acceptable. ♦The command has been issued during the modal in which the two-part system simultaneous thread cutting is not acceptable. ♦A workpiece coordinate system preset command (G92.1) has been issued during tool length compensation, nose R compensation or tool radius compensation. 		
Remedy		
<ul style="list-style-type: none"> ♦Correct the program. 		
P29	Not accept command	4
Details		
<ul style="list-style-type: none"> ♦Coordinate system setting command (G92) has been given while tool length offset is temporarily canceled by G53, G28, G30 or G30.1 command. (Note 1) ♦You changed tool length offset with tool length compensation enabled (G43/G44) and then issued a coordinate system setting command (G92) before the offset was reflected. 		
(Note 1) The alarm does not occur if G92 and G53 are put in a block (G92 G53 X0 Y0 Z0;).		
Remedy		
<ul style="list-style-type: none"> ♦Correct the program so that the coordinate system setting command (G92) is given after the tool length offset is properly reflected. 		
P30	Parity H error	
Details		
The number of holes per character on the paper tape is even for EIA code and odd for ISO code.		
Remedy		
<ul style="list-style-type: none"> ♦Check the paper tape. ♦Check the tape puncher and tape reader. 		

P31	Parity V error
Details	
The number of characters per block on the paper tape is odd.	
Remedy	
<ul style="list-style-type: none"> ♦Make the number of characters per block on the paper tape even. ♦Set the parameter parity V selection OFF. 	
P32	Illegal address
Details	
An address not listed in the specifications has been used.	
Remedy	
<ul style="list-style-type: none"> ♦Correct the program address. ♦Correct the parameter settings. ♦Check the specifications. 	
P33	Format error
Details	
The command format in the program is not correct.	
Remedy	
<ul style="list-style-type: none"> ♦Correct the program. 	
P34	Illegal G code
Details	
<ul style="list-style-type: none"> ♦The commanded G code is not in the specifications. 	
An illegal G code was commanded during the coordinate rotation command.	
<ul style="list-style-type: none"> ♦G51.2 or G50.2 was commanded when the rotary tool axis No. (the parameter "#1501polyax") was set to "0". 	
G51.2 or G50.2 was commanded when the tool axis was set to the linear axis (the parameter "#1017 rot" = 0).	
Remedy	
<ul style="list-style-type: none"> ♦Check and correct the G code address in the program. ♦Check the parameter setting values. 	
P35	Setting value range over
Details	
The setting range for the addresses has been exceeded.	
Remedy	
<ul style="list-style-type: none"> ♦Correct the program. 	
P36	Program end error
Details	
"EOR" has been read during tape and memory mode.	
Remedy	
<ul style="list-style-type: none"> ♦Enter the M02 and M30 command at the end of the program. ♦Enter the M99 command at the end of the subprogram. 	
P37	O, N number zero
Details	
"0" has been specified for program or sequence No.	
Remedy	
<ul style="list-style-type: none"> ♦Designate program Nos. within a range from 1 to 99999999. ♦Designate sequence Nos. within a range from 1 to 99999999. 	
P38	No spec: Add. Op block skip
Details	
"/n" has been issued while the optional block skip addition is not in the specifications.	
Remedy	
<ul style="list-style-type: none"> ♦Check the specifications. 	

P39	No specifications
	Details <ul style="list-style-type: none"> •A non-specified G code was commanded. •The selected operation mode is out of the option setting. •The selected operation mode is out of the parameter setting. Remedy <ul style="list-style-type: none"> •Check the specifications. •Check the parameter setting values.
P40	Pre-read block error
	Details <p>When tool radius compensation is executed, there is an error in the pre-read block and so the interference check is disabled.</p> Remedy <ul style="list-style-type: none"> •Reconsider the program.
P45	G code combination error
	Details <p>The combination of G codes in a block is inappropriate. A part of unmodal G codes and modal G codes cannot be commanded in a same block.</p> Remedy <p>Correct the combination of G codes. Separate the incompatible G codes into different blocks.</p>
P46	Cutting command invalid
	Details <p>A travel command other than G00 (positioning) was issued when all the following conditions were met.</p> <ul style="list-style-type: none"> •Parameter "#1247 set19/bit0" (Movement by tool length compensation command) is "1" •Multiple-axis synchronization control is active •Tool length compensation is not yet applied after G43 H** command (without axis position command) Remedy <ul style="list-style-type: none"> •When using tool length compensation during Multiple-axis synchronization control, issue a positioning command (G00) before performing cutting.
P48	Restart pos return incomplete
	Details <p>A travel command was issued before the execution of the block that had been restart-searched.</p> Remedy <ul style="list-style-type: none"> •Carry out program restart again. Travel command cannot be executed before the execution of the block that has been restart-searched.
P49	Invalid restart search
	Details <p>Restart search was attempted for a block that comes after any of the following command blocks: 3-dimensional circular interpolation, cylindrical interpolation, polar coordinate interpolation, milling interpolation, tool center point control, tool cutting point control, simple tool center point control, inclined surface machining, simple inclined surface machining, workpiece installation error compensation, axis name switch, mixed control, sub part system control I, sub part system control II, direct command mode, or arbitrary axis exchange control.</p> Remedy <ul style="list-style-type: none"> •Modify the position for restart search.
P50	No spec: Inch/Metric change
	Details <p>Inch/Metric changeover (G20/G21) command was issued while the function is out of specifications.</p> Remedy <ul style="list-style-type: none"> •Check the specifications.

P60	Compensation length over
Details	
The commanded movement distance is excessive (over 2^{31}).	
Remedy	
•Correct the command range for the axis address.	
P61	No spec: Unidirectional posit.
Details	
Unidirectional positioning (G60) was commanded while the function is out of specifications.	
Remedy	
•Check the specifications.	
P62	No F command
Details	
•No feed rate command has been issued.	
•There is no F command in the cylindrical interpolation or polar coordinate interpolation immediately after the G95 mode is commanded.	
Remedy	
•The default movement modal command at power ON is G01. This causes the machine to move without a G01 command if a movement command is issued in the program, and an alarm results. Use an F command to specify the feed rate.	
•Specify F with a thread lead command.	
P65	No spec: High speed mode 3
Details	
High-speed mode III (G05 P3) was commanded while the function is out of specifications.	
Remedy	
•Check whether the specifications are provided for the high-speed mode III.	
P67	F value is exceeding the limit
Details	
F's value in an F or ",F" command is exceeding the command range.	
Remedy	
•Check and correct F or ",F" command in the program.	
P70	Arc end point deviation large
Details	
•There is an error in the arc start and end points as well as in the arc center.	
•The difference of the involute curve through the start point and the end point is large.	
•When arc was commanded, one of the two axes configuring the arc plane was a scaling valid axis.	
Remedy	
•Correct the numerical values of the addresses that specify the start and end points, arc center as well as the radius in the program.	
•Correct the "+" and "-" directions of the address numerical values.	
•Check for the scaling valid axis.	
P71	Arc center error
Details	
•An arc center cannot be obtained in R-specified circular interpolation.	
•A curvature center of the involute curve cannot be obtained.	
Remedy	
•Correct the numerical values of the addresses in the program.	
•Correct the start and end points if they are inside of the base circle for involute interpolation. When carrying out tool radius compensation, make sure that the start and end points after compensation will not be inside of the base circle for involute interpolation.	
•Correct the start and end points if they are at an even distance from the center of the base circle for involute interpolation.	

P72	No spec: Helical cutting
Details	
A helical command has been issued though it is out of specifications.	
Remedy	
<ul style="list-style-type: none"> •Check whether the specifications are provided for the helical cutting. •An Axis 3 command has been issued by the circular interpolation command. If there is no helical specification, move the linear axis to the next block. 	
P73	No spec: Spiral cutting
Details	
A spiral command was issued though it is out of specifications.	
Remedy	
<ul style="list-style-type: none"> •Issue the G02.1 and G03.1 commands for circular interpolation. •Check whether the specifications are provided for the spiral cutting. 	
P74	Can't calculate 3DIM arc
Details	
The 3-dimension circular cannot be obtained because the end block was not specified during 3-dimension circular interpolation supplementary modal.	
The 3-dimension circular cannot be obtained due to an interruption during 3-dimension circular interpolation supplementary modal.	
Remedy	
<ul style="list-style-type: none"> •Correct the program. 	
P75	3DIM arc illegal
Details	
An illegal G code was issued during 3-dimension circular interpolation modal.	
Otherwise, 3-dimension circular interpolation command was issued during a modal for which a 3-dimension circular interpolation command cannot be issued.	
Remedy	
<ul style="list-style-type: none"> •Correct the program. 	
P76	No spec: 3DIM arc interpolat
Details	
G02.4/G03.4 was commanded though there is no 3-dimension circular interpolation specification.	
Remedy	
<ul style="list-style-type: none"> •Check the specifications. 	
P90	No spec: Thread cutting
Details	
A thread cutting command was issued though it is out of specifications.	
Remedy	
<ul style="list-style-type: none"> •Check the specifications. 	
P93	Illegal pitch vaule
Details	
An illegal thread lead (thread pitch) was specified at the thread cutting command.	
Remedy	
<ul style="list-style-type: none"> •Correct the thread lead for the thread cutting command. 	
P100	No spec: Cylindric interpolat
Details	
A cylindrical interpolation command was issued though it is out of specifications.	
Remedy	
<ul style="list-style-type: none"> •Check the specifications. 	

P110	Plane select during figure rot
Details	
Plane selection (G17/G18/G19) was commanded during figure rotation.	
Remedy	
♦Correct the machining program.	
P111	Plane selected while coord rot
Details	
Plane selection commands (G17, G18, G19) were issued during a coordinate rotation was being commanded.	
Remedy	
♦Always command coordinate rotation cancel after the coordinate rotation command, and then issue a plane selection command.	
P112	Plane selected while R compen
Details	
♦Plane selection commands (G17, G18, G19) were issued while tool radius compensation (G41, G42) and nose R compensation (G41, G42, G46) commands were being issued.	
♦Plane selection commands were issued after completing nose R compensation commands when there were no further axis movement commands after G40, and compensation has not been cancelled.	
Remedy	
♦Issue plane selection commands after completing (axis movement commands issued after G40 cancel command) tool radius compensation and nose R compensation commands.	
P113	Illegal plane select
Details	
The circular command axis does not correspond to the selected plane.	
Remedy	
♦Select a correct plane before issuing a circular command.	
P114	Plane axis command error
Details	
♦The axis specified in the fixed cycle for turning machining does not coincide with the selected plane.	
♦One or both of the selected plane axes have no travel when the fixed cycle for turning machining is commanded.	
Remedy	
♦Correct the plane selection before issuing the fixed cycle for turning machining.	
♦Correct the program so that the two axes of the selected plane are involved in the movement of the fixed cycle for turning machining.	
P120	No spec: Feed per rotation
Details	
Feed per rotation (G95) was commanded though it is out of specifications.	
Remedy	
♦Check the specifications.	
P121	F0 command during arc modal
Details	
F0 (F 1-digit feed) was commanded during the arc modal (G02/G03).	
Remedy	
♦Correct the machining program.	
P122	No spec: Auto corner override
Details	
An auto corner override command (G62) was issued though it is out of specifications.	
Remedy	
♦Check the specifications.	
♦Delete the G62 command from the program.	

P123	No spec: High-accuracy control
	Details High-accuracy control command was issued though it is out of specifications. Remedy <ul style="list-style-type: none"> •Check the specifications.
P124	No spec: Inverse time feed
	Details <ul style="list-style-type: none"> •The inverse time option is not provided. Remedy <ul style="list-style-type: none"> •Check the specifications.
P125	G93 mode error
	Details <ul style="list-style-type: none"> •The issued G code command is illegal during G93 mode. •G93 command was issued during a modal for which inverse time feed cannot be performed. Remedy <ul style="list-style-type: none"> •Correct the program.
P126	Invalid cmdn in high-accuracy
	Details An illegal command was issued during the high-accuracy control mode. <ul style="list-style-type: none"> •A G code group 13 command was issued during the high-accuracy control mode. •Milling, cylindrical interpolation or polar coordinate interpolation was commanded during the high-accuracy control mode. Remedy <ul style="list-style-type: none"> •Correct the program.
P127	No spec: SSS Control
	Details The SSS control valid parameter has been set although there is no SSS control specification. Remedy <ul style="list-style-type: none"> •Check the specifications. Set "#8090 SSS ON" to "0" when there is no SSS control specification.
P128	Machin condtn select I disable
	Details Machining condition selection I was commanded during the mode where the selection command is unavailable. Remedy <ul style="list-style-type: none"> •Check the program and see whether any unavailable mode is included during machining condition selection I. If any, cancel that mode.
P129	Hi-speed Hi-accuracy both ON
	Details Both the high-accuracy control mode and high-speed machining mode are commanded simultaneously in a part system where the simultaneous use of the two modes is disabled. Remedy <ul style="list-style-type: none"> •Correct the setting of "#8040 High-speed high-accuracy control-enabled part system". •Correct the machining program so that the high-accuracy control mode is not used together with high-speed machining mode.
P130	2nd M function code illegal
	Details The 2nd miscellaneous function address, commanded in the program, differs from the address set in the parameters. Remedy <ul style="list-style-type: none"> •Correct the 2nd miscellaneous function address in the program.

P131	No spec: Cnst surface ctrl G96
Details A constant surface speed control command (G96) was issued though it is out of specifications.	
Remedy <ul style="list-style-type: none"> •Check the specifications. •Issue a rotation speed command (G97) instead of the constant surface speed control command (G96). 	
P132	Spindle rotation speed S=0
Details No spindle rotation speed command has been issued.	
Remedy <ul style="list-style-type: none"> •Correct the program. 	
P133	Illegal P-No. G96
Details The illegal No. was specified for the constant surface speed control axis.	
Remedy <ul style="list-style-type: none"> •Correct the parameter settings and program that specify the constant surface speed control axis. 	
P134	G96 Clamp Err.
Details The constant surface speed control command (G96) was issued without commanding the spindle speed clamp (G92/G50).	
Remedy Press the reset key and carry out the remedy below. <ul style="list-style-type: none"> •Check the program. •Issue the G92/G50 command before the G96 command. •Command the constant surface speed cancel (G97) to switch to the rotation speed command. 	
P135	Spindle select command illegal
Details This program error is generated in Multiple-spindle Control I. This alarm is generated when spindle selection by address P is valid ("#1300 ext36/bit4" is "1") and either when: <ul style="list-style-type: none"> •There is no "P" address in combination with address S, M3, M4 or M5, while parameter "#1297 ext33/bit0" is "0"; •A spindle not defined by parameter "#3199 spCode" is specified; •An address not allowed in the same block with a "P" address is programmed; •The same spindle code has been set for some spindles with parameter "#3199 spCode". 	
Remedy <ul style="list-style-type: none"> •Check the program. •Check the parameter. 	
P140	No spec: Pos compen cmd
Details The position compensation command (G45 to G48) is out of specifications.	
Remedy <ul style="list-style-type: none"> •Check the specifications. 	
P141	Pos compen during rotation
Details Position compensation was commanded during the figure rotation or coordinate rotation command.	
Remedy <ul style="list-style-type: none"> •Correct the program. 	

P142	Pos compen invalid arc
	Details Position compensation cannot be executed with the issued arc command.
	Remedy <ul style="list-style-type: none"> •Correct the program.
P150	No spec: Nose R compensation
	Details <ul style="list-style-type: none"> •Tool radius compensation commands (G41 and G42) were issued though they are out of specifications. •Nose R compensation commands (G41, G42, and G46) were issued though they are out of specifications.
	Remedy <ul style="list-style-type: none"> •Check the specifications.
P151	Radius compen during arc mode
	Details A compensation command (G40, G41, G42, G43, G44, or G46) has been issued in the arc modal (G02 or G03).
	Remedy <ul style="list-style-type: none"> •Issue the linear command (G01) or rapid traverse command (G00) in the compensation command block or cancel block. (Set the modal to linear interpolation.)
P152	No intersection
	Details <ul style="list-style-type: none"> •In interference block processing during execution of a tool radius compensation (G41 or G42) or nose R compensation (G41, G42, or G46) command, the intersection point after one block is skipped cannot be determined. •The 3-dimensional tool radius compensation value (tool vertical direction compensation) (G41.2 or G42.2) cannot be determined.
	Remedy <ul style="list-style-type: none"> •Correct the program.
P153	Compensation interference
	Details An interference error has occurred while the tool radius compensation command (G41 or G42) or nose R compensation command (G41, G42 or G46) was being executed.
	Remedy <ul style="list-style-type: none"> •Correct the program.
P154	No spec: 3D compensation
	Details A three-dimensional compensation command was issued though it is out of specifications.
	Remedy <ul style="list-style-type: none"> •Check the specifications.
P155	Fixed cyc exec during compen
	Details A fixed cycle command has been issued in the radius compensation mode.
	Remedy <ul style="list-style-type: none"> •Issue a radius compensation cancel command (G40) to cancel the radius compensation mode that has been applied since the fixed cycle command was issued.
P156	R compen direction not defined
	Details A shift vector with undefined compensation direction was found at the start of G46 nose R compensation.
	Remedy <ul style="list-style-type: none"> •Change the vector to that which has the defined compensation direction. •Change the tool to that which has a different tip point No.

P157	R compen direction changed
Details	
During G46 nose R compensation, the compensation direction is reversed.	
Remedy	
<ul style="list-style-type: none"> •Change the G command to that which allows the reversed compensation direction (G00, G28, G30, G33, or G53). •Change the tool to that which has a different tip point No. •Enable "#8106 G46 NO REV-ERR". 	
P158	Illegal tip point
Details	
An illegal tip point No. (other than 1 to 8) was found during G46 nose R compensation.	
Remedy	
<ul style="list-style-type: none"> •Correct the tip point No. 	
P161	No spec: 3D tool R comp
Details	
3-dimensional tool radius compensation (tool vertical direction compensation) is not included in the specifications.	
Remedy	
<ul style="list-style-type: none"> •Check the specifications. 	
P162	Disable Cmd in 3D tool R comp
Details	
A command (G or T command, etc.) was issued during 3-dimensional tool radius compensation (tool vertical direction compensation), although it is disabled during the compensation.	
Remedy	
<ul style="list-style-type: none"> •Cancel 3-dimensional tool radius compensation (tool vertical direction compensation). 	
P163	3D tool R comp is disabled
Details	
3-dimensional tool radius compensation (tool vertical direction compensation) was commanded in a mode where the command is disabled.	
Remedy	
<ul style="list-style-type: none"> •Cancel the mode that disables the command. 	
P169	Tool offset amount zero
Details	
The offset amount designated with the compensation No. (D** or H**) in a compensation command (*1) is set to zero.	
(*1) Compensation command means the followings:	
<ul style="list-style-type: none"> •Tool radius compensation (G41, G42, G41.2, G42.2, G43.8, G43.9), the address D •Tool length compensation (G43, G44, G43.1, G43.4, G43.5, G43.7, G43.8, G43.9), the address H •Tool position compensation (G45, G46, G47, G48), the address D 	
Remedy	
<ul style="list-style-type: none"> •Check the offset amount of the compensation No. •Correct the program. 	

P170	No offset number
Details •No compensation No. (DOO, TOO or HOO) command was given when the radius compensation (G41, G42, G43 or G46) command was issued. Otherwise, the compensation No. is larger than the number of sets in the specifications. •H99 or D99 is commanded with the parameter "#1227 aux11/bit1" enabled when the length compensation method and radius compensation method are set to "1" or "2" for the M system tool life management II.	
Remedy •Add the compensation No. command to the compensation command block. •Check the number of sets for the tool compensation Nos. and correct the compensation No. command to be within the number of sets. •H99 and D99 commands cannot be used when the length compensation method and radius compensation are set to "1" or "2". Set the length compensation method and radius compensation method to "0".	
P171	No spec:Comp input by prog G10
Details Compensation data input by program (G10) was commanded though it is out of specifications.	
Remedy •Check the specifications.	
P172	G10 L number error
Details An address of G10 command is not correct.	
Remedy •Correct the address L No. of the G10 command.	
P173	G10 P number error
Details The compensation No. at the G10 command is not within the permitted number of sets in the specifications.	
Remedy •Check the number of sets for the tool compensation Nos. and correct the address P designation to be within the number of sets.	
P174	No spec:Comp input by prog G11
Details Compensation data input by program cancel (G11) was commanded though there is no specification of compensation data input by program.	
Remedy •Check the specifications.	
P177	Tool life count active
Details Registration of tool life management data with G10 was attempted when the "usage data count valid" signal was ON.	
Remedy •The tool life management data cannot be registered during the usage data count. Turn the "usage data count valid" signal OFF.	
P178	Tool life data entry over
Details The number of registration groups, total number of registered tools or the number of registrations per group exceeded the range in the specifications.	
Remedy •Correct the number of registrations.	

P179	Illegal group No.
Details <ul style="list-style-type: none"> ♦A duplicate group No. was found at the registration of the tool life management data with G10. ♦A group No. that was not registered was designated during the T****99 command. ♦An M code command, which must be issued as a single command, coexists in the same block as that of another M code command. ♦The M code commands set in the same group exist in the same block. Remedy <ul style="list-style-type: none"> ♦Register the estimated tool life data/cumulative usage data once for one group: commanding with a duplicate group No. is not allowed. ♦Correct to the group No. 	
P180	No spec: Drilling cycle
Details <p>A fixed cycle command (G72 - G89) was issued though it is out of specifications.</p> Remedy <ul style="list-style-type: none"> ♦Check the specifications. ♦Correct the program. 	
P181	No spindle command (Tap cycle)
Details <p>Spindle rotation speed (S) has not been commanded in synchronous tapping.</p> Remedy <ul style="list-style-type: none"> ♦Command the spindle rotation speed (S) in synchronous tapping. ♦When "#8125 Check Scode in G84" is set to "1", enter the S command in the same block where the synchronous tapping command is issued. 	
P182	Synchronous tap error
Details <ul style="list-style-type: none"> ♦Connection to the main spindle unit was not established. ♦The synchronous tapping was attempted with the spindle not serially connected under the multiple-spindle control I. ♦Synchronous tapping command was given to the analog spindle while analog spindle synchronous tapping was unavailable. ♦Punch Tap cycle command was given with no-load operation mode during manual arbitrary reverse run mode. Remedy <ul style="list-style-type: none"> ♦Check connection to the main spindle. ♦Check that the main spindle encoder exists. ♦Set 1 to the parameter #3024 (sout). ♦Correct the program. ♦Enable actual cutting mode to command Punch Tap cycle with manual arbitrary reverse run mode. 	
P183	No pitch/thread number
Details <p>The pitch or number of threads has not been commanded in the tap cycle of a fixed cycle for drilling command.</p> Remedy <ul style="list-style-type: none"> ♦Specify the pitch data and the number of threads by F or E command. 	
P184	Pitch/thread number error
Details <ul style="list-style-type: none"> ♦The pitch or the number of threads per inch is illegal in the tap cycle of the fixed cycle for drilling command. ♦The pitch is too small for the spindle rotation speed. ♦The thread number is too large for the spindle rotation speed. Remedy <ul style="list-style-type: none"> ♦Correct the pitch or the number of threads per inch. 	

P185	No spec: Sync tapping cycle
	<p>Details</p> <p>Synchronous tapping cycle (G84/G74) was commanded though it is out of specifications.</p> <p>Remedy</p> <ul style="list-style-type: none"> • Check the specifications.
P186	Illegal S cmdnd in synchro tap
	<p>Details</p> <p>S command was issued during synchronous tapping modal.</p> <p>Remedy</p> <ul style="list-style-type: none"> • Cancel the synchronous tapping before issuing the S command.
P188	Hole edge chamfering invalid
	<p>Details</p> <p>A G185 command was issued when one of the following conditions was true, which disables a hole edge chamfering command.</p> <ul style="list-style-type: none"> • The selected plane is not G19 plane. • The configuration of parameters "#1026 base_I" through "#1031 aux_K" is one that does not allow hole edge chamfering cycle. • The "Longitudinal hole drilling axis selection" signal (YCD4) is ON. • The axis name switch (G111) modal is active. <p>Remedy</p> <ul style="list-style-type: none"> • Ensure that G19 plane is selected when G185 is issued. • Turn off the "Longitudinal hole drilling axis selection" signal (YCD4). • Cancel axis name switch (G111) before issuing G185.
P190	No spec: Turning cycle
	<p>Details</p> <p>A lathe cutting cycle command was issued though it is out of specifications.</p> <p>Remedy</p> <ul style="list-style-type: none"> • Check the specification. • Delete the lathe cutting cycle command.
P191	Taper length error
	<p>Details</p> <p>In the lathe cutting cycle, the specified length of taper section is illegal.</p> <p>Remedy</p> <ul style="list-style-type: none"> • Set the smaller radius value than the axis travel amount in the lathe cycle command.
P192	Chamfering error
	<p>Details</p> <p>Chamfering in the thread cutting cycle is illegal.</p> <p>Remedy</p> <ul style="list-style-type: none"> • Set a chamfering amount not exceeding the cycle.
P199	Tool selection is incorrect
	<p>Details</p> <p>A turning tool shape compensation was commanded while a tool other than turning tool has been selected.</p> <p>Remedy</p> <ul style="list-style-type: none"> • Select "Lathing" for tool type in tool management data before giving the turning tool shape compensation command.
P200	No spec: MRC cycle
	<p>Details</p> <p>The compound type fixed cycle for turning machining I (G70 to G73) was commanded though it is out of specifications.</p> <p>Remedy</p> <ul style="list-style-type: none"> • Check the specifications.

P201	Program error (MRC)
Details <ul style="list-style-type: none"> ♦The subprogram, called with a compound type fixed cycle for turning machining I command, has at least one of the following commands: reference position return command (G27, G28, G29, G30); thread cutting (G33, G34); fixed cycle skip-function (G31, G31.n). ♦An arc command was found in the first movement block of the finished shape program in compound type fixed cycle for turning machining I. Remedy <ul style="list-style-type: none"> ♦Delete G27, G28, G29, G30, G31, G33, G34, and fixed cycle G codes from the subprogram called with the compound type fixed cycle for turning machining I commands (G70 to G73). ♦Delete G02 and G03 from the first movement block of the finished shape program in compound type fixed cycle for turning machining I. 	
P202	Block over (MRC)
Details <p>The number of blocks in the shape program of the compound type fixed cycle for turning machining I is over 50 or 200 (the maximum number differs according to the model).</p> Remedy <ul style="list-style-type: none"> ♦Set a 50/200 or less value for the number of blocks in the shape program called by the compound type fixed cycle for turning machining I commands (G70 to G73). (The maximum number differs according to the model). 	
P203	D cmnd figure error (MRC)
Details <p>A proper shape will not be obtained by executing the shape program for the compound type fixed cycle for turning machining I (G70 to G73).</p> Remedy <ul style="list-style-type: none"> ♦Correct the shape program for the compound type fixed cycle for turning machining I (G70 to G73). 	
P204	E cmnd fixed cycle error
Details <p>A command value of the compound type fixed cycle for turning machining (G70 to G76) is illegal.</p> Remedy <ul style="list-style-type: none"> ♦Correct the command value of the compound type fixed cycle for turning machining (G70 to G76). 	
P210	No spec: Pattern cycle
Details <p>A compound type fixed cycle for turning machining II (G74 to G76) command was commanded though it is out of specifications.</p> Remedy <ul style="list-style-type: none"> ♦Check the specifications. 	
P220	No spec: Special fixed cycle
Details <p>There are no special fixed cycle specifications.</p> Remedy <ul style="list-style-type: none"> ♦Check the specifications. 	
P221	No. of special fixed holes = 0
Details <p>"0" has been specified for the number of holes in special fixed cycle mode.</p> Remedy <ul style="list-style-type: none"> ♦Correct the program. 	
P222	G36 angle error
Details <p>A G36 command specifies "0" for angle intervals.</p> Remedy <ul style="list-style-type: none"> ♦Correct the program. 	

P223	G12/G13 radius error
Details	
The radius value specified with a G12 or G13 command is below the compensation amount.	
Remedy	
♦Correct the program.	
P224	No spec: Circular (G12/G13)
Details	
There are no circular cutting specifications.	
Remedy	
♦Check the specifications.	
P225	Illegal character input
Details	
♦Illegal character string was commanded during character string input.	
♦Word count exceeded the command range during character string input.	
Remedy	
♦Correct character string.	
Sub error number indicates which character is causing the alarm.	
If the word count exceeds the command range, sub error number will be "0".	
P229	Illegal arc rad. of engraving
Details	
The diameter of arc for the text is smaller than half the character height or than the character spacing.	
Remedy	
♦Correct the values programmed with the addresses H, I, J and L.	
P230	Subprogram nesting over
Details	
Over 10 times of subprogram calls have been done in succession from a subprogram.	
♦A M198 command was found in the program in the data server.	
Remedy	
♦Correct the program so that the number of subprogram calls does not exceed 10 times.	
P231	No sequence No.
Details	
The sequence No., commanded at the return from the subprogram or by GOTO in the subprogram call, was not set.	
Remedy	
♦Specify the sequence Nos. in the call block of the subprogram.	
P232	No program No.
Details	
♦The machining program has not been found when the machining program is called.	
Remedy	
♦Enter the machining program.	
♦Check the subprogram storage destination parameters.	
♦Ensure that the external device (including SD card/USB memory) that contains the file is mounted.	
P235	Program editing
Details	
Operation was attempted for the file under program editing.	
Remedy	
♦Execute the program again after completion of program editing.	

P240	No spec: Variable commands
Details A variable command (with #) was issued though it is out of specifications.	
Remedy •Check the specifications.	
P241	No variable No.
Details The variable No. commanded is out of the range specified in the specifications.	
Remedy •Check the specifications. •Correct the program variable No.	
P242	= not defined at vrble set
Details The "=" sign has not been commanded when a variable is defined.	
Remedy •Designate the "=" sign in the variable definition of the program.	
P243	Can't use variables
Details •An invalid variable has been specified in the left or right side of an operation expression. •Assignment to a write-protected variable has been commanded.	
Remedy •Correct the program.	
P244	Invalid set date or time
Details Date or time was set earlier than current date or time in the system variables (#3011, #3012) when the system lock was valid.	
Remedy •Date or time cannot be changed. •Correct the program.	
P245	Tool No. error
Details •Tool data read/write command has been executed without selecting the tool command method. •Tool command method (#68000) or tool selection No. (#68001) is incorrect. (1) The tool specified as "Tool in use" is not installed. (2) Any unregistered tool No. has been designated. (3) Tool selection No. (#68001) has not been designated. •Write of "Tool No." has been commanded using #68001 while tool No. is being designated. •Write of "Tool No." has been commanded for an already registered tool No.	
Remedy •Check the program to make sure that the tool command method (#68000) and tool selection No. (#68001) are correct. •Make sure, if you wish to designate a tool in use, that the said tool No. is nonzero and is already registered on the tool management screen. •Make sure, if you wish to designate a tool No., that the tool No. registered on the tool management screen has been commanded using #68001. •#68001 is unable to write the same tool No. as that already registered on the tool management screen.	
P246	Ext common var file not found
Details The extended common variable data file for the specified number does not exist.	
Remedy •Correct the extended common variable data file number in the machining program. •Ensure that an SD card is inserted.	

P247	Ext common var file not loaded
Details	
Extended common variable data file is not loaded.	
Remedy	
<ul style="list-style-type: none"> ♦Load the extended common variable data file. ♦Ensure that an SD card is inserted. 	
P248	Ext com vrble file load invld
Details	
Extended common variable data file cannot be loaded, because the number of real/integer data in the file is different from the number of real/integer data set in the parameter.	
Remedy	
<ul style="list-style-type: none"> ♦Load the extended common variable data file with the same allocation as the number of real/integer data set in the parameter. 	
P249	Position data unreadable
Details	
An attempt was made to pre-read a system variable (position data) that cannot be read during travel without waiting for the end point of the previous block to be reached.	
Remedy	
<ul style="list-style-type: none"> ♦Use position data that can be pre-read. ♦Program the reading of the system variable (position data) and a travel command in separate blocks. 	
P250	No spec: Figure rotation
Details	
Figure rotation (M98 I_J_P_H_L_) was commanded though it is out of specifications.	
Remedy	
<ul style="list-style-type: none"> ♦Check the specifications. 	
P251	Figure rotation overlapped
Details	
Figure rotation command was issued during figure rotation.	
Remedy	
<ul style="list-style-type: none"> ♦Correct the program. 	
P252	Coord rotate in fig. rotation
Details	
A coordinate rotation related command (G68, G69) was issued during figure rotation.	
Remedy	
<ul style="list-style-type: none"> ♦Correct the program. 	
P260	No spec: Coordinates rotation
Details	
A coordinate rotation command was issued though it is out of specifications.	
Remedy	
<ul style="list-style-type: none"> ♦Check the specifications. 	
P261	G code illegal (Coord rot)
Details	
Another G code or a T command has been issued in the block of coordinate rotation command.	
Remedy	
<ul style="list-style-type: none"> ♦Correct the program. 	

P262	Illegal modal (Coord rot)
Details	
A coordinate rotation command has been issued during modal in which coordinate rotation is not allowed.	
Remedy	
♦Correct the program.	
P270	No spec: User macro
Details	
A macro specification was commanded though it is out of specifications.	
Remedy	
♦Check the specifications.	
P271	No spec: Macro interrupt
Details	
A macro interruption command has been issued though it is out of specifications.	
Remedy	
♦Check the specifications.	
P272	NC and macro texts in a block
Details	
An executable statement and a macro statement exist together in the same block.	
Remedy	
♦Place the executable statement and macro statement in separate blocks in the program.	
P273	Macro call nesting over
Details	
The number of macro call nests exceeded the limit imposed by the specifications.	
Remedy	
♦Correct the program so that the macro calls do not exceed the limit imposed by the specifications.	
P275	Macro argument over
Details	
The number of argument sets in the macro call argument type II has exceeded the limit.	
Remedy	
♦Correct the program.	
P276	Illegal G67 command
Details	
A G67 command was issued though it was not during the G66 command modal.	
Remedy	
♦Correct the program.	
♦Issue G66 command before G67 command, which is a call cancel command.	
P277	Macro alarm message
Details	
An alarm command has been issued in #3000.	
Remedy	
♦Refer to the operator messages on the diagnosis screen.	
♦Refer to the instruction manual issued by the machine tool builder.	
P280	Brackets [] nesting over
Details	
Over five times have the parentheses "[" or "]" been used in a single block.	
Remedy	
♦Correct the program so that the number of "[" or "]" is five or less.	

P281	Brackets [] not paired
	<p>Details</p> <p>A single block does not have the same number of commanded parentheses "[" as that of "]".</p> <p>Remedy</p> <ul style="list-style-type: none"> •Correct the program so that "[" and "]" parentheses are paired up properly.
P282	Calculation impossible
	<p>Details</p> <p>The arithmetic formula is incorrect.</p> <p>Remedy</p> <ul style="list-style-type: none"> •Correct the formula in the program.
P283	Divided by zero
	<p>Details</p> <p>The denominator of the division is zero.</p> <p>Remedy</p> <ul style="list-style-type: none"> •Correct the program so that the denominator for division in the formula is not zero.
P288	IF EXCESS
	<p>Details</p> <p>The multiplicity of the IF statement exceeded 10 times.</p> <p>Remedy</p> <ul style="list-style-type: none"> •The program is reviewed so that the multiplicity of the IF statement does not exceed 10 times.
P289	IF-ENDIF MMC.
	<p>Details</p> <p>IF and ENDIF are not in pairs. THEN/ELSE is ordered in the absence of IF command.</p> <p>Remedy</p> <ul style="list-style-type: none"> •The program is reviewed so that IF and ENDIF become pairs. •Before THEN/ELSE command, IF[<conditional expression>]command is given.
P290	IF sentence error
	<p>Details</p> <p>There is an error in the "IF[<conditional>]GOTO(" statement.</p> <p>Remedy</p> <ul style="list-style-type: none"> •Correct the program.
P291	WHILE sentence error
	<p>Details</p> <p>There is an error in the "WHILE[<conditional>]DO(-END(" statement.</p> <p>Remedy</p> <ul style="list-style-type: none"> •Correct the program.
P292	SETVN sentence error
	<p>Details</p> <p>There is an error in the "SETVN(" statement when the variable name setting was made.</p> <p>Remedy</p> <ul style="list-style-type: none"> •Correct the program. •The number of characters in the variable name of the SETVN statement must be 7 or less.
P293	DO-END nesting over
	<p>Details</p> <p>The number of DO-END nesting levels in the "WHILE[<conditional>]DO(-END(" statement has exceeded 27.</p> <p>Remedy</p> <ul style="list-style-type: none"> •Correct the program so that the nesting levels of the DO-END statement does not exceed 27.

P294	DO and END not paired
	<p>Details</p> <p>The DOs and ENDS are not paired off properly.</p> <p>Remedy</p> <ul style="list-style-type: none"> ♦Correct the program so that the DOs and ENDS are paired off properly.
P295	WHILE/GOTO in tape
	<p>Details</p> <p>There is a WHILE or GOTO statement on the tape during tape operation.</p> <p>Remedy</p> <ul style="list-style-type: none"> ♦Apply memory mode operation instead of tape mode that does not allow the execution of the program with a WHILE or GOTO statement.
P296	No address (macro)
	<p>Details</p> <p>A required address has not been specified in the user macro.</p> <p>Remedy</p> <ul style="list-style-type: none"> ♦Correct the program.
P297	Address-A error
	<p>Details</p> <p>The user macro does not use address A as a variable.</p> <p>Remedy</p> <ul style="list-style-type: none"> ♦Correct the program.
P298	G200-G202 cmnd in tape
	<p>Details</p> <p>User macro G200, G201, or G202 was specified during tape or MDI mode.</p> <p>Remedy</p> <ul style="list-style-type: none"> ♦Correct the program.
P300	Variable name illegal
	<p>Details</p> <p>The variable names have not been commanded properly.</p> <p>Remedy</p> <ul style="list-style-type: none"> ♦Correct the variable names in the program.
P301	Variable name duplicated
	<p>Details</p> <p>A duplicate variable name was found.</p> <p>Remedy</p> <ul style="list-style-type: none"> ♦Correct the program so that no duplicate name exists.
P310	Not use GMSTB macro code
	<p>Details</p> <p>G, M, S, T, or B macro code was called during fixed cycle.</p> <p>Remedy</p> <ul style="list-style-type: none"> ♦Correct the program. ♦Correct the parameter settings.
P350	No spec: Scaling command
	<p>Details</p> <p>The scaling command (G50, G51) was issued though it is out of specifications.</p> <p>Remedy</p> <ul style="list-style-type: none"> ♦Check the specifications.

P360	No spec: Program mirror
Details A mirror image command (G50.1 or G51.1) has been issued though the programmable mirror image specifications are not provided.	
Remedy •Check the specifications.	
P370	No spec: Facing t-post MR
Details The facing turret mirror image specifications are not provided.	
Remedy •Check the specifications.	
P371	Facing t-post MR illegal
Details •Mirror image for facing tool posts was commanded to an axis in external mirror image or parameter mirror image. •The commanded mirror image for facing tool posts enables the mirror image for a rotary axis.	
Remedy •Correct the program. •Correct the parameter settings.	
P380	No spec: Corner R/C
Details The corner R/C was issued though it is out of specifications.	
Remedy •Check the specifications. •Delete the corner chamfering/corner rounding command in the program.	
P381	No spec: Arc R/C
Details Corner chamfering II or corner rounding II was commanded in the arc interpolation block though it is out of specifications.	
Remedy •Check the specifications.	
P382	No corner movement
Details The block next to corner chamfering/ corner rounding is not a travel command.	
Remedy •Replace the block succeeding the corner chamfering/ corner rounding command by G01 command.	
P383	Corner movement short
Details The travel distance in the corner chamfering/corner rounding command was shorter than the value in the corner chamfering/corner rounding command.	
Remedy •Set the smaller value for the corner chamfering/corner rounding than the travel distance.	
P384	Corner next movement short
Details The travel distance in the following block in the corner chamfering/corner rounding command was shorter than the value in the corner chamfering/corner rounding command.	
Remedy •Set the smaller value for the corner chamfering/corner rounding than the travel distance in the following block.	

P385	Corner during G00/G33
	Details A block with corner chamfering/corner rounding was given during G00 or G33 modal. Remedy •Correct the program.
P390	No spec: Geometric
	Details A geometric command was issued though it is out of specifications. Remedy •Check the specifications.
P391	No spec: Geometric arc
	Details There are no geometric IB specifications. Remedy •Check the specifications.
P392	Angle < 1 degree (GEOMT)
	Details The angular difference between the geometric line and line is 1° or less. Remedy •Correct the geometric angle.
P393	Inc value in 2nd block (GEOMT)
	Details The second geometric block has a command with an incremental value. Remedy •Issue a command with an absolute value in the second geometric block.
P394	No linear move command (GEOMT)
	Details The second geometric block contains no linear command. Remedy •Issue the G01 command.
P395	Illegal address (GEOMT)
	Details The geometric format is invalid. Remedy •Correct the program.
P396	Plane selected in GEOMT ctrl
	Details A plane switching command was issued during geometric command processing. Remedy •Complete the plane switching command before geometric command processing.
P397	Arc error (GEOMT)
	Details In geometric IB, the arc end point does not contact or intersect the start point of the next block. Remedy •Correct the first and second commands containing a circular arc command for geometric.

P398	No spec: Geometric1B
Details A geometric command was issued though the geometric 1B specifications are not provided.	
Remedy <ul style="list-style-type: none"> •Check the specifications. 	
P411	Illegal modal G111
Details <ul style="list-style-type: none"> •G111 was issued during milling mode. •G111 was issued during nose R compensation mode. •G111 was issued during constant surface speed. •G111 was issued during mixed control (cross axis control). •G111 was issued during fixed cycle. •G111 was issued during polar coordinate interpolation. •G111 was issued during cylindrical interpolation mode. 	
Remedy <ul style="list-style-type: none"> •Before commanding G111, cancel the following commands. •Milling mode •Nose R compensation •Constant surface speed •Mixed control (cross axis control) •Fixed cycle •Polar coordinate interpolation •Cylindrical interpolation 	
P412	No spec: Axis name switch
Details Axis name switch (G111) was issued though it is out of specifications.	
Remedy <ul style="list-style-type: none"> •Check the specifications. 	
P420	No spec: Para input by program
Details Parameter input by program (G10) was commanded though it is out of specifications.	
Remedy <ul style="list-style-type: none"> •Check the specifications. 	
P421	Parameter input error
Details <ul style="list-style-type: none"> •The specified parameter No. or set data is illegal. •An illegal G command address was input in parameter input mode. •A parameter input command was issued during fixed cycle modal or nose R compensation. •G10 L50, G10 L70, G10 L100, G11 were not commanded in independent blocks. 	
Remedy <ul style="list-style-type: none"> •Correct the program. 	
P422	Tool/Work shape input error
Details <ul style="list-style-type: none"> •G10 L100, G10 L101 or G11 has been given together with any other command in a block. •Address P or T has been omitted from G10 L100. •Address C has been omitted from G10 L101. 	
Remedy <ul style="list-style-type: none"> •Correct the program. 	

P423	R-Navi input error
Details <ul style="list-style-type: none"> ♦G10 L110, G10 L111 or G11 has been given together with any other command in a block. ♦Address Q has been omitted from G10 L110. ♦Address P, Q or D has been omitted from G10 L111. ♦Machining surface parameter input command has been issued for an undefined workpiece. ♦An index angle command has been given to any axis other than Z when using the coordinate axis direction setting method. ♦Neither the workpiece registration No. nor surface registration No. has been selected when setting a machining surface. Remedy <ul style="list-style-type: none"> ♦Correct the program. ♦Correct the setting of workpiece to machine. 	
P430	R-pnt return incomplete
Details <ul style="list-style-type: none"> ♦A command was issued to move an axis, which has not returned to the reference position, away from that reference position. ♦A command was issued to an axis removal axis. Remedy <ul style="list-style-type: none"> ♦Execute reference position return manually. ♦Disable the axis removal on the axis for which the command was issued. 	
P431	No spec: 2,3,4th R-point ret
Details <p>A command for second, third or fourth reference position return was issued though there are no such command specifications.</p> Remedy <ul style="list-style-type: none"> ♦Check the specifications. 	
P432	No spec: Start position return
Details <p>Start position return (G29) was commanded though it is out of specifications.</p> Remedy <ul style="list-style-type: none"> ♦Check the specifications. 	
P433	No spec: R-position check
Details <p>Reference position check (G27) was commanded though it is out of specifications.</p> Remedy <ul style="list-style-type: none"> ♦Check the specifications. 	
P434	Compare error
Details <p>One of the axes did not return to the reference position when the reference position check command (G27) was executed.</p> Remedy <ul style="list-style-type: none"> ♦Correct the program. 	
P435	G27 and M commands in a block
Details <p>An M command was issued simultaneously in the G27 command block.</p> Remedy <ul style="list-style-type: none"> ♦Place the M code command, which cannot be issued in a G27 command block, in separate block from G27 command block. 	

P436	G29 and M commands in a block
Details	
An M command was issued simultaneously in the G29 command block.	
Remedy	
<ul style="list-style-type: none"> •Place the M code command, which cannot be issued in a G29 command block, in separate block from G29 command block. 	
P438	G52 invalid during G54.1
Details	
A local coordinate system command was issued during execution of the G54.1 command.	
Remedy	
<ul style="list-style-type: none"> •Correct the program. 	
P450	No spec: Chuck barrier
Details	
The chuck barrier on command (G22) was specified although the chuck barrier is out of specifications.	
Remedy	
<ul style="list-style-type: none"> •Check the specifications. 	
P451	No spec: Stroke chk bef travel
Details	
Stroke check before travel (G22/G23) was commanded though it is out of specifications.	
Remedy	
<ul style="list-style-type: none"> •Check the specifications. 	
P452	Limit before travel exists
Details	
An illegal command, which places the axis travel start/end point in the prohibited area or moves the axis through the prohibited area, was detected when Stroke check before travel (G22) was commanded.	
Remedy	
<ul style="list-style-type: none"> •Correct the coordinate values of the axis address commanded in the program. 	
P460	Tape I/O error
Details	
An error has occurred in the tape reader. Otherwise an error has occurred in the printer during macro printing.	
Remedy	
<ul style="list-style-type: none"> •Check the power and cable of the connected devices. •Correct the I/O device parameters. 	
P461	File I/O error
Details	
<ul style="list-style-type: none"> •A file of the machining program cannot be read. •Unable to write to an external file. 	
Remedy	
<ul style="list-style-type: none"> •In memory mode, the programs stored in memory may have been destroyed. Output all of the programs and tool data and then format the system. •Ensure that the external device (including SD card/USB memory) that contains the file is mounted. •Correct the parameter settings for HD operation, SD card operation or USB memory operation. 	
P462	Computer link commu error
Details	
A communication error occurred during the BTR operation.	
Remedy	
<ul style="list-style-type: none"> •"L01 Computer link error" is displayed simultaneously. Take the remedy corresponding to the error No. 	

P470	Invalid cmd in 3D interf check
Details Any of the following commands has been given during 3D machine interference check. <ul style="list-style-type: none"> ♦Program format switch (G188/G189) ♦Diameter/Radius designation switch (G10.9) Remedy <ul style="list-style-type: none"> ♦Before the command, correct the program or disable interference check. ♦Use the PLC I/F method to switch the program format. 	
P480	No spec: Milling
Details <ul style="list-style-type: none"> ♦Milling was commanded though it is out of specifications. ♦Polar coordinate interpolation was commanded though it is out of specifications. Remedy <ul style="list-style-type: none"> ♦Check the specifications. 	
P481	Illegal G code (mill)
Details <ul style="list-style-type: none"> ♦An illegal G code was used during the milling mode. ♦An illegal G code was used during cylindrical interpolation or polar coordinate interpolation. ♦The G07.1 command was issued during the tool radius compensation. Remedy <ul style="list-style-type: none"> ♦Correct the program. 	
P482	Illegal axis (mill)
Details <ul style="list-style-type: none"> ♦A rotary axis was commanded during the milling mode. ♦Milling was executed though an illegal value was set for the milling axis No. ♦Cylindrical interpolation or polar coordinate interpolation was commanded during mirror image. ♦Cylindrical interpolation or polar coordinate interpolation was commanded before the tool compensation was completed after the T command. ♦G07.1 was commanded when cylindrical interpolation was not possible (there is no rotary axis, or external mirror image is ON). ♦An axis other than a cylindrical coordinate system axis was commanded during cylindrical interpolation. Remedy <ul style="list-style-type: none"> ♦Correct the machining program, parameters and PLC interface signals. 	
P484	R-pnt ret incomplete (mill)
Details <ul style="list-style-type: none"> ♦Movement was commanded to an axis that had not completed reference position return during the milling mode. ♦Movement was commanded to an axis that had not completed reference position return during cylindrical interpolation or polar coordinate interpolation. Remedy <ul style="list-style-type: none"> ♦Carry out manual reference position return. 	

P485	Illegal modal (mill)
Details	
<ul style="list-style-type: none"> •The milling mode was turned ON during nose R compensation or constant surface speed control. •A T command was issued during the milling mode. •The mode was switched from milling to cutting during tool compensation. •Cylindrical interpolation or polar coordinate interpolation was commanded during the constant surface speed control mode (G96). •The command unacceptable in the cylindrical interpolation was issued. •A T command was issued during the cylindrical interpolation or polar coordinate interpolation mode. •A movement command was issued when the plane was not selected just before or after the G07.1 command. •A plane selection command was issued during the polar coordinate interpolation mode. •Cylindrical interpolation or polar coordinate interpolation was commanded during tool radius compensation. •The G16 plane in which the radius value of a cylinder is "0" was specified. •A cylindrical interpolation or polar coordinate interpolation command was issued during coordinate rotation by program. 	
Remedy	
<ul style="list-style-type: none"> •Correct the program. •Issue G40 or G97 before issuing G12.1. •Issue a T command before issuing G12.1. •Issue G40 before issuing G13.1. •Specify the radius value of a cylinder other than "0", or specify the X axis's current value other than "0" before issuing G12.1/G16. 	
P486	Milling error
Details	
<ul style="list-style-type: none"> •The milling interpolation was issued during the mirror image (when parameter or external input is turned ON). •Polar coordinate interpolation, cylindrical interpolation or milling interpolation was commanded during mirror image for facing tool posts. •The start command of the cylindrical interpolation or polar coordinate interpolation was issued during the normal line control. 	
Remedy	
<ul style="list-style-type: none"> •Correct the program. 	

P501	Cross (G110) impossible
Details	
Mixed control command (G110), Arbitrary axis exchange command (G140), Arbitrary axis exchange return command (G141) or Base axis configuration restore command (G142) has been given to a part system that is under any of the following state.	
<ul style="list-style-type: none"> ♦Cylindrical interpolation mode ♦Polar coordinate interpolation mode ♦Milling interpolation mode ♦Constant surface speed control mode ♦Polygon cut mode ♦Hob machining mode ♦Nose R compensation mode ♦Tool radius compensation mode ♦During axis name switch ♦Fixed cycle for drilling ♦Fixed cycle for lathe turning ♦Compound-type fixed cycle mode ♦Special fixed cycle mode ♦Facing turret mirror image mode ♦Balance cut mode ♦Chuck barrier/Tailstock barrier ♦Stroke check before travel ♦During Macro modal call (G66.1) ♦Hypothetical axis interpolation mode ♦Figure rotation mode ♦During scaling ♦Coordinate rotation by parameter mode ♦Polar coordinate command mode ♦Normal line control mode ♦Circular cutting mode ♦Tool direction tool length compensation mode 	
Remedy	
♦Correct the program.	
P503	Illegal G110 axis
Details	
Any of the following commands was given to an axis that is under the following conditions: Mixed control command, Arbitrary axis exchange command, Arbitrary axis exchange return command or Basic axis configuration return command.	
<ul style="list-style-type: none"> ♦The commanded axis does not exist. ♦The command caused the maximum number of axes per part system to be exceeded. ♦The command was given to an axis for which axis exchange is disabled. 	
Remedy	
♦Correct the program.	
P505	Hobbing axis selection illegal
Details	
The axis No. set by the hobbing workpiece axis selection signal is not a rotary axis, or it is over the number of NC axes of the part system.	
Remedy	
♦Confirm that the axis set by the hobbing workpiece axis selection signal is a rotary axis and also an NC axis in the part system.	
P511	Synchronization M code error
Details	
<ul style="list-style-type: none"> ♦Two or more synchronization M codes were commanded in the same block. ♦The synchronization M code and "I" code were commanded in the same block. ♦Synchronization with the M code was commanded in 3rd part system or more. (Synchronization with the M code is valid only in 1st part system or 2nd part system.) 	
Remedy	
♦Correct the program.	

P520	Control axis superimposition/Designated axis illegal
	Details ♦The axis designated as the reference or superimposed axis is not available for superimposition. Remedy Correct the program.
P521	Illegal synchronization axis
	Details The axis specified as the reference or synchronized axis of synchronization between part systems cannot be synchronized. Remedy ♦Correct the program.
P522	Simple sync ax setting invalid
	Details The main axis for the simple synchronous control has been designated as tap axis for synchronous tapping. Remedy ♦Correct the program.
P530	Decimal point not possible
	Details A decimal point is included in the address for which a decimal point is invalid. ("#1274 ext10/bit0" (Decimal point command valid address)) Remedy ♦Remove the decimal point from the address for which a decimal point is invalid.
P540	No spec: G54.2
	Details ♦G54.2 was commanded when workpiece position offset for rotary axis was OFF. Remedy ♦Check the workpiece position offset for rotary axis.
P544	No spec: Wk instl err cmp
	Details The workpiece installation error compensation function is out of the specifications. Remedy ♦Check the specifications.
P545	Invid cmd in wk instl err cmp
	Details During workpiece installation error compensation, a command impossible to issue (such as G command) was issued. Remedy ♦Check the program. If you wish to issue a command impossible to issue (such as G command) during workpiece installation error compensation, cancel workpiece installation error compensation once.
P546	Wk instl err cmp cmd invalid
	Details ♦Workpiece installation error compensation was commanded in a G modal in which commanding it is not allowed. ♦An illegal G command was issued in the block that has a workpiece installation error compensation command. Remedy ♦Check the program. Also check the G modals which were issued at commanding the workpiece installation error compensation, and cancel illegal ones. ♦Issue the G command in a separate block.

P547	Illegal wk instl err cmp cmd
Details	
A command in which the rotary axis's travel distance exceeds 180 degrees was issued.	
Remedy	
♦Divide the travel command so that the rotary axis's travel distance per block is less than 180 degrees.	
P550	No spec: G06.2(NURBS)
Details	
There is no NURBS interpolation option.	
Remedy	
♦Check the specifications.	
P551	G06.2 knot error
Details	
The knot (k) command value is smaller than the value for the previous block.	
Remedy	
♦Correct the program.	
♦Specify the knot by monotone increment.	
P552	Start point of 1st G06.2 err
Details	
The block end point immediately before the G06.2 command and the G06.2 first block command value do not match.	
Remedy	
♦Match the G06.2 first block coordinate command value with the previous block end point.	
P554	Invld manual interrupt in G6.2
Details	
Manual interruption was executed in a block that applies the G06.2 mode.	
Remedy	
♦Execute the manual interruption in the block that does not apply the G06.2 mode.	
P555	Invalid restart during G06.2
Details	
Restart was attempted from the block that applies G06.2 mode.	
Remedy	
♦Restart from the block other than in G06.2 mode.	
P560	Fairing changeover disabled
Details	
♦A command to enable the fairing function was given while the smooth fairing function was ON.	
♦A command to enable the smooth fairing function was given while the fairing function was ON.	
Remedy	
♦Correct the program.	
P580	No spec: Axis selection for F
Details	
♦The option "selection of axis (axes) for feedrate command" is invalid.	
Remedy	
♦Check the specifications.	

P581	Axis selection for F invalid
Details	
♦The command "selection of axis (axes) for feedrate command" has been issued while the mode that disables the command is active.	
Remedy	
♦Correct the program.	
P582	Invalid cmd in F ax selection
Details	
♦The command issued is invalid while selection of axis (axes) for feedrate command is ON.	
Remedy	
♦Correct the program.	
P595	Skip axis illegal
Details	
♦No axis or more than 2 axes was/were issued to torque limitation skip command block.	
♦An axis during synchronous control was issued as the skip axis.	
♦An axis during inclined axis control was issued as the skip axis.	
♦Geometric command, corner R, or corner chamfering was issued in the same block as torque limitation skip command.	
♦A torque skip was commanded to the axis which is in the constant torque control or the proportional torque stopper control.	
Remedy	
♦Issue only an axis to the skip axis.	
♦Review the program.	
P600	No spec: Auto TLM
Details	
An automatic tool length measurement command (G37) was issued though it is out of specifications.	
Remedy	
♦Check the specifications.	
P601	No spec: Skip
Details	
A skip command (G31) was issued though it is out of specifications.	
Remedy	
♦Check the specifications.	
P602	No spec: Multi skip
Details	
A multiple skip command (G31.1, G31.2, G31.3 or G31 Pn) was issued though it is out of specifications.	
Remedy	
♦Check the specifications.	
P603	Skip speed 0
Details	
The skip speed is "0".	
Remedy	
♦Specify the skip speed.	
P604	TLM illegal axis
Details	
No axis was specified in the automatic tool length measurement block. Otherwise, two or more axes were specified.	
Remedy	
♦Specify only one axis.	

P605	T & TLM command in a block
Details The T code is in the same block as the automatic tool length measurement block.	
Remedy •Specify the T code before the automatic tool length measurement block.	
P606	T cmdnd not found before TLM
Details The T code was not yet specified in automatic tool length measurement.	
Remedy •Specify the T code before the automatic tool length measurement block.	
P607	TLM illegal signal
Details The measurement position arrival signal turned ON before the area specified by the D command or "#8006 ZONE d". Otherwise, the signal remained OFF to the end.	
Remedy •Correct the program.	
P608	Skip during radius compen
Details A skip command was issued during radius compensation processing.	
Remedy •Issue a radius compensation cancel (G40) command or remove the skip command.	
P610	Illegal parameter
Details •The parameter setting is not correct. <ul style="list-style-type: none"> - G114.1 was commanded while the spindle synchronization was selected with the PLC interface signal. - G110 was commanded while the mixed control (cross axis control) was selected with the PLC interface signal. - G125 was commanded while the control axis synchronization between part systems was selected with the PLC interface signal. - G126 was commanded while the control axis superimposition was selected with the PLC interface signal. 	
Remedy •Correct the settings of "#1514 expLinax (Exponential function interpolation linear axis)" and "#1515 expRotax (Exponential function interpolation rotary axis)". <ul style="list-style-type: none"> - Correct the program. - Correct the parameter settings. 	
P611	No spec: Exponential function
Details There is no specification for the exponential interpolation.	
Remedy •Check the specifications.	
P612	Exponential function error
Details A travel command for exponential interpolation was issued during mirror image for facing tool posts.	
Remedy •Correct the program.	

P650	Sub sys identification # error
Details <ul style="list-style-type: none"> ♦The identification No. specified in the address B of G122 or G144 is that of the part system where G122 is given. ♦The identification No. specified in the sub part system control I command (G122) is not set in the parameter #12049 SBS_no. Remedy <ul style="list-style-type: none"> ♦Change the address B of G122 or G144 to be any identification No. other than that of the part system where G122 is given. ♦Select the identification No. for the sub part system control I command (G122) from among the available Nos. ♦Specify the identification No. you wish to use for the sub part system control I command (G122) in the parameter #12049 SBS_no. 	
P651	Other G code in sub sys block
Details G122 or G144 has been given together with any other G code command in a block. Remedy <ul style="list-style-type: none"> ♦Do not command G122 or G144 together with any other G code command in a block. 	
P652	Illegal mode (sub part system)
Details G122 or G144 has been commanded in any of the following modes. <ul style="list-style-type: none"> ♦User macro modal call (G66, G66.1) ♦Fixed cycle mode ♦High-speed mode (G5, G5.1) Remedy Cancel the following modes before commanding G122 or G144. <ul style="list-style-type: none"> ♦User macro modal call (G66, G66.1) ♦Fixed cycle mode ♦High-speed mode (G5, G5.1) 	
P653	Illegal G code (sub part sys)
Details High-speed mode command (G5, G5.1) has been given in a sub part system. Remedy <ul style="list-style-type: none"> ♦Do not use the high-speed mode (G5, G5.1) in a sub part system. 	
P656	Illegal PLC device
Details <ul style="list-style-type: none"> ♦Specified the device other than R register/D register. ♦Specified the odd numbered device when 4 byte is specified. ♦Specified the device number that is out of the command range. ♦Specified the data length that is out of the command range. ♦Specified the bit number that is out of the command range. ♦Omitted the device number. ♦Omitted the project number after ",P". ♦Omitted the data length after ",". ♦Omitted the bit number after ".". Remedy <ul style="list-style-type: none"> ♦Check the program. 	
P657	PLC Device too much
Details Multiple assignment expressions which include the PLC direct interface command are commanded to the same block. Remedy <ul style="list-style-type: none"> ♦Command the assignment command using PLC direct interface by itself. 	

P700	Illegal command value
Details Spindle synchronization was commanded to a spindle that is not connected serially.	
Remedy <ul style="list-style-type: none"> ♦Correct the program. ♦Correct the parameter settings. 	
P705	Dia/Rad selection cmd invalid
Details G10.9 was commanded during a modal in which diameter/radius designation selection is not available.	
Remedy <ul style="list-style-type: none"> ♦Check the program. 	
P706	Invld cmd in dia/rad selection
Details A G code impossible to command was issued during switching between diameter and radius using the diameter/radius designation selection.	
Remedy <ul style="list-style-type: none"> ♦Check the program. 	
P709	No Rapid block overlap
Details The following commands were executed while there is no option for Rapid traverse block overlap. <ul style="list-style-type: none"> ♦G0.5 command ♦Reference position return command while "#1443 G28ol" (Enable G28 rapid traverse block overlap) is enabled ♦G0 command while "#12056 I_G0ol" (Enable G00 initial rapid traverse block overlap) is enabled 	
Remedy <ul style="list-style-type: none"> ♦Check the specification. ♦Disable the parameter. 	
P721	No selected point for return
Details G26 (Return to selected point) has been given in a program other than a machining interruption program.	
Remedy <ul style="list-style-type: none"> ♦Correct the program. 	
P727	Selected point error
Details The command order of the selected point is incorrect.	
Remedy <ul style="list-style-type: none"> ♦Correct the program. 	
P728	Invalid cmnd in mach interrupt
Details The executed command is unavailable in a machining interruption program.	
Remedy <ul style="list-style-type: none"> ♦Correct the program. 	
P729	Invalid cmd before tap retract
Details The command in the retraction program cannot be executed prior to the tap retraction command (G26).	
Remedy <ul style="list-style-type: none"> ♦Place the command after the tap retraction (G26) block. 	

P730	Invalid end pt for tap retract
Details	
The position (end point) given to the drill axis in the tap retraction command (G26) is lower than the R-point (closer to the hole bottom).	
Remedy	
•Correct the coordinates of the drill axis command.	
P740	Invalid cmd in multi-axis sync
Details	
The issued command is disabled during multiple-axis synchronization control.	
Remedy	
•Cancel the multiple-axis synchronization control before issuing the command.	
P790	Illegal command in VCC mode
Details	
The issued command cannot be used during the vibration cutting mode.	
Remedy	
•Correct the program.	
P791	VCC mode command illegal
Details	
Vibration cutting mode start command has been given although the command is disabled during the currently active mode.	
Remedy	
•Correct the program.	
P801	Turning tool offset disabled
Details	
Any of the following commands has been given during the G43.7 mode.	
<ul style="list-style-type: none"> •Mirror image by G code •Mirror image by parameter setting •Mirror image by external input •Tool length compensation along the tool axis •Automatic tool length measurement 	
A G43.7 command has been given in any of the following modes.	
<ul style="list-style-type: none"> •Mirror image by G code •Mirror image by parameter setting •Mirror image by external input •Fixed cycle for drilling 	
Remedy	
•Check the program. If you use the mirror image, tool length compensation along the tool axis, automatic tool length measurement or fixed cycle for drilling, use a G49 command to cancel the tool position offset.	
P802	Nose R compensation disabled
Details	
Any of the following commands has been given during nose R compensation for machining center system.	
<ul style="list-style-type: none"> •Mirror image by G code •Mirror image by parameter setting •Mirror image by external input 	
Nose R compensation for machining center system has been executed in any of the following modes.	
<ul style="list-style-type: none"> •Mirror image by G code •Mirror image by parameter setting •Mirror image by external input 	
Remedy	
•Check the program. If you use the mirror image, use a G40 command to cancel the nose R compensation for machining center system.	

P803	Proceed of prog check disabled
Details	
The commanded G code has disabled the program check.	
Remedy	
Delete the G code that disables the program check, and then retry the program check. (Note that deleting the G code may affect the operation of the subsequent blocks.)	
P811	Invalid cmd in MCR coord TF
Details	
A command that is invalid during motion control release (coordinate transformation) was issued.	
Remedy	
♦Correct the program.	
P890	Invalid command during F-CUT
Details	
An invalid command was executed during F-CUT.	
Possible commands are as follows.	
♦The M code for F-CUT ON/OFF command during beam ON	
♦The M code for beam ON/OFF command in the same block as the M code for F-CUT ON/OFF command	
♦A movement G code command other than G00, G01, G02, G03, G28, and G30	
♦An axis command other than the axes set as base axes I and J	
♦G04, G64 command	
Remedy	
♦Correct the machining program.	
P891	Rotary ax cmd invalid in F-CUT
Details	
A rotary axis command was executed while F-CUT was active.	
Remedy	
♦Correct the machining program.	
P892	Invalid cmd in laser part sys
Details	
A command (G command, etc.) not executable in the part system where the laser processing control was active was issued.	
Remedy	
♦Correct the program.	
P893	Simul laser prcsg cond chg cmd
Details	
The M code for laser processing condition selection was specified when changing laser processing conditions was not permissible.	
♦The M code for laser processing condition selection was specified in the same block as the M code for laser beam ON/OFF.	
Remedy	
♦Correct the program.	
P900	No spec: Normal line control
Details	
A normal line control command (G40.1, G41.1, or G42.1) was issued though it is out of specifications.	
Remedy	
♦Check the specifications.	
P901	Normal line control axis G92
Details	
A coordinate system preset command (G92) was issued to a normal line control axis during normal line control.	
Remedy	
♦Correct the program.	

P902	Normal line control axis error
	Details <ul style="list-style-type: none"> •The normal line control axis was set to a linear axis. •The normal line control axis was set to the linear type rotary axis II axis. •The normal line control axis has not been set. •The normal line control axis is the same as the plane selection axis. Remedy <ul style="list-style-type: none"> •Correct the normal line control axis setting.
P903	Plane chg in Normal line ctrl
	Details <p>The plane selection command (G17, G18, or G19) was issued during normal line control.</p> Remedy <ul style="list-style-type: none"> •Delete the plane selection command (G17, G18, or G19) from the program of the normal line control.
P910	No spec: tool cutting pnt ctrl
	Details <p>The option for tool cutting point control is not set.</p> Remedy <ul style="list-style-type: none"> •Check the specifications.
P911	Illegal TCPC command
	Details <ul style="list-style-type: none"> •Tool cutting point control was programmed during a modal where tool cutting point control is not permissible. •Tool cutting point control was programmed in the same block as a G code that cannot be used with tool cutting point control. Remedy <ul style="list-style-type: none"> •Correct the program. •Deactivate the function that cannot be used together.
P912	Illegal cmd during TCPC
	Details <p>A G code not executable during tool cutting point control mode was programmed.</p> Remedy <ul style="list-style-type: none"> •Correct the program. •Deactivate tool cutting point control.
P913	TCPC tool data illegal
	Details <p>Tool cutting point control was programmed with incorrect tool data.</p> Remedy <ul style="list-style-type: none"> •Correct the tool data. •Modify the parameter.
P920	No spec: 3D coord conv
	Details <p>There is no specification for 3-dimensional coordinate conversion.</p> Remedy <ul style="list-style-type: none"> •Check the specifications.
P921	Illegal G code at 3D coord
	Details <p>The commanded G code cannot be performed during 3-dimensional coordinate conversion modal.</p> Remedy <ul style="list-style-type: none"> •Refer to "Programming Manual" for usable G commands. •When the parameter "#8158 Init const sur spd" is enabled, disable the parameter or issue the constant surface speed control cancel (G97) command.

P922	Illegal mode at 3D coord
Details A 3-dimensional coordinate conversion command was issued during a modal for which 3-dimensional coordinate conversion cannot be performed.	
Remedy ♦Refer to "Programming Manual" for usable G commands.	
P923	Illegal addr in 3D coord blk
Details A G code and G68 was commanded in a block though the G code cannot be commanded with G68.	
Remedy ♦Refer to "Programming Manual" for usable G commands.	
P924	Travel cmd error in 3Dconvert
Details An incorrect travel command has been given during the 3D coordinate conversion mode.	
Remedy ♦Correct the program.	
P925	End point err in 3D conversion
Details The end point of a travel command given during "G68.1 ,E1" is not on the tool path.	
Remedy ♦Correct the program.	
P926	3D coordinate cnv format error
Details There is an error in the 3-dimensional coordinate conversion command. Check the following: ♦Not all IJK commands are described in the 3-dimensional coordinate conversion command block.	
Remedy ♦Correct the program.	
P930	No spec: Tool axis compen
Details A tool length compensation along the tool axis command was issued though it is out of specifications.	
Remedy ♦Check the specifications.	
P931	Executing tool axis compen
Details There is a G code that cannot be commanded during tool length compensation along the tool axis.	
Remedy ♦Correct the program.	
P932	Rot axis parameter error
Details ♦There is an invalid orthogonal axis name or rotary axis name set in the rotary axis configuration parameters. ♦There is an invalid setting related to axis configuration in the rotary axis configuration parameters. ♦A function that cannot be commanded when the spindle end offset is set was commanded.	
Remedy ♦Set the correct value and reboot. ♦Check the program.	

P934	Invalid axis configuration
Details <ul style="list-style-type: none"> •The function cannot be executed under the axis configuration of the part system. •An unavailable G code was given when "Select specifications of rotation direction parameter" is enabled (#1450/bit3 = 1), and the left-hand screw direction is selected by the rotation direction parameter (#7923, #7933, #7943, #7953 = 1). •The axis with the axis address H for absolute dimension command is included in the machine configuration. Remedy <ul style="list-style-type: none"> •Correct the program. •Check and correct the rotary axis configuration parameters so that the function can be executed in the axis configuration. 	
P940	No spec: Tool tip control
Details <p>There is no specification for tool tip center control.</p> Remedy <ul style="list-style-type: none"> •Check the specifications. 	
P941	Invalid T tip control command
Details <p>A tool tip center control command was issued during a modal for which a tool tip center control command cannot be issued.</p> Remedy <ul style="list-style-type: none"> •Correct the program. 	
P942	Invalid cmdnd during T tip ctrl
Details <p>A G code that cannot be commanded was issued during tool tip center control.</p> Remedy <ul style="list-style-type: none"> •Correct the program. 	
P943	Tool posture command illegal
Details <p>For tool center point control/tool cutting point control type 1, if the signs are different between the start point and end point of the tool-side rotary axis or table base-side rotary axis, the tool base-side rotary axis or the table workpiece-side rotary axis rotation exists in the same block, and does not pass a singular point. For tool center point control/tool cutting point control type 2, IJK command is incorrect.</p> Remedy <ul style="list-style-type: none"> •Correct the program. 	
P950	No spec: Tilt face machining
Details <p>Inclined surface machining option is not supported.</p> Remedy <ul style="list-style-type: none"> •Check the specifications. 	
P951	Ill cmd in tilt face machining
Details <p>A forbidden command (G command, etc.) was issued during inclined surface machining.</p> Remedy <ul style="list-style-type: none"> •Check the program. If you want to execute a command (G command, etc.) that is unavailable during inclined surface machining, cancel the inclined surface machining. 	

P952	Inclined face cut prohibited
Details Inclined surface machining was commanded during the mode where the machining is unavailable. Inclined surface machining was commanded during interruption.	
Remedy ♦Check the program and see whether any unavailable mode is included during inclined surface machining command. If any, cancel that mode.	
P953	Tool axis dir cntrl prohibited
Details Tool axis direction control was commanded during the mode where the control is unavailable.	
Remedy ♦Check the program and see whether any unavailable mode is included during tool axis direction control. If any, cancel that mode.	
P954	Inclined face command error
Details The address to issue the inclined surface machining command is incorrect.	
Remedy ♦Check the program.	
P955	Inclined face coord illegal
Details Impossible to define an inclined surface with the values you specified.	
Remedy ♦Check the program.	
P956	G68.2P10 surface not defined
Details The coordinate system for the machining surface selected with G68.2P10 has not been defined.	
Remedy ♦Set the machining surface so that the coordinate system can be defined.	
P957	Tool axis dir ctrl cmp amt 0
Details When the tool axis direction control type 2 (G53.6) was commanded, a tool length compensation No. whose compensation amount is 0 was commanded.	
Remedy ♦Correct the program. Set the tool length compensation amount, or command a tool length compensation No. whose compensation amount is not 0.	
P958	Tool axis dir ctrl axis illeg
Details The command was issued with an angle with which tool axis direction control of 4-axis configuration is not available.	
Remedy ♦Check the feature coordinate system defined in inclined surface machining command.	
P959	No spec: Simple inclined face
Details Simple inclined surface machining is not included in the specifications.	
Remedy ♦Check the specifications.	

P960	No spec: Direct command mode
Details	
G05 P4 was commanded while direct command mode option is OFF.	
Remedy	
•Check the specifications.	
P961	Invalid during dir cmnd mode
Details	
•A G code other than G05 P0 was commanded in direct command mode.	
•A sequence No. command, F code command, MSTB command or variable command was issued.	
•A corner chamfering command or corner R command was issued.	
•A travel command was issued to an axis that had not been command in the G05 P4 block.	
Remedy	
•Check the program.	
P962	Dir cmnd mode cmnd invalid
Details	
G05 P4 was commanded in a modal where direct command mode is not available.	
Remedy	
•Check the program.	
P963	Illegal direct cmnd mode cmnd
Details	
The commanded coordinate value was beyond the maximum travel distance in direct command mode.	
Remedy	
•Correct the coordinate value in direct command mode.	
P990	PREPRO error
Details	
Combining commands that required pre-reading (nose R offset, corner chamfering/corner rounding, geometric I, geometric IB, and compound type fixed cycle for turning machining) resulted in eight or more pre-read blocks.	
Remedy	
•Delete some or all of the combinations of commands that require pre-reading.	

Smart Safety Observation Alarm (V)

13 Smart Safety Observation Alarm (V)

13.1 Smart Safety Observation Error (V01/V02/V03/V04/V05/V06/V07)

13.1 Smart Safety Observation Error (V01/V02/V03/V04/V05/V06/V07)

V01	Safety watchdog error	0001	
Details			
Safety function is not carried out in specified cycle.			
Remedy			
•CPU may be faulty. Contact our service center.			
V01	Cross-check error	0002	
Details			
Each operation result of redundant CPU is different value.			
Remedy			
•CPU may be faulty. Contact our service center.			
V01	Safe sys internal process err	0003	Function No.
Details			
An error has occurred in the NC's internal process during execution of a safety function.			
The screen displays which safety function has been executed at the time of error, using the following numbers.			
0001: Safely-limited speed (SLS)			
0002: Safely-limited position (SLP)			
0003: Safe speed monitor (SSM)			
0004: Safe cam (SCA)			
0005: Safe operating stop (SOS)			
0006: Safe stop 1 (SS1)			
0007: Safe stop 2 (SS2)			
0008: Safe torque off (STO)			
0009: Safe brake control (SBC)			
000A: Diagnostic function			
000B: Safety I/O-related observation			
Remedy			
•CPU may be faulty. Contact our service center.			
V01	Safe para storage memory err 1	0004	
Details			
Safety parameter (for internal processing) which is saved in the memory is illegal value.			
Remedy			
•Input Safety parameter file and turn power ON again.			
•Clear the memory. (All data on the memory will be initialized. Back up the data as needed.)			
•When the above action does not help restoring, memory may be faulty. Contact our service center.			
V01	Safe para storage memory err 2	0005	
Details			
Safety parameter which is saved in the memory is illegal value.			
Remedy			
•Input Safety parameter file and turn power ON again.			
•Clear the memory. (All data on the memory will be initialized. Back up the data as needed.)			
•When the above action does not help restoring, memory may be faulty. Contact our service center.			
V01	Safety initial process timeout	0006	
Details			
The initialization process of the safety function at power ON is not completed within specified time.			
Remedy			
•CPU may be faulty. Contact our service center.			

13 Smart Safety Observation Alarm (V)

13.1 Smart Safety Observation Error (V01/V02/V03/V04/V05/V06/V07)

V01	NC-DRV initial safe comm error	0007	Axis name
Details The initial communication between NC unit and drive unit is incorrect. Displays the name of axis with error.			
Remedy <ul style="list-style-type: none"> •Check if there is no contact failure or no cable fracture after NC/Drive power OFF. •NC unit or drive unit may be faulty. Contact our service center. 			
V01	Safe IO init. process timeout	0008	Unit info
Details The safety I/O initialization process at power-up has not completed within the specified time. Displays the information of the unit with an error. bit24-27: Unit No. (*) The unit No. indicates the unit in which an alarm occurs. The channel No. and station No. to which the unit is connected can be confirmed by the following parameters. Channel No.: $\#51501 + 10 \times (\text{Unit No.} - 1)$ Station No.: $\#51502 + 10 \times (\text{Unit No.} - 1)$			
Remedy <ul style="list-style-type: none"> •Safety I/O unit may be faulty. Exchange the safety I/O unit. 			
V02	Encoder error	0001	Axis name
Details The feedback position received from drive unit is incorrect. Displays the name of axis with error.			
Remedy <ul style="list-style-type: none"> •Encoder may be faulty. Contact our service center. 			
V02	NC-DRV safe communication err	0004	Axis name
Details The communication between NC unit and drive unit is incorrect. Displays the name of axis with error.			
Remedy <ul style="list-style-type: none"> •Check if there is no contact failure or no cable fracture after NC/Drive power OFF. •NC unit or drive unit may be faulty. Contact our service center. 			
V02	Excess movement during pwr OFF	0005	Axis name
Details [Saved position at power shut OFF] and [restored position at power ON] are inconsistent in SLP/SCA encoder diagnosis during power OFF. Displays the name of axis with error.			
Remedy There are two causes of this alarm; one is "the axis being moved during power OFF" and the other is "the incorrect restoring of the position at power ON". <ul style="list-style-type: none"> •When it is likely with the cause "the axis being moved during power OFF", the alarm can be cancelled by turning ON the Safety reset signal while the Special safety alarm cancel signal is ON. •When it is likely with the cause "the incorrect restoring of the position at power ON", encoder may be faulty. Contact our service center. 			

13 Smart Safety Observation Alarm (V)

13.1 Smart Safety Observation Error (V01/V02/V03/V04/V05/V06/V07)

V03	Slave station comm. error 1	0001	Unit info
Details The data received by the safety I/O unit is incorrect. Displays the information of the unit with an error. bit24-27: Unit No. Safety observation target axes are stopped, and all the DOs of the safety I/O unit concerned are turned OFF. (*) The unit No. indicates the unit in which an alarm occurs. The channel No. and station No. to which the unit is connected can be confirmed by the following parameters. Channel No.: #51501 + 10 × (Unit No. - 1) Station No.: #51502 + 10 × (Unit No. - 1)			
Remedy •NC unit or safety I/O unit may be faulty. Exchange the NC unit or safety I/O unit.			
V03	Slave station comm. error 2	0002	Unit info
Details The data received by the safety I/O unit is incorrect. Displays the information of the unit with an error. bit24-27: Unit No. Safety observation target axes are stopped, and all the DOs of the safety I/O unit concerned are turned OFF. (*) The unit No. indicates the unit in which an alarm occurs. The channel No. and station No. to which the unit is connected can be confirmed by the following parameters. Channel No.: #51501 + 10 × (Unit No. - 1) Station No.: #51502 + 10 × (Unit No. - 1)			
Remedy •NC unit or safety I/O unit may be faulty. Exchange the NC unit or safety I/O unit.			
V03	Slave station comm. error 3	0003	Unit info
Details The data received by the safety I/O unit is incorrect. Displays the information of the unit with an error. bit24-27: Unit No. Safety observation target axes are stopped, and all the DOs of the safety I/O unit concerned are turned OFF. (*) The unit No. indicates the unit in which an alarm occurs. The channel No. and station No. to which the unit is connected can be confirmed by the following parameters. Channel No.: #51501 + 10 × (Unit No. - 1) Station No.: #51502 + 10 × (Unit No. - 1)			
Remedy •NC unit or safety I/O unit may be faulty. Exchange the NC unit or safety I/O unit.			

13 Smart Safety Observation Alarm (V)

13.1 Smart Safety Observation Error (V01/V02/V03/V04/V05/V06/V07)

V03	Slave station data compare err	0004	Unit info
Details The data received by the safety I/O unit is inconsistent. Displays the information of the unit with an error. bit24-27: Unit No. Safety observation target axes are stopped, and all the DOs of the safety I/O unit concerned are turned OFF. (*) The unit No. indicates the unit in which an alarm occurs. The channel No. and station No. to which the unit is connected can be confirmed by the following parameters. Channel No.: $\#51501 + 10 \times (\text{Unit No.} - 1)$ Station No.: $\#51502 + 10 \times (\text{Unit No.} - 1)$			
Remedy <ul style="list-style-type: none"> •Check the user safety sequence circuit to see if the output signal control circuit is correct. •Data corruption may have been caused due to noise. Take anti-noise measures on the connection between the NC unit and safety I/O unit. •NC unit or safety I/O unit may be faulty. Exchange the NC unit or safety I/O unit. 			
V03	Output OFF check error	0005	Unit info
Details Output signal of the safety I/O unit fails to be OFF. Displays the information of the unit with an error. bit24-27: Unit No. bit0-15: Signal BIT Safety observation target axes are stopped. (*) The unit No. indicates the unit in which an alarm occurs. The channel No. and station No. to which the unit is connected can be confirmed by the following parameters. Channel No.: $\#51501 + 10 \times (\text{Unit No.} - 1)$ Station No.: $\#51502 + 10 \times (\text{Unit No.} - 1)$			
Remedy <ul style="list-style-type: none"> •NC unit or safety I/O unit may be faulty. Exchange the NC unit or safety I/O unit. 			
V03	Output signal cross-check err	0006	Unit info
Details Loop-back signals of the outputs from the safety I/O unit are inconsistent between PLC1 and PLC2. Displays the information of the unit with an error. bit24-27: Unit No. bit0-15: Signal BIT Safety observation target axes are stopped. (*) The unit No. indicates the unit in which an alarm occurs. The channel No. and station No. to which the unit is connected can be confirmed by the following parameters. Channel No.: $\#51501 + 10 \times (\text{Unit No.} - 1)$ Station No.: $\#51502 + 10 \times (\text{Unit No.} - 1)$			
Remedy <ul style="list-style-type: none"> •Check the user safety sequence circuit to see if the output signal control circuit is correct. •NC unit or safety I/O unit may be faulty. Exchange the NC unit or safety I/O unit. 			

13 Smart Safety Observation Alarm (V)

13.1 Smart Safety Observation Error (V01/V02/V03/V04/V05/V06/V07)

V03	Transmission cross-check error	0007	Unit info
Details Output signals are inconsistent between the user safety sequence and safety I/O unit. Displays the information of the unit with an error. bit24-27: Unit No. bit0-15: Signal BIT Safety observation target axes are stopped. (*) The unit No. indicates the unit in which an alarm occurs. The channel No. and station No. to which the unit is connected can be confirmed by the following parameters. Channel No.: $\#51501 + 10 \times (\text{Unit No.} - 1)$ Station No.: $\#51502 + 10 \times (\text{Unit No.} - 1)$			
Remedy •Check the user safety sequence circuit to see if the output signal control circuit is correct. •NC unit or safety I/O unit may be faulty. Exchange the NC unit or safety I/O unit.			
V03	Reception cross-check error	0008	Unit info
Details Input signals from the safety I/O unit are inconsistent between PLC1 and PLC2. Displays the information of the unit with an error. bit24-27: Unit No. bit0-15: Signal BIT Safety observation target axes are stopped. (*) The unit No. indicates the unit in which an alarm occurs. The channel No. and station No. to which the unit is connected can be confirmed by the following parameters. Channel No.: $\#51501 + 10 \times (\text{Unit No.} - 1)$ Station No.: $\#51502 + 10 \times (\text{Unit No.} - 1)$			
Remedy •Any input device (emergency stop button, for example) connected to the safety I/O unit may be faulty. Check the input devices. •NC unit or safety I/O unit may be faulty. Exchange the NC unit or safety I/O unit.			
V03	Host station comm. error 1	0009	Unit info
Details The data received from the safety I/O unit is incorrect. Displays the information of the unit with an error. bit24-27: Unit No. Safety observation target axes are stopped. (*) The unit No. indicates the unit in which an alarm occurs. The channel No. and station No. to which the unit is connected can be confirmed by the following parameters. Channel No.: $\#51501 + 10 \times (\text{Unit No.} - 1)$ Station No.: $\#51502 + 10 \times (\text{Unit No.} - 1)$			
Remedy •Data corruption may have been caused due to noise. Take anti-noise measures on the connection between the NC unit and safety I/O unit. •NC unit or safety I/O unit may be faulty. Exchange the NC unit or safety I/O unit.			

13 Smart Safety Observation Alarm (V)

13.1 Smart Safety Observation Error (V01/V02/V03/V04/V05/V06/V07)

V03	Host station comm. error 2	0010	Unit info
Details The data received from the safety I/O unit is incorrect. Displays the information of the unit with an error. bit24-27: Unit No. Safety observation target axes are stopped. (*) The unit No. indicates the unit in which an alarm occurs. The channel No. and station No. to which the unit is connected can be confirmed by the following parameters. Channel No.: $\#51501 + 10 \times (\text{Unit No.} - 1)$ Station No.: $\#51502 + 10 \times (\text{Unit No.} - 1)$			
Remedy ♦NC unit or safety I/O unit may be faulty. Exchange the NC unit or safety I/O unit.			
V03	Host station comm. error 3	0011	Unit info
Details The data received from the safety I/O unit is incorrect. Displays the information of the unit with an error. bit24-27: Unit No. Safety observation target axes are stopped. (*) The unit No. indicates the unit in which an alarm occurs. The channel No. and station No. to which the unit is connected can be confirmed by the following parameters. Channel No.: $\#51501 + 10 \times (\text{Unit No.} - 1)$ Station No.: $\#51502 + 10 \times (\text{Unit No.} - 1)$			
Remedy ♦The cable connecting between the NC unit and safety I/O unit may be disconnected or loosened. Check the cable. ♦NC unit or safety I/O unit may be faulty. Exchange the NC unit or safety I/O unit.			
V03	Drv safe receive crosscheck er	0012	ZR device No.
Details The input signals from the drive's safety function are inconsistent. The screen displays the No. of device ZR with an error. Safety observation target axes are stopped.			
Remedy ♦NC unit may be faulty. Exchange the NC unit.			
V03	User safety sequence 1 error	0013	Error cause number
Details An error has occurred in User safety sequence 1. The screen displays the error cause by the number. Safety observation target axes are stopped. User safety sequences 1 and 2 are both stopped. All the DOs of the connected safety I/O unit are turned OFF.			
Remedy ♦Refer to the list of user safety sequence error details in Smart safety observation Specification manual. Cancel the error based on the displayed error cause, and then turn OFF and ON the NC power.			
V03	User safety sequence 2 error	0014	Error cause number
Details An error has occurred in User safety sequence 2. The screen displays the error cause. Safety observation target axes are stopped. User safety sequences 1 and 2 are both stopped. All the DOs of the connected safety I/O unit are turned OFF.			
Remedy ♦Refer to the list of user safety sequence error details in Smart safety observation Specification manual. Cancel the error based on the displayed error cause, and then turn OFF and ON the NC power.			

13 Smart Safety Observation Alarm (V)

13.1 Smart Safety Observation Error (V01/V02/V03/V04/V05/V06/V07)

V03	Output sig. cross check error	0015	Unit info
Details <p>The signals output to the safety I/O unit are unmatched between PLC1 and PLC2. Displays the information of the unit with an error.</p> <p>bit24-27: Unit No. bit0-15: Signal BIT</p> <p>The axes covered by safety function come to a standstill.</p> <p>(*) The unit No. indicates the unit in which an alarm occurs. The channel No. and station No. to which the unit is connected can be confirmed by the following parameters.</p> <p>Channel No.: #51501 + 10 × (Unit No. - 1) Station No.: #51502 + 10 × (Unit No. - 1)</p>			
Remedy <ul style="list-style-type: none"> •Check the user safety sequence to make sure the output signal control circuit is correct. •Set tolerable time more than 300ms, when an output signal is controlled with 100ms timer. •NC unit may be faulty. Replace the NC unit. 			
V04	Safety observation & Smart both ON	0001	
Details <p>The system has both an axis for which Safety observation is enabled (the parameter "#2313 SV113(SSF8)/bitF" or "#13229 SP229(SFNC9)/bitF" is "1") and an axis for which Smart safety observation is enabled (the parameter "#51101 SF_Disable" or "#51301 SF_SDisable" is "0").</p>			
Remedy <ul style="list-style-type: none"> •Disable Safety observation for all the axes (Set the parameters "#2313 SV113(SSF8)/bitF" and "#13229 SP229(SFNC9)/bitF" to "0"), and turn ON the NC reset signal. •Disable Smart safety observation for all the axes (Set the parameters "#51101 SF_Disable" and "#51301 SF_SDisable" to "1"), and turn the power OFF and ON. 			
V04	Safety IO device unconnectable	0002	Safety I/O unit-connect- ed channel
Details <p>A safety I/O unit has been connected with the smart safety observation option OFF or with the parameters "#51101 SF_Disable" and "#51301 SF_SDisable" set to "1" for all the axes. The screen displays the channel to which the safety I/O unit is connected by the bit number.</p> <p>bit0: Operation panel bit1: RIO 1CH bit2: RIO 2CH bit3: RIO 3CH bit4: RIO 4CH</p>			
Remedy <ul style="list-style-type: none"> •Disconnect the safety I/O unit, and then turn OFF and ON the power. •If you wish to use Smart safety observation, implement the following and then turn the power OFF and ON. <ul style="list-style-type: none"> - Enable the option. - Turn "0" the axis parameter of Smart safety observation ("#51101 SF_Disable" / "#51301 SF_SDisable"). 			

13 Smart Safety Observation Alarm (V)

13.1 Smart Safety Observation Error (V01/V02/V03/V04/V05/V06/V07)

V04	Safe IO disabled: connect err	0003	Safety I/O unit-connect- ed channel
Details A safety I/O unit has been connected to the I/O connection channel where RIO1.0 unit is connected. The screen displays the I/O connection channel to which the safety I/O unit is connected using a bit number. bit0: Operation panel bit1: RIO 1CH bit2: RIO 2CH bit3: RIO 3CH bit4: RIO 4CH			
Remedy <ul style="list-style-type: none"> For the I/O connection channel where the safety signal input/output is conducted, no devices other than RIO2.0 unit or safety I/O unit can be connected. If you are unable to change the I/O device configuration immediately, set the parameters "#51101 SF_Disable" and "#51301 SF_SDisable" to "1" for all the axes, and turn OFF and ON the power. This prevents occurrence of this alarm. 			
V04	Safe IO disabled: no safe I/Os	0004	
Details None of the I/O connection channels is connected to a safety I/O unit.			
Remedy <ul style="list-style-type: none"> Connect a safety I/O unit to the I/O connection channel through which the safety signals are input/output. If you are unable to change the I/O device configuration immediately, set the parameters "#51101 SF_Disable" and "#51301 SF_SDisable" to "1" for all the axes, and turn OFF and ON the power. This prevents occurrence of this alarm. 			
V04	Safety PLC is not yet written	0005	
Details Safety PLC has not been written.			
Remedy <ul style="list-style-type: none"> Write safety PLC and turn the power OFF and ON. If safety PLC is not ready, set the parameters "#51101 SF_Disable" and "#51301 SF_SDisable" to "1" for all the axes, and then turn the power OFF and ON. This prevents occurrence of this alarm. 			
V04	NC-DRV safety comm. Disabled	0006	Optical channel No.
Details The optical channel connected to an axis for which the parameter "#51101 SF_Disable" or "#51301 SF_SDisable" is set to "0" is configured with any drive unit other than MDS-E Series. (MDS-D Series drive unit is connected to the said channel.) The screen displays the No. of optical communication channel of this error.			
Remedy <ul style="list-style-type: none"> Do not connect any drive unit other than MDS-E Series to the optical channel of the axis for which the parameter "#51101 SF_Disable" or "#51301 SF_SDisable" is set to "0". If an MDS-E Series drive unit is not ready, set the parameters "#51101 SF_Disable" / "#51301 SF_SDisable" to "1" for all the axes of the said channel, and then turn OFF and ON the power. This prevents occurrence of this alarm. 			

13 Smart Safety Observation Alarm (V)

13.1 Smart Safety Observation Error (V01/V02/V03/V04/V05/V06/V07)

V04	EMG stop signal device illegal	0007	Emergency stop device index No.
Details <p>The channel No. or station No. of the emergency stop signal device (set by parameters) does not coincide with any contact point (channel/station No. specified by the safety I/O assignment parameters RIO CH No and RIO Station No.) of the safety I/O unit. The screen displays the index No. of the incorrectly set emergency stop signal device.</p> <p>0001: EMG_Dev1_ch to EMG_Dev1_bit 0002: EMG_Dev2_ch to EMG_Dev2_bit</p> Remedy <ul style="list-style-type: none"> • Change the channel, station or bit No. of emergency stop signal device to be one of the contact points of the safety I/O unit. And then turn OFF and ON the power. • When you change the setting of emergency stop signal device channel No. (EMG_Dev1_ch / EMG_Dev2_ch) to 0, and turn OFF and ON the power, the designation of emergency stop signal device is disabled, so this alarm is cleared. 			
V04	Safe IO assign para setting er	0009	Channel No.
Details <p>Safety I/O device assignment parameter is incorrect.</p> <ul style="list-style-type: none"> • The safety I/O device assignment parameter of the connected safety I/O unit is not set. • The safety I/O device assignment parameter is set for any disconnected safety I/O unit. • The set channel No. or station No. is overlapped. Remedy <ul style="list-style-type: none"> • Make sure which safety I/O unit is connected, set the safety I/O device assignment parameters, and then turn OFF and ON the power. 			
V05	SLS speed error	0001	Axis name
Details <p>During SLS observation, the command/FB speed has exceeded the safely-limited speed(*) and has not dropped below the speed limit within the SLS detection delay time (set by parameter). The screen displays the name of axis of this error.</p> <p>(*)Safely-limited speed = SLS speed tolerance x SLS speed override / 100</p> Remedy <ul style="list-style-type: none"> • This error can be cancelled by the safety reset signal while motor speed is under SLS limit. • If the SLS speed tolerance or SLS speed override (set by parameter) is lower than the assumption, change the parameter setting and turn OFF and ON the power. • If the SLS detection delay time (set by parameter) is shorter than the assumption, change the parameter setting. • Check the safety ladder to make sure that SLS speed tolerance and SLS speed override are changed in a timely manner. 			
V05	SLS deceleration error	0002	Axis name
Details <p>The command/FB speed has failed to decelerate to the safely-limited speed(*) or lower within a period of SLS deceleration observation time (set by parameter) after start of SLS observation. The screen displays the name of axis of this error.</p> <p>(*)Safely-limited speed = SLS speed tolerance x SLS speed override / 100</p> Remedy <ul style="list-style-type: none"> • This error can be cancelled by the safety reset signal while motor speed is under SLS limit. • If the SLS speed tolerance or SLS speed override (set by parameter) is lower than the assumption, change the parameter setting and turn OFF and ON the power. • If the SLS deceleration observation time (set by parameter) is shorter than the assumption, change the parameter setting. 			

13 Smart Safety Observation Alarm (V)

13.1 Smart Safety Observation Error (V01/V02/V03/V04/V05/V06/V07)

V05	SLP position error	0003	Axis name
Details <p>The command position/FB position has gone out of the SLP position tolerance range (set by parameter) during the SLP observation, and failed to return to the tolerance range within the SLP detection delay time (set by parameter). The screen displays the name of axis of this error.</p>			
Remedy <ul style="list-style-type: none"> ♦ This error can be cancelled by the safety reset signal while the axis is in the SLP position range. ♦ If the axis is out of the SLP position range, deactivate SLP observation, cancel this error using the safety reset signal, and then move the axis to a safe position in a manual mode. ♦ If the safely-limited position range (specified by the SLP position tolerance parameters) is smaller than the assumption, change the parameter settings and turn OFF and ON the power. ♦ If the SLP detection delay time (set by parameter) is shorter than the assumption, change the parameter setting. ♦ Check the safety ladder to make sure that SLP position tolerance is changed in a timely manner. 			
V05	SOS speed error	0004	Axis name
Details <p>The command/FB speed, which had exceeded the SOS stop speed (set by parameter) during SOS, has failed to drop to the SOS stop speed or lower within the SOS_V detection delay time (set by parameter). The screen displays the name of axis of this error.</p> <p>*If the conditions of two or more SOS-related alarms are met at a time, the notification priority order is as follows: SOS position deviation error > SOS travel distance error > SOS speed error.</p>			
Remedy <ul style="list-style-type: none"> ♦ This error can be cancelled by the safety reset signal while In SOS stop is ON. ♦ If In SOS stop is OFF, deactivate SOS, cancel this error using the safety reset signal, and then move the axis to a safe position in a manual mode. ♦ If the parameter of SOS stop speed is lower than the assumption, change the setting and turn OFF and ON the power. ♦ If the SOS_V detection delay time (set by parameter) is shorter than the assumption, change the parameter setting. 			
V05	SOS position deviation error	0005	Axis name
Details <p>The position deviation (difference between the command and FB positions), which had exceeded the SOS position deviation tolerance (set by parameter) during SOS, has failed to reduce to the SOS position deviation tolerance or smaller within the SOS_PD detection delay time (set by parameter). The screen displays the name of axis of this error.</p> <p>*If the conditions of two or more SOS-related alarms are met at a time, the notification priority order is as follows: SOS position deviation error > SOS travel distance error > SOS speed error.</p>			
Remedy <ul style="list-style-type: none"> ♦ Refer to the corrective actions of "SOS speed error" for how to cancel this error. ♦ If the SOS position deviation tolerance (set by parameter) is smaller than the assumption, change the setting and turn OFF and ON the power. ♦ If the SOS_PD detection delay time (set by parameter) is shorter than the assumption, change the parameter setting. 			

13 Smart Safety Observation Alarm (V)

13.1 Smart Safety Observation Error (V01/V02/V03/V04/V05/V06/V07)

V05	SOS travel distance error	0006	Axis name
Details The command/FB travel distance, which had exceeded the SOS travel distance tolerance (+/-) (set by parameter) during SOS, has failed to reduce to the SOS travel distance tolerance (+/-) or smaller within the SOS_P detection delay time (set by parameter). The screen displays the name of axis of this error. *If the conditions of two or more SOS-related alarms are met at a time, the notification priority order is as follows: SOS position deviation error > SOS travel distance error > SOS speed error.			
Remedy <ul style="list-style-type: none"> •Refer to the corrective actions of "SOS speed error" for how to cancel this error. •If the SOS travel distance tolerance (+/-) (set by parameter) is smaller than the assumption, change the setting and turn OFF and ON the power. •If the SOS_P detection delay time (set by parameter) is shorter than the assumption, change the parameter setting. 			
V05	SS1 deceleration error	0007	Axis name
Details The SS1 deceleration observation time (set by parameter) has elapsed with the command/FB speed exceeding the SOS stop speed (set by parameter) since the start of SS1. The screen displays the name of axis of this error.			
Remedy <ul style="list-style-type: none"> •This error can be cancelled by the safety reset signal while In SS1 stop is ON. •If the SS1 deceleration observation time (set by parameter) is shorter than the assumption, change the parameter setting. 			
V05	SS2 deceleration error	0008	Axis name
Details The command/FB speed has been exceeding the SOS stop speed (set by parameter) for a period of SS2 deceleration observation time (set by parameter) since the start of SS2. The screen displays the name of axis of this error.			
Remedy <ul style="list-style-type: none"> •Deactivate SS2, cancel this error using the safety reset signal, and then move the axis to a safe position in a manual mode. •If the SS2 deceleration observation time (set by parameter) is shorter than the assumption, change the parameter setting. 			
V06	Safety external EMG stop is ON	0001	
Details Emergency stop signal is OFF (open status), although Safety external emergency stop is enabled.			
Remedy <ul style="list-style-type: none"> •Ensure the safety of the machine, and then turn the emergency stop signal ON (close status). 			
V07	DRV safe circuit error	Error No.	Axis name
Details The drive unit's internal safety circuit has caused abnormal operation. The error number corresponding to the contents of abnormal operation appears.			
Remedy <ul style="list-style-type: none"> •Drive unit may be damaged. Replace the drive unit. 			

13 Smart Safety Observation Alarm (V)

13.2 Smart Safety Observation Warning (V50/V51/V52/V53/V54)

13.2 Smart Safety Observation Warning (V50/V51/V52/V53/V54)

V50	SSM hysteresis setting error	0001	Axis name
Details The SSM hysteresis width (set by parameter) is greater than the SSM speed (set by parameter). The screen displays the name of axis of this error.			
Remedy ♦Change the SSM hysteresis width parameter to be a smaller value than the SSM speed.			
V50	Safe absol. posn unestablished	0002	Axis name
Details ♦After enabling SLP/SCA (Parameter SLP_Enable/SCA_Enable is 1), the Safety absolute position has never been established. ♦In SLP/SCA encoder diagnosis during power OFF, [saved position at power shut OFF] and [restored position at power ON] are inconsistent. While this alarm is ON, SLP/SCA will not operate. Displays the name of axis of this error.			
Remedy ♦This alarm can be cancelled by turning ON the Safety absolute position check signal. Before turning ON the Safety absolute position check signal, however, move the axis by manual operation to the position where the coordinate value is clear (the position that is marked or the reference position etc.) (When in the relative position detection system, it requires to operate reference position return to establish the reference position.) then compare the actual position and the displayed position to confirm both positions are corresponding.			
V51	SBT start disabled	0001	Factor No.
Details When turning ON the SBT start signal (SBTSTEXm / SBTSTMOM), the test start condition are not met. Displays the factor why the brake test start is impossible * When there are multiple factors, the smaller item is shown. 0001: part systems in automatic operation 0002: not in in-position 0003: in servo OFF state. 0004: in current limit 0005: the secondary axis in the synchronous control 0006: in superimposition control 0007: in arbitrary axis exchange control 0008: in mixed control 0009: Parameter for SBT error 000A: reference position establishment incomplete 000B: applies exclusive control of SBT 000C: the secondary axis SBT disabled 000D: the secondary axis SBT start disabled 000E: the secondary axis in single method			
Remedy ♦Check the start-enabled condition of the brake test. Eliminate the cause of the alarm, then enable the SBT start signal to start the brake test.			
V51	SBT warning 1	0002	Axis name
Details The axis movement amount exceeded the tolerable value in external brake test pattern 1. Displays the name of axis with the error.			
Remedy ♦Move the axis to safe position by manual operation. Take corrective action to the brake after the power OFF. Then turn power ON and carry out the brake test again. This alarm will be cancelled when the test completes normally. ♦This alarm can be cancelled with the safety reset signal. The external brake SBT incomplete signal (SBTN-FEXm), however, remains ON.			

13 Smart Safety Observation Alarm (V)

13.2 Smart Safety Observation Warning (V50/V51/V52/V53/V54)

V51	SBT warning 4	0005	Axis name
Details The axis movement amount exceeded the tolerable value in the test pattern 1 of motor brake test. Displays the name of axis with the error.			
Remedy <ul style="list-style-type: none"> • Move the axis to safe position by manual operation. Take corrective action to the brake after the power OFF. Then turn power ON and carry out the brake test again. This alarm will be cancelled when the test completes normally. • This alarm can be cancelled with the safety reset signal. The external brake SBT incomplete signal (SBTN-FEXm), however, remains ON. When this alarm is cancelled with the safety reset signal, however, the motor brake SBT incomplete signal (SBTNFMOM) remains ON. 			
V51	SBT warning 5	0006	Axis name
Details The axis movement amount exceeded the tolerable value in the test pattern 2 of motor brake test. Displays the name of axis with the error.			
Remedy <ul style="list-style-type: none"> • Move the axis to safe position by manual operation. Take corrective action to the brake after the power OFF. Then turn power ON and carry out the brake test again. This alarm will be cancelled when the test completes normally. • This alarm can be cancelled with the safety reset signal. The external brake SBT incomplete signal (SBTN-FEXm), however, remains ON. When this alarm is cancelled with the safety reset signal, however, the motor brake SBT incomplete signal (SBTNFMOM) remains ON. 			
V51	SBT warning 6	0007	Axis name
Details The axis movement amount exceeded the tolerable value in the test pattern 3 of motor brake test. Displays the name of axis with the error.			
Remedy <ul style="list-style-type: none"> • Move the axis to safe position by manual operation. Take corrective action to the brake after the power OFF. Then turn power ON and carry out the brake test again. This alarm will be cancelled when the test completes normally. • This alarm can be cancelled with the safety reset signal. The external brake SBT incomplete signal (SBTN-FEXm), however, remains ON. When this alarm is cancelled with the safety reset signal, however, the motor brake SBT incomplete signal (SBTNFMOM) remains ON. 			
V52	PLC safety stop is active	0001	Axis name
Details A PLC input signal "Safe stop 1 request" or "Safe torque off request" is OFF (normal close). The screen displays the name of axis for which the said signal is OFF.			
Remedy <ul style="list-style-type: none"> • Ensure the safety of the machine, and then turn ON either Safe stop 1 request signal or Safe torque off request signal. 			

13 Smart Safety Observation Alarm (V)

13.2 Smart Safety Observation Warning (V50/V51/V52/V53/V54)

V53	Warning on 24Hr continuous ON	0001	Unit info
Details Output signal of the safety I/O unit has been kept ON for 24 hours or longer. Displays the information of the unit which is subject to the warning. bit24-27: Unit No. bit0-15: Signal BIT (*) The unit No. indicates the unit in which an alarm occurs. The channel No. and station No. to which the unit is connected can be confirmed by the following parameters. Channel No.: $\#51501 + 10 \times (\text{Unit No.} - 1)$ Station No.: $\#51502 + 10 \times (\text{Unit No.} - 1)$			
Remedy ♦Turn OFF the output signal concerned through the user safety sequence, or use the output OFF check function to make sure that the output signal turns OFF.			
V54	Simple test mode is active	0001	
Details ♦Smart safety observation target axis (the parameters "#51101 SF_Disable" = 0 / "#51301 SF_SDisable" = 0) is defined as a hypothetical axis (the parameter "#51015 safe_drv_test" = 1). In this case some alarms fail to occur, thus avoid this setting while a drive unit is being connected. ♦NC system is set to a simulation mode (the parameter "#1168 test" = 1). During this mode some alarms fail to occur, thus do not use this mode while a safety I/O unit is connected.			
Remedy ♦Connect MDS-E Series drive to all the axes subject to safety observation, set the parameter ("#51015 safe_drv_test" = 0) and then turn OFF and ON the power. ♦Connect a safety I/O unit, set the parameter ("#1168 test" = 0) and then turn OFF and ON the power.			

13 Smart Safety Observation Alarm (V)

13.2 Smart Safety Observation Warning (V50/V51/V52/V53/V54)

Parameter

User Parameters

14 User Parameters

14.1 Machining Parameters

The parameters with "(PR)" requires the CNC to be turned OFF after the settings. Turn the power OFF and ON to enable the parameter settings.

14.1 Machining Parameters

#1026	base_I	Base axis I
	<p>Set the names of the basic axes that compose the plane.</p> <p>Set the axis name set in "#1013 axname".</p> <p>If all three items ("base_I", "base_J" and "base_K") do not need to be set, such as for 2-axis specifications, input "0", and the parameter will be blank.</p> <p>Normally, when X, Y and Z are specified respectively for base_I, _J, _K, the following relation will be established:</p> <p>G17: X-Y</p> <p>G18: Z-X</p> <p>G19: Y-Z</p> <p>Or specify any other axis name desired.</p> <p>---Setting range---</p> <p>Axis names such as X, Y or Z</p>	
#1027	base_J	Base axis J
	<p>Set the names of the basic axes that compose the plane.</p> <p>Set the axis name set in "#1013 axname".</p> <p>If all three items ("base_I", "base_J" and "base_K") do not need to be set, such as for 2-axis specifications, input "0", and the parameter will be blank.</p> <p>Normally, when X, Y and Z are specified respectively for base_I, _J, _K, the following relation will be established:</p> <p>G17: X-Y</p> <p>G18: Z-X</p> <p>G19: Y-Z</p> <p>Or specify any other axis name desired.</p> <p>---Setting range---</p> <p>Axis names such as X, Y or Z</p>	
#1028	base_K	Base axis K
	<p>Set the names of the basic axes that compose the plane.</p> <p>Set the axis name set in "#1013 axname".</p> <p>If all three items ("base_I", "base_J" and "base_K") do not need to be set, such as for 2-axis specifications, input "0", and the parameter will be blank.</p> <p>Normally, when X, Y and Z are specified respectively for base_I, _J, _K, the following relation will be established:</p> <p>G17: X-Y</p> <p>G18: Z-X</p> <p>G19: Y-Z</p> <p>Or specify any other axis name desired.</p> <p>---Setting range---</p> <p>Axis names such as X, Y or Z</p>	
#1029	aux_I	Flat axis I
	<p>Set the axis name when there is an axis parallel to "#1026 base_I".</p> <p>---Setting range---</p> <p>Axis names such as X, Y or Z</p>	

14 User Parameters

14.1 Machining Parameters

#1030	aux_J	Flat axis J
Set the axis name when there is an axis parallel to "#1027 base_J".		
---Setting range---		
Axis names such as X, Y or Z		
#1031	aux_K	Flat axis K
Set the axis name when there is an axis parallel to "#1028 base_K".		
---Setting range---		
Axis names such as X, Y or Z		
#1084	RadErr	Arc error
Set the tolerable error range when the end point deviates from the center coordinate in the circular command.		
---Setting range---		
0 to 1.000 (mm)		
#1171	taprov	Tap return override
Set the tap return override value for the synchronous tapping.		
When "0" is set, it will be regarded as 100%.		
---Setting range---		
0 to 100 (%)		
#1185	spd_F1	F1 digit feedrate F1
Set the feedrate for the F command in the F 1-digit command ("#1079 F1digit" is set to "1").		
Feedrate when F1 is issued (mm/min).		
When "#1246 set08/bit6" is set to "1" and F 1-digit feed is commanded, the feedrate can be increased/decreased by operating the manual handle.		
---Setting range---		
0 to 1000000 (mm/min)		
#1186	spd_F2	F1 digit feedrate F2
Set the feedrate for the F command in the F 1-digit command ("#1079 F1digit" is set to "1").		
Feedrate when F2 is issued (mm/min).		
When "#1246 set08/bit6" is set to "1" and F 1-digit feed is commanded, the feedrate can be increased/decreased by operating the manual handle.		
---Setting range---		
0 to 1000000 (mm/min)		
#1187	spd_F3	F1 digit feedrate F3
Set the feedrate for the F command in the F 1-digit command ("#1079 F1digit" is set to "1").		
Feedrate when F3 is issued (mm/min).		
When "#1246 set08/bit6" is set to "1" and F 1-digit feed is commanded, the feedrate can be increased/decreased by operating the manual handle.		
---Setting range---		
0 to 1000000 (mm/min)		
#1188	spd_F4	F1 digit feedrate F4
Set the feedrate for the F command in the F 1-digit command ("#1079 F1digit" is set to "1").		
Feedrate when F4 is issued (mm/min).		
When "#1246 set08/bit6" is set to "1" and F 1-digit feed is commanded, the feedrate can be increased/decreased by operating the manual handle.		
---Setting range---		
0 to 1000000 (mm/min)		

14 User Parameters

14.1 Machining Parameters

#1189	spd_F5	F1 digit feedrate F5
	Set the feedrate for the F command in the F 1-digit command ("F1079 F1digit" is set to "1"). Feedrate when F5 is issued (mm/min). When "#1246 set08/bit6" is set to "1" and F 1-digit feed is commanded, the feedrate can be increased/decreased by operating the manual handle. ---Setting range--- 0 to 1000000 (mm/min)	
#1506	F1_FM	Upper limit of F 1-digit feedrate
	Set the maximum value up to which the F 1-digit feedrate can be changed. ---Setting range--- 0 to 1000000 (mm/min)	
#1507	F1_K	F 1-digit feedrate change constant
	Set the constant that determines the speed change rate per manual handle graduation in F 1-digit feedrate change mode. ---Setting range--- 0 to 32767	
#8001	WRK COUNT M	
	Set the M code for counting the number of the workpiece repeated machining. The number of the M-codes set by this parameter is counted. The No. will not be counted when set to "0". ---Setting range--- 0 to 999	
#8002	WRK COUNT	
	Set the initial value of the number of workpiece machining. The number of current workpiece machining is displayed. ---Setting range--- 0 to 999999	
#8003	WRK COUNT LIMIT	
	Set the maximum number of workpiece machining. A signal will be output to PLC when the number of machining times is counted to this limit. ---Setting range--- 0 to 999999	
#8004	SPEED	
	Set the feedrate during automatic tool length measurement. ---Setting range--- 1 to 1000000 (mm/min)	
#8005	ZONE r	
	Set the distance between the measurement point and deceleration start point. ---Setting range--- 0 to 99999.999 (mm)	
#8006	ZONE d	
	Set the tolerable range of the measurement point. An alarm will occur when the sensor signal turns ON before the range, set by this parameter, has not been reached from the measurement point, or when the signal does not turn ON after the range is passed. ---Setting range--- 0 to 99999.999 (mm)	

14 User Parameters

14.1 Machining Parameters

#8007	OVERRIDE
Set the override value for automatic corner override.	
---Setting range---	
0 to 100 (%)	
#8008	MAX ANGLE
Set the maximum corner opening angle where deceleration should start automatically.	
When the angle is larger than this value, deceleration will not start.	
---Setting range---	
0 to 180 (°)	
#8009	DSC. ZONE
Set the position where deceleration starts at the corner.	
Designate at which length point before the corner deceleration should start.	
---Setting range---	
0 to 99999.999 (mm)	
#8010	ABS. MAX.
Set the maximum value when inputting the tool compensation amount.	
A value exceeding this setting value cannot be set.	
Absolute value of the input value is set.	
(If a negative value is input, it is treated and set as a positive value.)	
When "0" is set, this parameter is disabled.	
---Setting range---	
0 to 9999.999 (mm)	
(Input setting increment applies)	
#8011	INC. MAX.
Set the maximum value for when inputting the tool compensation amount in the incremental mode.	
A value exceeding this setting value cannot be set.	
Absolute value of the input value is set.	
(If a negative value is input, it is treated and set as a positive value.)	
When "0" is set, this parameter is disabled.	
---Setting range---	
0 to 9999.999 (mm)	
(Input setting increment applies)	
#8038	Path recog. range
Path recognition range	
Specify the range to recognize the tool paths adjoining to the command position when the smooth fairing function is ON.	
If "0" is set, the range will be 1.000 (mm).	
---Setting range---	
0 to 100.000 (mm)	
#8039	Comp. range limit
Compensation distance tolerance	
Specify the upper limit of the distance between the command position and compensation position when the smooth fairing function is ON.	
If you specify a negative value, operation is conducted with no tolerance limit.	
If "0" is set, the tolerance will be 0.005 (mm).	
---Setting range---	
-1.000 to 100.000 (mm)	

14 User Parameters

14.1 Machining Parameters

#8041	C-rot.R
Set the length from the center of the normal line control axis to the tool tip. This is used to calculate the turning speed at the block joint. This is enabled during the normal line control type II. ---Setting range--- 0.000 to 99999.999 (mm)	
#8042	C-ins.R
Set the radius of the arc to be automatically inserted into the corner during normal line control. This is enabled during the normal line control type I. ---Setting range--- 0.000 to 99999.999 (mm)	
#8043	Tool HDL FD OFS
Set the length from the tool holder to the tool tip. ---Setting range--- 0.000 to 99999.999 (mm)	
#8044	UNIT*10
Set the command increment scale. The scale will be "1" when "0" is set. ---Setting range--- 0 to 10000 (fold) 0: One fold	
#8045	Varying spd thread
Select whether to enable the variable speed thread cutting function. 0: Disable 1: Enable	
#8061	G76 THICK
Set the minimum cutting amount for compound type thread cutting cycle (G76). The value set in this parameter will be applied when the cutting amount in compound thread cutting cycle (G76) without Q command is smaller than that in this parameter. This parameter is valid only when "#1222 aux06/bit4" is set to "1". ---Setting range--- 0.000 to 99999.999 (mm)	
#8069	G76G78in-posn wdt.
Not used. Set to "0.000".	
#8070	Turning cycle mode
1: If a zero-travel distance block is given during turning cycle mode (G90, G92 or G94), the turning cycle is executed again. 0: If a zero-travel distance block is given during turning cycle mode (G90, G92 or G94), the turning cycle is not executed.	
#8071	3-D CMP (for M system only)
Set the value of the denominator constants for 3-dimensional tool radius compensation. Set the value of "p" in the following formula. $V_x = i \times r/p$, $V_y = j \times r/p$, $V_z = k \times r/p$ Vx, Vy, Vz: X, Y, and Z axes or vectors of horizontal axes i, j, k: Program command value r: Offset $p = \sqrt{i^2 + j^2 + k^2}$ when the set value is "0". ---Setting range--- 0 to 99999.999	

14 User Parameters

14.1 Machining Parameters

#8072	SCALING P (for M system only)
Set the scale factor for reduction or magnification in the machining program specified by G50 or G51 command.	
This parameter will be valid when the program specifies no scale factor.	
---Setting range---	
-99.999999 to 99.999999	
#8075	SpiralEndErr (for M system only)
Set the tolerable error range (absolute value) when the end point position, commanded by the spiral or conical interpolation command with the command format type 2, differs from the end point position obtained from the speed and increment/decrement amount.	
---Setting range---	
0 to 99999.999 (mm)	
#8077	Involute error
Set the tolerable error between the involute curve through the start point and the involute curve through the end point.	
---Setting range---	
0.000 to 99999.999 (mm)	
#8078	Screen Saver Timer
Set the period of time before turn-OFF of the display unit backlight.	
When "0" is set, the backlight is not turned OFF.	
It is possible to turn OFF the backlight of the monitor screen as well by using the [SHIFT] + [C.B] keys, unless its window is displayed.	
---Setting range---	
1 to 60 (min)	
0: The backlight is not turned OFF	
#8081	Gcode Rotat (for L system only)
Set the rotation angle when the coordinate rotation by program is commanded.	
This parameter is enabled when "1" is set in "#1270 ext06/bit5" (Coordinate rotation angle without command).	
This parameter is set as absolute command regardless of the "#8082 G68.1 R INC" setting. If the rotation angle is designated by an address R in G68.1 command, the designation by program will be applied.	
---Setting range---	
-360.000 to +360.000 (°)	
#8082	G68.1 R INC (for L system only)
Select absolute command or incremental command to use for the rotation angle command R at L-system coordinate rotation.	
0: Use absolute command in G90 modal, incremental command in G91 modal	
1: Always use incremental command	
(Note) If G91 does not exist in the G code system, the command type is decided by this parameter only.	
#8100	Chip removal speed
Specify the reverse speed of chip removal operation.	
When "0" is set, this setting is disabled.	
The reverse speed will be limited with the parameters "the maximum spindle rotation speed" "#3005 smax1" to "#3008 smax4" of the selected gear.	
---Setting range---	
0 to 999999 (r/min)	
#8621	Coord rot plane (H)
Set the plane (horizontal axis) for coordinate rotation control.	
Usually, set the name of the 1st axis.	
When this parameter is not set, the coordinate rotation function will not work.	
---Setting range---	
Axis name	

14 User Parameters

14.1 Machining Parameters

#8622	Coord rot plane (V)
Set the plane (vertical axis) for coordinate rotation control. Usually, set the name of the 2nd axis. When this parameter is not set, the coordinate rotation function will not work. ---Setting range--- Axis name	
#8623	Coord rot centr (H)
Set the center coordinates (horizontal axis) for coordinate rotation control. ---Setting range--- -99999.999 to 99999.999 (mm)	
#8624	Coord rot centr (V)
Set the center coordinates (vertical axis) for coordinate rotation control. ---Setting range--- -99999.999 to 99999.999 (mm)	
#8625	Coord rot vctr (H)
Set the vector components (horizontal axis) for coordinate rotation control. When this parameter is set, the coordinate rotation control angle (#8627) will be automatically calculated. ---Setting range--- -99999.999 to 99999.999 (mm)	
#8626	Coord rot vctr (V)
Set the vector components (vertical axis) for coordinate rotation control. When this parameter is set, the coordinate rotation control angle (#8627) will be automatically calculated. ---Setting range--- -99999.999 to 99999.999 (mm)	
#8627	Coord rot angle
Set the rotation angle for coordinate rotation control. When this parameter is set, the coordinate rotation vector (#8625, #8626) will be "0". ---Setting range--- -360.000 to 360.000 (°)	
#8631	GraphicsBaseAxis_I
Specify the name of base axis for the graphics. Select an alphabetical letter from A to Z. When there is no need to set all three parameters (GraphicsBaseAxis_I, GraphicsBaseAxis_J and GraphicsBaseAxis_K) (e.g. for two-axis specifications), enter "0" to leave the parameter blank. Normally, when X, Y and Z are specified in "GraphicsBaseAxis_I", "GraphicsBaseAxis_J" and "GraphicsBaseAxis_K" respectively, the following relationship will be established: G17: X-Y G18: Z-X G19: Y-Z Or specify any other axis name desired. ---Setting range--- 0 or from A to Z	

14 User Parameters

14.1 Machining Parameters

#8632	GraphicsBaseAxis_J
<p>Specify the name of base axis for the graphics.</p> <p>Select an alphabetical letter from A to Z.</p> <p>When there is no need to set all three parameters (GraphicsBaseAxis_I, GraphicsBaseAxis_J and GraphicsBaseAxis_K) (e.g. for two-axis specifications), enter "0" to leave the parameter blank.</p> <p>Normally, when X, Y and Z are specified in "GraphicsBaseAxis_I", "GraphicsBaseAxis_J" and "GraphicsBaseAxis_K" respectively, the following relationship will be established:</p> <p>G17: X-Y</p> <p>G18: Z-X</p> <p>G19: Y-Z</p> <p>Or specify any other axis name desired.</p> <p>---Setting range---</p> <p>0 or from A to Z</p>	
#8633	GraphicsBaseAxis_K
<p>Specify the name of base axis for the graphics.</p> <p>Select an alphabetical letter from A to Z.</p> <p>When there is no need to set all three parameters ("GraphicsBaseAxis_I", "GraphicsBaseAxis_J" and "GraphicsBaseAxis_K") (e.g. for two-axis specifications), enter "0" to leave the parameter blank.</p> <p>Normally, when X, Y and Z are specified in "GraphicsBaseAxis_I", "GraphicsBaseAxis_J" and "GraphicsBaseAxis_K" respectively, the following relationship will be established:</p> <p>G17: X-Y</p> <p>G18: Z-X</p> <p>G19: Y-Z</p> <p>Or specify any other axis name desired.</p> <p>---Setting range---</p> <p>0 or from A to Z</p>	
#8701	Tool length
<p>Set the length to the touch tool tip.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p>	
#8702	Tool Dia
<p>Set the diameter of the sphere at the touch tool tip.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p>	
#8703	OFFSET X
<p>This sets the deviation amount (X direction) from the touch tool center to the spindle center.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p>	
#8704	OFFSET Y
<p>Set the deviation amount (Y direction) from the touch tool center to the spindle center.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p>	
#8705	RETURN
<p>Set the one-time return distance for contacting again.</p> <p>---Setting range---</p> <p>0 to 99999.999 (mm)</p>	
#8706	FEED
<p>Set the feedrate when contacting again.</p> <p>---Setting range---</p> <p>1 to 60000 (mm/min)</p>	

14 User Parameters

14.1 Machining Parameters

#8707	Skip past amout (H)
Set the difference (horizontal axis direction) between the skip read value and actual skip position.	
---Setting range---	
-99999.999 to 99999.999 (mm)	
#8708	Skip past amout (V)
Set the difference (vertical axis direction) between the skip read value and actual skip position.	
---Setting range---	
-99999.999 to 99999.999 (mm)	
#8709	EXT work sign rvs
Reverse the sign of external workpiece coordinate.	
Select when using the external workpiece coordinate system with Z shift.	
0: External workpiece offset without sign reversal	
1: External workpiece offset with sign reversal	
#8710	EXT work ofs invld
Set whether to enable external workpiece offset subtraction when setting the workpiece coordinate offset.	
0: Not subtract the external workpiece offset. (Conventional specification)	
1: Subtract the external workpiece offset.	
#8711	TLM L meas axis
Set the tool length measurement axis.	
Set the "#1022 axname2" axis name.	
---Setting range---	
Axis name	
(Note) If the axis name is illegal or not set, the 3rd axis name will be set as default.	
#8712	TLM D meas axis
Set the tool diameter measurement axis.	
Set the "#1022 axname2" axis name.	
---Setting range---	
Axis name	
(Note) If the axis name is illegal or not set, the 1st axis name will be set as default.	
#8713	Skip coord. Switch (For M system only)
Select the coordinate system for reading skip coordinate value.	
Select whether to read the skip coordinate in the workpiece coordinate system or in the feature coordinate system during inclined surface machining command.	
Select whether to read the skip coordinate in the workpiece coordinate system or in the workpiece installation coordinate system during workpiece installation error compensation.	
0: Workpiece coordinate system	
1: Feature coordinate system/Workpiece installation coordinate system	
#8714	Thrdrecut lead ax
Specify the name of lead axis that performs thread recutting.	
If any nonexistent axis name is specified, the 1st axis of the part system is used as a lead axis for thread recutting.	
If the parameter "#8714 Thrdrecut lead ax" is unspecified, Z axis is set as the parameter value at power ON.	
---Setting range---	
A,B,C,H,U,V,W,X,Y,Z	
#8715	Thread recut SP#
Specify the No. or name of spindle that performs thread recutting.	
If 0 or any nonexistent spindle No. or name is specified, the 1st spindle is used for thread recutting.	
---Setting range---	
Spindle No. method: 0 to 8	
Spindle name method: 0 to 9	
(Default: 0)	

14 User Parameters

14.1 Machining Parameters

(PR)	#8716	EXT/Wrksft Share (for L system only)
		<p>Set this parameter to "1" if you wish to disable the external workpiece coordinate system offset. This parameter is enabled when "#11056 Workshift invalid" (Workpiece coordinate system shift OFF) is "0".</p> <p>0: Use the external work coordinate offset (EXT) to implement compensation</p> <p>1: Implement compensation without using the external work coordinate offset (EXT)</p>
	#8717	WE measure wk zero
		<p>Specify the workpiece zero position that is used for measuring the workpiece installation error.</p> <p>0: Workpiece center</p> <p>1: Apex in X-, Y- direction</p> <p>2: Apex in X+, Y- direction</p> <p>3: Apex in X+, Y+ direction</p> <p>4: Apex in X-, Y+ direction</p>
	#8718	WE meas. wk coord
		<p>Specify the workpiece coordinate system in which you input the workpiece coordinates for workpiece installation error measurement.</p> <p>Set the number part of the coordinate system modal. (54, 54.1, 55, 56, 57, 58 or 59)</p> <p>---Setting range---</p> <p>0, 54 to 59</p>
	#8719	WE meas. ext wk No
		<p>If workpiece installation error measurement is performed in the extended workpiece coordinate system, specify the address P value of G54.1.</p> <p>If "#8718 WE meas. wk coord" is not 54.1, there is no need for setting this parameter.</p> <p>---Setting range---</p> <p>0 to 300</p>
	#8720	WE mea. wk X-width
		<p>Specify the X direction width of the rectangular workpiece for which workpiece installation error measurement is performed.</p> <p>If the sensor's accessible range is small due to jig etc., specify the width of the portion that is stuck out of the jig.</p> <p>---Setting range---</p> <p>0.000 to 99999.999 (mm)</p>
	#8721	WE mea. wk Y-width
		<p>Specify the Y direction width of the rectangular workpiece for which workpiece installation error measurement is performed.</p> <p>If the sensor's accessible range is small due to jig etc., specify the width of the portion that is stuck out of the jig.</p> <p>---Setting range---</p> <p>0.000 to 99999.999 (mm)</p>
	#8722	WE mea. wk Z-width
		<p>Specify the Z direction width of the rectangular workpiece for which workpiece installation error measurement is performed.</p> <p>If the sensor's accessible range is small due to jig etc., specify the width of the portion that is stuck out of the jig.</p> <p>---Setting range---</p> <p>0.000 to 99999.999 (mm)</p>
	#8723	WK inst. err comp#
		<p>Specify the workpiece installation error No. for write during the workpiece installation error measurement.</p> <p>Set "1" for G54.4 P1.</p> <p>---Setting range---</p> <p>0 to 7</p>

14 User Parameters


14.1 Machining Parameters

#8724	Sensor T L comp No
Specify the tool length compensation No. of the touch probe to be used for measurement of rotation center error and workpiece installation error.	
Set the touch probe offset in the said number before measurement.	
If the specified offset is significantly large, the probe may be damaged.	
---Setting range---	
0 to 999	
#12066	Tolerance ctrl ON
Select whether to enable the tolerance control.	
0: Disable	
1: Enable	
(Note) Tolerance control is available only under SSS control.	
To enable this function, set "#8090 SSS ON" to "1".	
#12067	Tolerance spd coef
Set the compensation coefficient to adjust a path error or clamp speed in the corner while tolerance control is ON.	
This parameter is enabled during tolerance control. Thus set this parameter if you wish to use different clamp speed according to ON/OFF of tolerance control.	
When "0" is set in this parameter, the standard value (100%) is applied.	
---Setting range---	
0 to 2000 (%)	
#12068	Smoothing range
Spline interpolation 2: Smoothing range	
Normally set "0" in this parameter.	
If you run a program with micro segments and its reciprocating paths are uneven, set the parameter to about 3 to 5 times the length of the programmed segments.	
---Setting range---	
0.000 to 10.000 (mm)	
#12069	Corner angle
Tolerance control: Corner recognition angle	
Specify the corner recognition angle. Normally set to "0".	
---Setting range---	
0.000 to 180.000 (°)	
#19001	Syn.tap(,S)cancel
0: Retain the spindle speed (,S) in synchronous tap return	
1: Cancel the spindle speed (,S) in synchronous tap return with G80	
The same value as "#1223 aux07/bit6" will be reflected. When either setting changes, the other will change accordingly.	
#19002	Zero-point mark
Select the position for displaying the zero point mark in the graphic trace and 2D check.	
0: Machine coordinates zero point (same as conventional method)	
1: Workpiece coordinate zero point	
The same value as "#1231 set03/bit4" will be reflected. When either setting changes, the other will change accordingly.	
#19003	PRG coord rot type
Select the start point of the first travel command after coordinate rotation by program is commanded.	
0: Calculate the end position using the current position on the local coordinate system before rotating, without rotating the start point in accordance with the coordinates rotation.	
1: Calculate the end position, assuming that the start point rotates in accordance with the coordinates rotation.	

14 User Parameters

14.1 Machining Parameters

	#19004 Tap feedrate limit
	Set the upper limit of the cutting feed rate in synchronous tapping.
	---Setting range---
	0 to 1000 (mm/rev)
	(Note) Setting "0" disables this parameter.
	When the commanded cutting feed rate in synchronous tapping exceeds this setting, a program error (P184) will occur.
	#19005 manual Fcmd2 clamp
	Set a clamp speed coefficient (%) for manual speed command 2.
	The feed rate is clamped at the command feed rate or rapid traverse rate for automatic operation, which was multiplied by this parameter's value.
	(Note) This setting is valid only for manual speed command 2.
	---Setting range---
	0 to 1000 (%)
	0: 100% (Default value)
(PR)	#19006 EOR Disable
	Set whether to handle an EOR(%) in machining program as the end of program in automatic operation, graphic check, program transfer to NC memory/NC memory2, program editing, and buffer correction.
	Tape operation, Computer Link B, and serial input/output are not included.
	0: An EOR(%) is handled as the end of machining program.
	1: An EOR(%) is not handled as the end of machining program. The program will be read to the end of file.
	#19007 Prg check constant
	Set the speed constant to be used for the program check operation function.
	---Setting range---
	0 to 60000
	#19008 PRM coord rot type
	Select the start point of the initial travel command after parameter coordinate rotation.
	0: Calculate the end position, assuming that the start point rotates in accordance with the coordinates rotation.
	1: Calculate the end position using the current position on the local coordinate system before rotating, without rotating the start point in accordance with the coordinates rotation.
	#19009 Corner check angle
	Corner deceleration check angle
	Specify the internal angle formed by two blocks, at or below which the block joint is determined as a corner and the latter block's start timing is controlled accordingly while the automatic error detect is ON.

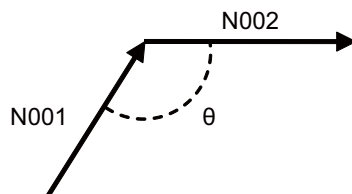


---Setting range---

0 to 180 (°)

14 User Parameters

14.1 Machining Parameters
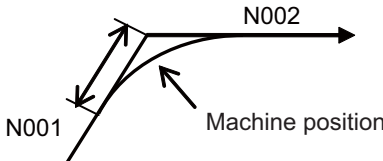
#19010	Corner check width	
<p>Corner deceleration check width When deceleration of the currently executed block has started and a position error width between the programmed end point and machine position has reduced to this parameter or less, the control starts execution of the next block.</p> <div></div> <p>---Setting range---</p> <p>0 to 99.999 (mm)</p>		
#19012	Ana-Tap-Voltage1	
<p>Analog spindle synch tap: Voltage output magnification (at cutting) Specify the spindle speed magnification to be applied during cutting in analog spindle synchronous tapping. When 0 is set, the magnification is taken as 100%. If the spindle fails to rotate as commanded due to such as cutting load, set this parameter to correct the speed.</p> <p>---Setting range---</p> <p>0 to 200 (%)</p>		
#19013	Ana-Tap-Voltage2	
<p>Analog spindle synch tap: Voltage output magnification (at retract) Specify the spindle speed magnification to be applied during retract in analog spindle synchronous tapping. When 0 is set, the magnification is taken as 100%. If the spindle fails to rotate as commanded due to such as cutting load, set this parameter to correct the speed.</p> <p>---Setting range---</p> <p>0 to 200 (%)</p>		
#19014	G04 P factor	
<p>The value of address P of G04 with no decimals is multiplied by the value determined by this parameter. This parameter is only relevant only when "#8112 DECIMAL PNT-P" is "0", or when "#1078 Decpt2" is "0". The value is determined as 10ⁿ (n = -3 to 3).</p> <p>-3: 1/1000 -2: 1/100 -1: 1/10 0: 1 1: 10 2: 100 3: 1000</p>		
#19019	fixpro G04P factor	Fixed cycle G04 P factor valid
<p>Select whether to enable the setting of "#19014 G04 P factor" for G04 commands in a fixed cycle subprogram.</p> <p>0: Disable 1: Enable</p>		
#19101	Stylus sphere dia.	
<p>Specify the diameter of stylus sphere that is used for measurement of rotation center error or workpiece installation error. If the set value is significantly different from the actual diameter, the sensor may be damaged.</p> <p>---Setting range---</p> <p>0.000, 0.100 to 10.000 (mm)</p>		

14 User Parameters

14.1 Machining Parameters

	#19102	Stylus length
		<p>Specify the length of stylus that is used for workpiece installation error measurement.</p> <p>If the set value is significantly different from the actual length, the sensor may be damaged.</p> <p>---Setting range---</p> <p>0.000 to 99999.999 (mm)</p>
	#19103	Sensor over-travel
		<p>Specify the over-travel distance of the sensor that is used for measurement of rotation center error or workpiece installation error. (allowable excess of sensor, over-stroke)</p> <p>Set the smallest over-travel distance among all the axes.</p> <p>The initial approaching speed to the reference sphere is determined according to the over-travel distance.</p> <p>If the set over-travel distance is greater than the actual distance, the sensor may be damaged.</p> <p>---Setting range---</p> <p>0.000 to 100.000 (mm)</p>
	#19104	G12.1 no reversal
		<p>Select whether to retain the rotation direction of C axis when circular interpolation takes place near the workpiece zero during milling interpolation or during polar coordinate interpolation.</p> <p>0: Not retain (the direction requiring the smaller amount of rotation)</p> <p>1: Retain the rotation direction</p>
	#19105	G12.1 zero range
		<p>Specify the range to be determined as workpiece zero when #19104 is set to "1".</p> <p>---Setting range---</p> <p>0 to 1.000 (mm)</p>
	#19200+5(n-1)	CLC desired load n
		<p>Specify the desired load during the cutting load control. (n = 1 to 8)</p> <p>During the cutting load control, feedrate is controlled so that the cutting load becomes the set value.</p> <p>---Setting range---</p> <p>0 to 327 (%)</p>
	#19201+5(n-1)	CLC detect.load n
		<p>Specify the minimum load to be treated as in cutting state. (n = 1 to 8)</p> <p>When the spindle load value is equal to or greater than the setting value, cutting load control is executed.</p> <p>---Setting range---</p> <p>0 to 327 (%)</p>
	#19202+5(n-1)	CLC max.feedrate n
		<p>Specify the maximum feedrate during the cutting load control as a percentage (%) of the command speed. (n = 1 to 8)</p> <p>When "0" is set, it is assumed that 120% is set.</p> <p>---Setting range---</p> <p>0 to 300 (%)</p> <p>0: 120% (default value)</p>
	#19203+5(n-1)	CLC min.feedrate n
		<p>Specify the minimum feedrate during the cutting load control as a percentage (%) of the command speed. (n = 1 to 8)</p> <p>When "0" is set, it is assumed that 90% is set.</p> <p>---Setting range---</p> <p>0 to 300 (%)</p> <p>0: 90% (default value)</p>
(PR)	#19250	NCAID con. valid
		<p>Specify whether to enable the connection with NC MachiningAID.</p> <p>0: Disable</p> <p>1: Enable</p>

14 User Parameters

14.1 Machining Parameters

#19251	NCAID tool warning
Specify whether the NC MachiningAID output tool exchange warning.	
0: Does not output warning	
1: Only outputs alarm No.5	
2: Outputs both alarm No.4 and alarm No.5	
#19252	NCAID ABN stop
Specify the behavior when the NC MachiningAID alarm for "Machining diagnostics error detected" occurs.	
0: Does not stop by alarm	
1: Stops by alarm	
#19253	NCAID ilg stop
Specify the behavior when the NC MachiningAID alarm for "Machining diagnostics invalid" occurs.	
0: Does not stop by alarm	
1: Stops by alarm	
#19401	G33.n chamfer spd
Not used.	
#19405	Rotary ax drawing
Specify this parameter to draw a path of C axis (rotary axis) according to its rotation in the graphic trace and 2D graphic trace.	
When "#1013 axname" is set to "C", the axis is handled as a rotary axis.	
By setting this parameter to "C", a rotation path around the Z axis on actual workpiece can be expressed.	
When the Graphic check rotary axis drawing option or Graphic trace rotary axis drawing option is disabled, this parameter is ignored.	
C: Enable this function	
0: Disable this function	
(Setting is cleared when "0" is set)	
#19406	Hob retract ON at alarm
Select whether to enable the retract at an alarm during hobbing.	
0: Disable	
1: Enable	
(Standard value: 0)	
#19407	Hob retract acceleration deceleration OFF
Select whether to disable the acceleration/deceleration of a retract.	
0: Enable	
1: Disable	
(Standard value: 0)	
#19417	Hole dec check 2
This is enabled when #1253 set25 bit2 is 1.	
The operation at the hole bottom and the hole drilling stop position is as below.	
0: Perform no deceleration check.	
1: Perform command deceleration check.	
2: Perform in-position check.	
<Target fixed cycles>	
Machining center: G81, G82, G83, G73	
Lathe: G83, G87, G83.2	
#19418	Arc inside min ovr (for M system only)
Set the minimum value of arc inside override.	
R1/R2 come close to zero and the tool feed stops when the radius of tool center path(R1) is very smaller than the radius of program path (R2).	
When this parameter is set and $R1/R2 \leq (\text{parameter setting value})$, tool feed is $F \times (\text{parameter setting value})$.	
When this parameter is "0" or "100", the arc inside override is disabled.	
---Setting range---	
0 to 100 (%)	

14 User Parameters

14.1 Machining Parameters

#19419	Timing sync system
Specify the counterpart part system for timing synchronization or for balance cut when the part system No. is omitted.	
Set the part system No. in a way that reflects the combination of two part systems as follows.	
(Example) Timing synchronization between Part systems 1 and 3	
Enter 3 for the 1st part system, and enter 1 for the 3rd part system.	
(Note) When 0 is set, timing synchronization is carried out between Part systems 1 and 2.	
---Setting range---	
0 to 8	
#19420	Arc inside ovr ON (for M system only)
Select the enable conditions for the arc inside override.	
0: Enable during tool radius compensation	
1: Enable during tool radius compensation and automatic corner override	
(Note) When M2 format is in use, the arc inside override enables during tool radius compensation, regardless of the setting value of this parameter.	
#19421	Arc inside ovr typ (for M system only)
Specify the type of arc inside override.	
0: Type 1	
Arc inside override during circular cutting is invalid.	
1: Type 2	
Arc inside override during circular cutting is valid.	
#19424	G185 factor
This parameter specifies the factor (%) for calculating the pick feed amount that is used when address A (pick feed amount) and address E (number of chamfering cycles) are omitted from G185 (hole edge chamfering cycle).	
The pick feed amount is calculated through the following formula.	
Tool radius (mm) * G185 factor (%)	
---Setting range---	
0 to 100 (%)	
0: 20% (default value)	
#19425	ManualB Std R1
Set a radius used as standard for the rotary axis speed.	
When the setting value of #19425 is larger than that of "#19427 ManualB Std R2", #19425 setting will be used as surface speed control standard radius 2: #19427 setting will be used as surface speed control standard radius 1.	
---Setting range---	
0 to 99999.999 (mm)	
#19426	ManualB Std F1
This sets the rotary axis speed for surface speed control standard radius 1 (ManualB Std R1).	
When the setting value of #19426 is larger than that of "#19428 ManualB Std F2", #19426 setting will be used as surface speed control standard speed 2: #19427 setting will be used as surface speed control standard speed 1.	
---Setting range---	
1 to 1000000 (°/min)	

14 User Parameters

14.1 Machining Parameters

#19427	ManualB Std R2
Set a radius used as standard for the rotary axis speed. When the same value is set as "#19425 ManualB Std R1", the surface speed control standard speed 1 (ManualB Std F1) will be selected as the rotary axis speed if the radius is less than that value. The surface speed control standard speed 2 (ManualB Std F2) is selected if larger than the set value.	
---Setting range---	
0 to 99999.999 (mm)	
#19428	ManualB Std F2
Set the rotary axis speed for surface speed control standard radius 2 (ManualB Std R2).	
---Setting range---	
1 to 1000000 (°/min)	
#19431	Num display in prg
Select whether to switch the display of numeric part that follows each address in the currently executed program.	
0: Display the program as originally programmed.	
1: Replace the numeric part (variable, operation or function) that follows each address with the calculated value.	
#19437	Skip fin in rough1
Specify whether to execute roughing along finishing shape in roughing cycle (G71, G72) when pocket machining is OFF.	
0: Execute roughing along finishing shape	
1: Not execute roughing along finishing shape	
#19438	Skip fin in rough2
Specify whether to execute roughing along finishing shape in roughing cycle (G71, G72) when pocket machining is ON.	
0: Not execute roughing along finishing shape	
1: Execute roughing along finishing shape	
#19442	Path at G71 comp.
When roughing along finishing shape is enabled in roughing cycle (G71,G72), select the path to move to the cycle command point after the completion of roughing along finishing shape.	
0: Move to the cycle command point without passing through the start point of roughing.	
1: Move to the cycle command point via the start point of roughing.	
For ZX plane, the move to the start point of roughing is performed with one axis at a time in the following order:	
G71: in the order of Z axis and X axis	
G72: in the order of X axis and Z axis	
#19443	Retract aft rough
Specify whether to retract after roughing along finishing shape when roughing along finishing shape is enabled in rough cutting cycle (G71, G72).	
0: Not retract	
1: Retract	
This parameter is valid when "#19442 Path at G71 comp." is set to "1".	
#19444	Drill cut reduce
Specify the cutting reduction amount in Fixed cycle for drilling using the cutting reduction amount specification method.	
This parameter is enabled when address J is omitted.	
When "0" is set, the cutting amount reduction method is disabled.	
---Setting range---	
0 to 99999.999 (mm)	

14 User Parameters

14.1 Machining Parameters

#19445	Drill cut min.amt
Specify the minimum cutting amount in Fixed cycle for drilling using the cutting reduction amount specification method.	
This parameter is enabled when address ,K is omitted.	
When "0" is set, the cutting amount specification method is disabled.	
---Setting range---	
0 to 99999.999 (mm)	
#19446	Chatter Supp Ampl
Set the variation amplitude for chatter suppression control.	
If "0" is specified, chatter is not suppressed.	
This parameter is for L system only.	
---Setting range---	
0 to 50 (%)	
#19447	Chatter Supp Cycle
Set the variation cycle for chatter suppression control.	
If "0.0" is specified, chatter is not suppressed.	
This parameter is for L system only.	
---Setting range---	
0.0 to 5.0 (s)	
#19601	TCPC sing pt agl
Specify the threshold angle to determin whether the tool is near a singular point in tool cutting point control.	
(Note) When "0" is specified, the behavior is the same as when 0.001 (deg) is set.	
---Setting range---	
0.000 to 5.000 (deg)	
#19602	TCPC sing pt posn
Select which point is treated as the cutting point during singular orientation in tool cutting point control.	
0: Type 1	
The tool center point	
1: Type 2	
The point on the end face of the tool nearest the cutting point before the singular point.	
#19603	TCPC corner R
Specify the corner R of the end mill tool used in tool cutting point control.	
(Note) When a square end mill is used, set "0".	
---Setting range---	
0.000 to 99999.999 (mm)	
0.000 to 9999.9999 (inch)	
#79601	Safety clrn: O.D.
This parameter specifies the clearance from the outer diameter of the workpiece using the radius value.	
---Setting range---	
0 to 65535 (0.001 mm/0.0001 inch)	
#79602	Safety clrn: I.D.
This parameter specifies the clearance from the inner diameter of the workpiece using the radius value.	
---Setting range---	
0 to 65535 (0.001 mm/0.0001 inch)	
#79603	Safety clrn: front
This parameter specifies the clearance from the front face of the workpiece.	
---Setting range---	
0 to 65535 (0.001 mm/0.0001 inch)	

14 User Parameters

14.1 Machining Parameters

#79604 Safety clrn: rear

This parameter specifies the clearance from the rear face of the workpiece.

---Setting range---

0 to 65535 (0.001 mm/0.0001 inch)

14.2 Fixed Cycle Parameters

#8012	G73n (for M system only)
	Set the return amount for G73 (step cycle).
	---Setting range---
	0 to 99999.999 (mm)
#8013	G83 n
	Set the return amount for G83 (deep hole drilling cycle).
	---Setting range---
	0 to 99999.999 (mm)
#8014	CDZ-VALE (for L system only)
	Set the chamfering amount for G76, G78 (thread cutting cycle).
	---Setting range---
	0 to 127 (0.1 lead)
#8015	CDZ-ANGLE (for L system only)
	Set the chamfering angle for G76, G78 (thread cutting cycle).
	---Setting range---
	0 to 89 (°)
#8016	G71 MINIMUM (for L system only)
	Set the minimum value of the last cutting amount by the rough cutting cycle (G71, G72).
	The cutting amount of the last cutting will be the remainder. When the remainder is smaller than this parameter setting, the last cycle will not be executed.
	---Setting range---
	0 to 999.999 (mm)
#8017	G71 DELTA-D (for L system only)
	Set the change amount of the rough cutting cycle.
	The rough cutting cycle (G71, G72) cutting amount repeats $x+dx$, x , $x-dx$ using the value (x) commanded with D as a reference. Set the change amount dx .
	---Setting range---
	0 to 999.999 (mm)
#8018	G84/G74 n
	Set the retract amount m in a G84/G74/G88 pecking tapping cycle.
	(Note) In the case of a normal tapping cycle, set to "0".
	---Setting range---
	0 to 999.999 (mm)
#8051	G71 THICK
	Set the amount of cut-in by the rough cutting cycle (G71, G72)
	---Setting range---
	0 to 99999.999 (mm)
#8052	G71 PULL UP
	Set the amount of pull-up when returning to the cutting start point for the rough cutting cycle (G71, G72).
	---Setting range---
	0 to 99999.999 (mm)
#8053	G73 U
	Set the X-axis cutting margin of the forming rough cutting cycle (G73).
	---Setting range---
	-99999.999 to 99999.999 (mm)

14 User Parameters

14.2 Fixed Cycle Parameters

#8054	G73 W
Set the Z-axis cutting margin of the forming rough cutting cycle (G73).	
---Setting range---	
-99999.999 to 99999.999 (mm)	
#8055	G73 R
Set how many times cutting will be performed in the forming rough cutting cycle (G73).	
---Setting range---	
0 to 99999 (times)	
#8056	G74 RETRACT
Set the amount of retract in the cut-off cycle (G74, G75).	
---Setting range---	
0 to 999.999 (mm)	
#8057	G76 LAST-D
Set the amount of final cut-in by the compound type thread cutting (G76).	
---Setting range---	
0 to 999.999 (mm)	
#8058	G76 TIMES
Set how many times the amount of final cut-in cycle (G76 finish margin) will be divided in the compound type thread cutting (G76).	
---Setting range---	
0 to 99 (times)	
#8059	G76 ANGLE
Set the angle (thread angle) of the tool nose in the compound type thread cutting (G76).	
---Setting range---	
0 to 99 (°)	
#8083	G83S modeM (for M system only)
Set the M command code for changing to the small diameter deep hole drilling cycle mode.	
---Setting range---	
1 to 999999999	
#8084	G83S Clearance (for M system only)
Set the clearance amount for the small diameter deep hole drilling cycle (G83).	
---Setting range---	
0 to 999.999 (mm)	
#8085	G83S Forward F (for M system only)
Set the feedrate from the R point to the cutting start position in the small diameter deep hole drilling cycle (G83).	
---Setting range---	
0 to 99999 (mm/min)	
#8086	G83S Back F (for M system only)
Set the speed for returning from the hole bottom during the small diameter deep hole drilling cycle (G83).	
---Setting range---	
0 to 99999 (mm/min)	

14.3 Control Parameters 1

(PR)	#1041	I_inch	Initial state (inch)
		<p>Select the unit system for the program travel amount when the power is turned ON or reset and for position display.</p> <p>0: Metric system</p> <p>1: Inch system</p> <p>(Note) The units of the following data are converted by "#1041 I_inch".</p> <ul style="list-style-type: none"> - Command unit at power ON and reset (Inch/metric command mode) But under the following conditions, the unit will follow G20/G21 command modal even at reset. When reset modal is retained ("#1151 rstint"="0") When G code group 06 reset modal is retained ("#1210 RstGmd/bit5" ON) - Unit system for position display (counter, user parameter, tool, work offset) - User parameter I/O unit - Parameter unit of user parameters concerning length and speed - Arc error parameter (#1084 RadErr) 	
	#1078	Decpt2	Decimal point type 2
		<p>Select the increment of position commands that do not have a decimal point.</p> <p>0: Minimum input command unit (follows "#1015 cunit")</p> <p>1: 1mm (or 1inch) unit (For the dwell time, 1s unit is used.)</p>	
	#1080	Dril_Z	Drilling Z fixed
		<p>Select a fixed cycle hole drilling axis.</p> <p>0: Use an axis vertical to the selected plane as hole drilling axis.</p> <p>1: Use the Z axis as the hole drilling axis regardless of the selected plane.</p>	
	#1091	Mpoint	Ignore middle point
		<p>Select how to handle the middle point during G28 and G30 reference position return.</p> <p>0: Pass the middle point designated in the program and move to the reference position.</p> <p>1: Ignore the middle point designated in the program and move straight to the reference position.</p>	
	#1103	T_Life	Validate life management
		<p>Select whether to use the tool life management.</p> <p>0: Not use tool life management.</p> <p>1: Use tool life management.</p>	
	#1104	T_Com2	Tool command method 2
		<p>Select how to handle the tool command in the program when "#1103 T_Life" is set to "1".</p> <p>0: Handle the command as group No.</p> <p>1: Handle the command as tool No.</p> <p>(Note) In the case of the tool life management III, the program tool command will be handled as the tool No. regardless of the setting.</p>	
	#1105	T_sel2	Tool selection method 2
		<p>Select the tool selection method when "#1103 T_Life" is set to "1".</p> <p>0: Select in order of registered No. from the tools used in the same group.</p> <p>1: Select the tool with the longest remaining life from the tools used or unused in the same group.</p>	
	#1106	Tcount	Life management (for L system only)
		<p>Select the input method when address N is omitted in inputting the data (G10 L3 command) for tool life management function II.</p> <p>0: Time specified input</p> <p>1: Number of times specified input</p>	

14 User Parameters

14.3 Control Parameters 1

#1126	PB_G90	Playback G90
Select the method to command the playback travel amount in the playback editing. 0: Incremental value 1: Absolute value		
#1128	RstVCI	Clear variables by resetting
Select how to handle the common variables when resetting. 0: Common variables won't change after resetting. 1: Common variables will be cleared #100 to #199 by resetting.		
#1129	PwrVCI	Clear variables by power-ON
Select how to handle the common variables when the power is turned ON. 0: The common variables are in the same state as before turning the power OFF. 1: Common variables will be cleared #100 to #199 when the power is turned ON.		
#1302	AutoRP	Automatic return by program restart
Select the method to move to the restart position when restarting the program. 0: Move the system to the restart position manually. 1: For program restarting, the first activation automatically moves the system to the restart position.		
#8101	MACRO SINGLE	
Select how to control the blocks where the user macro command continues. 0: Do not stop while macro blocks continue. 1: Stop every block during signal block operation.		
#8102	COLL. ALM OFF	
Select the interference control to the workpiece from the tool diameter during tool radius compensation and nose R compensation. 0: An alarm will be output and operation stops when an interference is judged. 1: Changes the path to avoid interference.		
#8103	COLL. CHK OFF	
Select the interference control to the workpiece from the tool diameter during tool radius compensation and nose R compensation. 0: Performs interference check. 1: Does not perform interference check.		
#8105	EDIT LOCK B	
Select the edit lock for program Nos. 8000 to 9999 in the memory. 0: Editing possible 1: Prohibit the editing of above programs.		
When "1" is set, the file cannot be opened.		
#8106	G46 NO REV-ERR (for L system only)	
Select the control for the compensation direction reversal in G46 (nose R compensation). 0: An alarm will be output and operation will stop when the compensation direction is reversed (G41 -> G42' G42 -> G41). 1: An alarm won't occur when the compensation direction is reversed, and the current compensation direction will be maintained.		
#8107	R COMPENSATION	
Select whether to move to the inside because of a delay in servo response to a command during arc cutting mode. 0: Move to the inside, making the arc smaller than the command value. 1: Compensate the movement to the inside.		

14 User Parameters

14.3 Control Parameters 1

#8108	R COMP Select
Select the arc radius error compensation target. 0: Perform compensation over all axes. 1: Perform compensation axis by axis. (Note) This parameter is effective only when "#8107 R COMPENSATION" is "1".	
#8109	HOST LINK
Select whether to enable computer link B instead of the RS-232C port. 0: Disable (Enable normal RS-232C communication.) 1: Enable (Disable normal RS-232C communication.)	
#8110	G71/G72 POCKET
Select whether to enable the pocket machining when there is a dimple (pocket) in the rough cutting cycle (G71, G72) finishing program. 0: OFF 1: ON	
#8111	Milling Radius
Select the diameter or radius command of the linear axis for milling (cylindrical/polar coordinate) interpolation. 0: All axes radius command 1: Each axis setting (follows "#1019 dia") (Note) This parameter is valid only in the milling (cylindrical/polar coordinate) interpolation mode.	
#8112	DECIMAL PNT-P
Select whether to enable the decimal point command for G04 address P. 0: Disable 1: Enable	
#8113	Milling Init G16
Set which plane to execute for milling machining after the power is turned ON or reset. #8113: 0, #8114: 0 ---> G17 plane #8113: 0, #8114: 1 ---> G19 plane #8113: 1, #8114: 0 ---> G16 plane #8113: 1, #8114: 1 ---> G16 plane 0: Not G16 plane 1: G16 plane (Note) This parameter is valid for the G code system 2, 3, 4 or 5 ("#1037 cmdtyp"="3", "4", "5" or "6").	
#8114	Milling Init G19
Set which plane to execute for milling machining after the power is turned ON or reset. #8113: 0, #8114: 0 ---> G17 plane #8113: 0, #8114: 1 ---> G19 plane #8113: 1, #8114: 0 ---> G16 plane #8113: 1, #8114: 1 ---> G16 plane 0: Not G19 plane 1: G19 plane (Note) This parameter is valid for the G code system 2, 3, 4 or 5 ("#1037 cmdtyp"="3", "4", "5" or "6").	

14 User Parameters

14.3 Control Parameters 1

		#8115 G83/87 RAPID
		Select the operation upon the completion of each step in deep hole drilling cycle (G83, G87). 0: Returns to R point before performing next step. 1: Returns by the amount of d (parameter setting) setting value before performing next step.
		#8116 CoordRotPara invd
		Select whether to enable the coordinate rotation by the parameters. 0: Enable 1: Disable
		#8117 OFS Diam DESIGN
		Select tool radius or tool diameter compensation amount to be specified. 0: Tool radius compensation amount 1: Tool diameter compensation amount
		#8119 Comp. unit switch
		Select the setting unit of compensation amount that has no decimal point. 0: 1mm (or 1inch) unit 1: The minimum command unit (follows "#1003 iunit")
(PR)	#8120	FONT SELECTION
		Select the font when Simplified Chinese is selected for "#1043 lang". 0: MITSUBISHI CNC GOTHIC font 1: Standard Windows font (Note) This parameter is enabled for M800VW/M80VW with Windows-based display.
		#8121 Screen Capture
		Select whether to enable the screen capture function. 0: Invalid 1: Valid (Screenshots are saved on USB memory or on front-side SD card) 2: Valid (Screenshots are saved on back-side SD card) (Note 1) By setting this parameter to "1" or "2", and by keeping pushing the [SHIFT] key, screen capture will be executed. (Note 2) This parameter is valid for M800VS and M80V. (Note 3) If an USB memory is inserted, it takes precedence over other devices. (*) This parameter is reset to "0" (Invalid) when the power is turned ON again.
		#8122 Keep G43 MDL M-REF
		Select whether to keep the tool length offset by high speed manual reference position return during tool length offset. 0: Will not be kept (Cancel) 1: Hold
		#8123 H-spd retract ON
		Select whether to enable high-speed retract while fixed cycle for drilling is running. 0: Disable 1: Enable
		#8124 Mirr img at reset
		Select the operation type of the mirror image by parameter setting and the mirror image by external input. 0: The current mirror image is canceled, and new mirror image will start with the machine position at reset as the mirror center. 1: The mirror center is kept to continue the mirror image.
		#8125 Check Scode in G84
		Select how to operate when there is no S command in synchronous tapping block. 0: Use the spindle function modal value as S-command value. 1: Output a program error (P181).

14 User Parameters

14.3 Control Parameters 1

#8126	Disable op tone
<p>Disable operation tones when operating the keyboard/touch panel.</p> <p>0: Enable the operation tones</p> <p>1: Disable the operation tones</p> <p>(Note) This parameter is enabled for M800VS, M80V, non-Windows-based display of M800VW/M80VW.</p>	
#8127	R-Navi manu F coor
<p>Select the initial value of the coordinate system for a manual feed while a machining surface is selected in the R-Navi function.</p> <p>0: Feature coordinate system</p> <p>1: Machine coordinate system</p>	
#8129	Subpro No. select
<p>Select the subprogram No. to be called preferentially in subprogram control.</p> <p>0: Commanded program No.</p> <p>1: Four-digit program No. beginning with O No.</p> <p>2: Eight-digit program No. beginning with O No.</p> <p>(Note) The program to be called in user macro, figure rotation, macro interruption and compound type fixed cycle also follows this setting.</p>	
#8130	Dwell in rev.
<p>Select the type of dwell for G04.</p> <p>0: Dwell time is specified in seconds, irrespective of the synchronous feed mode (G95) or the asynchronous feed mode (G94). For G04D, the dwell specified in spindle revolutions is applied.</p> <p>1: Dwell time is specified in spindle revolutions while the synchronous feed mode (G95) is ON, whereas it is specified in seconds while the asynchronous feed mode (G94) is ON.</p>	
#8131	High speed/accu 3
<p>Select how to treat high-speed high-accuracy II and III commands.</p> <p>0: As specified in G05P command</p> <p>1: Treat G05 P2 during high-accuracy mode or G05P10000 as high-speed high-accuracy control III command (G05P20000).</p> <p>2: Treat G05P20000 as high-speed high-accuracy control II command (G05P10000).</p>	
#8132	G53.6 block stop
<p>Select whether to execute a single block stop at the completion of rotation of each axis when G53.6 is given with the number of simultaneous contour control axes limited to 4.</p> <p>0: Not execute a single block stop</p> <p>1: Execute a single block stop</p>	
#8133	Intrctv macro call
<p>Specify the interactive macro to call from the cycle of interactive cycle insertion.</p> <p>0: Call standard interactive macro</p> <p>1: Call interactive macro in the machining program area</p> <p>When a program, whose name is same as standard interactive macro, exists in the machining program area, the program in the machining program area is called preferentially if "1" is set to this parameter.</p> <p>When a program, whose name is same as standard interactive macro, does not exist in the machining program area, standard interactive macro is called even if "1" is set to this parameter.</p>	
#8134	Email send disable
<p>E-mail sending by the email notification to operator can be disabled.</p> <p>0: Enable</p> <p>1: Disable</p>	
#8135	G5P4 single block
<p>Single block stop is disabled during direct command mode.</p> <p>0: Not disable single block stop</p> <p>1: Disable single block stop</p>	

14 User Parameters

14.3 Control Parameters 1

#8137	T. tool shape comp
	<p>Select whether to enable the turning-tool shape compensation in compound type fixed cycle for turning machining I.</p> <p>0: Disable 1: Enable</p>
#8138	Pre-compens. shape
	<p>Select whether to display the pre-compensation finish shape of the turning-tool shape compensation for compound type fixed cycle for turning machining I in 2D graphic check.</p> <p>0: Display 1: Not display</p>
#8139	TCP G0 temp.cancel
	<p>Select whether to temporarily cancel the interpolation of linear axes that results from the rotation of the table for a G0 command during tool center point control/tool cutting point control.</p> <p>0: Not temporarily cancel the interpolation 1: Temporarily cancel the interpolation</p> <p>(Note 1) This parameter is valid for a machine with a rotary axis on the table side. (Note 2) This parameter is valid when "#7908 SLCT_PRG_COORD" = 1 (when programming is done with respect to the workpiece coordinate system).</p>
(PR)	#8140 Reserve T wear com
	<p>This parameter enables the tool wear compensation amounts to be reserved with the machining being performed. The reserved tool wear compensation values can be written and executed using the PLC signal. With this function, the following five types of tool wear compensation amounts can be reserved:</p> <ul style="list-style-type: none"> ♦Tool nose wear compensation amount for the 1st axis (normally X axis) ♦Tool nose wear compensation amount for the 2nd axis (normally Z axis) ♦Tool wear compensation amount for the additional axis ♦Tool wear compensation amount for the 2nd additional axis ♦Tool nose radius wear compensation amount <p>0: Disable the reserved memory for tool wear compensation. 1: Enable the reserved memory for tool wear compensation.</p>
#8141	Restart srch ONBP
	<p>Select the type of Restart search to be performed when Restart search is executed with specified ONBP No. in the multi-part system program management.</p> <p>0: Restart search through a program individually for each part system. 1: Restart search through a program for all part systems at once. (Program No., sequence No., block No. and number of repetitions will be common to all part systems.)</p> <p>(Note) This parameter is only valid when "#1285 ext21/bit0" (Multi-part system program management) is set to "1" and "#1285 ext21/bit1" (program search is performed for all part systems) is set to "1".</p>
#8142	PLC timer unit
	<p>Select the time unit for the value specified for PLC timer.</p> <p>0: The time unit is determined by the PLC program instruction. 1: 1 ms units</p>
#8143	PLC int.timer unit
	<p>Select the time unit for the value specified for PLC integrated timer.</p> <p>0: The time unit is determined by the PLC program instruction. 1: 1 ms units 2: 10 ms units</p>

14 User Parameters

14.3 Control Parameters 1

#8144	OP srch NB all	Operation/check search with specified NB No. for all part systems at once
		<p>Select whether to search only the displayed part systems or search through for all part systems at once when operation/check search is executed with specified NB No. in the Multi-part system program management.</p> <p>0: Search through NB No. only for displayed part systems.</p> <p>1: Search through NB No. for all part systems at once.</p> <p>(Note) This parameter is enabled only when "#1285 ext21/bit0" (Multi-part system program management) and "#1285 ext21/bit1" (Switching of program search type) are set to "1".</p>
#8145	Validate F1 digit	
		<p>Select whether to execute the F command with a 1-digit code command or with a direct numerical command. (The same value as "#1079 F1digit" will be reflected. When either setting changes, the other will change accordingly.)</p> <p>0: Direct numerical command (command feedrate during feed per minute or rotation)</p> <p>1: 1-digit code command (with the feedrate specified by the parameters "#1185 spd_F1" to "#1189 spd_F5")</p>
(PR)	#8146	RTDS IP address
		<p>Specify the IP address of the PC to which the sampling data is sent in Real-time data sampling.</p> <p>---Setting range---</p> <p>0.0.0.0 to 255.255.255.255</p>
#8150	Arb AxExch Ret Inv	
		<p>Specify whether to temporarily cancel the retention of the axis exchange by arbitrary axis exchange control at power off.</p> <p>0: Not temporarily cancel.</p> <p>1: Temporarily cancel (start up with the basic axis configuration).</p> <p>(Note) This parameter is for recovery.</p> <p>If the axis exchange by arbitrary axis exchange control cannot be cancelled by normal operation, set this parameter to "1" and turn the power off and on again.</p> <p>Normally, set it to "0".</p>
#8155	Sub-pro interrupt	
		<p>Select the type of the user macro interrupt.</p> <p>(The same value as "#1229 set01/bit0" will be reflected. When either setting changes, the other will change accordingly.)</p> <p>0: The user macro interrupt of macro type</p> <p>1: The user macro interrupt of sub-program type</p>
#8156	Fine thread cut E	
		<p>Select what is to be specified with the address E.</p> <p>(The same value as "#1229 set01/bit1" will be reflected. When either setting changes, the other will change accordingly.)</p> <p>0: Specify the number of threads per inch for inch screw cutting.</p> <p>1: Specify the precision lead for inch screw cutting.</p>

14 User Parameters

14.3 Control Parameters 1

#8157 Radius comp type B (M system) / Nose R comp type B (L system)	
	<p>For M system</p> <p>Select the method of the arithmetic processing for the intersection point when the start-up or cancel command is operated during radius compensation. (The same value as "#1229 set01/bit2" will be reflected. When either setting changes, the other will change accordingly.)</p> <p>0: The processing does not handle the start-up or cancel command block: handle the offset vector in the direction vertical to that of the command instead.</p> <p>1: The processing is executed for the intersection point between the command block and the next block.</p> <p>For L system</p> <p>Select the method of the arithmetic processing for the intersection point when the start-up or cancel commands are operated during nose R or radius compensation. (The same value as "#1229 set01/bit2" will be reflected. When either setting changes, the other will change accordingly.)</p> <p>0: The processing does not handle the start-up or cancel command block: handle the offset vector in the direction vertical to that of the command instead.</p> <p>1: The processing is executed for the intersection point between the command block and the next block.</p>
#8158 Init const sur spd	
	<p>Select the initial state after the power-ON. (The same value as "#1229 set01/bit3" will be reflected. When either setting changes, the other will change accordingly.)</p> <p>0: Constant surface speed control cancel mode</p> <p>1: Constant surface speed control mode</p>
#8159 Synchronous tap	
	<p>Select whether to use the floating tap chuck in G74 and G84 tap cycles. (The same value as "#1229 set01/bit4" will be reflected. When either setting changes, the other will change accordingly.)</p> <p>0: With a floating tapping chuck</p> <p>1: Without a floating tapping chuck</p>
#8160 Start point alarm	
	<p>Select an operation when the operation start point cannot be found while moving to the next block of G117. (The same value as "#1229 set01/bit5" will be reflected. When either setting changes, the other will change accordingly.)</p> <p>0: The auxiliary function is enabled after the block for the movement has finished.</p> <p>1: The program error (P33) occurs.</p>
#8161 Vibe cut F value	
	<p>Select how the F command value is treated during the vibration cutting mode.</p> <p>0: The F command value is a resultant speed that does not include the vibration component.</p> <p>1: The F command value is the resultant speed that includes the vibration component.</p>
(PR) #8165 Tlife_DrillCnt	
	<p>Select how to count a fixed cycle for drilling when the tool is managed based on the number of uses in tool life management.</p> <p>0: Add one when the change from rapid traverse to cutting feed takes place</p> <p>1: Add the number of drilled holes</p>
#8166 operation mode 1	
	Not used. Set to "0".
#8167 operation mode 2	
	Not used. Set to "0".
#8168 operation mode 3	
	Not used. Set to "0".
#8169 operation mode 4	
	Not used. Set to "0".

14 User Parameters

14.3 Control Parameters 1

(PR)	#8170	Remote Service
Select whether to enable the Remote service function.		
0: Disable		
1: Enable		
(PR)	#8171	Diag Report Enable
Select whether to enable the Diagnosis report function of Remote service.		
0: Disable		
1: Enable		
(PR)	#8172	Enable Cond Report
Select whether to enable Machine condition monitoring report for the remote service gateway function.		
0: Disable		
1: Enable		
	#11801	SPRINT ON SPRINT ON
Specify whether to enable or disable SPRINT.		
0: Disable		
1: Enable		
When SPRINT is enabled		
♦M codes for SPRINT control are executable.		
♦SKIP8 is assigned to the SPRINT connector of the expansion unit FCU8-EX543.		

14 User Parameters

14.4 Control Parameters 2

14.4 Control Parameters 2

#1025	I_plane	Initial plane selection
	Select the plane to be selected when the power is turned ON or reset. When 0 is specified, 1 is assumed (X-Y plane).e model and specifications. 1: X-Y plane (G17 command state) 2: Z-X plane (G18 command state) 3: Y-Z plane (G19 command state)	
(PR) #1037	cmdtyp	Command type
	Set the G code list and compensation type for programs. 1: List1 (for M) Type I (one compensation amount for one compensation No.) 2: List1 (for M) Type II (shape and wear compensation amounts for one comp. No.) 3: List2 (for L) Type III (shape and wear compensation amounts for one comp. No.) 4: List3 (for L) Ditto 5: List4 (for special L) Ditto 6: List5 (for special L) Ditto 7: List6 (for special L) Ditto 8: List7 (for special L) Ditto 9: List8 (for M) M2 form at type Type I (one compensation amount for one compensation No.) 10: List8 (for M) M2 form at type Type II (shape and wear compensation amounts for one compensation No.) There are some items in the specifications that can be used or cannot be used according to the value set in this parameter. The file structure may also change depending on the compensation data type. (Note) When this parameter is changed, the file system will be changed after the power is turned ON. So always execute format. The new format will be enabled after turning the power ON again. Setting order (1) cmdtyp changeover -> (2) Turn power ON again -> (3) Format -> (4) Turn power ON again (Note) Compensation type III can be selected for M system by setting #1046.	
#1073	I_Absm	Initial absolute setting
	Select the mode (absolute or incremental) at turning ON the power or reset. 0: Incremental setting 1: Absolute setting	
#1074	I_Sync	Initial synchronous feed
	Select the feedrate mode at turning ON the power or reset. 0: Asynchronous feed (feed per minute) 1: Synchronous feed (feed per revolution)	
#1075	I_G00	Initial G00
	Select the linear command mode at turning ON the power or reset. 0: Linear interpolation (G01 command state) 1: Positioning (G00 command state)	
#1076	AbsInc	ABS/INC address (for L system only)
	Select the command method for the absolute and incremental commands. The absolute command/incremental command can be issued by using the absolute command address and incremental command address for the same axis. 0: Use G command for the absolute and incremental commands. 1: Use axis name for the absolute and incremental commands. (The axis name in "#1013 axname" will be the absolute command, "#1014 incax" will be the incremental command.)	

14 User Parameters

14.4 Control Parameters 2

#1085	G00Drn	G00 dry run
	Select whether to apply dry run (feed at manual setting speed instead of command feedrate) to the G00 command. 0: Not apply to G00. (move at rapid traverse rate) 1: Apply to G00. (move at manual setting speed)	
#1086	G0Intp	G00 non-interpolation
	Select the G00 travel path type. 0: Move linearly toward the end point. (interpolation type) 1: Move to the end point of each axis at the rapid traverse feedrate for each axis. (non-interpolation) (Note) If this parameter is set to "1", neither of the following functions will be available: rapid traverse constant-gradient acceleration/deceleration and rapid traverse constant-gradient multi-step acceleration/deceleration.	
#1148	I_G611	Initial hi-precis
	Select the modal state at power ON from among the following: high-accuracy control mode, high-speed high-accuracy control I mode, high-speed high-accuracy control II mode or high-speed high-accuracy control III mode. 0: G08P0/G64 (cutting) mode 1: G08P1/G61.1 (high-accuracy control) mode 2: G05.1Q1 (high-speed high-accuracy control I) mode 3: G05P10000 (high-speed high-accuracy control II) mode 4: G05P20000 (high-speed high-accuracy control III) mode	
#8173	Hold intr amount	
	Select whether to clear or hold the interruption amount after the "NC reset 1 (or 2)" signal is ON when the manual ABS switch is OFF. 0: Clear (Reset the coordinate deviation due to the interruption) 1: Hold	
#8174	T meas. in mirror	
	Select the measurement operation for mirror-imaged axes during the manual tool length measurement 1 or 2. 0: Set the measurement result as the tool length. 1: Reverse the sign of measurement result and set it as the tool length.	
#8179	Stroke_prechkTYPE	
	Select when the stroke limit before travel function should determine a command as entering the forbidden area set by the stored stroke limit. 0: Operation stops by the stroke check before travel function only when the end point of the command is in the forbidden area. 1: Operation stops by the stroke check before travel function when the command path passes through the forbidden area. For a command other than given below, the operation stops only when the end point is in the forbidden area. Corresponding commands: G00, G01, G02, G03, G28, G30, G33 and G53	
#8180	Ini spline intrpl2	
	Set the modal state to Spline interpolation2 when power is turned ON. 0: Disable 1: Enable (Note) This function is only valid while SSS control and Tolerance control are enabled. To enable the setting, set "#8090 SSS ON" and "#12066 Tolerance ctrl ON" to "1".	

14 User Parameters

14.4 Control Parameters 2

#79801	Tool turn posn
This parameter specifies the position where the tool change command is issued.	
0: X: clearance, Z: clearance	
1: X: machine zero, Z: clearance	
2: X: clearance, Z: machine zero	
3: X: machine zero, Z: machine zero	
4: X: 2nd reference position, Z: 2nd reference position	
5: X: clearance, Z: end point of previous process	
6: X: machine zero, Z: end point of previous process	
7: X: end point of previous process, Z: clearance	
8: X: end point of previous process, Z: machine zero	
#79802	Tool turn clrn X
This parameter specifies the clearance in X axis direction using the radius value. This clearance is used to avoid interference with the workpiece while the tool is turning.	
---Setting range---	
0 to 65535 (0.001 mm/0.0001 inch)	
#79803	Tool turn clrn Z
This parameter specifies the clearance in Z axis direction. This clearance is used to avoid interference with the workpiece while the tool is turning.	
---Setting range---	
0 to 65535 (0.001 mm/0.0001 inch)	

14.5 I/O Parameters

#9001	DATA IN PORT
Select the port for inputting the data such as machine program and parameters. 1: ch1 2: ch2	
#9002	DATA IN DEV.
Select the device No. for inputting the data. (The device Nos. correspond to the input/output device parameters.) ---Setting range--- 0 to 4	
#9003	DATA OUT PORT
Select the port for outputting the data such as machine program and parameters. 1: ch1 2: ch2	
#9004	DATA OUT DEV.
Select the device No. for outputting the data. (The device Nos. correspond to the input/output device parameters.) ---Setting range--- 0 to 4	
#9005	TAPE MODE PORT
Select the input port for running with the tape mode. 1: ch1 2: ch2	
#9006	TAPE MODE DEV.
Select the device No. to be run with the tape mode. (The device Nos. correspond to the input/output device parameters.) ---Setting range--- 0 to 4	
#9007	MACRO PRINT PORT
Select the output port used for the user macro DPRINT command. 1: ch1 2: ch2 9: Memory card	
#9008	MACRO PRINT DEV.
Select the device No. used for the DPRINT command. (The device Nos. correspond to the input/output device parameters.) ---Setting range--- 0 to 4	
#9009	PLC IN/OUT PORT
Select the port for inputting/outputting various data with PLC. 1: ch1 2: ch2	
#9010	PLC IN/OUT DEV.
Select the device No. used for the PLC input/output. (The device Nos. correspond to the input/output device parameters.) ---Setting range--- 0 to 4	

14 User Parameters

14.5 I/O Parameters

#9011	REMOTE PRG IN PORT
	Select the port for inputting remote programs. 1: ch1 2: ch2
#9012	REMOTE PRG IN DEV.
	Select the device No. used to input remote programs. (The device Nos. correspond to the input/output device parameters.) ---Setting range--- 0 to 4
#9013	EXT UNIT PORT
	Select the port for communication with an external unit. 1: ch1 2: ch2
#9014	EXT UNIT DEV.
	Select the unit No. used for communication with an external unit (The device Nos. correspond to the input/output device parameters.) ---Setting range--- 0 to 4
#9017	HANDY TERMINAL PORT
	Select the port for communication with a handy terminal. 1: ch1 2: ch2
#9018	HANDY TERMINAL DEV.
	Select the device No. used for communication with a handy terminal. (The device Nos. correspond to the input/output device parameters.) ---Setting range--- 0 to 4
#9053	M2 macro converter
	Not used.
#9054	MACRO PRINT FILE
	Set the file name to save the output data to a memory card with the DRPNT command for the user macro. If this parameter is not set, the data will be output under the following name. dprt\$-MMDDhhmmssff \$ is the part system No. in which DPRNT is commanded, MMDDhhmmssff is the current date. (MM: month, DD: day, hh: hour, mm: minute, ss: second, ff: millisecond) (Note) This parameter is enabled when "#9007 Macro print directory" is set to "9". ---Setting range--- Program name or file name (up to 32 characters)
#9101	DEV0 DEVICE NAME
	Set the device name corresponding to the device No. Set a simple name for quick identification. ---Setting range--- Use three or less characters consisting of alphabet characters, numerals and symbols.

14 User Parameters

14.5 I/O Parameters

#9102 DEV0 BAUD RATE

Select the serial communication speed.

- 0: 19200 (bps)
- 1: 9600
- 2: 4800
- 3: 2400
- 4: 1200
- 5: 600
- 6: 300
- 7: 110

#9103 DEV0 STOP BIT


Select the stop bit length used in the start-stop system.

Refer to "#9104 DEV0 PARITY CHECK". At the output of data, the number of characters is always adjusted for the parity check.

- 1: 1 (bit)
- 2: 1.5
- 3: 2

#9104 DEV0 PARITY CHECK

Select whether to add a parity check bit to the data.

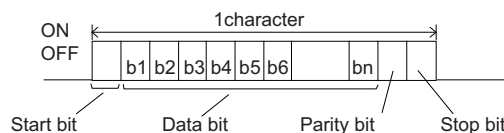

Set this parameter in accordance with the I/O device specifications.

- 0: Not add a parity bit at the input/output
- 1: Add a parity bit at the input/output

#9105 DEV0 EVEN PARITY

Select odd or even when parity is added to the data. This parameter is ignored when no parity is added.

- 0: Odd parity
- 1: Even parity

#9106 DEV0 CHR. LENGTH

Set the length of the data bit.

Refer to "#9104 DEV0 PARITY CHECK".

- 0: 5 (bit)
- 1: 6
- 2: 7 (NC connection not supported)
- 3: 8

#9107 DEV0 TERMINATR TYP

Select the code to terminate data reading.

- 0, 3: EOR
- 1, 2: EOB or EOR

(*) When M800VW display side serial port is selected

- 0: No terminator
- 1: EOR
- 2: EOB
- 3: EOB or EOR

14 User Parameters

14.5 I/O Parameters

#9108	DEV0 HAND SHAKE
Select the transmission control method. No handshaking will be used when a value except 1 to 3 is set. 1: RTS/CTS method 2: No handshaking 3: DC code method	
#9109	DEV0 DC CODE PRY
Select the DC code type when the DC code method is selected. 0: Not add parity to DC code. (DC3 = 13H) 1: Add parity to DC code. (DC3 = 93H)	
#9111	DEV0 DC2/4 OUTPUT
Select the DC code handling when outputting data to the output device. DC2 / DC4 0: None / None 1: Yes / None 2: None / Yes 3: Yes / Yes	
#9112	DEV0 CR OUTPUT
Select whether to add the (CR) code just before the EOB (L/F) code during output. 0: Not add 1: Add	
#9113	DEV0 EIA OUTPUT
Select ISO or EIA code for data output. In data input mode, the ISO and EIA codes are identified automatically. 0: ISO code output 1: EIA code output	
#9114	DEV0 FEED CHR.
Set the length of the tape feed to be output at the start and end of the data during tape output. ---Setting range--- 0 to 999 (characters)	
#9115	DEV0 PARITY V
Select whether to perform the parity check for the number of characters in a block at the input of data. At the output of data, the number of characters is always adjusted for the parity check. 0: Not perform parity V check 1: Perform parity V check	
#9116	DEV0 TIME-OUT (sec)
Set the time out time to detect an interruption in communication. Time out check will not be executed when set to "0". ---Setting range--- 0 to 30 (s)	
#9117	DEV0 DR OFF
Select whether to enable the DR data check in data I/O mode. 0: Enable 1: Disable	
#9118	DEV0 DATA ASCII
Select the code of the output data. 0: ISO/EIA code (Depends on whether #9113, #9213, #9313, #9413 or #9513 EIA output parameter is set up.) 1: ASCII code	

14 User Parameters

14.5 I/O Parameters

#9119	DEV0 INPUT TYPE
	<p>Select the mode for input (verification).</p> <p>0: Standard input (Data from the very first EOB is handled as significant information.)</p> <p>1: EOBs following the first EOB of the input data are skipped until data other than EOB is input.</p>
#9120	DEV0 OUT BUFFER
	<p>Select the buffer size of the output data which is output to output device using NC side serial port.</p> <p>If the output device has a transmission error (overrun error), decrease the buffer size with this parameter.</p> <p>If the buffer size is decreased, output time will prolong according to the size.</p> <p>0: 250 bytes (default)</p> <p>1: 1 byte</p> <p>2: 4 bytes</p> <p>3: 8 bytes</p> <p>4: 16 bytes</p> <p>5: 64 bytes</p>
#9121	DEV0 EIA CODE [
	<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "[".</p> <p>When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>
#9122	DEV0 EIA CODE]
	<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "]".</p> <p>When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>
#9123	DEV0 EIA CODE #
	<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "#".</p> <p>When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>
#9124	DEV0 EIA CODE *
	<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "*".</p> <p>When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>
#9125	DEV0 EIA CODE =
	<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "=".</p> <p>When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>
#9126	DEV0 EIA CODE:
	<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code ":".</p> <p>When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>

14 User Parameters

14.5 I/O Parameters

#9127	DEV0 EIA CODE \$
<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "\$".</p> <p>When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>	
#9128	DEV0 EIA CODE !
<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "!".</p> <p>When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>	
#9201	DEV1 DEVICE NAME
<p>Set the device name corresponding to the device No.</p> <p>Set a simple name for quick identification.</p> <p>---Setting range---</p> <p>Use three or less characters consisting of alphabet characters, numerals and symbols.</p>	
#9202	DEV1 BAUD RATE
<p>Select the serial communication speed.</p> <p>0: 19200 (bps)</p> <p>1: 9600</p> <p>2: 4800</p> <p>3: 2400</p> <p>4: 1200</p> <p>5: 600</p> <p>6: 300</p> <p>7: 110</p>	
#9203	DEV1 STOP BIT
<p>Select the stop bit length used in the start-stop system.</p> <p>Refer to "#9204 DEV1 PARITY CHECK". At the output of data, the number of characters is always adjusted for the parity check.</p> <p>1: 1 (bit)</p> <p>2: 1.5</p> <p>3: 2</p>	
#9204	DEV1 PARITY CHECK
<p>Select whether to add a parity check bit to the data.</p> <div data-bbox="308 1581 871 1727"> </div> <p>Set this parameter in accordance with the I/O device specifications.</p> <p>0: Not add a parity bit at the input/output</p> <p>1: Add a parity bit at the input/output</p>	
#9205	DEV1 EVEN PARITY
<p>Select odd or even when parity is added to the data. This parameter is ignored when no parity is added.</p> <p>0: Odd parity</p> <p>1: Even parity</p>	

14 User Parameters

14.5 I/O Parameters

#9206	DEV1 CHR. LENGTH
Set the length of the data bit. Refer to "#9204 DEV1 PARITY CHECK". 0: 5 (bit) 1: 6 2: 7 (NC connection not supported) 3: 8	
#9207	DEV1 TERMINATR TYP
Select the code to terminate data reading. 0, 3: EOR 1, 2: EOB or EOR (*) When M800VW display side serial port is selected 0: No terminator 1: EOR 2: EOB 3: EOB or EOR	
#9208	DEV1 HAND SHAKE
Select the transmission control method. No handshaking will be used when a value except 1 to 3 is set. 1: RTS/CTS method 2: No handshaking 3: DC code method	
#9209	DEV1 DC CODE PRY
Select the DC code type when the DC code method is selected. 0: Not add parity to DC code. (DC3 = 13H) 1: Add parity to DC code. (DC3 = 93H)	
#9211	DEV1 DC2/4 OUTPUT
Select the DC code handling when outputting data to the output device. DC2 / DC4 0: None / None 1: Yes / None 2: None / Yes 3: Yes / Yes	
#9212	DEV1 CR OUTPUT
Select whether to add the (CR) code just before the EOB (L/F) code during output. 0: Not add 1: Add	
#9213	DEV1 EIA OUTPUT
Select ISO or EIA code for data output. In data input mode, the ISO and EIA codes are identified automatically. 0: ISO code output 1: EIA code output	
#9214	DEV1 FEED CHR.
Set the length of the tape feed to be output at the start and end of the data during tape output. ---Setting range--- 0 to 999 (characters)	

14 User Parameters

14.5 I/O Parameters

#9215	DEV1 PARITY V
<p>Select whether to perform the parity check for the number of characters in a block at the input of data. At the output of data, the number of characters is always adjusted for the parity check.</p> <p>0: Not perform parity V check 1: Perform parity V check</p>	
#9216	DEV1 TIME-OUT (sec)
<p>Set the time out time to detect an interruption in communication. Time out check will not be executed when set to "0".</p> <p>---Setting range---</p> <p>0 to 30 (s)</p>	
#9217	DEV1 DR OFF
<p>Select whether to enable the DR data check in data I/O mode.</p> <p>0: Enable 1: Disable</p>	
#9218	DEV1 DATA ASCII
<p>Select the code of the output data.</p> <p>0: ISO/EIA code (Depends on whether #9113, #9213, #9313, #9413 or #9513 EIA output parameter is set up.) 1: ASCII code</p>	
#9219	DEV1 INPUT TYPE
<p>Select the mode for input (verification).</p> <p>0: Standard input (Data from the very first EOB is handled as significant information.) 1: EOBs following the first EOB of the input data are skipped until data other than EOB is input.</p>	
#9220	DEV1 OUT BUFFER
<p>Select the buffer size of the output data which is output to output device using NC side serial port. If the output device has a transmission error (overrun error), decrease the buffer size with this parameter. If the buffer size is decreased, output time will prolong according to the size.</p> <p>0: 250 bytes (default) 1: 1 byte 2: 4 bytes 3: 8 bytes 4: 16 bytes 5: 64 bytes</p>	
#9221	DEV1 EIA CODE [
<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code " [". When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>	
#9222	DEV1 EIA CODE]
<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "] ". When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>	

14 User Parameters

14.5 I/O Parameters

#9223	DEV1 EIA CODE #
Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "#". When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.	
---Setting range---	
0 to FF (hexadecimal)	
#9224	DEV1 EIA CODE *
Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "*". When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.	
---Setting range---	
0 to FF (hexadecimal)	
#9225	DEV1 EIA CODE =
Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "=". When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.	
---Setting range---	
0 to FF (hexadecimal)	
#9226	DEV1 EIA CODE:
Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code ":". When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.	
---Setting range---	
0 to FF (hexadecimal)	
#9227	DEV1 EIA CODE \$
Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "\$". When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.	
---Setting range---	
0 to FF (hexadecimal)	
#9228	DEV1 EIA CODE !
Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "!". When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.	
---Setting range---	
0 to FF (hexadecimal)	
#9301	DEV2 DEVICE NAME
Set the device name corresponding to the device No. Set a simple name for quick identification.	
---Setting range---	
Use three or less characters consisting of alphabet characters, numerals and symbols.	
#9302	DEV2 BAUD RATE
Select the serial communication speed.	
0: 19200 (bps)	
1: 9600	
2: 4800	
3: 2400	
4: 1200	
5: 600	
6: 300	
7: 110	

14 User Parameters

14.5 I/O Parameters

#9303 DEV2 STOP BIT


Select the stop bit length used in the start-stop system.

Refer to "#9304 DEV2 PARITY CHECK". At the output of data, the number of characters is always adjusted for the parity check.

- 1: 1 (bit)
- 2: 1.5
- 3: 2

#9304 DEV2 PARITY CHECK

Select whether to add a parity check bit to the data.

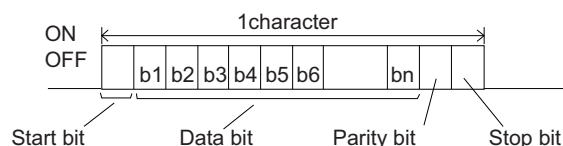

Set this parameter in accordance with the I/O device specifications.

- 0: Not add a parity bit at the input/output
- 1: Add a parity bit at the input/output

#9305 DEV2 EVEN PARITY

Select odd or even when parity is added to the data. This parameter is ignored when no parity is added.

- 0: Odd parity
- 1: Even parity

#9306 DEV2 CHR. LENGTH

Set the length of the data bit.

Refer to "#9304 DEV2 PARITY CHECK".

- 0: 5 (bit)
- 1: 6
- 2: 7 (NC connection not supported)
- 3: 8

#9307 DEV2 TERMINATR TYP

Select the code to terminate data reading.

- 0, 3: EOR
- 1, 2: EOB or EOR

(*) When M800VW display side serial port is selected

- 0: No terminator
- 1: EOR
- 2: EOB
- 3: EOB or EOR

#9308 DEV2 HAND SHAKE

Select the transmission control method.

No handshaking will be used when a value except 1 to 3 is set.

- 1: RTS/CTS method
- 2: No handshaking
- 3: DC code method

#9309 DEV2 DC CODE PRY

Select the DC code type when the DC code method is selected.

- 0: Not add parity to DC code. (DC3 = 13H)
- 1: Add parity to DC code. (DC3 = 93H)

14 User Parameters

14.5 I/O Parameters

#9311	DEV2 DC2/4 OUTPUT
Select the DC code handling when outputting data to the output device. DC2 / DC4 0: None / None 1: Yes / None 2: None / Yes 3: Yes / Yes	
#9312	DEV2 CR OUTPUT
Select whether to add the (CR) code just before the EOB (L/F) code during output. 0: Not add 1: Add	
#9313	DEV2 EIA OUTPUT
Select ISO or EIA code for data output. In data input mode, the ISO and EIA codes are identified automatically. 0: ISO code output 1: EIA code output	
#9314	DEV2 FEED CHR.
Set the length of the tape feed to be output at the start and end of the data during tape output. ---Setting range--- 0 to 999 (characters)	
#9315	DEV2 PARITY V
Select whether to perform the parity check for the number of characters in a block at the input of data. At the output of data, the number of characters is always adjusted for the parity check. 0: Not perform parity V check 1: Perform parity V check	
#9316	DEV2 TIME-OUT (sec)
Set the time out time to detect an interruption in communication. Time out check will not be executed when set to "0". ---Setting range--- 0 to 30 (s)	
#9317	DEV2 DR OFF
Select whether to enable the DR data check in data I/O mode. 0: Enable 1: Disable	
#9318	DEV2 DATA ASCII
Select the code of the output data. 0: ISO/EIA code (Depends on whether #9113, #9213, #9313, #9413 or #9513 EIA output parameter is set up.) 1: ASCII code	
#9319	DEV2 INPUT TYPE
Select the mode for input (verification). 0: Standard input (Data from the very first EOB is handled as significant information.) 1: EOBs following the first EOB of the input data are skipped until data other than EOB is input.	

14 User Parameters

14.5 I/O Parameters

#9320	DEV2 OUT BUFFER
<p>Select the buffer size of the output data which is output to output device using NC side serial port.</p> <p>If the output device has a transmission error (overrun error), decrease the buffer size with this parameter.</p> <p>If the buffer size is decreased, output time will prolong according to the size.</p> <p>0: 250 bytes (default)</p> <p>1: 1 byte</p> <p>2: 4 bytes</p> <p>3: 8 bytes</p> <p>4: 16 bytes</p> <p>5: 64 bytes</p>	
#9321	DEV2 EIA CODE [
<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "[".</p> <p>When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>	
#9322	DEV2 EIA CODE]
<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "]" .</p> <p>When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>	
#9323	DEV2 EIA CODE #
<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "#".</p> <p>When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>	
#9324	DEV2 EIA CODE *
<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "*".</p> <p>When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>	
#9325	DEV2 EIA CODE =
<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "=".</p> <p>When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>	
#9326	DEV2 EIA CODE:
<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code ":".</p> <p>When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>	

14 User Parameters

14.5 I/O Parameters

#9327	DEV2 EIA CODE \$
<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "\$".</p> <p>When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>	
#9328	DEV2 EIA CODE !
<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "!".</p> <p>When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>	
#9401	DEV3 DEVICE NAME
<p>Set the device name corresponding to the device No.</p> <p>Set a simple name for quick identification.</p> <p>---Setting range---</p> <p>Use three or less characters consisting of alphabet characters, numerals and symbols.</p>	
#9402	DEV3 BAUD RATE
<p>Select the serial communication speed.</p> <p>0: 19200 (bps)</p> <p>1: 9600</p> <p>2: 4800</p> <p>3: 2400</p> <p>4: 1200</p> <p>5: 600</p> <p>6: 300</p> <p>7: 110</p>	
#9403	DEV3 STOP BIT
<p>Select the stop bit length used in the start-stop system.</p> <p>Refer to "#9404 DEV3 PARITY CHECK". At the output of data, the number of characters is always adjusted for the parity check.</p> <p>1: 1 (bit)</p> <p>2: 1.5</p> <p>3: 2</p>	
#9404	DEV3 PARITY CHECK
<p>Select whether to add a parity check bit to the data.</p> <div data-bbox="349 1583 911 1729" data-label="Diagram"> <p>The diagram illustrates the structure of a character frame. It is a horizontal sequence of bits. The first bit is the 'Start bit'. This is followed by 'Data bit' fields labeled b1, b2, b3, b4, b5, b6, and then bn. After the data bits is the 'Parity bit'. The final bit is the 'Stop bit'. A bracket above the entire sequence from the start bit to the stop bit is labeled '1 character'. To the left of the start bit, there are two labels: 'ON' and 'OFF', with arrows pointing to the start bit.</p> </div>	
<p>Set this parameter in accordance with the I/O device specifications.</p> <p>0: Not add a parity bit at the input/output</p> <p>1: Add a parity bit at the input/output</p>	
#9405	DEV3 EVEN PARITY
<p>Select odd or even when parity is added to the data. This parameter is ignored when no parity is added.</p> <p>0: Odd parity</p> <p>1: Even parity</p>	

14 User Parameters

14.5 I/O Parameters

#9406	DEV3 CHR. LENGTH
Set the length of the data bit. Refer to "#9404 DEV3 PARITY CHECK". 0: 5 (bit) 1: 6 2: 7 (NC connection not supported) 3: 8	
#9407	DEV3 TERMINATR TYP
Select the code to terminate data reading. 0, 3: EOR 1, 2: EOB or EOR (*) When M800VW display side serial port is selected 0: No terminator 1: EOR 2: EOB 3: EOB or EOR	
#9408	DEV3 HAND SHAKE
Select the transmission control method. No handshaking will be used when a value except 1 to 3 is set. 1: RTS/CTS method 2: No handshaking 3: DC code method	
#9409	DEV3 DC CODE PRY
Select the DC code type when the DC code method is selected. 0: Not add parity to DC code. (DC3 = 13H) 1: Add parity to DC code. (DC3 = 93H)	
#9411	DEV3 DC2/4 OUTPUT
Select the DC code handling when outputting data to the output device. DC2 / DC4 0: None / None 1: Yes / None 2: None / Yes 3: Yes / Yes	
#9412	DEV3 CR OUTPUT
Select whether to add the (CR) code just before the EOB (L/F) code during output. 0: Not add 1: Add	
#9413	DEV3 EIA OUTPUT
Select ISO or EIA code for data output. In data input mode, the ISO and EIA codes are identified automatically. 0: ISO code output 1: EIA code output	
#9414	DEV3 FEED CHR.
Set the length of the tape feed to be output at the start and end of the data during tape output. ---Setting range--- 0 to 999 (characters)	

14 User Parameters

14.5 I/O Parameters

#9415	DEV3 PARITY V
<p>Select whether to perform the parity check for the number of characters in a block at the input of data. At the output of data, the number of characters is always adjusted for the parity check.</p> <p>0: Not perform parity V check 1: Perform parity V check</p>	
#9416	DEV3 TIME-OUT (sec)
<p>Set the time out time to detect an interruption in communication. Time out check will not be executed when set to "0".</p> <p>---Setting range---</p> <p>0 to 30 (s)</p>	
#9417	DEV3 DR OFF
<p>Select whether to enable the DR data check in data I/O mode.</p> <p>0: Enable 1: Disable</p>	
#9418	DEV3 DATA ASCII
<p>Select the code of the output data.</p> <p>0: ISO/EIA code (Depends on whether #9113, #9213, #9313, #9413 or #9513 EIA output parameter is set up.) 1: ASCII code</p>	
#9419	DEV3 INPUT TYPE
<p>Select the mode for input (verification).</p> <p>0: Standard input (Data from the very first EOB is handled as significant information.) 1: EOBs following the first EOB of the input data are skipped until data other than EOB is input.</p>	
#9420	DEV3 OUT BUFFER
<p>Select the buffer size of the output data which is output to output device using NC side serial port. If the output device has a transmission error (overrun error), decrease the buffer size with this parameter. If the buffer size is decreased, output time will prolong according to the size.</p> <p>0: 250 bytes (default) 1: 1 byte 2: 4 bytes 3: 8 bytes 4: 16 bytes 5: 64 bytes</p>	
#9421	DEV3 EIA CODE [
<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code " [". When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>	
#9422	DEV3 EIA CODE]
<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "] ". When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>	

14 User Parameters

14.5 I/O Parameters

#9423	DEV3 EIA CODE #
Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "#". When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.	
---Setting range---	
0 to FF (hexadecimal)	
#9424	DEV3 EIA CODE *
Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "*". When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.	
---Setting range---	
0 to FF (hexadecimal)	
#9425	DEV3 EIA CODE =
Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "=". When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.	
---Setting range---	
0 to FF (hexadecimal)	
#9426	DEV3 EIA CODE:
Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code ":". When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.	
---Setting range---	
0 to FF (hexadecimal)	
#9427	DEV3 EIA CODE \$
Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "\$". When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.	
---Setting range---	
0 to FF (hexadecimal)	
#9428	DEV3 EIA CODE !
Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "!". When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.	
---Setting range---	
0 to FF (hexadecimal)	
#9501	DEV4 DEVICE NAME
Set the device name corresponding to the device No. Set a simple name for quick identification.	
---Setting range---	
Use three or less characters consisting of alphabet characters, numerals and symbols.	
#9502	DEV4 BAUD RATE
Select the serial communication speed.	
0: 19200 (bps)	
1: 9600	
2: 4800	
3: 2400	
4: 1200	
5: 600	
6: 300	
7: 110	

14 User Parameters

14.5 I/O Parameters

#9503 DEV4 STOP BIT


Select the stop bit length used in the start-stop system.

Refer to "#9504 DEV4 PARITY CHECK". At the output of data, the number of characters is always adjusted for the parity check.

- 1: 1 (bit)
- 2: 1.5
- 3: 2

#9504 DEV4 PARITY CHECK

Select whether to add a parity check bit to the data.

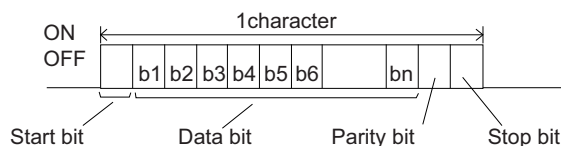

Set this parameter in accordance with the I/O device specifications.

- 0: Not add a parity bit at the input/output
- 1: Add a parity bit at the input/output

#9505 DEV4 EVEN PARITY

Select odd or even when parity is added to the data. This parameter is ignored when no parity is added.

- 0: Odd parity
- 1: Even parity

#9506 DEV4 CHR. LENGTH

Set the length of the data bit.

Refer to "#9504 DEV4 PARITY CHECK".

- 0: 5 (bit)
- 1: 6
- 2: 7 (NC connection not supported)
- 3: 8

#9507 DEV4 TERMINATR TYP

Select the code to terminate data reading.

- 0, 3: EOR
- 1, 2: EOB or EOR

(*) When M800VW display side serial port is selected

- 0: No terminator
- 1: EOR
- 2: EOB
- 3: EOB or EOR

#9508 DEV4 HAND SHAKE

Select the transmission control method.

No handshaking will be used when a value except 1 to 3 is set.

- 1: RTS/CTS method
- 2: No handshaking
- 3: DC code method

#9509 DEV4 DC CODE PRY

Select the DC code type when the DC code method is selected.

- 0: Not add parity to DC code. (DC3 = 13H)
- 1: Add parity to DC code. (DC3 = 93H)

14 User Parameters

14.5 I/O Parameters

#9511	DEV4 DC2/4 OUTPUT
Select the DC code handling when outputting data to the output device.	
DC2 / DC4	
0: None / None	
1: Yes / None	
2: None / Yes	
3: Yes / Yes	
#9512	DEV4 CR OUTPUT
Select whether to add the (CR) code just before the EOB (L/F) code during output.	
0: Not add	
1: Add	
#9513	DEV4 EIA OUTPUT
Select ISO or EIA code for data output.	
In data input mode, the ISO and EIA codes are identified automatically.	
0: ISO code output	
1: EIA code output	
#9514	DEV4 FEED CHR.
Set the length of the tape feed to be output at the start and end of the data during tape output.	
---Setting range---	
0 to 999 (characters)	
#9515	DEV4 PARITY V
Select whether to perform the parity check for the number of characters in a block at the input of data.	
At the output of data, the number of characters is always adjusted for the parity check.	
0: Not perform parity V check	
1: Perform parity V check	
#9516	DEV4 TIME-OUT (sec)
Set the time out time to detect an interruption in communication.	
Time out check will not be executed when set to "0".	
---Setting range---	
0 to 30 (s)	
#9517	DEV4 DR OFF
Select whether to enable the DR data check in data I/O mode.	
0: Enable	
1: Disable	
#9518	DEV4 DATA ASCII
Select the code of the output data.	
0: ISO/EIA code	
(Depends on whether #9113, #9213, #9313, #9413 or #9513 EIA output parameter is set up.)	
1: ASCII code	
#9519	DEV4 INPUT TYPE
Select the mode for input (verification).	
0: Standard input (Data from the very first EOB is handled as significant information.)	
1: EOBs following the first EOB of the input data are skipped until data other than EOB is input.	

14 User Parameters

14.5 I/O Parameters

#9520	DEV4 OUT BUFFER
<p>Select the buffer size of the output data which is output to output device using NC side serial port.</p> <p>If the output device has a transmission error (overrun error), decrease the buffer size with this parameter.</p> <p>If the buffer size is decreased, output time will prolong according to the size.</p> <p>0: 250 bytes (default)</p> <p>1: 1 byte</p> <p>2: 4 bytes</p> <p>3: 8 bytes</p> <p>4: 16 bytes</p> <p>5: 64 bytes</p>	
#9521	DEV4 EIA CODE [
<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "[".</p> <p>When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>	
#9522	DEV4 EIA CODE]
<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "]".</p> <p>When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>	
#9523	DEV4 EIA CODE #
<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "#".</p> <p>When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>	
#9524	DEV4 EIA CODE *
<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "*".</p> <p>When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>	
#9525	DEV4 EIA CODE =
<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "=".</p> <p>When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>	
#9526	DEV4 EIA CODE:
<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code ":".</p> <p>When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>	

14 User Parameters

14.5 I/O Parameters

#9527	DEV4 EIA CODE \$
	<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "\$".</p> <p>When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>
#9528	DEV4 EIA CODE !
	<p>Set the code in hexadecimal, which does not duplicate the existing EIA codes, for the special code "!".</p> <p>When output with EIA code, data can be output using the alternate code in which the special ISO code, not included in EIA, is specified.</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>

14 User Parameters

14.6 Axis Parameters

14.6 Axis Parameters

#1063	mandog	Manual dog-type
	<p>Select the manual reference position return method for the second return (after the coordinate system is established) and later.</p> <p>The initial reference position return after the power ON is performed with dog-type return, and the coordinate system will be established.</p> <p>(This setting is not required when the absolute position detection is used.)</p> <p>0: High speed return 1: Dog-type</p>	
#8201	AX. RELEASE	
	<p>Select the function to remove the control axis from the control target.</p> <p>0: Control as normal. 1: Remove from control target.</p>	
#8202	OT-CHECK OFF	
	<p>Select whether to enable or disable the stored stroke limit II function set with #8204 and #8205.</p> <p>0: Enable 1: Disable</p>	
#8203	OT-CHECK-CANCEL	
	<p>Select whether or not the stored stroke limit (I, II, IIB, IB and IC) is enabled for the axis for which the simple absolute position method is selected ("#2049 type" is "9") until the first reference position return after power on is completed.</p> <p>0: Enable (determined by #8202 and #8230 for II and IIB) 1: Disable</p>	
#8204	OT-CHECK-N	
	<p>Set the coordinates of the (-) direction in the movable range of the stored stroke limit II or the lower limit coordinates of the prohibited range of stored stroke limit IIB.</p> <p>If the sign and value are the same as #8205, the stored stroke limit II (or IIB) set with #8204 and #8205 will be invalid.</p> <p>If the stored stroke limit IIB function is selected, the prohibited range will be between two points even when #8204 and #8205 are set in reverse.</p> <p>When II is selected, the entire range will be prohibited if #8204 and #8205 are set in reverse.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p>	
#8205	OT-CHECK-P	
	<p>Set the coordinates of the (+) direction in the movable range of the stored stroke limit II or the upper limit coordinates of the prohibited range of stored stroke limit IIB.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p>	
#8206	TOOL CHG. P	
	<p>Set the coordinates of the tool change position for G30. n (tool change position return).</p> <p>Set with coordinates in the basic machine coordinate system.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p>	
#8207	G76/87 IGNR (for M system only)	
	<p>Select whether to enable the shift operation at G76 (fine boring) and G87 (back boring).</p> <p>0: Shift effective 1: No shift</p>	
#8208	G76/87 (-) (for M system only)	
	<p>Select the shift direction at G76 and G87.</p> <p>0: Shift to (+) direction 1: Shift to (-) direction</p>	

14 User Parameters

14.6 Axis Parameters

#8209 G60 SHIFT (for M system only)	
Set the last positioning direction and distance for a G60 (unidirectional positioning) command.	
---Setting range---	
-99999.999 to 99999.999 (mm)	
#8210 OT INSIDE	
Select whether the stored stroke limit function set by #8204 and #8205 prevents the machine from moving to the inside or outside of the specified range.	
0: Inhibits outside area (Select stored stroke limit II.)	
1: Inhibits inside area (Select stored stroke limit IIB.)	
#8211 MIRR. IMAGE	
Select whether to enable the parameter mirror image function.	
0: Disable	
1: Enable	
(PR)	#8213 Rotation axis type
Select the rotation type (short-cut valid/invalid) or linear type (workpiece coordinate linear type/all coordinate linear type).	
This parameter is enabled only when "#1017 rot" is set to "1". (Note)	
0: Short-cut invalid	
1: Short-cut valid	
2: Workpiece coordinate linear type	
3: All coordinate linear type	
(Note) The movement method is as follows by the specified rotation axis type.	
<Workpiece coordinate value>	
0, 1: Display range 0° to 359.999°	
2, 3: Display range 0° to ±99999.999°	
<Machine coordinate value/relative position>	
0, 1, 2: Display range 0° to 359.999°	
3: Display range 0° to ±99999.999°	
<ABS command>	
0: The incremental amount from the end point to the current position is divided by 360, and the axis moves by the remainder amount according to the sign.	
1: Moves with a short-cut to the end point.	
2, 3: In the same manner as the normal linear axis, moves according to the sign by the amount obtained by subtracting the current position from the end point.	
<INC command>	
0, 1, 2, 3: Moves in the direction of the commanded sign by the commanded incremental amount starting at the current position.	
<Reference position return>	
0, 1, 2: The movement to the middle point applies to the ABS command or the INC command.	
Returns with movement within 360 degrees from the middle point to reference position.	
3: The movement to the middle point applies to the ABS command or the INC command.	
Moves and returns in the reference position direction for the difference from the current position to the reference position.	
#8215 TLM std length	
Set the TLM standard length.	
TLM standard length is the distance from a tool replacement point (reference position) to the measurement basic point (surface) which is used to measure the tool length.	
(The same value as "#2016 tlmI+" will be reflected. When either setting changes, the other will change accordingly.)	
---Setting range---	
-99999.999 to 99999.999 (mm)	

14 User Parameters

14.6 Axis Parameters

	#8216	Type in G28 return
		<p>Select the performance after establishing the reference position in reference position return command.</p> <p>0: Moves to the reference position.</p> <p>1: Won't move to the reference position.</p>
	#8217	Check start point
		<p>Set a drawing start position in graphic check of each axis.</p> <p>Set a distance from actual machine position by an incremental value.</p> <p>When "0" is set, an actual machine position will be regarded as a start point in graphic check.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p>
	#8218	Dir cmd retrct amt
		<p>Set in which direction and how much the tool escapes when the operation is halted during direct command mode. (Radius value)</p> <p>The tool does not escape when "0" is set.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p>
	#8219	Hob retract amount 1
		<p>Set the retract amount using the radius value when the Hob retract amount selection signal is OFF. (Radius value)</p> <p>Retract is carried out in the negative direction if a negative value is set.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p>
	#8220	Hob retract amount 2
		<p>Set the retract amount using the radius value when the Hob retract amount selection signal is ON. (Radius value)</p> <p>Retract is carried out in the negative direction if a negative value is set.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p>
	#8221	Hob retract speed
		<p>Set the retract speed during hobbing.</p> <p>---Setting range---</p> <p>1 to 1000000 (mm/min)</p>
(PR)	#8224	Posn display range
		<p>Current position display range</p> <p>Select the display range of the current position.</p> <p>0: 0 to 359.999 deg</p> <p>1: -99999.999 to 99999.999 deg</p>
(PR)	#8225	Wk coord at R ret.
		<p>Workpiece coordinate position displayed right after automatic reference position return</p> <p>Select whether to apply a range of 0 to 360 degrees to the workpiece coordinate position displayed right after automatic reference position return if the said position is out of the range of 0 to 360 degrees.</p> <p>0: Display the position in a range of 0 to 360 degrees</p> <p>1: Not display the position in a range of 0 to 360 degrees</p>
	#8226	Wk position check
		<p>Workpiece position check</p> <p>Select whether to check a difference of workpiece coordinate position between when NC is reset and when program operation is started, when both High-speed simple program check mode ON (X712) and High-speed simple program check: Coordinate position check ON (X713) are set to ON.</p> <p>0: Disable the check</p> <p>1: Enable the check</p>

14 User Parameters

14.6 Axis Parameters

#8227	Machine posn check
<p>Machine position check Select whether to check a difference of machine coordinate command position between when NC is reset and when program operation is started, when both High-speed simple program check mode ON (X712) and High-speed simple program check: Coordinate position check ON (X713) are set to ON.</p> <p>0: Disable the check 1: Enable the check</p>	
#8230	OT-CHECK[2] OFF
<p>Select whether to enable or disable the stored stroke limit IIB function set with #8231 and #8232.</p> <p>0: Enable 1: Disable</p> <p>(Note) This parameter is valid when "#8210 OT INSIDE" is "1".</p>	
#8231	OT-CHECK[2]-N
<p>Set the coordinates of the lower limit of the prohibited area of the stored stroke limit IIB.</p> <p>If the same value is set for both the sign and numeral value as #8232, the stored stroke limit IIB function set with #8231 and #8232 will be disabled.</p> <p>If #8231 and #8232 are set in reverse, the area between the two points is still a prohibited area.</p> <p>(Note) This parameter is valid when "#8210 OT INSIDE" is "1" and "#8230 OT-CHECK[2] OFF" is "0".</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p>	
#8232	OT-CHECK[2]-P
<p>Set the coordinates of the upper limit of the prohibited area of the stored stroke limit IIB.</p> <p>(Note) This parameter is valid when "#8210 OT INSIDE" is "1" and "#8230 OT-CHECK[2] OFF" is "0".</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p>	

14.7 Ethernet Parameters

(PR)	#1926	Global IP address	IP address
		Set the main CPU's IP address. Set the NC IP address seen from an external source.	
		---Setting range--- Set these parameters in accordance with the network rules in the connection environment.	
(PR)	#1927	Global Subnet mask	Subnet mask
		Set the subnet mask for the IP address.	
		---Setting range--- Set these parameters in accordance with the network rules in the connection environment.	
(PR)	#1928	Global Gateway	Gateway
		Set the IP address for the gateway.	
		---Setting range--- Set these parameters in accordance with the network rules in the connection environment.	
(PR)	#1934	Local IP address	
		Set the HMI side CPU's IP address. (Note) This parameter is dedicated to M800VW/M80VW with Windows-based display.	
		---Setting range--- Set these parameters in accordance with the network rules in the connection environment.	
(PR)	#1935	Local Subnet mask	
		Set the HMI side CPU's subnet mask. (Note) This parameter is dedicated to M800VW/M80VW with Windows-based display.	
		---Setting range--- Set these parameters in accordance with the network rules in the connection environment.	
(PR)	#1937	NET1 IP Address	NET1 IP address
		Specify the IP address of the file server (NFS server). If "0.0.0.0" is set in this parameter, network drive (NET1) cannot be used (disabled).	
		---Setting range--- 0.0.0.0 to 255.255.255.255	
(PR)	#1938	NET2 IP Address	NET2 IP address
		Specify the IP address of the file server (NFS server). If "0.0.0.0" is set in this parameter, network drive (NET2) cannot be used (disabled).	
		---Setting range--- 0.0.0.0 to 255.255.255.255	
(PR)	#1939	NET3 IP Address	NET3 IP address
		Specify the IP address of the file server (NFS server). If "0.0.0.0" is set in this parameter, network drive (NET3) cannot be used (disabled).	
		---Setting range--- 0.0.0.0 to 255.255.255.255	
(PR)	#1940	NET4 IP Address	NET4 IP address
		Specify the IP address of the file server (NFS server). If "0.0.0.0" is set in this parameter, network drive (NET4) cannot be used (disabled).	
		---Setting range--- 0.0.0.0 to 255.255.255.255	

14 User Parameters

14.7 Ethernet Parameters

	#1941	Local time compen	Local time correction
		<p>Files stored on file server are managed based on the system time (GMT: Greenwich Mean Time).</p> <p>This parameter is used to specify the correction time for converting the time obtained through custom API library from the system time basis to local time basis.</p> <p>When this parameter is set to 0, the NC determines the correction time based on the language selected by "#1043 lang".</p> <p>---Setting range---</p> <p>-12 to 12 [hour]</p>	
(PR)	#1953	Intra IP address	IP address on non-Windows-based display unit (LAN1) side
		<p>Specify the IP address on the non-Windows-based display unit (LAN1) side.</p> <p>---Setting range---</p> <p>Set these parameters in accordance with the network rules in the connection environment.</p>	
(PR)	#1954	Intra Subnet mask	Subnet mask on non-Windows-based display unit (LAN1) side
		<p>Specify the IP address of subnet mask on the non-Windows-based display unit (LAN1) side.</p> <p>---Setting range---</p> <p>Set these parameters in accordance with the network rules in the connection environment.</p>	
(PR)	#1955	Intra Gateway	Gateway on non-Windows-based display unit (LAN1) side
		<p>Specify the gateway IP address on the non-Windows-based display unit (LAN1) side.</p> <p>---Setting range---</p> <p>Set these parameters in accordance with the network rules in the connection environment.</p>	
(PR)	#1956	Global IP address3	IP address 3
		<p>This parameter specifies the IP address of LAN3.</p> <p>The specified address serves as the external IP address of the CNC.</p> <p>(Note) This parameter is enabled for M800VW/M80VW Series.</p> <p>---Setting range---</p> <p>Set the parameter in accordance with the network requirements.</p>	
(PR)	#1957	Global Subnetmask3	Subnet mask 3
		<p>This parameter specifies the subnet mask of LAN3.</p> <p>(Note) This parameter is enabled for M800VW/M80VW Series.</p> <p>---Setting range---</p> <p>Set the parameter in accordance with the network requirements.</p>	
(PR)	#9701	IP addr auto set	
		<p>The IP address is automatically assigned from the server.</p> <p>0: Manual setting</p> <p>1: Automatic setting</p> <p>(Note) When the automatic setting is selected, "#11005 PC IP address, PC Subnet, PC Gateway" will be invalid.</p>	
	#9706	Host No.	
		<p>Select the No. of the host to be used from host 1 to host 4.</p> <p>---Setting range---</p> <p>1 to 4: Host No.</p>	

14 User Parameters

14.7 Ethernet Parameters

#9711	Host1 host name
<p>Set the host computer name.</p> <p>This parameter allows the NC to easily recognize the host computer on the network. Set the host computer's name (name registered in C:\windows\hosts) or the IP address.</p> <p><Setting example></p> <p>For host name: mspc160</p> <p>For IP address: 150.40.0.111</p> <p>(Note) Set the host computer's TCP/IP address if communication is not carried out correctly.</p> <p>---Setting range---</p> <p>15 characters (alphanumeric) or less</p>	
#9712	Host1 user name
<p>Set the user name when logging into the host computer.</p> <p>---Setting range---</p> <p>15 characters (alphanumeric) or less</p>	
#9713	Host1 password
<p>Set the password when logging into the host computer.</p> <p>---Setting range---</p> <p>15 characters (alphanumeric) or less</p>	
#9714	Host1 directory
<p>Set the directory name of the host computer.</p> <p>The directory released to the client (NC unit) with the host computer's server is handled as the root directory by the NC unit.</p> <p>---Setting range---</p> <p>31 characters (alphanumeric) or less</p>	
#9715	Host1 host type
<p>Select the type of the host computer.</p> <p>0: UNIX/PC automatic judgment</p> <p>1: UNIX</p> <p>2: PC (DOS)</p> <p>(Note) When "0" is set, the settings for the following parameters will be invalid.</p> <ul style="list-style-type: none"> - #9716 Wrd pos: name - #9717 Wrd pos: size - #9718 Wrd pos: Dir - #9719 Wrd pos: cmnt - #9720 Wrd num: cmnt 	
#9716	Host 1 Wrd pos: name
<p>Set the file name display position (nth word from left) of the list displayed when the ftp command "dir" is executed.</p> <p>(Note) One word designates a character string divided by one or more spaces.</p> <p>---Setting range---</p> <p>0 to 100</p> <p>0: Default value</p>	

14 User Parameters

14.7 Ethernet Parameters

#9717	Host 1 Wrđ pos: size
Set the size display position (nth word from left) of the list displayed when the ftp command "dir" is executed.	
(Note) One word designates a character string divided by one or more spaces.	
---Setting range---	
0 to 100	
0: Default value	
#9718	Host 1 Wrđ pos: Dir
Set the <DIR> display position (nth word from left) of the list displayed when the ftp command "dir" is executed.	
(Note) One word designates a character string divided by one or more spaces.	
---Setting range---	
0 to 100	
0: Default value	
#9719	Host 1 Wrđ pos: cmnt
Set the comment (date, time, etc.) display position (nth word from left) of the list displayed when the ftp command "dir" is executed.	
(Note) One word designates a character string divided by one or more spaces.	
---Setting range---	
0 to 100	
0: Default value	
#9720	Host 1 Wrđ num: cmnt
Set the number of words to be displayed as a comment.	
(Note) One word designates a character string divided by one or more spaces.	
---Setting range---	
0 to 100	
0: Default value	
#9721	Host 1 no total siz
Set whether to display the total number of characters registered in the machining programs of host1 when displaying the file list.	
If there are many files in the directory to be referred to, the list can be updated quickly by setting "1".	
0: Display	
1: Not display	
#9731	Host2 host name
Set the host computer name.	
This parameter allows the NC to easily recognize the host computer on the network. Set the host computer's name (name registered in C:\windows\hosts) or the IP address.	
<Setting example>	
For host name: mspc160	
For IP address: 150.40.0.111	
(Note) Set the host computer's TCP/IP address if communication is not carried out correctly.	
---Setting range---	
15 characters (alphanumeric) or less	
#9732	Host2 user name
Set the user name when logging into the host computer.	
---Setting range---	
15 characters (alphanumeric) or less	

14 User Parameters

14.7 Ethernet Parameters

#9733	Host2 password
Set the password when logging into the host computer.	
---Setting range---	
15 characters (alphanumeric) or less	
#9734	Host2 directory
Set the directory name of the host computer.	
The directory released to the client (NC unit) with the host computer's server is handled as the root directory by the NC unit.	
---Setting range---	
31 characters (alphanumeric) or less	
#9735	Host2 host type
Select the type of the host computer.	
0: UNIX/PC automatic judgment	
1: UNIX	
2: PC (DOS)	
(Note) When "0" is set, the settings for the following parameters will be invalid.	
- #9736 Wrd pos: name	
- #9737 Wrd pos: size	
- #9738 Wrd pos: Dir	
- #9739 Wrd pos: cmnt	
- #9740 Wrd num: cmnt	
#9736	Host 2 Wrd pos: name
Set the file name display position (nth word from left) of the list displayed when the ftp command "dir" is executed.	
(Note) One word designates a character string divided by one or more spaces.	
---Setting range---	
0 to 100	
0: Default value	
#9737	Host 2 Wrd pos: size
Set the size display position (nth word from left) of the list displayed when the ftp command "dir" is executed.	
(Note) One word designates a character string divided by one or more spaces.	
---Setting range---	
0 to 100	
0: Default value	
#9738	Host 2 Wrd pos: Dir
Set the <DIR> display position (nth word from left) of the list displayed when the ftp command "dir" is executed.	
(Note) One word designates a character string divided by one or more spaces.	
---Setting range---	
0 to 100	
0: Default value	

14 User Parameters

14.7 Ethernet Parameters

#9739	Host 2 Wrđ pos: cmnt
Set the comment (date, time, etc.) display position (nth word from left) of the list displayed when the ftp command "dir" is executed.	
(Note) One word designates a character string divided by one or more spaces.	
---Setting range---	
0 to 100	
0: Default value	
#9740	Host 2 Wrđ num: cmnt
Set the number of words to be displayed as a comment.	
(Note) One word designates a character string divided by one or more spaces.	
---Setting range---	
0 to 100	
0: Default value	
#9741	Host 2 no total siz
Set whether to display the total number of characters registered in the machining programs of host1 when displaying the file list.	
If there are many files in the directory to be referred to, the list can be updated quickly by setting "1".	
0: Display	
1: Not display	
#9751	Host3 host name
Set the host computer name.	
This parameter allows the NC to easily recognize the host computer on the network. Set the host computer's name (name registered in C:\windows\hosts) or the IP address.	
<Setting example>	
For host name: mspc160	
For IP address: 150.40.0.111	
(Note) Set the host computer's TCP/IP address if communication is not carried out correctly.	
---Setting range---	
15 characters (alphanumeric) or less	
#9752	Host3 user name
Set the user name when logging into the host computer.	
---Setting range---	
15 characters (alphanumeric) or less	
#9753	Host3 password
Set the password when logging into the host computer.	
---Setting range---	
15 characters (alphanumeric) or less	
#9754	Host3 directory
Set the directory name of the host computer.	
The directory released to the client (NC unit) with the host computer's server is handled as the root directory by the NC unit.	
---Setting range---	
31 characters (alphanumeric) or less	

14 User Parameters

14.7 Ethernet Parameters

#9755	Host3 host type
	<p>Select the type of the host computer.</p> <p>0: UNIX/PC automatic judgment</p> <p>1: UNIX</p> <p>2: PC (DOS)</p> <p>(Note) When "0" is set, the settings for the following parameters will be invalid.</p> <ul style="list-style-type: none"> - #9756 Wrd pos: name - #9757 Wrd pos: size - #9758 Wrd pos: Dir - #9759 Wrd pos: cmnt - #9760 Wrd num: cmnt
#9756	Host 3 Wrd pos: name
	<p>Set the file name display position (nth word from left) of the list displayed when the ftp command "dir" is executed.</p> <p>(Note) One word designates a character string divided by one or more spaces.</p> <p>---Setting range---</p> <p>0 to 100</p> <p>0: Default value</p>
#9757	Host 3 Wrd pos: size
	<p>Set the size display position (nth word from left) of the list displayed when the ftp command "dir" is executed.</p> <p>(Note) One word designates a character string divided by one or more spaces.</p> <p>---Setting range---</p> <p>0 to 100</p> <p>0: Default value</p>
#9758	Host 3 Wrd pos: Dir
	<p>Set the <DIR> display position (nth word from left) of the list displayed when the ftp command "dir" is executed.</p> <p>(Note) One word designates a character string divided by one or more spaces.</p> <p>---Setting range---</p> <p>0 to 100</p> <p>0: Default value</p>
#9759	Host 3 Wrd pos: cmnt
	<p>Set the comment (date, time, etc.) display position (nth word from left) of the list displayed when the ftp command "dir" is executed.</p> <p>(Note) One word designates a character string divided by one or more spaces.</p> <p>---Setting range---</p> <p>0 to 100</p> <p>0: Default value</p>
#9760	Host 3 Wrd num: cmnt
	<p>Set the number of words to be displayed as a comment.</p> <p>(Note) One word designates a character string divided by one or more spaces.</p> <p>---Setting range---</p> <p>0 to 100</p> <p>0: Default value</p>

14 User Parameters

14.7 Ethernet Parameters

#9761	Host 3 no total siz
	<p>Set whether to display the total number of characters registered in the machining programs of host1 when displaying the file list.</p> <p>If there are many files in the directory to be referred to, the list can be updated quickly by setting "1".</p> <p>0: Display 1: Not display</p>
#9771	Host4 host name
	<p>Set the host computer name.</p> <p>This parameter allows the NC to easily recognize the host computer on the network. Set the host computer's name (name registered in C:\windows\hosts) or the IP address.</p> <p><Setting example></p> <p>For host name: mspc160 For IP address: 150.40.0.111</p> <p>(Note) Set the host computer's TCP/IP address if communication is not carried out correctly.</p> <p>---Setting range---</p> <p>15 characters (alphanumeric) or less</p>
#9772	Host4 user name
	<p>Set the user name when logging into the host computer.</p> <p>---Setting range---</p> <p>15 characters (alphanumeric) or less</p>
#9773	Host4 password
	<p>Set the password when logging into the host computer.</p> <p>---Setting range---</p> <p>15 characters (alphanumeric) or less</p>
#9774	Host4 directory
	<p>Set the directory name of the host computer.</p> <p>The directory released to the client (NC unit) with the host computer's server is handled as the root directory by the NC unit.</p> <p>---Setting range---</p> <p>31 characters (alphanumeric) or less</p>
#9775	Host4 host type
	<p>Select the type of the host computer.</p> <p>0: UNIX/PC automatic judgment 1: UNIX 2: PC (DOS)</p> <p>(Note) When "0" is set, the settings for the following parameters will be invalid.</p> <ul style="list-style-type: none"> - #9776 Wrd pos: name - #9777 Wrd pos: size - #9778 Wrd pos: Dir - #9779 Wrd pos: cmnt - #9780 Wrd num: cmnt
#9776	Host 4 Wrd pos: name
	<p>Set the file name display position (nth word from left) of the list displayed when the ftp command "dir" is executed.</p> <p>(Note) One word designates a character string divided by one or more spaces.</p> <p>---Setting range---</p> <p>0 to 100 0: Default value</p>

14 User Parameters

14.7 Ethernet Parameters

	#9777	Host 4 Wrđ pos: size	
			Set the size display position (nth word from left) of the list displayed when the ftp command "dir" is executed.
			(Note) One word designates a character string divided by one or more spaces.
		---Setting range---	
			0 to 100
			0: Default value
	#9778	Host 4 Wrđ pos: Dir	
			Set the <DIR> display position (nth word from left) of the list displayed when the ftp command "dir" is executed.
			(Note) One word designates a character string divided by one or more spaces.
		---Setting range---	
			0 to 100
			0: Default value
	#9779	Host 4 Wrđ pos: cmnt	
			Set the comment (date, time, etc.) display position (nth word from left) of the list displayed when the ftp command "dir" is executed.
			(Note) One word designates a character string divided by one or more spaces.
		---Setting range---	
			0 to 100
			0: Default value
	#9780	Host 4 Wrđ num: cmnt	
			Set the number of words to be displayed as a comment.
			(Note) One word designates a character string divided by one or more spaces.
		---Setting range---	
			0 to 100
			0: Default value
	#9781	Host 4 no total siz	
			Set whether to display the total number of characters registered in the machining programs of host1 when displaying the file list.
			If there are many files in the directory to be referred to, the list can be updated quickly by setting "1".
			0: Display
			1: Not display
(PR)	#9800	MES-IF DB IP addr	DB IP address
			Set the IP address of the connection destination database.
		---Setting range---	
			0.0.0.0 to 255.255.255.255
(PR)	#9801	MES-IF DB Port No	DB PORT No.
			Set the service port No. of the connection destination database connector.
		---Setting range---	
			1024 to 65535
(PR)	#9802	MES-IF DB timeout	DB communication time-out (sec)
			Set the communication timeout time (in seconds) with the connection destination database. When "0" is set, the time will be regarded as 60 seconds.
		---Setting range---	
			0 to 3600

14 User Parameters

14.7 Ethernet Parameters

(PR)	#9803	MES-IF DB Type	DB type
		Select the type of the connection destination database.	
		0: Oracle or none specified	
		1: Microsoft SQL Server	
		2: Microsoft Access	
		---Setting range---	
		0 to 2	
(PR)	#9804	MES-IF DB Name	Database name
		Set the name of the connection destination database.	
		---Setting range---	
		Up to 15 characters including alphanumeric characters and '_' (underscore)	
(PR)	#9805	MES-IF DB User	User name
		Set the user name for connecting the database.	
		(The omission of the user name is possible in MS Access. Enter "0" if omitted.)	
		---Setting range---	
		Up to 15 characters including alphanumeric characters and '_' (underscore)	
(PR)	#9806	MES-IF DB Password	Password
		Set the password for the user name.	
		(The omission of the user name is possible in MS Access. Enter "0" if omitted.)	
		---Setting range---	
		Up to 15 characters including alphanumeric characters and '_' (underscore)	
(PR)	#9807	MES-IF DB Table	DB table name
		Set the table name registered by the registration function of each database. Register the table name to which the following suffix is added in the database.	
		_FIN: Machining information database registration	
		_ALM: Alarm information database registration	
		_USR: User arbitrary information database registration	
		---Setting range---	
		Up to 15 characters including alphanumeric characters and '_' (underscore)	
(PR)	#9810	IP Filter for LAN1	
		This parameter specifies whether to allow or block access from IP addresses within the specified range for the LAN1 network.	
		When IP filter setting is not used, enter "0".	
		0: Disable IP filter setting	
		1: Allow	
		2: Block	
(PR)	#9811	StartFilterIP LAN1-1	
		This parameter specifies the IP address of the beginning of the 1st IP address range to be filtered on LAN1.	
		---Setting range---	
		0.0.0.0 to 255.255.255.255	
(PR)	#9812	EndFilterIP LAN1-1	
		This parameter specifies the IP address of the end of the 1st IP address range to be filtered on LAN1.	
		---Setting range---	
		0.0.0.0 to 255.255.255.255	
(PR)	#9813	StartFilterIP LAN1-2	
		This parameter specifies the IP address of the beginning of the 2nd IP address range to be filtered on LAN1.	
		---Setting range---	
		0.0.0.0 to 255.255.255.255	

14 User Parameters

14.7 Ethernet Parameters

(PR)	#9814	EndFilterIP LAN1-2
This parameter specifies the IP address of the end of the 2nd IP address range to be filtered on LAN1.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9815	StartFiltIP LAN1-3
This parameter specifies the IP address of the beginning of the 3rd IP address range to be filtered on LAN1.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9816	EndFilterIP LAN1-3
This parameter specifies the IP address of the end of the 3rd IP address range to be filtered on LAN1.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9817	StartFiltIP LAN1-4
This parameter specifies the IP address of the beginning of the 4th IP address range to be filtered on LAN1.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9818	EndFilterIP LAN1-4
This parameter specifies the IP address of the end of the 4th IP address range to be filtered on LAN1.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9819	StartFiltIP LAN1-5
This parameter specifies the IP address of the beginning of the 5th IP address range to be filtered on LAN1.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9820	EndFilterIP LAN1-5
This parameter specifies the IP address of the end of the 5th IP address range to be filtered on LAN1.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9821	StartFiltIP LAN1-6
This parameter specifies the IP address of the beginning of the 6th IP address range to be filtered on LAN1.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9822	EndFilterIP LAN1-6
This parameter specifies the IP address of the end of the 6th IP address range to be filtered on LAN1.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9823	StartFiltIP LAN1-7
This parameter specifies the IP address of the beginning of the 7th IP address range to be filtered on LAN1.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9824	EndFilterIP LAN1-7
This parameter specifies the IP address of the end of the 7th IP address range to be filtered on LAN1.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9825	StartFiltIP LAN1-8
This parameter specifies the IP address of the beginning of the 8th IP address range to be filtered on LAN1.		
---Setting range---		
0.0.0.0 to 255.255.255.255		

14 User Parameters

14.7 Ethernet Parameters

(PR)	#9826	EndFilterIP LAN1-8
This parameter specifies the IP address of the end of the 8th IP address range to be filtered on LAN1.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9830	IP Filter for LAN2
This parameter specifies whether to allow or block access from IP addresses within the specified range for the LAN2/GDI network.		
When IP filter setting is not used, enter "0".		
0: Disable IP filter setting		
1: Allow		
2: Block		
(PR)	#9831	StartFiltIP LAN2-1
This parameter specifies the IP address of the beginning of the 1st IP address range to be filtered on LAN2/GDI.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9832	EndFilterIP LAN2-1
This parameter specifies the IP address of the end of the 1st IP address range to be filtered on LAN2/GDI.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9833	StartFiltIP LAN2-2
This parameter specifies the IP address of the beginning of the 2nd IP address range to be filtered on LAN2/GDI.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9834	EndFilterIP LAN2-2
This parameter specifies the IP address of the end of the 2nd IP address range to be filtered on LAN2/GDI.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9835	StartFiltIP LAN2-3
This parameter specifies the IP address of the beginning of the 3rd IP address range to be filtered on LAN2/GDI.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9836	EndFilterIP LAN2-3
This parameter specifies the IP address of the end of the 3rd IP address range to be filtered on LAN2/GDI.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9837	StartFiltIP LAN2-4
This parameter specifies the IP address of the beginning of the 4th IP address range to be filtered on LAN2/GDI.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9838	EndFilterIP LAN2-4
This parameter specifies the IP address of the end of the 4th IP address range to be filtered on LAN2/GDI.		
---Setting range---		
0.0.0.0 to 255.255.255.255		

14 User Parameters

14.7 Ethernet Parameters

(PR)	#9839	StartFilterIP LAN2-5
	This parameter specifies the IP address of the beginning of the 5th IP address range to be filtered on LAN2/GDI.	
	---Setting range---	
	0.0.0.0 to 255.255.255.255	
(PR)	#9840	EndFilterIP LAN2-5
	This parameter specifies the IP address of the end of the 5th IP address range to be filtered on LAN2/GDI.	
	---Setting range---	
	0.0.0.0 to 255.255.255.255	
(PR)	#9841	StartFilterIP LAN2-6
	This parameter specifies the IP address of the beginning of the 6th IP address range to be filtered on LAN2/GDI.	
	---Setting range---	
	0.0.0.0 to 255.255.255.255	
(PR)	#9842	EndFilterIP LAN2-6
	This parameter specifies the IP address of the end of the 6th IP address range to be filtered on LAN2/GDI.	
	---Setting range---	
	0.0.0.0 to 255.255.255.255	
(PR)	#9843	StartFilterIP LAN2-7
	This parameter specifies the IP address of the beginning of the 7th IP address range to be filtered on LAN2/GDI.	
	---Setting range---	
	0.0.0.0 to 255.255.255.255	
(PR)	#9844	EndFilterIP LAN2-7
	This parameter specifies the IP address of the end of the 7th IP address range to be filtered on LAN2/GDI.	
	---Setting range---	
	0.0.0.0 to 255.255.255.255	
(PR)	#9845	StartFilterIP LAN2-8
	This parameter specifies the IP address of the beginning of the 8th IP address range to be filtered on LAN2/GDI.	
	---Setting range---	
	0.0.0.0 to 255.255.255.255	
(PR)	#9846	EndFilterIP LAN2-8
	This parameter specifies the IP address of the end of the 8th IP address range to be filtered on LAN2/GDI.	
	---Setting range---	
	0.0.0.0 to 255.255.255.255	
(PR)	#9850	IP Filter for LAN3
	This parameter specifies whether to allow or block access from IP addresses within the specified range for the LAN3 network.	
	When IP filter setting is not used, enter "0".	
	0: Disable IP filter setting	
	1: Allow	
	2: Block	
	(Note) This parameter is enabled for M800VW/M80VW Series.	
(PR)	#9851	StartFilterIP LAN3-1
	This parameter specifies the IP address of the beginning of the 1st IP address range to be filtered on LAN3.	
	(Note) This parameter is enabled for M800VW/M80VW Series.	
	---Setting range---	
	0.0.0.0 to 255.255.255.255	

14 User Parameters

14.7 Ethernet Parameters

(PR)	#9852	EndFilterIP LAN3-1
<p>This parameter specifies the IP address of the end of the 1st IP address range to be filtered on LAN3. (Note) This parameter is enabled for M800VW/M80VW Series.</p> <p>---Setting range---</p> <p>0.0.0.0 to 255.255.255.255</p>		
(PR)	#9853	StartFiltIP LAN3-2
<p>This parameter specifies the IP address of the beginning of the 2nd IP address range to be filtered on LAN3. (Note) This parameter is enabled for M800VW/M80VW Series.</p> <p>---Setting range---</p> <p>0.0.0.0 to 255.255.255.255</p>		
(PR)	#9854	EndFilterIP LAN3-2
<p>This parameter specifies the IP address of the end of the 2nd IP address range to be filtered on LAN3. (Note) This parameter is enabled for M800VW/M80VW Series.</p> <p>---Setting range---</p> <p>0.0.0.0 to 255.255.255.255</p>		
(PR)	#9855	StartFiltIP LAN3-3
<p>This parameter specifies the IP address of the beginning of the 3rd IP address range to be filtered on LAN3. (Note) This parameter is enabled for M800VW/M80VW Series.</p> <p>---Setting range---</p> <p>0.0.0.0 to 255.255.255.255</p>		
(PR)	#9856	EndFilterIP LAN3-3
<p>This parameter specifies the IP address of the end of the 3rd IP address range to be filtered on LAN3. (Note) This parameter is enabled for M800VW/M80VW Series.</p> <p>---Setting range---</p> <p>0.0.0.0 to 255.255.255.255</p>		
(PR)	#9857	StartFiltIP LAN3-4
<p>This parameter specifies the IP address of the beginning of the 4th IP address range to be filtered on LAN3. (Note) This parameter is enabled for M800VW/M80VW Series.</p> <p>---Setting range---</p> <p>0.0.0.0 to 255.255.255.255</p>		
(PR)	#9858	EndFilterIP LAN3-4
<p>This parameter specifies the IP address of the end of the 4th IP address range to be filtered on LAN3. (Note) This parameter is enabled for M800VW/M80VW Series.</p> <p>---Setting range---</p> <p>0.0.0.0 to 255.255.255.255</p>		
(PR)	#9859	StartFiltIP LAN3-5
<p>This parameter specifies the IP address of the beginning of the 5th IP address range to be filtered on LAN3. (Note) This parameter is enabled for M800VW/M80VW Series.</p> <p>---Setting range---</p> <p>0.0.0.0 to 255.255.255.255</p>		
(PR)	#9860	EndFilterIP LAN3-5
<p>This parameter specifies the IP address of the end of the 5th IP address range to be filtered on LAN3. (Note) This parameter is enabled for M800VW/M80VW Series.</p> <p>---Setting range---</p> <p>0.0.0.0 to 255.255.255.255</p>		

14 User Parameters

14.7 Ethernet Parameters

(PR)	#9861	StartFilterIP LAN3-6
This parameter specifies the IP address of the beginning of the 6th IP address range to be filtered on LAN3. (Note) This parameter is enabled for M800VW/M80VW Series.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9862	EndFilterIP LAN3-6
This parameter specifies the IP address of the end of the 6th IP address range to be filtered on LAN3. (Note) This parameter is enabled for M800VW/M80VW Series.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9863	StartFilterIP LAN3-7
This parameter specifies the IP address of the beginning of the 7th IP address range to be filtered on LAN3. (Note) This parameter is enabled for M800VW/M80VW Series.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9864	EndFilterIP LAN3-7
This parameter specifies the IP address of the end of the 7th IP address range to be filtered on LAN3. (Note) This parameter is enabled for M800VW/M80VW Series.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9865	StartFilterIP LAN3-8
This parameter specifies the IP address of the beginning of the 8th IP address range to be filtered on LAN3. (Note) This parameter is enabled for M800VW/M80VW Series.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9866	EndFilterIP LAN3-8
This parameter specifies the IP address of the end of the 8th IP address range to be filtered on LAN3. (Note) This parameter is enabled for M800VW/M80VW Series.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9903	Time Diff(UTC)
Specify the offset from the Coordinated Universal Time (UTC). When a leading minus sign (-) is added, the offset is negative. When a leading plus sign (+) or no sign is added, the offset is positive. Set the offset in "hh:mm" format.		
---Setting range---		
-11:00 to +14:00		
(PR)	#9904	Preferred DNS
Set the IP address of the primary DNS server.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#9905	Alternate DNS
Set the IP address of the secondary DNS server.		
---Setting range---		
0.0.0.0 to 255.255.255.255		

14 User Parameters

14.7 Ethernet Parameters

(PR)	#9906	Proxy Address	
		Set the proxy server name or the IP address of the proxy server. If the server name is longer than 63 characters, set the IP address. ---Setting range--- A string of up to 63 characters, which can contain letters, numbers and symbols	
(PR)	#9907	Proxy Port	
		Specify the proxy server port number. ---Setting range--- 0 to 65535	
(PR)	#11005	PC IP address	IP address setting
		Set the IP address of the display unit or the PC in which machining programs are stored (or the IP address of the IPC for M80V). Set the IP address of the display unit which is powered OFF with the Auto power OFF function. When the 3D machine interference check function is enabled, set the IP address of the display unit to be used for the 3D machine interference check (for M800VW only). (Note) When "0.0.0.0" is entered, "192.168.100.2" is automatically assigned. PC Subnet Set the subnet mask for the display unit or PC in which machining programs are stored. PC Gateway Set the gateway for the display unit or PC in which machining programs are stored. ---Setting range--- 0.0.0.0 to 255.255.255.255	

14.8 Computer Link Parameters

#9601	BAUD RATE
	<p>Select the rate at which data is transferred.</p> <p>0: 19200 (bps)</p> <p>1: 9600</p> <p>2: 4800</p> <p>3: 2400</p> <p>4: 1200</p> <p>5: 600</p> <p>6: 300</p> <p>7: 110</p> <p>8: 38400</p>
#9602	STOP BIT
	<p>Select the stop bit length used in the start-stop system.</p> <p>Refer to "#9603 PARITY EFFECTIVE". At the output of data, the number of characters is always adjusted for the parity check.</p> <p>1: 1 (bit)</p> <p>2: 1.5</p> <p>3: 2</p>
#9603	PARITY EFFECTIVE
	<p>Select whether to add the parity bit to the data.</p> <p>The parameter is set when using a parity bit separately from the data bit.</p> <div data-bbox="346 1068 908 1211"> </div> <p>Set this parameter in accordance with the I/O device specifications.</p> <p>0: Not add a parity bit at the input/output</p> <p>1: Add a parity bit at the input/output</p>
#9604	EVEN PARITY
	<p>Select odd or even when parity is added to the data. This parameter is ignored when no parity is added.</p> <p>0: Odd parity</p> <p>1: Even parity</p>
#9605	CHR. LENGTH
	<p>Set the length of the data bit.</p> <p>Refer to "#9603 PARITY EFFECTIVE".</p> <p>0: 5 (bit)</p> <p>1: 6</p> <p>2: 7 (NC connection not supported)</p> <p>3: 8</p>
#9606	HAND SHAKE
	<p>Select the transmission control method.</p> <p>"3" (DC code method) should be set for computer link B.</p> <p>0: No control</p> <p>1: RTS/CTS method</p> <p>2: No handshaking</p> <p>3: DC code method</p>

14 User Parameters

14.8 Computer Link Parameters

#9607	TIME-OUT SET
Set the time-out time at which an interruption of data transfer during data input/output should be detected. "0" means infinite time-out. ---Setting range--- 0 to 999 (1/10s)	
#9608	DATA CODE
Set the code to be used for the data description. Refer to "#9603 PARITY EFFECTIVE". 0: ASCII code 1: ISO code	
#9609	LINK PARAM. 1
bit1: DC1 output after NAK or SYN Select whether to output the DC1 code after the NAK or SYN code is output. 0: Not output the DC1 code. 1: Output the DC1 code. bit7: Enable/disable resetting Select whether to enable the resetting in the computer link. 0: Enable 1: Disable	
#9610	LINK PARAM. 2
bit2: Specify the control code parity (even parity for the control code). Select whether to add an even parity to the control code, in accordance with the I/O device specifications. 0: Not add a parity bit to the control code 1: Add a parity bit to the control code bit3: Parity V Select whether to enable checking of parity V in one block at the input of the data. 0: Disable 1: Enable	
#9611	Link PARAM. 3
Not used. Set to "0".	
#9612	Link PARAM. 4
Not used. Set to "0".	
#9613	Link PARAM. 5
Not used. Set to "0".	
#9614	START CODE
Select the code used to command the first transfer of file data. This parameter is used for a specific user. Normally set "0". 0: DC1 (11H) 1: BEL (07H)	

14 User Parameters

14.8 Computer Link Parameters

#9615	CTRL. CODE OUT
bit0: NAK output	
Select whether to send the NAK code to the host if a communication error occurs in computer link B.	
0: Not output the NAK code	
1: Output the NAK code.	
bit1: SYN output	
Select whether to send the SYN code to the host if NC resetting or an emergency stop occurs in computer link B.	
0: Not output the SYN code.	
1: Output the SYN code.	
bit3: DC3 output	
Select whether to send the DC3 code to the host when the communication ends in computer link B.	
0: Not output the DC3 code.	
1: Output the DC3 code.	
#9616	CTRL. INTERVAL
Not used. Set to "0".	
#9617	WAIT TIME
Not used. Set to "0".	
#9618	PACKET LENGTH
Not used. Set to "0".	
#9619	BUFFER SIZE
Not used. Set to "0".	
#9620	START SIZE
Not used. Set to "0".	
#9621	DC1 OUT SIZE
Not used. Set to "0".	
#9622	POLLING TIMER
Not used. Set to "0".	
#9623	TRANS. WAIT TMR
Not used. Set to "0".	
#9624	RETRY COUNTER
Not used. Set to "0".	

14 User Parameters

14.9 Subprogram Storage Location Parameters

14.9 Subprogram Storage Location Parameters

#8876	M198 pro stor: dev
<p>When calling a subprogram using M198, the subprogram to be called will be searched from the storage (device and directory) designated with this parameter.</p> <p>(Example) M198 P (program No.)</p> <p>[Device] "#8876 M198 pro stor: dev"</p> <p>[Directory] "#8877 M198 pro stor: dir"</p> <p>(Note 1) If the called subprogram is not found, a program error will occur.</p> <p>(Note 2) If a device is not designated, the subprogram is searched for from the first directory of the memory card for M800VS/M80V, and from the first directory of the data server for M800VW/M80VW.</p> <p>(Note 3) The setting of G (HD) is available for M800VW/M80VW equipped with the Windows-based display unit. The setting of G (HD) is available for M80V when a program stored in the IPC is run on the NC connected to the same network.</p> <p>---Setting range---</p> <p>G: HD</p> <p>R: Memory card</p> <p>D: Data server</p> <p>N: USB Memory</p>	
#8877	M198 pro stor: dir
<p>Specify the storage location (directory) for the subprogram.</p> <p>When calling a subprogram, the subprogram to be called will be searched from the directory designated with this parameter.</p> <p>Refer to the description of "#8876 M198 pro stor:dev".</p> <p>---Setting range---</p> <p>Directory 48 characters</p>	
#8880	Subpro stor D0: dev
<p>If ",D1" to ",D4" is designated in a subprogram call, the called program will be searched from the storage (device and directory) set by this parameter.</p> <p>(Example) When "M98 P (program No.), D0" is commanded, the device and directory below will be searched.</p> <p>[Device] "#8880 Subpro stor D0: dev"</p> <p>[Directory] "#8881 Subpro stor D0: dir"</p> <p>(Note 1) If the called subprogram is not found, a program error will occur.</p> <p>(Note 2) If there is no designation of D0 to D4, search is done according to the settings #8890 to #8894.</p> <p>(Note 3) The setting of G (HD) is available for M800VW/M80VW equipped with the Windows-based display unit, or for M80V when a program stored in the IPC is run on the NC connected to the same network.</p> <p>---Setting range---</p> <p>M: Memory</p> <p>E: Memory2</p> <p>G: HD</p> <p>R: Memory card</p> <p>D: Data server</p> <p>N: USB Memory</p>	
#8881	Subpro stor D0: dir
<p>Select the storage destination (directory) for the subprogram.</p> <p>When D0 is designated at a subprogram call, the subprogram to be called will be searched from the directory selected with this parameter.</p> <p>Refer to "#8880 Subpro stor D0: dev".</p> <p>---Setting range---</p> <p>Directory 48 characters</p>	

14 User Parameters

14.9 Subprogram Storage Location Parameters

#8882	Subpro stor D1: dev
<p>If ",D1" to ",D4" is designated in a subprogram call, the called program will be searched from the storage (device and directory) set by this parameter.</p> <p>(Example) When "M98 P (program No.), D0" is commanded, the device and directory below will be searched.</p> <p>[Device] "#8880 Subpro stor D0: dev"</p> <p>[Directory] "#8881 Subpro stor D0: dir"</p> <p>(Note 1) If the called subprogram is not found, a program error will occur.</p> <p>(Note 2) If there is no designation of D0 to D4, search is done according to the settings #8890 to #8894.</p> <p>(Note 3) The setting of G (HD) is available for M800VW/M80VW equipped with the Windows-based display unit, or for M80V when a program stored in the IPC is run on the NC connected to the same network.</p> <p>---Setting range---</p> <p>M: Memory</p> <p>E: Memory2</p> <p>G: HD</p> <p>R: Memory card</p> <p>D: Data server</p> <p>N: USB Memory</p>	
#8883	Subpro stor D1: dir
<p>Select the storage destination (directory) for the subprogram.</p> <p>When D1 is designated at a subprogram call, the subprogram to be called will be searched from the directory selected with this parameter.</p> <p>Refer to "#8882 Subpro stor D1: dev".</p> <p>---Setting range---</p> <p>Directory 48 characters</p>	
#8884	Subpro stor D2: dev
<p>If ",D1" to ",D4" is designated in a subprogram call, the called program will be searched from the storage (device and directory) set by this parameter.</p> <p>(Example) When "M98 P (program No.), D0" is commanded, the device and directory below will be searched.</p> <p>[Device] "#8880 Subpro stor D0: dev"</p> <p>[Directory] "#8881 Subpro stor D0: dir"</p> <p>(Note 1) If the called subprogram is not found, a program error will occur.</p> <p>(Note 2) If there is no designation of D0 to D4, search is done according to the settings #8890 to #8894.</p> <p>(Note 3) The setting of G (HD) is available for M800VW/M80VW equipped with the Windows-based display unit, or for M80V when a program stored in the IPC is run on the NC connected to the same network.</p> <p>---Setting range---</p> <p>M: Memory</p> <p>E: Memory2</p> <p>G: HD</p> <p>R: Memory card</p> <p>D: Data server</p> <p>N: USB Memory</p>	
#8885	Subpro stor D2: dir
<p>Select the storage destination (directory) for the subprogram.</p> <p>When D2 is designated at a subprogram call, the subprogram to be called will be searched from the directory selected with this parameter.</p> <p>Refer to "#8884 Subpro stor D2: dev".</p> <p>---Setting range---</p> <p>Directory 48 characters</p>	

14 User Parameters

14.9 Subprogram Storage Location Parameters

#8886	Subpro stor D3: dev
<p>If ",D1" to ",D4" is designated in a subprogram call, the called program will be searched from the storage (device and directory) set by this parameter.</p> <p>(Example) When "M98 P (program No.), D0" is commanded, the device and directory below will be searched.</p> <p>[Device] "#8880 Subpro stor D0: dev"</p> <p>[Directory] "#8881 Subpro stor D0: dir"</p> <p>(Note 1) If the called subprogram is not found, a program error will occur.</p> <p>(Note 2) If there is no designation of D0 to D4, search is done according to the settings #8890 to #8894.</p> <p>(Note 3) The setting of G (HD) is available for M800VW/M80VW equipped with the Windows-based display unit, or for M80V when a program stored in the IPC is run on the NC connected to the same network.</p> <p>---Setting range---</p> <p>M: Memory</p> <p>E: Memory2</p> <p>G: HD</p> <p>R: Memory card</p> <p>D: Data server</p> <p>N: USB Memory</p>	
#8887	Subpro stor D3: dir
<p>Select the storage destination (directory) for the subprogram.</p> <p>When D3 is designated at a subprogram call, the subprogram to be called will be searched from the directory selected with this parameter.</p> <p>Refer to "#8886 Subpro stor D3: dev".</p> <p>---Setting range---</p> <p>Directory 48 characters</p>	
#8888	Subpro stor D4: dev
<p>If ",D1" to ",D4" is designated in a subprogram call, the called program will be searched from the storage (device and directory) set by this parameter.</p> <p>(Example) When "M98 P (program No.), D0" is commanded, the device and directory below will be searched.</p> <p>[Device] "#8880 Subpro stor D0: dev"</p> <p>[Directory] "#8881 Subpro stor D0: dir"</p> <p>(Note 1) If the called subprogram is not found, a program error will occur.</p> <p>(Note 2) If there is no designation of D0 to D4, search is done according to the settings #8890 to #8894.</p> <p>(Note 3) The setting of G (HD) is available for M800VW/M80VW equipped with the Windows-based display unit, or for M80V when a program stored in the IPC is run on the NC connected to the same network.</p> <p>---Setting range---</p> <p>M: Memory</p> <p>E: Memory2</p> <p>G: HD</p> <p>R: Memory card</p> <p>D: Data server</p> <p>N: USB Memory</p>	
#8889	Subpro stor D4: dir
<p>Select the storage destination (directory) for the subprogram.</p> <p>When D4 is designated at a subprogram call, the subprogram to be called will be searched from the directory selected with this parameter.</p> <p>Refer to "#8888 Subpro stor D4: dev".</p> <p>---Setting range---</p> <p>Directory 48 characters</p>	

14 User Parameters**14.9 Subprogram Storage Location Parameters**

#8890-8894 Subpro srch odr D0 to D4

Specify the search order of D0 to D4 (devices and directories storing subprograms) when ",D0" to ",D4" are omitted from subprogram call.

Search is performed in the order from 1 to 5. When "0" is set, the device is excluded from search.

If the same value is set for more than one device, search is carried out in the order from the one with a smaller parameter number.

If "0" is set for all the devices, the memory is searched.

---Setting range---

0 to 5

14 User Parameters

14.10 Barrier Data (for L system only)

14.10 Barrier Data (for L system only)

#8300	P0 (for L system only)
	Set the reference X-coordinates of the chuck and the tail stock barrier. Set the center coordinate of workpiece by the basic machine coordinate system. (radius value) ---Setting range--- -99999.999 to 99999.999 (mm)
#8301	P1 (for L system only)
	Set the area of the chuck and tail stock barrier. X axis: Set the coordinate from the workpiece center (P0). (radius value) Z axis: Set the coordinates in the basic machine coordinate system. ---Setting range--- -99999.999 to 99999.999 (mm)
#8302	P2 (for L system only)
	Set the area of the chuck and tail stock barrier. X axis: Set the coordinate from the workpiece center (P0). (radius value) Z axis: Set the coordinates in the basic machine coordinate system. ---Setting range--- -99999.999 to 99999.999 (mm)
#8303	P3 (for L system only)
	Set the area of the chuck and tail stock barrier. X axis: Set the coordinate from the workpiece center (P0). (radius value) Z axis: Set the coordinates in the basic machine coordinate system. ---Setting range--- -99999.999 to 99999.999 (mm)
#8304	P4 (for L system only)
	Set the area of the chuck and tail stock barrier. X axis: Set the coordinate from the workpiece center (P0). (radius value) Z axis: Set the coordinates in the basic machine coordinate system. ---Setting range--- -99999.999 to 99999.999 (mm)
#8305	P5 (for L system only)
	Set the area of the chuck and tail stock barrier. X axis: Set the coordinate from the workpiece center (P0). (radius value) Z axis: Set the coordinates in the basic machine coordinate system. ---Setting range--- -99999.999 to 99999.999 (mm)
#8306	P6 (for L system only)
	Set the area of the chuck and tail stock barrier. X axis: Set the coordinate from the workpiece center (P0). (radius value) Z axis: Set the coordinates in the basic machine coordinate system. ---Setting range--- -99999.999 to 99999.999 (mm)
#8310	Barrier ON (for L system only)
	Select whether to enable the chuck and tailstock barrier. 0: Disable (Setting from special display unit will be enabled) 1: Enable

14 User Parameters

14.10 Barrier Data (for L system only)


#8311	P7 (for L system only)
Set the area of the left spindle section. X axis: Set the coordinate from the workpiece center (P0). (radius value) Z axis: Set the coordinates in the basic machine coordinate system. ---Setting range--- -99999.999 to 99999.999 (mm)	
#8312	P8 (for L system only)
Set the area of the left spindle section. X axis: Set the coordinate from the workpiece center (P0). (radius value) Z axis: Set the coordinates in the basic machine coordinate system. ---Setting range--- -99999.999 to 99999.999 (mm)	
#8313	P9 (for L system only)
Set the area of the right spindle section. X axis: Set the coordinate from the workpiece center (P0). (radius value) Z axis: Set the coordinates in the basic machine coordinate system. ---Setting range--- -99999.999 to 99999.999 (mm)	
#8314	P10 (for L system only)
Set the area of the right spindle section. X axis: Set the coordinate from the workpiece center (P0). (radius value) Z axis: Set the coordinates in the basic machine coordinate system. ---Setting range--- -99999.999 to 99999.999 (mm)	
#8315	Barrier Type (L) (for L system only)
Select the shape of the left chuck and tailstock barrier. 0: No area 1: Chuck 2: Tailstock	
#8316	Barrier Type (R) (for L system only)
Select the shape of the right chuck and tailstock barrier. 0: No area 1: Chuck 2: Tailstock	
#8317	ELIV. AX. Name (for L system only)
Set the name of the delivery axis when the right chuck and tailstock barrier is movable. When using the multi-part system method and the delivery axis is an axis in the other part system, designate the axis including the part system as 1A, 1B or 2A, 2B. If the part system is not designated as A and B, the set part system will be used. ---Setting range--- A/B/.. (axis name) 1A/1B/.. 2A/2B/.. (with part system designated) 0: Cancel	

14 User Parameters

14.10 Barrier Data (for L system only)

#8318	Stock Angle (L) (for L system only)
	Set the angle for the left tailstock end section. The angle will be interpreted as 90° if there is no setting (when "0" is set). ---Setting range--- 0 to 180 (°) 0: 90° (default)
#8319	Stock Angle (R) (for L system only)
	Set the angle for the right tailstock end section. The angle will be interpreted as 90° if there is no setting (when "0" is set). ---Setting range--- 0 to 180 (°) 0: 90° (default)

14.11 High-accuracy Control Parameters
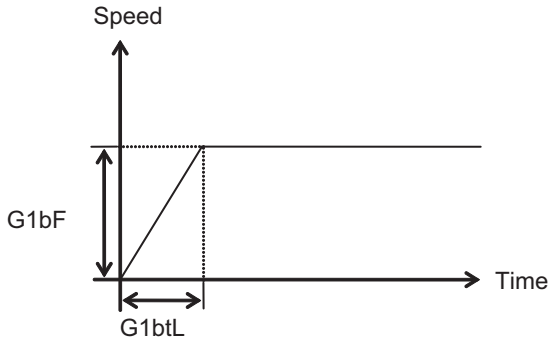
#1149	cireft	Arc deceleration speed change
Select whether to decelerate at the arc entrance or exit. 0: Not decelerate 1: Decelerate		
#1205	G0bdcc	Acceleration and deceleration before G0 interpolation
0: Post-interpolation acceleration/deceleration is applied to G00. 1: Pre-interpolation acceleration/deceleration is applied to G00 even in the high accuracy control mode. 2: Rapid traverse constant-gradient multi-step acceleration/deceleration is enabled. When the multi-part system simultaneous high-accuracy control option is enabled, "1" can be set for the 2nd part system and the following.		
#1206	G1bF	Maximum speed
Set a cutting feedrate when applying pre-interpolation acceleration/deceleration. When high-accuracy control time constant expansion is valid, set the maximum of cutting feed clamp speed of each axis. ---Setting range--- 1 to 999999 (mm/min)		
#1207	G1btL	Time constant
Set a cutting feed time constant when applying pre-interpolation acceleration/deceleration. When set to "0", the time constant will be clamped at 1ms.		
		
---Setting range--- Without high-accuracy control time constant expansion: 1 to 5000 (ms) With high-accuracy control time constant expansion: 1 to 30000 (ms)		
Cutting feed Acc Cutting feed acceleration Displays cutting feed acceleration.		
#1209	cirdcc	Arc deceleration speed
Set the deceleration speed at the arc entrance or exit. ---Setting range--- 1 to 999999 (mm/min)		
#1568	SfiltG1	G01 soft acceleration/deceleration filter
Set the filter time constant for smoothly changing the acceleration rate for the cutting feed acceleration/deceleration in pre-interpolation acceleration/deceleration. - Notch frequency Hz Displays the notch frequency (Hz) for the S-pattern filter set in "#1568 SfiltG1" (G01 soft acceleration/deceleration filter). ---Setting range--- 0 to 200 (ms)		

14 User Parameters

14.11 High-accuracy Control Parameters

#1569	SfiltG0	G00 soft acceleration/deceleration filter
Set the filter time constant for smoothly changing the acceleration rate for the rapid traverse acceleration/deceleration in pre-interpolation acceleration/deceleration.		
---Setting range---		
0 to 200 (ms)		
#1570	Sfilt2	Soft acceleration/deceleration filter 2
Set the filter time constant for smoothly changing the acceleration rate in pre-interpolation acceleration/deceleration.		
This will be disabled when "0" or "1" is set.		
- Notch frequency Hz		
Displays the notch frequency (Hz) for the S-shape filter set in "#1570 Sfilt2" (Soft acceleration/deceleration filter 2).		
---Setting range---		
0 to 200 (ms)		
#1571	SSSdis	SSS control adjustment coefficient fixed value selection
Fix the shape recognition range for SSS control.		
---Setting range---		
0/1		
#7914	ROT_PREFILT	Rotary axis prefilter time constant
Set the time constant for rotary axis prefilter.		
By setting this time constant, the orientation change of the tool (rotary axis motion) during tool center point control/tool cutting point control becomes smoother.		
This parameter can also be set from [Setup] screen ([User] - [Hi-prec param]).		
When "0" is specified, the rotary axis prefiltering function is disabled.		
---Setting range---		
0 to 200 (ms)		

14 User Parameters

14.11 High-accuracy Control Parameters

#8019 R COMP

Set a compensation coefficient for reducing a control error in the reduction of a corner roundness and arc radius.

The larger the set value is, the smaller the theoretical error will be. However, since the speed at the corner goes down, the cycle time will be extended.

Coefficient = 100 - setting value


(Note) This function will be enabled when "#8021 COMP_CHANGE" is set to "0".

---Setting range---

0 to 99 (%)

Theoretical radius decrease error amount

Displays the theoretical radius decrease error amount, ΔR (mm), from the automatic calculation by NC.

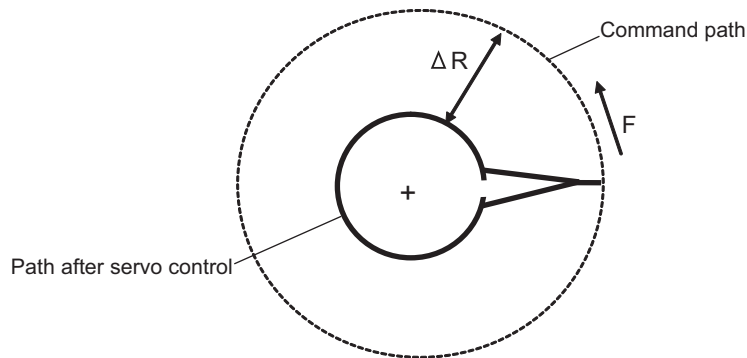

Theoretical radius decrease amount in arc

R5mm arc deceleration speed

Displays a deceleration speed (mm/min) along an arc of 5 (mm) radius.

R1mm arc deceleration speed

Displays a deceleration speed (mm/min) along an arc of 1 (mm) radius.


14 User Parameters

14.11 High-accuracy Control Parameters

#8020 DCC ANGLE

Set the minimum value of an angle (external angle) that should be assumed to be a corner.

When an inter-block angle (external angle) in high-accuracy mode is larger than the set value, it will be determined as a corner and the speed will go down to sharpen the edge.

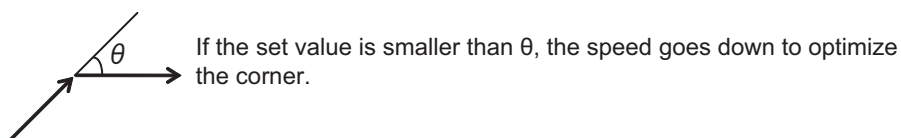

(Note) If "0" is set, it will be handled as "5" degrees.


---Setting range---

0 to 89 (°)

0: 5 degree (Equals to setting "5")

Theoretical corner dull amount

Displays the corner dull amount Δc (mm) in respect to the corner's angle (external angle) θ (°).

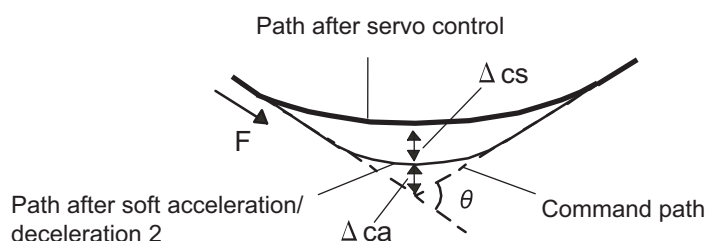

Theoretical roundness amount at corner

ca(mm): Error (Δ) caused by the soft acceleration/deceleration 2

cs(mm): Error (Δ) caused by the servo system

Corner deceleration speed

Display corner deceleration speed c (mm/min) for the corner of the angle (external angle) with θ (°).

Theoretical dull amount at 90 degree

Display corner dull amount when the angle is 90 degree.

Corner deceleration speed at 90 degree

Display corner deceleration speed when the angle is 90 degree.

#8021 COMP_CHANGE

Select whether to share or separate the compensation coefficient at the corner/curve during the high-accuracy control mode.

0: Share ("#8019 R COMP" is applied.)

1: Separate

* Corner: #8022 CORNER COMP

* Curve: #8023 CURVE COMP

(Note) Set "1" when using SSS/EasySSS control.

14 User Parameters

14.11 High-accuracy Control Parameters

#8022	CORNER COMP
<p>Set the compensation coefficient to further reduce or increase the roundness at the corner during the high-accuracy control mode.</p> <p>Coefficient = 100 - setting value</p> <p>(Note) This is valid when "#8021 COMP CHANGE" is set to "1".</p> <p>Reference to "#8020 Corner decreasing speed" for theoretical corner roundness amount, corner decreasing speed, theoretical 90 degree dull amount, 90 degree corner decreasing speed.</p> <p>---Setting range---</p> <p>-1000 to 99 (%)</p>	
#8023	CURVE COMP
<p>Set the compensation coefficient to further reduce or increase the radius reduction amount at the curve (arc, involute, spline) during the high-accuracy control mode.</p> <p>Coefficient = 100 - setting value</p> <p>(Note) This is valid when "#8021 COMP CHANGE" is set to "1".</p> <p>For theoretical radius reduction error amount, R5mm arc deceleration speed and R1mm arc deceleration speed, refer to "#8019 R COMP".</p> <p>---Setting range---</p> <p>-1000 to 99 (%)</p>	
#8025	SPLINE ON
<p>For M system only.</p> <p>Specify whether to enable the fine spline function.</p> <p>0: Disable the fine spline function.</p> <p>1: Enable the fine spline function.</p> <p>Spline interpolation will be valid during G61.2 modal regardless of this setting.</p>	
#8026	CANCEL ANG. (for M system only)
<p>Set the angle where the spline interpolation is temporarily canceled.</p> <p>When the angle made by blocks exceeds this parameter setting value, spline interpolation will be canceled temporarily. In consideration of the pick feed, set a value a little smaller than the pick feed angle.</p> <p>---Setting range---</p> <p>0 to 180 (°)</p> <p>0: 180 (°)</p>	
#8027	Toler-1 (for M system only)
<p>Set the maximum chord error (tolerance) in a block that includes an inflection point. Set the tolerance applicable when the applicable block is developed to fine segments by CAM. (normally about 10 μm)</p> <p>When "0.000" is set, the applicable block will be linear.</p> <p>---Setting range---</p> <p>0.000 to 100.000 (mm)</p>	
#8028	Toler-2 (for M system only)
<p>Set the maximum chord error (tolerance) in a block that includes no inflection point. Set the tolerance applicable when the applicable block is developed to fine segments by CAM. (normally about 10 μm)</p> <p>When "0.000" is set, the applicable block will be linear.</p> <p>---Setting range---</p> <p>0.000 to 100.000 (mm)</p>	
#8029	FairingL (for M system only)
<p>Set the length of the block subject to fairing.</p> <p>(Enabled when "#8033 Fairing ON" is set to "1".)</p> <p>---Setting range---</p> <p>0 to 100.000 (mm)</p>	

14 User Parameters

14.11 High-accuracy Control Parameters

#8030	MINUTE LENG (for M system only)
<p>Set the fine-segment length where the spline interpolation is temporarily canceled.</p> <p>When the length of one block exceeds this parameter setting value, spline interpolation is canceled temporarily and linear interpolation is performed. Set a value a little smaller than one block length of the program.</p> <p>If "-1" is set, spline interpolation will be performed regardless of block length.</p> <p>---Setting range---</p> <p>-1 to 127 (mm)</p> <p>0: 1 (mm)</p>	
#8033	Fairing ON (for M system only)
<p>Select whether or not to use the fairing or smooth fairing function.</p> <p>0: Use neither of them</p> <p>1: Use the fairing function</p> <p>2: Use the smooth fairing function</p>	
#8034	AccClamp ON (for M system only)
<p>Select the method for clamping the cutting speed.</p> <p>0: Clamp with parameter "#2002 clamp" or the corner deceleration function.</p> <p>1: Clamp the cutting speed with acceleration judgment. (Enabled when "#8033 Fairing ON" is set to "1".)</p>	
#8036	CordecJudge (for M system only)
<p>Select the condition to decide a corner.</p> <p>0: A corner is decided from the angle of the neighboring block.</p> <p>1: A corner is decided from the angle of the neighboring block, excluding minute blocks. (Enabled when "#8033 Fairing ON" is set to "1".)</p>	
#8037	CorJudgeL (for M system only)
<p>Set the length of the block to be excluded when deciding a corner.</p> <p>(Enabled when "#8036 CordecJudge" is set to "1".)</p> <p>---Setting range---</p> <p>0 to 99999.999 (mm)</p>	
#8038	Path recog. range
<p>Path recognition range</p> <p>Specify the range to recognize the tool paths adjoining to the command position when the smooth fairing function is ON.</p> <p>If "0" is set, the range will be 1.000 (mm).</p> <p>---Setting range---</p> <p>0 to 100.000 (mm)</p>	
#8039	Comp. range limit
<p>Compensation distance tolerance</p> <p>Specify the upper limit of the distance between the command position and compensation position when the smooth fairing function is ON.</p> <p>If you specify a negative value, operation is conducted with no tolerance limit.</p> <p>If "0" is set, the tolerance will be 0.005 (mm).</p> <p>---Setting range---</p> <p>-1.000 to 100.000 (mm)</p>	
(PR)	#8040 High-SpeedAcc
<p>High-speed high-accuracy control-enabled part system</p> <p>Select whether to enable the simultaneous use of the high-accuracy control and high-speed machining mode (including the high-speed high-accuracy control I and II) for each part system.</p> <p>0: Not enable</p> <p>1: Enable</p> <p>"1" can be set for up to two part systems. If you set "1" for three or more part systems, the alarm (Y51 0032) will result.</p>	

14 User Parameters

14.11 High-accuracy Control Parameters

#8090	SSS ON (for M system only)
Set whether to enable the SSS control with G05 P10000. 0: Disable 1: Enable	
#8091	StdLength (for M system only)
Set the maximum value of the range for recognizing the shape. To eliminate the effect of steps or errors, etc., set a large value. To enable sufficient deceleration, set a small value. If "0.000" is set, the standard value (1.000mm) will be applied. ---Setting range--- 0 to 100.000 (mm)	
#8092	ClampCoeff (for M system only)
Set the clamp speed at the curved section configured of fine segments. Coefficient = $\sqrt{\text{setting value}}$ ---Setting range--- 1 to 100	
#8093	StepLeng (for M system only)
Set the width of the step at which the speed is not to be decelerated. (Approximately the same as the CAM path difference [Tolerance].) If "0" is set, the standard value (5 μ m) will be applied. If a minus value is set, the speed will decelerate at all minute steps. ---Setting range--- -1.000 to 0.100 (mm)	
#8094	DccWaitAdd (for M system only)
Set the time to wait for deceleration when the speed FB does not drop to the clamp speed. ---Setting range--- 0 to 100 (ms)	
#8096	Deceler. coeff. ON
Deceleration coefficient for SSS control ON Select whether to enable the speed coefficients ("#8097 Corner deceleration coefficient for SSS control", "#8098 Arc clamp speed coefficient for SSS control") that are used for compensating for a path error and clamp speed under SSS control. 0: Disable 1: Enable	
#8097	Corner decel coeff
Corner deceleration coefficient for SSS control Specify the compensation coefficient to be used for adjusting a path error and clamp speed at a corner under SSS control. This parameter is enabled during SSS control. Thus set this parameter if you wish to use different compensation coefficients according to ON/OFF of SSS control (If you wish to adjust a path error and clamp speed at a corner, use "#8022 CORNER COMP"). If the setting value is smaller, the theoretical path error will decrease, but the cycle time may be longer because the corner deceleration speed will slow down. Note that this parameter is enabled when "#8096 Deceleration coefficient for SSS control ON" is "1". When "0" is set in this parameter, the standard value (300%) is applied. ---Setting range--- 0 to 2000 (%)	

14 User Parameters

14.11 High-accuracy Control Parameters

#8098	Arc clamp spd coef	
<p>Arc clamp speed coefficient for SSS control</p> <p>Specify the compensation coefficient to be used for adjusting a path error and clamp speed on an arc under SSS control. This parameter is enabled during SSS control. Thus set this parameter if you wish to use different compensation coefficients according to ON/OFF of SSS control (If you wish to adjust a path error and clamp speed on an arc, use "#8023 CURVE COMP").</p> <p>If the setting value is smaller, the theoretical path error will decrease, but the cycle time may be longer because the arc clamp speed will slow down.</p> <p>Note that this parameter is enabled when "#8096 Deceleration coefficient for SSS control ON" is "1".</p> <p>When "0" is set in this parameter, the standard value (100%) is applied.</p> <p>---Setting range---</p> <p>0 to 2000 (%)</p>		
#12051	Jerk_filtG1	G01 jerk filter
<p>Specify the time constant of filter that is used for smoothing the change of jerk when pre-interpolation acceleration/deceleration is performed in cutting feed.</p> <p>This filter causes no path error, as the filter is applied to the resultant speed calculated before interpolation. If you specify the jerk filter time constant, the time constants of each filter will be as follows:</p> <p>- S-shape filter time constant "#1568 SfiltG1" - "Jerk_filtG1"</p> <p>- Jerk filter time constant "Jerk_filtG1"</p> <p>---Setting range---</p> <p>0 to 50 (ms)</p>		
#12052	Jerk_filtG0	G00 jerk filter
<p>Specify the time constant of filter that is used for smoothing the change of jerk when pre-interpolation acceleration/deceleration is performed in cutting feed.</p> <p>This filter causes no path error, as the filter is applied to the resultant speed calculated before interpolation. If you specify the jerk filter time constant, the time constants of each filter will be as follows:</p> <p>- S-shape filter time constant "#1569 SfiltG0" - "Jerk_filtG0"</p> <p>- Jerk filter time constant "Jerk_filtG0"</p> <p>---Setting range---</p> <p>0 to 50 (ms)</p>		
#12053	EachAxAccCntrl	Enable axis-specific acceleration tolerance control
<p>Select how to calculate the deceleration speed for a corner between the blocks where the high-accuracy control is enabled.</p> <p>0: Optimal corner deceleration (calculate the deceleration speed using the acceleration tolerance common for all the axes determined by G1bF and G1btL)</p> <p>1: Axis-specific acceleration tolerance control (calculate the deceleration speed using acceleration tolerances of each axis determined by G1bFx and G1btLx)</p>		
#12060	VblAccPreInt	Variable-acceleration pre-interpolation acceleration/deceleration ON
<p>Select whether to enable variable-acceleration pre-interpolation acceleration/deceleration control while high-accuracy control is ON.</p> <p>0: Pre-interpolation acceleration/deceleration (Apply the acceleration rate that is determined by G1bF and G1btL and is common for all the axes)</p> <p>1: Variable-acceleration pre-interpolation acceleration/deceleration (Apply the acceleration rate that is determined by G1bFx and G1btLx for each axis) (Note) Variable-acceleration pre-interpolation acceleration/deceleration is a function available under SSS control. To enable this function, set "#8090 SSS ON" to "1".</p>		

14 User Parameters

14.11 High-accuracy Control Parameters

#12066	Tolerance ctrl ON	
Select whether to enable the tolerance control.		
0: Disable		
1: Enable		
(Note) Tolerance control is available only under SSS control.		
To enable this function, set "#8090 SSS ON" to "1".		
#12067	Tolerance spd coef	
Set the compensation coefficient to adjust a path error or clamp speed in the corner while tolerance control is ON.		
This parameter is enabled during tolerance control. Thus set this parameter if you wish to use different clamp speed according to ON/OFF of tolerance control.		
When "0" is set in this parameter, the standard value (100%) is applied.		
---Setting range---		
0 to 2000 (%)		
#12068	Smoothing range	
Spline interpolation 2: Smoothing range		
Normally set "0" in this parameter.		
If you run a program with micro segments and its reciprocating paths are uneven, set the parameter to about 3 to 5 times the length of the programmed segments.		
---Setting range---		
0.000 to 10.000 (mm)		
#12069	Corner angle	
Tolerance control: Corner recognition angle		
Specify the corner recognition angle. Normally set to "0".		
---Setting range---		
0.000 to 180.000 (°)		
#12070	Sfilt2_tol	Tolerance control: Soft acceleration/deceleration filter 2
Specify the time constant of the filter that smoothes out fluctuations in acceleration under the tolerance control.		
Basically set to 0.		
---Setting range---		
0 to 200 (ms)		

14 User Parameters

14.12 High-accuracy Control Axis Parameters

14.12 High-accuracy Control Axis Parameters

#2001	rapid	Rapid traverse rate
Set the rapid traverse feedrate for each axis. (Note) The maximum value to be set depends on the machine specifications. ---Setting range--- 1 to 1000000 (mm/min)		
#2002	clamp	Cutting feedrate for clamp function
Set the maximum cutting feedrate for each axis. Even if the feedrate in G01 exceeds this value, the clamp will be applied at this feedrate. ---Setting range--- 1 to 1000000 (mm/min)		
#2010	fwd_g	Feed forward gain
Set a feed forward gain for pre-interpolation acceleration/deceleration. The larger the set value, the smaller the theoretical control error will be. However, if a machine vibration occurs, set the smaller value. ---Setting range--- 0 to 200 (%)		
#2068	G0fwdg	G00 feed forward gain
Set a feed forward gain for G00 pre-interpolation acceleration/deceleration. The larger the setting value, the shorter the positioning time during in-position checking. If a machine vibration occurs, set the smaller value. ---Setting range--- 0 to 200 (%)		
#2096	crncsp	Minimum corner deceleration speed
Set the minimum clamp speed for corner deceleration in the high-accuracy control mode. Normally set "0". (Note) This parameter is invalid during SSS control. ---Setting range--- 0 to 1000000 (mm/min)		
#2109	Rapid (H-precision)	Rapid traverse rate for high-accuracy control mode
Set the rapid traverse rate for each axis in the high-accuracy control mode. When 0 is set, "#2001 rapid" is used. ---Setting range--- 0 to 1000000 (mm/min)		
#2110	Clamp (H-precision)	Cutting feed clamp speed for high-accuracy control mode
Set the cutting feed maximum speed for each axis in the high-accuracy control mode. When 0 is set, "#2002 clamp" is used. ---Setting range--- 0 to 1000000 (mm/min)		

14 User Parameters

14.12 High-accuracy Control Axis Parameters

#2157	G1bFx	Maximum axis-specific pre-interpolation cutting feed rate
<p>When axis-specific acceleration tolerance control is ON: Specify the maximum speed to be used for calculating each axis' acceleration tolerance. When "0" is set, "#2001 rapid" is used.</p> <p>When variable-acceleration pre-interpolation acceleration/deceleration is ON: Specify the maximum speed to be used for calculating each axis' acceleration. When "0" is set, "#1206 G1bF" is used.</p> <p>When both axis-specific acceleration tolerance control and variable-acceleration pre-interpolation acceleration/deceleration are ON: Specify the maximum speed to be used for calculating each axis' acceleration. When "0" is set, "#1206 G1bF" is used.</p> <p>When neither axis-specific acceleration tolerance control nor variable-acceleration pre-interpolation acceleration/deceleration is ON: This parameter is disabled.</p> <p>---Setting range--- 0 to 999999 (mm/min)</p>		
#2158	G1btLx	Axis-specific pre-interpolation cutting feed time constant
<p>When axis-specific acceleration tolerance control is ON: Specify the time constant (a time to be taken until reaching the maximum speed) to be used for calculating each axis' acceleration tolerance. When "0" is set, "#2004 G0tL" is used.</p> <p>When variable-acceleration pre-interpolation acceleration/deceleration is ON: Specify the time constant (a time to be taken until reaching the maximum speed) to be used for calculating each axis' acceleration. When "0" is set, "#1207 G1btL" is used.</p> <p>When both axis-specific acceleration tolerance control and variable-acceleration pre-interpolation acceleration/deceleration are ON: Specify the time constant (a time to be taken until reaching the maximum speed) to be used for calculating each axis' acceleration. When "0" is set, "#1207 G1btL" is used.</p> <p>When neither axis-specific acceleration tolerance control nor variable-acceleration pre-interpolation acceleration/deceleration is ON: This parameter is disabled.</p> <p>---Setting range--- 0 to 5000 (ms)</p>		
#2159	compX	Accuracy coefficient for each axis
<p>Specify the compensation coefficient to be used for adjusting a path error and clamp speed at a corner for each axis during the high-accuracy control mode. If the setting value is larger, the edge accuracy will improve, but the cycle time may be longer because the corner speed will slow down.</p> <p>This parameter is disabled when the axis-specific acceleration tolerance control is OFF.</p> <p>---Setting range--- -1000 to 99 (%)</p>		

14 User Parameters

14.13 Operation Parameters

14.13 Operation Parameters

#8901	Counter type 1
	<p>Select the type of the following counters on the Monitor screen.</p> <ul style="list-style-type: none"> ♦Normal display: Upper-left counter ♦2-, 3- or 4-part system simultaneous display (four counters): Upper-left counter ♦2-, 3- or 4-part system simultaneous display (two counters): Upper counter ♦2-, 3- or 4-part system simultaneous display (one counter): Counter <p>Either relative position or tip work position is displayed by default.</p> <p>(Note 1) 3- or 4-part system simultaneous display is enabled for a 15- or 19-type display unit only.</p> <p>(Note 2) Tip work position is displayed when 5-axis-related option is ON.</p> <p>(Note 3) PLC axis position is displayed when "#11091 PLC counter valid" is "1".</p> <ul style="list-style-type: none"> 1: Current position 2: Workpiece coordinate position 3: Machine position 4: Program position 8: Remain command 9: Manual interrupt amount 10: Next command 11: Restart position 12: Remain distance 16: Tip workpiece coordinate position 18: Tool axis movement 19: Tip machine position 20: Relative position 21: Table coordinate position 22: Workpiece installation position 23: Inclined surface coordinate position 27: PLC axis position <p>---Setting range---</p> <p>1 to 27</p>

14 User Parameters

14.13 Operation Parameters

#8902 Counter type 2

Select the type of the following counters on the Monitor screen.

- ♦Normal display: Lower-left counter
- ♦2-, 3- or 4-part system simultaneous display (four counters): Lower-left counter
- ♦2-, 3- or 4-part system simultaneous display (two counters): Lower counter

Programmed position is displayed by default.

(Note 1) 3- or 4-part system simultaneous display is enabled for a 15- or 19-type display unit only.

(Note 2) PLC axis position is displayed when "#11091 PLC counter valid" is "1".

- 1: Current position
- 2: Workpiece coordinate position
- 3: Machine position
- 4: Program position
- 8: Remain command
- 9: Manual interrupt amount
- 10: Next command
- 11: Restart position
- 12: Remain distance
- 16: Tip workpiece coordinate position
- 18: Tool axis movement
- 19: Tip machine position
- 20: Relative position
- 21: Table coordinate position
- 22: Workpiece installation position
- 23: Inclined surface coordinate position
- 27: PLC axis position

---Setting range---

1 to 27

14 User Parameters

14.13 Operation Parameters

#8903	Counter type 3
	<p>Select the type of the following counters on the Monitor screen.</p> <ul style="list-style-type: none"> ♦Normal display: Upper-right counter ♦2-, 3- or 4-part system simultaneous display (four counters): Upper-right counter <p>Remaining command is displayed by default.</p> <p>(Note 1) 3- or 4-part system simultaneous display is enabled for a 15- or 19-type display unit only.</p> <p>(Note 2) PLC axis position is displayed when "#11091 PLC counter valid" is "1".</p> <ul style="list-style-type: none"> 1: Current position 2: Workpiece coordinate position 3: Machine position 4: Program position 8: Remain command 9: Manual interrupt amount 10: Next command 11: Restart position 12: Remain distance 16: Tip workpiece coordinate position 18: Tool axis movement 19: Tip machine position 20: Relative position 21: Table coordinate position 22: Workpiece installation position 23: Inclined surface coordinate position 27: PLC axis position <p>---Setting range---</p> <p>1 to 27</p>
#8904	Counter type 4
	<p>Select the type of the following counters on the Monitor screen.</p> <ul style="list-style-type: none"> ♦Normal display: Lower-right counter ♦2-, 3- or 4-part system simultaneous display (four counters): Lower-right counter <p>Next command is displayed by default.</p> <p>(Note 1) 3- or 4-part system simultaneous display is enabled for a 15- or 19-type display unit only.</p> <p>(Note 2) PLC axis position is displayed when "#11091 PLC counter valid" is "1".</p> <ul style="list-style-type: none"> 1: Current position 2: Workpiece coordinate position 3: Machine position 4: Program position 8: Remain command 9: Manual interrupt amount 10: Next command 11: Restart position 12: Remain distance 16: Tip workpiece coordinate position 18: Tool axis movement 19: Tip machine position 20: Relative position 21: Table coordinate position 22: Workpiece installation position 23: Inclined surface coordinate position 27: PLC axis position <p>---Setting range---</p> <p>1 to 27</p>

14 User Parameters

14.13 Operation Parameters

#8905	Counter type 5
<p>Select the type of counter on the Monitor screen (Simple display). Either relative position or tip work position is displayed by default. (Note 1) Tip work position is displayed when 5-axis-related option or program format switch option is ON. (Note 2) PLC axis position is displayed when "#11091 PLC counter valid" is "1".</p> <p>1: Current position 2: Workpiece coordinate position 3: Machine position 4: Program position 8: Remain command 9: Manual interrupt amount 10: Next command 11: Restart position 12: Remain distance 16: Tip workpiece coordinate position 18: Tool axis movement 19: Tip machine position 20: Relative position 21: Table coordinate position 22: Workpiece installation position 23: Inclined surface coordinate position 27: PLC axis position</p> <p>---Setting range--- 1 to 27</p>	
#8906	Counter type 6
Not used. Set to "0".	
#8910	Edit undo
<p>Set whether to enable the Undo function during program edit on the Monitor screen or Edit screen.</p> <p>0: Disable 1: Enable</p> <p>(Note) This parameter is enabled for M800VW/M800VS/M80VW Series.</p>	
#8911	NAVI-Message ON
<p>Select whether or not to display a confirmation message upon rewrite of common variable in NAVI operation.</p> <p>0: Not display a confirming message 1: Display a confirming message</p>	
#8912	NAVI operate type
<p>Select the NAVI operation during automatic operation.</p> <p>0: NAVI is unable to start during automatic operation. 1: NAVI is able to start during automatic operation. (An operation involving common variable rewrite is disabled.)</p>	
#8913	Touch panel sense
<p>Set the sensibility of the touch panel. The smaller the setting value is, the more sensitive the panel will be. (1: sensitive, 4: insensitive) When set to "0", the sensibility will be the same as when the standard setting of 2 is applied.</p> <p>---Setting range--- 0 to 4</p>	
#8914	Auto Top search
<p>Select the operation method for restart search type 2.</p> <p>0: It is necessary to set the top search position arbitrarily. 1: The restart search is executed from O No. that is designated as head.</p>	

14 User Parameters

14.13 Operation Parameters

#8915	Auto backup day 1
<p>The automatic backup is executed when the CNC power is turned ON for the first time after the designated date of the month.</p> <p>When "-1" is set in this parameter, the automatic backup is executed every time the CNC power is turned ON (a maximum of once per day).</p> <p>---Setting range---</p> <p>-1: Everyday 0: Disabled 1 to 31: Designated date of a month</p>	
#8916	Auto backup day 2
<p>The automatic backup is executed when the CNC power is turned ON for the first time after the designated date of the month.</p> <p>---Setting range---</p> <p>0: Disabled 1 to 31: Designated date of a month</p>	
#8917	Auto backup day 3
<p>The automatic backup is executed when the CNC power is turned ON for the first time after the designated date of the month.</p> <p>---Setting range---</p> <p>0: Disabled 1 to 31: Designated date of a month</p>	
#8918	Auto backup day 4
<p>The automatic backup is executed when the CNC power is turned ON for the first time after the designated date of the month.</p> <p>---Setting range---</p> <p>0: Disabled 1 to 31: Designated date of a month</p>	
#8919	Auto backup device
<p>Select the automatic backup target device.</p> <p>[M800VW/M80VW with Windows-based display]</p> <p>0: DS 1: HD 2: Memory card 3: USB Memory</p> <p>[M800VS/M80V Series]</p> <p>0: DS 2: Memory card 3: USB Memory</p> <p>(Note 1) The setting range differs according to the CNC model. (Note 2) Any value outside the setting range is treated as "0".</p>	
#8920	3D tool ofs select
<p>Select the method to calculate the drawing position when drawing a solid.</p> <p>With 3D drawing, the drawing position (tool tip position) is calculated with the method designated with this parameter, and the image is drawn.</p> <p>0: For tool radius compensation, use the tool compensation amount set in tool compensation screen. For tool length, use the value in tool set window. (for tool length measurement type I)</p> <p>1: Use the tool compensation amount set in tool compensation screen for both tool radius and tool length compensation. (for tool length measurement type II)</p> <p>2: Use the value set in tool set window for both tool radius and tool length compensation. (for tool length measurement type I)</p> <p>3: Use the value set in tool set window for both tool radius and tool length compensation. (for tool length measurement type II)</p>	

14 User Parameters

14.13 Operation Parameters

		#8921 Mass Edit select
		<p>Select the editing mode for the machining programs saved in HD, memory card, DS or USB memory.</p> <p>0: Regular editing mode If the program size is 1.0 MB (When "#8910 Edit undo" is invalid, 2.0 MB) or more, mass-editing will be applied. (For M80V Series, mass-editing is applied to 0.5 MB or greater capacity.)</p> <p>1: Mass-editing mode</p>
		#8922 T-reg-dup check
		<p>Set whether to enable the duplication check in registering tools to magazine pots, and in setting tool Nos. for spindle/standby.</p> <p>0: Duplication check valid for all valid magazines 1: Duplication check invalid 2: Duplication check valid only for the selected magazine</p>
(PR)	#8923	Hide Edit-IO menu
		<p>Set whether to enable the edit-in/out menu. When disabled, the edit-input/output menu won't appear. However, the maintenance-in/out menu is always enabled regardless of this parameter setting.</p> <p>0: Enable 1: Disable</p>
		#8924 Meas. confirm msg
		<p>Select whether to display a confirming message when attempting to write compensation data for tool measurement, or coordinate system data for workpiece measurement.</p> <p>However, the confirmation message will not appear in L system tool measurement simple mode "#8957 T meas (L)-Simple".</p> <p>0: Not display a confirming message 1: Display a confirming message</p>
		#8925 SP on 1st part sys
		<p>Select which spindle to display in the 1st part system window for the 2-, 3- or 4-part system simultaneous display.</p> <p>(Note 1) If you select "00" for the 2-, 3- or 4-part system simultaneous display, the default display is used (1st spindle on the upper side and 2nd spindle on the lower side).</p> <p>(Note 2) If you set the same number as, or a greater number than the setting of "#1039 spinno", or if the high- or low-order setting is "0", the 1st spindle is displayed.</p> <p>(Note 3) If you set the low-order to F, the screen shows the actual rotation speed, command speed and load meter of the high-order spindle. Note that for the 4-counter display in 4-part system simultaneous display, even if the low-order is not F, the screen shows the actual rotation speed, command speed and load meter of the high-order and low-order spindles.</p> <p>(Note 4) 3- or 4-part system simultaneous display is enabled for a 15- or 19-type display unit only.</p> <p>---Setting range---</p> <p>High-order (Select an upper side spindle.) : 0 to 8 Low-order (Select a lower side spindle.) : 0 to 8, F</p>

14 User Parameters

14.13 Operation Parameters

#8926	SP on 2nd part sys
<p>Select which spindle to display in the 2nd part system window for the 2-, 3- or 4-part system simultaneous display.</p> <p>(Note 1) If you select "00" for the 2-, 3- or 4-part system simultaneous display, the default display is used (1st spindle on the upper side and 2nd spindle on the lower side).</p> <p>(Note 2) If you set the same number as, or a greater number than the setting of "#1039 spinno", or if the high- or low-order setting is "0", the 1st spindle is displayed.</p> <p>(Note 3) If you set the low-order to F, the screen shows the actual rotation speed, command speed and load meter of the high-order spindle. Note that for the 4-counter display in 4-part system simultaneous display, even if the low-order is not F, the screen shows the actual rotation speed, command speed and load meter of the high-order and low-order spindles.</p> <p>(Note 4) 3- or 4-part system simultaneous display is enabled for a 15- or 19-type display unit only.</p> <p>---Setting range---</p> <p>High-order (Select an upper side spindle.) : 0 to 8 Low-order (Select a lower side spindle.) : 0 to 8, F</p>	
#8927	SP on 3rd part sys
<p>Select which spindle to display in the 3rd part system window for the 2-, 3- or 4-part system simultaneous display.</p> <p>(Note 1) If you select "00" for the 2-, 3- or 4-part system simultaneous display, the default display is used (1st spindle on the upper side and 2nd spindle on the lower side).</p> <p>(Note 2) If you set the same number as, or a greater number than the setting of "#1039 spinno", or if the high- or low-order setting is "0", the 1st spindle is displayed.</p> <p>(Note 3) If you set the low-order to F, the screen shows the actual rotation speed, command speed and load meter of the high-order spindle. Note that for the 4-counter display in 4-part system simultaneous display, even if the low-order is not F, the screen shows the actual rotation speed, command speed and load meter of the high-order and low-order spindles.</p> <p>(Note 4) 3- or 4-part system simultaneous display is enabled for a 15- or 19-type display unit only.</p> <p>---Setting range---</p> <p>High-order (Select an upper side spindle.) : 0 to 8 Low-order (Select a lower side spindle.) : 0 to 8, F</p>	
#8928	SP on 4th part sys
<p>Select which spindle to display in the 4th part system window for the 2-, 3- or 4-part system simultaneous display.</p> <p>(Note 1) If you select "00" for the 2-, 3- or 4-part system simultaneous display, the default display is used (1st spindle on the upper side and 2nd spindle on the lower side).</p> <p>(Note 2) If you set the same number as, or a greater number than the setting of "#1039 spinno", or if the high- or low-order setting is "0", the 1st spindle is displayed.</p> <p>(Note 3) If you set the low-order to F, the screen shows the actual rotation speed, command speed and load meter of the high-order spindle. Note that for the 4-counter display in 4-part system simultaneous display, even if the low-order is not F, the screen shows the actual rotation speed, command speed and load meter of the high-order and low-order spindles.</p> <p>(Note 4) 3- or 4-part system simultaneous display is enabled for a 15- or 19-type display unit only.</p> <p>---Setting range---</p> <p>High-order (Select an upper side spindle.) : 0 to 8 Low-order (Select a lower side spindle.) : 0 to 8, F</p>	
#8929	Disable=INPUT:comp
<p>Disable [=INPUT] menu for tool compensation and workpiece coordinate offset values. Fix the setting method to the incremental value input.</p> <p>0: Enable 1: Disable</p>	
#8930	Disable=INPUT:var
<p>Disable [=INPUT] menu for common variables.</p> <p>0: Enable 1: Disable</p>	

14 User Parameters

14.13 Operation Parameters

#8931 Display/Set limit	
Select the restriction of the connected NC's screen display/settings on/from the remote control tool (NC Monitor2).	
0: Permit the screen display/settings	
1: Permit the screen display only	
2: Restrict the connection	
(PR)	#8932 Hide measure scrn
Select whether to display the tool measurement screen and workpiece measurement screen.	
0: Display	
1: Not display	
(Note) If the "#11056 Workshift invalid" (Workpiece coordinate system shift OFF) is "0" for the L system, the screen is displayed as the workpiece coordinate system shift screen even when this parameter is set to "1".	
#8933 Disable lngth comp	
Set whether to disable the setting of tool shape compensation amount.	
0: Enable the setting	
1: Disable the setting	
The shape compensation amount covers the following data according to the tool compensation type.	
• Compensation type I ("1" in "#1037 cmdtyp(command type)")	
... Compensation amount (the sum of shape compensation and wear compensation amount)	
• Compensation type II ("2" in "#1037 cmdtyp(command type)")	
... Length dimension and radius dimension	
• Compensation type III ("3" in "#1037 cmdtyp(command type)")	
... Tool length and tool nose R	
#8934 Disable wear comp	
Select whether to disable the setting of tool wear compensation amount.	
0: Enable the setting	
1: Disable the setting	
The wear compensation amount covers the following data according to the tool compensation type.	
• Compensation type I ("1" in "#1037 cmdtyp(command type)")	
... This parameter is disabled.	
• Compensation type II ("2" in "#1037 cmdtyp(command type)")	
... Length wear and radius wear	
• Compensation type III ("3" in "#1037 cmdtyp(command type)")	
... Tool wear and tool nose wear	
#8935 W COORD CONFIRM	
Select whether to display confirmation message when setting workpiece coordinate system offset in [Easy setting] menu.	
0: Not display	
1: Display	
#8936 Delete leading 0	
In creating a file, or in transferring a file, if the file name of the new file, or the file name of the transfer destination consists only of numerical figures, 0 of the file name head will be deleted from the name.	
0: Designated file name (0 remains in the file name)	
1: 0 will be deleted from the file name	

14 User Parameters

14.13 Operation Parameters

#8937	File sort volume
Set the maximum number of files to sort in the memory card, USB memory and DS lists. If the setting is large, update of the list may take longer.	
---Setting range---	
64 to 1000: (M800VW/M80VW with Windows-based display)	
64 to 250: (M800VS)	
64 to 128: (M80V)	
Standard: 128	
#8938	Edit-Not show Prg
Select whether to enable the automatic display on the Edit screen, when selected, of the programs searched by operation/check search or the MDI programs in MDI mode.	
0: Enable the automatic display	
1: Disable the automatic display	
#8939	Undo confirm msg
Display a confirming message when operating the [Undo] menu.	
0: Not display a confirming message	
1: Display a confirming message	
#8940	Set select display
Select what to display in the selectable display area.	
0: Common variable	
1: Local variable	
2: Workpiece coordinate system offset	
3: All spindles' rotation speed	
4: Expanded counters	
5: Tool center coordinate display	
6: Tool compensation amount	
(Note1) Tool center coordinate display is available only when any of the 5-axis related options is enabled.	
(PR)	#8941 ABS/INC for T-ofs
Enable switching the method to set tool compensation data (absolute/incremental value) with INPUT key.	
0: Fix it to the absolute value input.	
1: Enable to switch between absolute and incremental value input.	
(PR)	#8942 \$1 color
Set the color to be shown on the top-left of screen for the 1st part system. This enables you to change the color patterns for each part system.	
When set to "0", the settings between #8943(#8962) and #8945(#8965) are disabled and the screen is shown by the default color pattern for all the part systems.	
(Note) When set to "0" or "1", the color is determined by the setting of "#11060 Screen theme color".	
0: Theme color (default)	
1: Theme color	
2: Pink	
3: Light blue	
4: Orange	
5: Green	
6: Fuchsia	
7: YellowGreen	
8: Brown	

14 User Parameters

14.13 Operation Parameters

(PR)	#8943	\$2 color
		<p>Set the color to be shown on the top-left of screen for the 2nd part system. This enables you to change the color patterns for each part system.</p> <p>(Note 1) This parameter is enabled when "#8942 \$1 color" is set to the values "1" to "8".</p> <p>(Note 2) When set to "1", the color is determined by the setting of "#11060 Screen theme color".</p> <ul style="list-style-type: none"> 1: Theme color (default) 2: Pink 3: Light blue 4: Orange 5: Green 6: Fuchsia 7: YellowGreen 8: Brown
(PR)	#8944	\$3 color
		<p>Set the color to be shown on the top-left of screen for the 3rd part system. This enables you to change the color patterns for each part system.</p> <p>(Note 1) This parameter is enabled when "#8942 \$1 color" is set to the values "1" to "8".</p> <p>(Note 2) When set to "1", the color is determined by the setting of "#11060 Screen theme color".</p> <ul style="list-style-type: none"> 1: Theme color (default) 2: Pink 3: Light blue 4: Orange 5: Green 6: Fuchsia 7: YellowGreen 8: Brown
(PR)	#8945	\$4 color
		<p>Set the color to be shown on the top-left of screen for the 4th part system. This enables you to change the color patterns for each part system.</p> <p>(Note 1) This parameter is enabled when "#8942 \$1 color" is set to the values "1" to "8".</p> <p>(Note 2) When set to "1", the color is determined by the setting of "#11060 Screen theme color".</p> <ul style="list-style-type: none"> 1: Theme color (default) 2: Pink 3: Light blue 4: Orange 5: Green 6: Fuchsia 7: YellowGreen 8: Brown
	#8952	Edit-win \$ switch
		<p>Select whether to enable switching of program displayed in the edit window on Monitor screen according to the displayed part system when part system switch is performed.</p> <ul style="list-style-type: none"> 0: Not switch 1: Switch
(PR)	#8953	2\$ disp switch typ
		<p>Select how to switch the part system to display when the 2-, 3- or 4-part system simultaneous display is enabled.</p> <ul style="list-style-type: none"> 0, 1: The No. of part system to display is incremented by one. The operation target is switched when the part system displayed in the non-active area is selected. 2: The operation target on the left side is fixed to \$1. When \$1 is selected for the part system switch, the left side is the operation target. When \$2 or after is selected, the displayed part system on the right side is incremented by one. <p>(Note) 3- or 4-part system simultaneous display is enabled for a 15- or 19-type display unit only.</p>

14 User Parameters

14.13 Operation Parameters

	#8954	Initial type
		<p>Select the default setting of the coordinate axis direction designation method to be displayed on the [Surface detail] screen of R-Navi.</p> <p>0,1: Point (+) on the axis 2: Latitude/Longitude 3: Latitude/Projection angle 4: Start point/End point 5: Index angle</p>
	#8955	Init axis pair
		<p>Select the default coordinate axis combination to be displayed on the [Surface detail] screen of R-Navi.</p> <p>0,1: Z/X 2: Z/Y 3: X/Y</p>
(PR)	#8956	User key type
		<p>Select the definition type of the user-defined keys.</p> <p>There are two user-defined keys.</p> <p>♦Type 1: It is the same as the conventional specification. A line feed between "[]" is not dealt as ";". It is dealt as an upper case/lower case letter depending on the CapsLock status. A symbolic character may be converted into a specific character.</p> <p>♦Type 2: A line break inside square brackets "[]" is dealt as ";". Regardless of the CapsLock status, the defined character is input. A symbolic character is also input as defined.</p> <p>0: Type 1 (conventional specification) 1: Type 2</p>
(PR)	#8957	T meas (L)-Simple
		<p>Select the operation mode of the manual tool length measurement 1 for L system.</p> <p>0: Normal operation mode (Conventional specification) Select an axis to measure using the cursor position.</p> <p>1: Simple operation mode Select an axis to measure using an axis address key or menu. More than one axis can be selected.</p>
	#8958	SP on 5th part sys
		<p>Select which spindle to display in the 5th part system window for the 2-, 3- or 4-part system simultaneous display.</p> <p>(Note 1) If you select "00" for the 2-, 3- or 4-part system simultaneous display, the default display is used (1st spindle on the upper side and 2nd spindle on the lower side).</p> <p>(Note 2) If you set the same number as, or a greater number than the setting of "#1039 spinno", or if the high- or low-order setting is "0", the 1st spindle is displayed.</p> <p>(Note 3) If you set the low-order to F, the screen shows the actual rotation speed, command speed and load meter of the high-order spindle. Note that for the 4-counter display in 4-part system simultaneous display, even if the low-order is not F, the screen shows the actual rotation speed, command speed and load meter of the high-order and low-order spindles.</p> <p>(Note 4) 3- or 4-part system simultaneous display is enabled for a 15- or 19-type display unit only.</p> <p>---Setting range---</p> <p>High-order (Select an upper side spindle.) : 0 to 8 Low-order (Select a lower side spindle.) : 0 to 8, F</p>

14 User Parameters

14.13 Operation Parameters

#8959	SP on 6th part sys
	<p>Select which spindle to display in the 6th part system window for the 2-, 3- or 4-part system simultaneous display.</p> <p>(Note 1) If you select "00" for the 2-, 3- or 4-part system simultaneous display, the default display is used (1st spindle on the upper side and 2nd spindle on the lower side).</p> <p>(Note 2) If you set the same number as, or a greater number than the setting of "#1039 spinno", or if the high- or low-order setting is "0", the 1st spindle is displayed.</p> <p>(Note 3) If you set the low-order to F, the screen shows the actual rotation speed, command speed and load meter of the high-order spindle. Note that for the 4-counter display in 4-part system simultaneous display, even if the low-order is not F, the screen shows the actual rotation speed, command speed and load meter of the high-order and low-order spindles.</p> <p>(Note 4) 3- or 4-part system simultaneous display is enabled for a 15- or 19-type display unit only.</p> <p>---Setting range---</p> <p>High-order (Select an upper side spindle.) : 0 to 8</p> <p>Low-order (Select a lower side spindle.) : 0 to 8, F</p>
#8960	SP on 7th part sys
	<p>Select which spindle to display in the 7th part system window for the 2-, 3- or 4-part system simultaneous display.</p> <p>(Note 1) If you select "00" for the 2-, 3- or 4-part system simultaneous display, the default display is used (1st spindle on the upper side and 2nd spindle on the lower side).</p> <p>(Note 2) If you set the same number as, or a greater number than the setting of "#1039 spinno", or if the high- or low-order setting is "0", the 1st spindle is displayed.</p> <p>(Note 3) If you set the low-order to F, the screen shows the actual rotation speed, command speed and load meter of the high-order spindle. Note that for the 4-counter display in 4-part system simultaneous display, even if the low-order is not F, the screen shows the actual rotation speed, command speed and load meter of the high-order and low-order spindles.</p> <p>(Note 4) 3- or 4-part system simultaneous display is enabled for a 15- or 19-type display unit only.</p> <p>---Setting range---</p> <p>High-order (Select an upper side spindle.) : 0 to 8</p> <p>Low-order (Select a lower side spindle.) : 0 to 8, F</p>
#8961	SP on 8th part sys
	<p>Select which spindle to display in the 8th part system window for the 2-, 3- or 4-part system simultaneous display.</p> <p>(Note 1) If you select "00" for the 2-, 3- or 4-part system simultaneous display, the default display is used (1st spindle on the upper side and 2nd spindle on the lower side).</p> <p>(Note 2) If you set the same number as, or a greater number than the setting of "#1039 spinno", or if the high- or low-order setting is "0", the 1st spindle is displayed.</p> <p>(Note 3) If you set the low-order to F, the screen shows the actual rotation speed, command speed and load meter of the high-order spindle. Note that for the 4-counter display in 4-part system simultaneous display, even if the low-order is not F, the screen shows the actual rotation speed, command speed and load meter of the high-order and low-order spindles.</p> <p>(Note 4) 3- or 4-part system simultaneous display is enabled for a 15- or 19-type display unit only.</p> <p>---Setting range---</p> <p>High-order (Select an upper side spindle.) : 0 to 8</p> <p>Low-order (Select a lower side spindle.) : 0 to 8, F</p>

14 User Parameters

14.13 Operation Parameters

(PR)	#8962	\$5 color
		<p>Set the color to be shown on the top-left of screen for the 5th part system. This enables you to change the color patterns for each part system.</p> <p>(Note 1) This parameter is enabled when "#8942 \$1 color" is set to the values "1" to "8".</p> <p>(Note 2) When set to "1", the color is determined by the setting of "#11060 Screen theme color".</p> <p>---Setting range---</p> <ul style="list-style-type: none"> 1: Theme color (default) 2: Pink 3: Light blue 4: Orange 5: Green 6: Fuchsia 7: YellowGreen 8: Brown
(PR)	#8963	\$6 color
		<p>Set the color to be shown on the top-left of screen for the 6th part system. This enables you to change the color patterns for each part system.</p> <p>(Note 1) This parameter is enabled when "#8942 \$1 color" is set to the values "1" to "8".</p> <p>(Note 2) When set to "1", the color is determined by the setting of "#11060 Screen theme color".</p> <p>---Setting range---</p> <ul style="list-style-type: none"> 1: Theme color (default) 2: Pink 3: Light blue 4: Orange 5: Green 6: Fuchsia 7: YellowGreen 8: Brown
(PR)	#8964	\$7 color
		<p>Set the color to be shown on the top-left of screen for the 7th part system. This enables you to change the color patterns for each part system.</p> <p>(Note 1) This parameter is enabled when "#8942 \$1 color" is set to the values "1" to "8".</p> <p>(Note 2) When set to "1", the color is determined by the setting of "#11060 Screen theme color".</p> <p>---Setting range---</p> <ul style="list-style-type: none"> 1: Theme color (default) 2: Pink 3: Light blue 4: Orange 5: Green 6: Fuchsia 7: YellowGreen 8: Brown

14 User Parameters

14.13 Operation Parameters

(PR)	#8965	\$8 color
		<p>Set the color to be shown on the top-left of screen for the 8th part system. This enables you to change the color patterns for each part system.</p> <p>(Note 1) This parameter is enabled when "#8942 \$1 color" is set to the values "1" to "8".</p> <p>(Note 2) When set to "1", the color is determined by the setting of "#11060 Screen theme color".</p> <p>---Setting range---</p> <ul style="list-style-type: none"> 1: Theme color (default) 2: Pink 3: Light blue 4: Orange 5: Green 6: Fuchsia 7: YellowGreen 8: Brown
(PR)	#8966	Edit: INS or OVR
		<p>Select whether to insert or overwrite during edit. Insert or overwrite mode can also be changed temporarily using the INS key.</p> <ul style="list-style-type: none"> 0: Overwrite mode 1: Insert mode
(PR)	#8967	Delete key action
		<p>Select the [DELETE] key operation during edit.</p> <ul style="list-style-type: none"> 0: The key serves as a Delete key. (erases the character after the cursor) 1: The key serves as a Back Space key. (erases the character before the cursor)
	#8968	Tool shape radius
		<p>Tool shape radius designation</p> <p>Select the tool shape designation method.</p> <ul style="list-style-type: none"> 0: Diameter designation 1: Radius designation

14 User Parameters

14.13 Operation Parameters

#8969	Tool offset type 1
	<p>Specify the display item for the 1st column (type) and 2nd column (compensation amount) on the right side of the tool management screen list display.</p> <p>The setting value and display item are specified as follows.</p> <p>(Setting value): (1st column) / (2nd column)</p> <p>· Tool compensation type I</p> <p>0-11: H (Compensation No.) / Length compensation</p> <p>· Tool compensation type II</p> <p>0, 5-11: H (Compensation No.) / Length compensation</p> <p>1: H (Compensation No.) / Length compensation</p> <p>2: D (Compensation No.) / Radius compensation</p> <p>3: +H (Compensation No.) / Length wear</p> <p>4: +D (Compensation No.) / Radius wear</p> <p>· Tool compensation type III</p> <p>0: (Axis name (1st axis))(Compensation No.) / 1st axis tool length</p> <p>1: (Axis name (1st axis))(Compensation No.) / 1st axis tool length</p> <p>2: (Axis name (2nd axis))(Compensation No.) / 2nd axis tool length</p> <p>3: (Axis name (Additional axis))(Compensation No.) / Additional axis tool length</p> <p>4: +(Axis name (1st axis))(Compensation No.) / 1st axis wear</p> <p>5: +(Axis name (2nd axis))(Compensation No.) / 2nd axis wear</p> <p>6: +(Axis name (Additional axis))(Compensation No.) / Additional axis wear</p> <p>7: R / Nose R</p> <p>8: +R / R wear</p> <p>9: P / Point</p> <p>10: (Axis name (2nd additional axis))(Compensation No.) / 2nd additional axis tool length</p> <p>11: +(Axis name (2nd additional axis))(Compensation No.) / 2nd additional axis wear</p> <p>---Setting range---</p> <p>0 to 11</p>

14 User Parameters

14.13 Operation Parameters

#8970	Tool offset type 2
	<p>Specify the display item for the 3rd column (type) and 4th column (compensation amount) on the right side of the tool management screen list display.</p> <p>The setting value and display item are specified as follows.</p> <p>(Setting value): (3rd column) / (4th column)</p> <ul style="list-style-type: none"> · Tool compensation type I 0-11: Set to blank / Set to blank · Tool compensation type II 0, 5-11: D (Compensation No.) / Radius compensation 1: H (Compensation No.) / Length compensation 2: D (Compensation No.) / Radius compensation 3: +H (Compensation No.) / Length wear 4: +D (Compensation No.) / Radius wear · Tool compensation type III 0: (Axis name (2nd axis))(Compensation No.) / 2nd axis tool length 1: (Axis name (1st axis))(Compensation No.) / 1st axis tool length 2: (Axis name (2nd axis))(Compensation No.) / 2nd axis tool length 3: (Axis name (Additional axis))(Compensation No.) / Additional axis tool length 4: +(Axis name (1st axis))(Compensation No.) / 1st axis wear 5: +(Axis name (2nd axis))(Compensation No.) / 2nd axis wear 6: +(Axis name (Additional axis))(Compensation No.) / Additional axis wear 7: R / Nose R 8: +R / R wear 9: P / Point 10: (Axis name (2nd additional axis))(Compensation No.) / 2nd additional axis tool length 11: +(Axis name (2nd additional axis))(Compensation No.) / 2nd additional axis wear <p>---Setting range---</p> <p>0 to 11</p>
#8971	Alarm window ON
	<p>Select whether to enable the alarm display window.</p> <p>0: Disable the alarm display window</p> <p>1: Enable the alarm display window</p>
#8972	T code offset disp
	<p>For L system only</p> <p>Select whether to display tool offset data with the address T's offset No. at the head when the tool offset screen is opened after a manual value command.</p> <p><Monitor screen></p> <p>* Open the tool offset screen (window)</p> <p><Setup screen></p> <p>* Display the tool offset screen</p> <p>(Note) The display is unchanged if you change a tool offset No. with the tool offset screen displayed.</p> <p>0: Not display tool offset data with the address T's offset No. at the head</p> <p>1: Display tool offset data with the address T's offset No. at the head</p>
(PR) #8973	Selective display
	<p>Select whether to enable selective display on an 8.4- or 10.4-type display terminal.</p> <p>0: Disable selective display</p> <p>1: Enable selective display. Select what to display using the parameter "#8940 Set select display".</p>

14 User Parameters

14.13 Operation Parameters

#8974	Simple PLC switch
Select whether to enable ON/OFF of PLC switch without a press of the [Setting valid] menu.	
0: Enable ON/OFF of PLC switch after a press of the [Setting valid] menu.	
1: Enable ON/OFF of PLC switch without a press of the [Setting valid] menu.	
#8975	No. search process
Select how the [XXX No search] menu works on screens including the parameter and tool offset screens.	
0: When you press [No search], enter the No. to display and then press [INPUT], the data on the display is ordered to start from the designated No.	
1: When you enter the No. to display and then press [No. search], the data on the display is ordered to start from the designated No.	
#8976	Menu animation OFF
Select whether to disable animated graphics of the menus.	
0: Enable the animation	
1: Disable the animation	
#8977	Multi-\$ simul edit
Select whether to open the same named programs of different part systems simultaneously for each editing area upon a press of Open on Edit screen while Multi-part system program management is enabled.	
0: Disable (Not open the programs simultaneously for each editing area)	
1: Enable (Open the programs simultaneously for each editing area)	
#8979	Touch op noise res
Set the noise tolerance of touch operation.	
The larger setting value gives the higher noise tolerance, but the operation response becomes dull.	
0: Select this when the motions are normal at one and two points in the stable environment of the power supply.	
1 to 4: If the touch detection position is unstable, increase the setting value according to the cursor blur level.	
(Note) Do not execute touch operation for two seconds after changing this parameter.	
#8980	R-Navi graphic dir
Specify the coordinate system direction of the workpiece graphics (machining surface graphics) to be displayed on the R-Navi surface list screen or surface selection screen.	
(Note) The angle (degrees) is a CCW rotation when viewed from the positive end of the height axis.	
---Setting range---	
0: XYZ 0°	
1: YZX 0°	
2: ZXY 0°	
3: XYZ 90°	
4: YZX 90°	
5: ZXY 90°	
6: XYZ 180°	
7: YZX 180°	
8: ZXY 180°	
9: XYZ 270°	
10: YZX 270°	
11: ZXY 270°	
#8981	NCmemory date disp
Specify the display items when displaying the updated time and date of the file on the "Date / Comment" if NC memory/NC memory2 is selected on the program list display.	
0: Displays the program comment. (Conventional operation)	
1: Displays the updated time and date.	
(Note) When multi-part system program management is valid, program comment display is specified, regardless of this setting.	

14 User Parameters

14.13 Operation Parameters

	#8982	CheckSmltns\$1Invl
		In the check method 2 of graphic check, checking for 1st part system is invalid. 0: Enable the check. (The part system is the check target) 1: Disable the check. (The part system is not the check target)
	#8983	CheckSmltns\$2Invl
		In the check method 2 of graphic check, checking for 2nd part system is invalid. 0: Enable the check. (The part system is the check target) 1: Disable the check. (The part system is not the check target)
	#8984	CheckSmltns\$3Invl
		In the check method 2 of graphic check, checking for 3rd part system is invalid. 0: Enable the check. (The part system is the check target) 1: Disable the check. (The part system is not the check target)
	#8985	CheckSmltns\$4Invl
		In the check method 2 of graphic check, checking for 4th part system is invalid. 0: Enable the check. (The part system is the check target) 1: Disable the check. (The part system is not the check target)
	#8986	CheckSmltns\$5Invl
		In the check method 2 of graphic check, checking for 5th part system is invalid. 0: Enable the check. (The part system is the check target) 1: Disable the check. (The part system is not the check target)
	#8987	CheckSmltns\$6Invl
		In the check method 2 of graphic check, checking for 6th part system is invalid. 0: Enable the check. (The part system is the check target) 1: Disable the check. (The part system is not the check target)
	#8988	CheckSmltns\$7Invl
		In the check method 2 of graphic check, checking for 7th part system is invalid. 0: Enable the check. (The part system is the check target) 1: Disable the check. (The part system is not the check target)
	#8989	CheckSmltns\$8Invl
		In the check method 2 of graphic check, checking for 8th part system is invalid. 0: Enable the check. (The part system is the check target) 1: Disable the check. (The part system is not the check target)
(PR)	#8990	Edit-up/down keys
		At the time of normal edit, specify the operation with up and down cursor keys in the block on the several lines. 0: Moves by line number 1: Moves by line on display (Note) For mass-editing, the operation is always as "1" setting.
	#8991	Interactive cycle
		Select whether to enable the interactive cycle insertion function. 0: Disable 1: Enable
(PR)	#8992	Cycle switch
		Switch the selectable cycle type. 0: Standard/Extended cycle 1: Not used 2: Not used

14 User Parameters

14.13 Operation Parameters

	#8993	Cycle highlight
		<p>Select whether to highlight the program cycle (from the cycle header to the footer) inserted through the interactive cycle insertion.</p> <p>0: Not highlight 1: Highlight</p>
	#8994	=InputOFF:Interact
		<p>Select whether to disable the [=Input] menu for interactive cycle insertion. Fix the setting method to the incremental value input.</p> <p>0: Enable [=Input] menu 1: Disable [=Input] menu</p>
	#8995	Touchop longtaptim
		<p>Set the time until recognized as long press (long tap). When releasing a finger within the set time, it is recognized as tap.</p> <p>0: 800 (ms) 1: 1000 2: 1500 3: 2000</p>
(PR)	#8996	Simple program ON
		<p>Select whether to enable the simple programming function.</p> <p>0: Disable 1: Enable</p>
	#8997	Hi-speed grph chck
		<p>Select whether to increase the graphic check speed. When you select 1 to 3, graphic check becomes faster. Note however that the workpiece shape is drawn more inward than the programmed path. The greater the setting value, the faster the graphic check will be.</p> <p>0: Disable 1: Level 1 2: Level 2 3: Level 3</p> <p>High-speed graphic check is enabled for the check method 1 only.</p>
	#8998	Finish shape view
		<p>Select whether to enable the finished shape display.</p> <p>0: Disable 1: Enable</p>
(PR)	#8999	Simul edit - View
		<p>Select the display format for simultaneous program edit (3 or 4 Edit), which can be selected with the [Display setting] menu.</p> <p>0: [2 Edit] and [3 Edit] are selectable. 1: [2 Edit] and [4 Edit] are selectable.</p>
(PR)	#19701	Restrain VNCserver
		<p>Select whether to restrain the VNC client from connecting to the NC, displaying the NC screen or performing setting to the NC. Menu selection may be disabled depending on the set value.</p> <p>0: Disable the VNC server function. 1: Enable the VNC server function, and allow the VNC client to display the NC screen and to perform setting operation. 2: Enable the VNC server function, and allow the VNC client to display the NC screen, but the available setting operation is INPUT key only.</p>

14 User Parameters

14.13 Operation Parameters

	#19702	VNC password
		Specify the password for connecting to the VNC server. The password is needed for VNC client of an external PC to connect to the server.
		---Setting range--- Up to 8 characters including alphanumeric characters and ' _ ' (underscore)
(PR)	#19703	VNC server port
		Specify the port number for connecting to the VNC server. The recommended value is "5901". (Note) If you use the remote desktop function, do not set "5900".
		---Setting range--- 0 to 65535
	#19704	VNC color depth
		Specify the color depth of the screen displayed by the VNC client via VNC server connection. 0: 16-bit color depth 1: 8-bit color depth
	#19705	VNC transmit cycle
		Specify the transmission cycle for the VNC server to send screen data to the VNC client. 0: Standard transmission cycle 1: Increase the cycle two-fold. 2: Increase the cycle four-fold. (Note) If you increase the transmission cycle, the NC screen refresh may be delayed.
	#19710	Edit-Upward search
		Enable upward search for the text search function in the edit window and edit screen. 0: Search downward from the cursor position. 1: Enable upward and downward search from the cursor position.
	#19711	Unit of feed disp
		Switch the unit of feedrate display for Feedrate per revolution. 0: Display the feedrate in mm/rev unit. 1: Display the feedrate in mm/min unit.
	#19712	Sys var pre-read
		Switch the behavior of the system variables (position data) that cannot be read during travel. 0: A program error is generated 1: Read the system variables after the execution of the block performing travel is completed
	#19715	Cycle output dest.
		Select where to output a cycle created with the interactive cycle insertion. 0: Output to the main program 1: Output to a subprogram stored in NC memory 2: Output to a subprogram stored in the directory "#8880/8881 Subpro stor D0" 3: Output to a subprogram stored in the directory "#8882/8883 Subpro stor D1" 4: Output to a subprogram stored in the directory "#8884/8885 Subpro stor D2" 5: Output to a subprogram stored in the directory "#8886/8887 Subpro stor D3" 6: Output to a subprogram stored in the directory "#8888/8889 Subpro stor D4"
	#19717	W coord: cursor
		Select where the cursor is located after data entry on the workpiece coordinate system offset screen. 0: Cursor moves to the next line. If the original cursor position is in the last line, it moves to the top of the next data. 1: Cursor moves to the next line. If the original cursor position is in the last line, the position is unchanged. 2: Unchanged from the original position. (Note) When base common parameter "#1759 cfgPR09/bit1" is set to "1", the cursor does not move regardless of this parameter setting.

14 User Parameters

14.13 Operation Parameters

#19721	3Dmac.simu.inval
<p>Disable 3D machining simulation in Graphic check (3D).</p> <p>0: Enable 3D machining simulation.</p> <p>1: Disable 3D machining simulation.</p> <p>(*) This parameter is for M800VW series only.</p>	
#19723	3D intrf tooltype
<p>Select the method for calculating the shape of the tool model in the 3D machine interference check.</p> <p>The method specified with this parameter is used to calculate and draw the shape of the tool model.</p> <p>0: Use the tool data set in Tool management screen for both tool radius and tool length.</p> <p>1: Use the tool compensation amount set in Tool compensation screen for both tool radius and tool length.</p> <p>(Note) When Tool compensation type I is used, the tool data set in Tool management screen is used for tool radius regardless of the setting value of this parameter.</p>	
#19724	Repeat key switch
<p>Switch the behavior of the repeat key (page switch key/cursor key).</p> <p>0: Screen stop time depends on the length of time the button is pressed</p> <p>1: The screen stops as soon as the button is released</p> <p>(Note) This parameter is only valid for M800VS and M80V.</p>	
#19730	WebAccess
<p>Specify whether to enable WebAccess (NC screen remote browsing) function. Also set restrictions on screen operations when the function is enabled.</p> <p>0: Disable the function.</p> <p>1: Enable the function. Touch, click and key input are possible.</p> <p>2: Enable the function. Touch, click and key input are possible. Input via [INPUT] key is not possible.</p> <p>3: Enable the function. Touch, click and key input are not possible. Only the NC screen can be displayed.</p> <p>(Note) This parameter is enabled for M800VS/M80V Series.</p>	
#19731	WebAccess USER
<p>Specify the user name when logging in from a Web browser using WebAccess (NC screen remote browsing) function.</p> <p>(Note) This parameter is enabled for M800VS/M80V Series.</p> <p>---Setting range---</p> <p>31 characters (alphanumeric) or less</p>	
#19732	WebAccess PSWD
<p>Specify the password when logging in from a Web browser using WebAccess (NC screen remote browsing) function.</p> <p>(Note) This parameter is enabled for M800VS/M80V Series.</p> <p>---Setting range---</p> <p>Up to 31 characters in length, containing alphanumeric characters and symbols</p>	

14 User Parameters

14.14 Machining Condition Selection Parameters

14.14 Machining Condition Selection Parameters

(Note) The machining condition parameter groups which can be set through the machining condition setting screen are stored according to the application. The guidance display and parameter input/output on the screen follow the machining condition parameter numbers in the following table. These parameters can only be set through the machining condition setting screen.

Nos. on the machining condition setting screen	Machining Condition Parameters (Application 1)	Machining Condition Parameters (Application 2)	Machining Condition Parameters (Application 3)
#1207	#42001	#42301	#42601
#1568	#42002	#42302	#42602
#1570	#42003	#42303	#42603
#2010	#42007	#42307	#42607
#8019	#42004	#42304	#42604
#8020	#42008	#42308	#42608
#8022	#42005	#42305	#42605
#8023	#42006	#42306	#42606
#8026	#42009	#42309	#42609
#8027	#42010	#42310	#42610
#8028	#42011	#42311	#42611
#8030	#42012	#42312	#42612
#8033	#42013	#42313	#42613
#8029	#42014	#42314	#42614
#8037	#42015	#42315	#42615
#8090	#42016	#42316	#42616
#8091	#42017	#42317	#42617
#8093	#42018	#42318	#42618
#2659	#42019	#42319	#42619
#1206	#42020	#42320	#42620
#12070	#42021	#42321	#42621

#1206

G1bF

Maximum speed

Set a cutting feedrate when applying pre-interpolation acceleration/deceleration.


When high-accuracy control time constant expansion is valid, set the maximum of cutting feed clamp speed of each axis.

---Setting range---

1 to 999999 (mm/min)

14 User Parameters

14.14 Machining Condition Selection Parameters
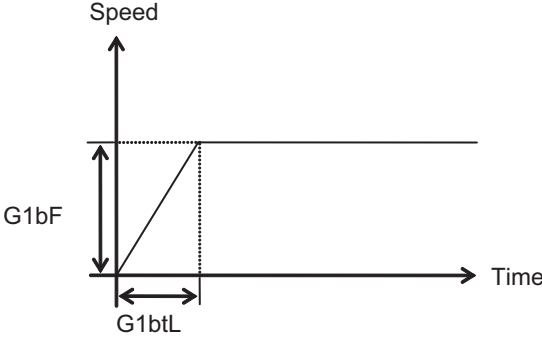
#1207	G1btL	Time constant
Set a cutting feed time constant when applying pre-interpolation acceleration/deceleration. When set to "0", the time constant will be clamped at 1ms.		
		
---Setting range--- Without high-accuracy control time constant expansion: 1 to 5000 (ms) With high-accuracy control time constant expansion: 1 to 30000 (ms)		
Cutting feed Acc Cutting feed acceleration Displays cutting feed acceleration.		
#1568	SfiltG1	G01 soft acceleration/deceleration filter
Set the filter time constant for smoothly changing the acceleration rate for the cutting feed acceleration/deceleration in pre-interpolation acceleration/deceleration. - Notch frequency Hz Displays the notch frequency (Hz) for the S-pattern filter set in "#1568 SfiltG1" (G01 soft acceleration/deceleration filter).		
---Setting range--- 0 to 200 (ms)		
#1570	Sfilt2	Soft acceleration/deceleration filter 2
Set the filter time constant for smoothly changing the acceleration rate in pre-interpolation acceleration/deceleration. This will be disabled when "0" or "1" is set. - Notch frequency Hz Displays the notch frequency (Hz) for the S-shape filter set in "#1570 Sfilt2" (Soft acceleration/deceleration filter 2).		
---Setting range--- 0 to 200 (ms)		
#2010	fwd_g	Feed forward gain
Set a feed forward gain for pre-interpolation acceleration/deceleration. The larger the set value, the smaller the theoretical control error will be. However, if a machine vibration occurs, set the smaller value.		
---Setting range--- 0 to 200 (%)		
#2659	tolerance	Tolerance
Specify a tolerance (tolerable error) to be used under tolerance control. Set a tolerable error for fine segment program created by CAM. (Usually around 0.01(mm)) If 0.000 is set, it is operated with the tolerance of 0.01(mm). When designating the tolerance amount with the "K address", this parameter is not used.		
---Setting range--- 0.000 to 100.000 (mm)		

14 User Parameters

14.14 Machining Condition Selection Parameters

#8019 R COMP

Set a compensation coefficient for reducing a control error in the reduction of a corner roundness and arc radius.

The larger the set value is, the smaller the theoretical error will be. However, since the speed at the corner goes down, the cycle time will be extended.

Coefficient = 100 - setting value


(Note) This function will be enabled when "#8021 COMP_CHANGE" is set to "0".

---Setting range---

0 to 99 (%)

Theoretical radius decrease error amount

Displays the theoretical radius decrease error amount, ΔR (mm), from the automatic calculation by NC.

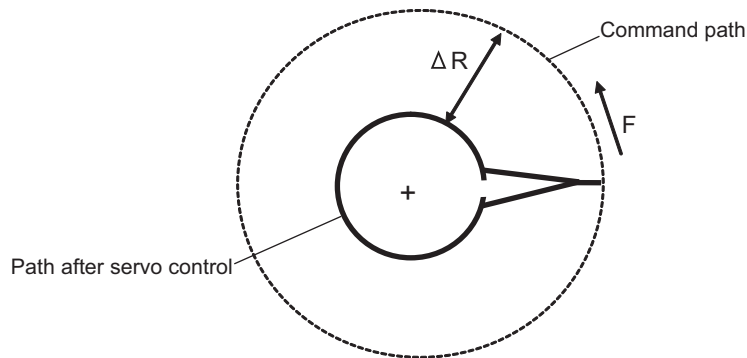

Theoretical radius decrease amount in arc

R5mm arc deceleration speed

Displays a deceleration speed (mm/min) along an arc of 5 (mm) radius.

R1mm arc deceleration speed

Displays a deceleration speed (mm/min) along an arc of 1 (mm) radius.


14 User Parameters

14.14 Machining Condition Selection Parameters

#8020 DCC ANGLE

Set the minimum value of an angle (external angle) that should be assumed to be a corner.

When an inter-block angle (external angle) in high-accuracy mode is larger than the set value, it will be determined as a corner and the speed will go down to sharpen the edge.

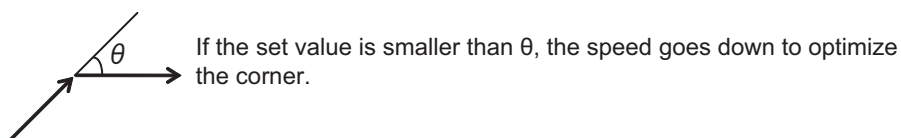

(Note) If "0" is set, it will be handled as "5" degrees.


---Setting range---

0 to 89 (°)

0: 5 degree (Equals to setting "5")

Theoretical corner dull amount

Displays the corner dull amount Δc (mm) in respect to the corner's angle (external angle) θ (°).

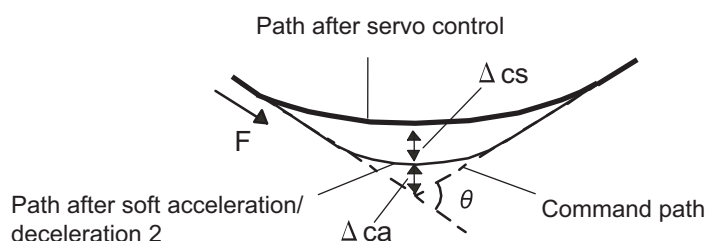

Theoretical roundness amount at corner

ca(mm): Error (Δ) caused by the soft acceleration/deceleration 2

cs(mm): Error (Δ) caused by the servo system

Corner deceleration speed

Display corner deceleration speed c (mm/min) for the corner of the angle (external angle) with θ (°).

Theoretical dull amount at 90 degree

Display corner dull amount when the angle is 90 degree.

Corner deceleration speed at 90 degree

Display corner deceleration speed when the angle is 90 degree.

#8021 COMP_CHANGE

Select whether to share or separate the compensation coefficient at the corner/curve during the high-accuracy control mode.

0: Share ("#8019 R COMP" is applied.)

1: Separate

* Corner: #8022 CORNER COMP

* Curve: #8023 CURVE COMP

(Note) Set "1" when using SSS/EasySSS control.

14 User Parameters

14.14 Machining Condition Selection Parameters

#8022	CORNER COMP
<p>Set the compensation coefficient to further reduce or increase the roundness at the corner during the high-accuracy control mode.</p> <p>Coefficient = 100 - setting value</p> <p>(Note) This is valid when "#8021 COMP CHANGE" is set to "1".</p> <p>Reference to "#8020 Corner decreasing speed" for theoretical corner roundness amount, corner decreasing speed, theoretical 90 degree dull amount, 90 degree corner decreasing speed.</p> <p>---Setting range---</p> <p>-1000 to 99 (%)</p>	
#8023	CURVE COMP
<p>Set the compensation coefficient to further reduce or increase the radius reduction amount at the curve (arc, involute, spline) during the high-accuracy control mode.</p> <p>Coefficient = 100 - setting value</p> <p>(Note) This is valid when "#8021 COMP CHANGE" is set to "1".</p> <p>For theoretical radius reduction error amount, R5mm arc deceleration speed and R1mm arc deceleration speed, refer to "#8019 R COMP".</p> <p>---Setting range---</p> <p>-1000 to 99 (%)</p>	
#8025	SPLINE ON
<p>For M system only.</p> <p>Specify whether to enable the fine spline function.</p> <p>0: Disable the fine spline function.</p> <p>1: Enable the fine spline function.</p> <p>Spline interpolation will be valid during G61.2 modal regardless of this setting.</p>	
#8026	CANCEL ANG. (for M system only)
<p>Set the angle where the spline interpolation is temporarily canceled.</p> <p>When the angle made by blocks exceeds this parameter setting value, spline interpolation will be canceled temporarily. In consideration of the pick feed, set a value a little smaller than the pick feed angle.</p> <p>---Setting range---</p> <p>0 to 180 (°)</p> <p>0: 180 (°)</p>	
#8027	Toler-1 (for M system only)
<p>Set the maximum chord error (tolerance) in a block that includes an inflection point. Set the tolerance applicable when the applicable block is developed to fine segments by CAM. (normally about 10 μm)</p> <p>When "0.000" is set, the applicable block will be linear.</p> <p>---Setting range---</p> <p>0.000 to 100.000 (mm)</p>	
#8028	Toler-2 (for M system only)
<p>Set the maximum chord error (tolerance) in a block that includes no inflection point. Set the tolerance applicable when the applicable block is developed to fine segments by CAM. (normally about 10 μm)</p> <p>When "0.000" is set, the applicable block will be linear.</p> <p>---Setting range---</p> <p>0.000 to 100.000 (mm)</p>	
#8029	FairingL (for M system only)
<p>Set the length of the block subject to fairing.</p> <p>(Enabled when "#8033 Fairing ON" is set to "1".)</p> <p>---Setting range---</p> <p>0 to 100.000 (mm)</p>	

14 User Parameters

14.14 Machining Condition Selection Parameters

#8030	MINUTE LENG (for M system only)	
	<p>Set the fine-segment length where the spline interpolation is temporarily canceled.</p> <p>When the length of one block exceeds this parameter setting value, spline interpolation is canceled temporarily and linear interpolation is performed. Set a value a little smaller than one block length of the program.</p> <p>If "-1" is set, spline interpolation will be performed regardless of block length.</p> <p>---Setting range---</p> <p>-1 to 127 (mm)</p> <p>0: 1 (mm)</p>	
#8033	Fairing ON (for M system only)	
	<p>Select whether or not to use the fairing or smooth fairing function.</p> <p>0: Use neither of them</p> <p>1: Use the fairing function</p> <p>2: Use the smooth fairing function</p>	
#8037	CorJudgeL (for M system only)	
	<p>Set the length of the block to be excluded when deciding a corner.</p> <p>(Enabled when "#8036 CordecJudge" is set to "1".)</p> <p>---Setting range---</p> <p>0 to 99999.999 (mm)</p>	
#8090	SSS ON (for M system only)	
	<p>Set whether to enable the SSS control with G05 P10000.</p> <p>0: Disable</p> <p>1: Enable</p>	
#8091	StdLength (for M system only)	
	<p>Set the maximum value of the range for recognizing the shape.</p> <p>To eliminate the effect of steps or errors, etc., set a large value. To enable sufficient deceleration, set a small value.</p> <p>If "0.000" is set, the standard value (1.000mm) will be applied.</p> <p>---Setting range---</p> <p>0 to 100.000 (mm)</p>	
#8093	StepLeng (for M system only)	
	<p>Set the width of the step at which the speed is not to be decelerated. (Approximately the same as the CAM path difference [Tolerance].)</p> <p>If "0" is set, the standard value (5μm) will be applied.</p> <p>If a minus value is set, the speed will decelerate at all minute steps.</p> <p>---Setting range---</p> <p>-1.000 to 0.100 (mm)</p>	
#12070	Sfilt2_tol	Tolerance control: Soft acceleration/deceleration filter 2
	<p>Specify the time constant of the filter that smoothes out fluctuations in acceleration under the tolerance control.</p> <p>Basically set to 0.</p> <p>---Setting range---</p> <p>0 to 200 (ms)</p>	
#42001	P1-G1btL	Time constant for machining condition selection I
	<p>Time constant for machining condition selection I</p> <p>Set the time constant for the machining condition selection I function. This is equivalent to the parameter "#1207 G1btL".</p> <p>---Setting range---</p> <p>Without high-accuracy control time constant expansion: 0 to 5000 (ms)</p> <p>With high-accuracy control time constant expansion: 0 to 30000 (ms)</p>	

14 User Parameters

14.14 Machining Condition Selection Parameters

#42002	P1-SfiltG1	G01soft acceleration/deceleration filter for machining condition selection I
<p>G01soft acceleration/deceleration filter for machining condition selection I</p> <p>Set the G01 soft acceleration/deceleration filter's time constant for the machining condition selection I function. This is equivalent to the parameter "#1568 SfiltG1".</p> <p>---Setting range---</p> <p>0 to 200 (ms)</p>		
#42003	P1-Sfilt2	Soft acceleration/deceleration filter 2 for machining condition selection I
<p>Soft acceleration/deceleration filter 2 for machining condition selection I</p> <p>Set the soft acceleration/deceleration filter 2's time constant for the machining condition selection I function. This is equivalent to the parameter "#1570 Sfilt2".</p> <p>---Setting range---</p> <p>0 to 50 (ms)</p>		
#42004	P1-rcomp	Accuracy coefficient for machining condition selection I
<p>Accuracy coefficient for machining condition selection I</p> <p>Set the accuracy coefficient for the machining condition selection I function. This is equivalent to the parameter "#8019 R COMP".</p> <p>* This setting is enabled when "#8021 COMP_CHANGE" is set to "0".</p> <p>---Setting range---</p> <p>0 to 99 (%)</p>		
#42005	P1-cor_comp	Corner accuracy coefficient for machining condition selection I
<p>Corner accuracy coefficient for machining condition selection I</p> <p>Set the corner accuracy coefficient for the machining condition selection I function. This is equivalent to the parameter "#8022 CORNER COMP".</p> <p>* This setting is enabled when "#8021 COMP_CHANGE" is set to "1".</p> <p>---Setting range---</p> <p>-1000 to 99 (%)</p>		
#42006	P1-cur_comp	Curve accuracy coefficient for machining condition selection I
<p>Curve accuracy coefficient for machining condition selection I</p> <p>Set the curve accuracy coefficient for the machining condition selection I function. This is equivalent to the parameter "#8023 CURVE COMP".</p> <p>* This setting is enabled when "#8021 COMP_CHANGE" is set to "1".</p> <p>---Setting range---</p> <p>-1000 to 99 (%)</p>		
#42007	P1-fwd_g	Feed forward gain for machining condition selection I
<p>Feed forward gain for machining condition selection I</p> <p>Set the feed forward gain for the machining condition selection I function. This is equivalent to the parameter "#2010 fwd_g".</p> <p>---Setting range---</p> <p>0 to 200 (%)</p>		
#42008	P1-fcorn	Corner deceleration angle for machining condition selection I
<p>Corner deceleration angle for machining condition selection I</p> <p>Set the corner deceleration angle for the machining condition selection I function. This is equivalent to the parameter "#8020 DCC ANGLE".</p> <p>---Setting range---</p> <p>0 to 89 (°)</p>		

14 User Parameters

14.14 Machining Condition Selection Parameters

#42009	P1-spcanag	Cancel angle for machining condition selection I
	Cancel angle for machining condition selection I Set the cancel angle for the machining condition selection I function. This is equivalent to the parameter "#8026 CANCEL ANG". ---Setting range--- 0 to 180 (°)	
#42010	P1-distth1	Chord error 1 for machining condition selection I
	Chord error 1 for machining condition selection I Set the chord error 1 for the machining condition selection I function. This is equivalent to the parameter "#8027 Toler-1". ---Setting range--- 0.000 to 100.000 (mm)	
#42011	P1-distth2	Chord error 2 for machining condition selection I
	Chord error 2 for machining condition selection I Set the chord error 2 for the machining condition selection I function. This is equivalent to the parameter "#8028 Toler-2". ---Setting range--- 0.000 to 100.000 (mm)	
#42012	P1-minute	Fine segment length for machining condition selection I
	Fine segment length for machining condition selection I Set the fine segment length for the machining condition selection I function. This is equivalent to the parameter "#8030 MINUTE LENG". ---Setting range--- -1 to 127 (mm)	
#42013	P1-fairing	Fairing ON for machining condition selection I
	Fairing ON for machining condition selection I Set whether to enable the fairing function for the machining condition selection I function. This is equivalent to the parameter "#8033 Fairing ON". ---Setting range--- 0/1	
#42014	P1-minleng	Fairing L for machining condition selection I
	Fairing L for machining condition selection I Set the fairing length for the machining condition selection I function. This is equivalent to the parameter "#8029 FairingL". ---Setting range--- 0 to 100.000 (mm)	
#42015	P1-cordeclen	Corner judgment length for machining condition selection I
	Corner judgment length for machining condition selection I Set the corner judgment length for the machining condition selection I function. This is equivalent to the parameter "#8037 CorJudgeL". ---Setting range--- 0 to 99999.999 (mm)	
#42016	P1-sss_prcm	SSS/EasySSS control ON for machining condition selection I
	SSS/EasySSS control ON for machining condition selection I Set whether to enable the SSS/EasySSS control for the machining condition selection I function. This is equivalent to the parameter "#8090 SSS ON". ---Setting range--- 0/1	

14 User Parameters

14.14 Machining Condition Selection Parameters

#42017	P1-std_length	Standard length for machining condition selection I
		Standard length for machining condition selection I Set the standard length for the machining condition selection I function. This is equivalent to the parameter "#8091 StdLength". ---Setting range--- 0 to 100.000 (mm)
#42018	P1-step_length	Step width for machining condition selection I
		Step width for machining condition selection I Set the width of the step for the machining condition selection I function. This is equivalent to the parameter "#8093 StepLeng". ---Setting range--- -1.000 to 0.100 (mm)
#42019	P1-tolerance	Tolerance for machining condition selection I
		Set the tolerance for machining condition selection parameter group for machining condition selection I function. This is equivalent to the parameter "#2659 tolerance". ---Setting range--- 0 to 100.000 (mm)
#42020	P1-G1bF	Machining condition selection I: maximum speed
		Specify the maximum speed for the machining condition parameters of the machining condition selection I function (equivalent to "#1206 G1bF"). ---Setting range--- 1 to 1000000 (mm/min)
#42021	P1-Sfilt2_tol	Machining condition selection I: tolerance control soft accel/decel filter 2
		Specify the tolerance control soft acceleration/deceleration filter 2 for the machining condition parameters of the machining condition selection I function (equivalent to "#12070 Sfilt2_tol"). ---Setting range--- 0 to 200 (ms)
#42301	P2-G1btL	Time constant for machining condition selection I
		Time constant for machining condition selection I Set the time constant for the machining condition selection I function. This is equivalent to the parameter "#1207 G1btL". ---Setting range--- Without high-accuracy control time constant expansion: 0 to 5000 (ms) With high-accuracy control time constant expansion: 0 to 30000 (ms)
#42302	P2-SfiltG1	G01soft acceleration/deceleration filter for machining condition selection I
		G01soft acceleration/deceleration filter for machining condition selection I Set the G01 soft acceleration/deceleration filter's time constant for the machining condition selection I function. This is equivalent to the parameter "#1568 SfiltG1". ---Setting range--- 0 to 200 (ms)
#42303	P2-Sfilt2	Soft acceleration/deceleration filter 2 for machining condition selection I
		Soft acceleration/deceleration filter 2 for machining condition selection I Set the soft acceleration/deceleration filter 2's time constant for the machining condition selection I function. This is equivalent to the parameter "#1570 Sfilt2". ---Setting range--- 0 to 50 (ms)

14 User Parameters

14.14 Machining Condition Selection Parameters

#42304	P2-rcomp	Accuracy coefficient for machining condition selection I
		<p>Accuracy coefficient for machining condition selection I</p> <p>Set the accuracy coefficient for the machining condition selection I function. This is equivalent to the parameter "#8019 R COMP".</p> <p>* This setting is enabled when "#8021 COMP_CHANGE" is set to "0".</p> <p>---Setting range---</p> <p>0 to 99 (%)</p>
#42305	P2-cor_comp	Corner accuracy coefficient for machining condition selection I
		<p>Corner accuracy coefficient for machining condition selection I</p> <p>Set the corner accuracy coefficient for the machining condition selection I function. This is equivalent to the parameter "#8022 CORNER COMP".</p> <p>* This setting is enabled when "#8021 COMP_CHANGE" is set to "1".</p> <p>---Setting range---</p> <p>-1000 to 99 (%)</p>
#42306	P2-cur_comp	Curve accuracy coefficient for machining condition selection I
		<p>Curve accuracy coefficient for machining condition selection I</p> <p>Set the curve accuracy coefficient for the machining condition selection I function. This is equivalent to the parameter "#8023 CURVE COMP".</p> <p>* This setting is enabled when "#8021 COMP_CHANGE" is set to "1".</p> <p>---Setting range---</p> <p>-1000 to 99 (%)</p>
#42307	P2-fwd_g	Feed forward gain for machining condition selection I
		<p>Feed forward gain for machining condition selection I</p> <p>Set the feed forward gain for the machining condition selection I function. This is equivalent to the parameter "#2010 fwd_g".</p> <p>---Setting range---</p> <p>0 to 200 (%)</p>
#42308	P2-fcorn	Corner deceleration angle for machining condition selection I
		<p>Corner deceleration angle for machining condition selection I</p> <p>Set the corner deceleration angle for the machining condition selection I function. This is equivalent to the parameter "#8020 DCC ANGLE".</p> <p>---Setting range---</p> <p>0 to 89 (°)</p>
#42309	P2-spcanag	Cancel angle for machining condition selection I
		<p>Cancel angle for machining condition selection I</p> <p>Set the cancel angle for the machining condition selection I function. This is equivalent to the parameter "#8026 CANCEL ANG".</p> <p>---Setting range---</p> <p>0 to 180 (°)</p>
#42310	P2-distth1	Chord error 1 for machining condition selection I
		<p>Chord error 1 for machining condition selection I</p> <p>Set the chord error 1 for the machining condition selection I function. This is equivalent to the parameter "#8027 Toler-1".</p> <p>---Setting range---</p> <p>0.000 to 100.000 (mm)</p>

14 User Parameters

14.14 Machining Condition Selection Parameters

#42311	P2-distth2	Chord error 2 for machining condition selection I
		Chord error 2 for machining condition selection I Set the chord error 2 for the machining condition selection I function. This is equivalent to the parameter "#8028 Toler-2". ---Setting range--- 0.000 to 100.000 (mm)
#42312	P2-minute	Fine segment length for machining condition selection I
		Fine segment length for machining condition selection I Set the fine segment length for the machining condition selection I function. This is equivalent to the parameter "#8030 MINUTE LENG". ---Setting range--- -1 to 127 (mm)
#42313	P2-fairing	Fairing ON for machining condition selection I
		Fairing ON for machining condition selection I Set whether to enable the fairing function for the machining condition selection I function. This is equivalent to the parameter "#8033 Fairing ON". ---Setting range--- 0/1
#42314	P2-minleng	Fairing L for machining condition selection I
		Fairing L for machining condition selection I Set the fairing length for the machining condition selection I function. This is equivalent to the parameter "#8029 FairingL". ---Setting range--- 0 to 100.000 (mm)
#42315	P2-cordeclen	Corner judgment length for machining condition selection I
		Corner judgment length for machining condition selection I Set the corner judgment length for the machining condition selection I function. This is equivalent to the parameter "#8037 CorJudgeL". ---Setting range--- 0 to 99999.999 (mm)
#42316	P2-sss_prcm	SSS/EasySSS control ON for machining condition selection I
		SSS/EasySSS control ON for machining condition selection I Set whether to enable the SSS/EasySSS control for the machining condition selection I function. This is equivalent to the parameter "#8090 SSS ON". ---Setting range--- 0/1
#42317	P2-std_length	Standard length for machining condition selection I
		Standard length for machining condition selection I Set the standard length for the machining condition selection I function. This is equivalent to the parameter "#8091 StdLength". ---Setting range--- 0 to 100.000 (mm)
#42318	P2-step_length	Step width for machining condition selection I
		Step width for machining condition selection I Set the width of the step for the machining condition selection I function. This is equivalent to the parameter "#8093 StepLeng". ---Setting range--- -1.000 to 0.100 (mm)

14 User Parameters

14.14 Machining Condition Selection Parameters

#42319	P2-tolerance	Tolerance for machining condition selection I
	Set the tolerance for machining condition selection parameter group for machining condition selection I function. This is equivalent to the parameter "#2659 tolerance".	
	---Setting range---	
	0 to 100.000 (mm)	
#42320	P2-G1bF	Machining condition selection I: maximum speed
	Specify the maximum speed for the machining condition parameters of the machining condition selection I function (equivalent to "#1206 G1bF").	
	---Setting range---	
	1 to 1000000 (mm/min)	
#42321	P2-Sfilt2_tol	Machining condition selection I: tolerance control soft accel/decel filter 2
	Specify the tolerance control soft acceleration/deceleration filter 2 for the machining condition parameters of the machining condition selection I function (equivalent to "#12070 Sfilt2_tol").	
	---Setting range---	
	0 to 200 (ms)	
#42601	P3-G1btL	Time constant for machining condition selection I
	Time constant for machining condition selection I	
	Set the time constant for the machining condition selection I function. This is equivalent to the parameter "#1207 G1btL".	
	---Setting range---	
	Without high-accuracy control time constant expansion: 0 to 5000 (ms)	
	With high-accuracy control time constant expansion: 0 to 30000 (ms)	
#42602	P3-SfiltG1	G01soft acceleration/deceleration filter for machining condition selection I
	G01soft acceleration/deceleration filter for machining condition selection I	
	Set the G01 soft acceleration/deceleration filter's time constant for the machining condition selection I function. This is equivalent to the parameter "#1568 SfiltG1".	
	---Setting range---	
	0 to 200 (ms)	
#42603	P3-Sfilt2	Soft acceleration/deceleration filter 2 for machining condition selection I
	Soft acceleration/deceleration filter 2 for machining condition selection I	
	Set the soft acceleration/deceleration filter 2's time constant for the machining condition selection I function. This is equivalent to the parameter "#1570 Sfilt2".	
	---Setting range---	
	0 to 50 (ms)	
#42604	P3-rcomp	Accuracy coefficient for machining condition selection I
	Accuracy coefficient for machining condition selection I	
	Set the accuracy coefficient for the machining condition selection I function. This is equivalent to the parameter "#8019 R COMP".	
	* This setting is enabled when "#8021 COMP_CHANGE" is set to "0".	
	---Setting range---	
	0 to 99 (%)	

14 User Parameters

14.14 Machining Condition Selection Parameters

#42605	P3-cor_comp	Corner accuracy coefficient for machining condition selection I
		<p>Corner accuracy coefficient for machining condition selection I</p> <p>Set the corner accuracy coefficient for the machining condition selection I function. This is equivalent to the parameter "#8022 CORNER COMP".</p> <p>* This setting is enabled when "#8021 COMP_CHANGE" is set to "1".</p> <p>---Setting range---</p> <p>-1000 to 99 (%)</p>
#42606	P3-cur_comp	Curve accuracy coefficient for machining condition selection I
		<p>Curve accuracy coefficient for machining condition selection I</p> <p>Set the curve accuracy coefficient for the machining condition selection I function. This is equivalent to the parameter "#8023 CURVE COMP".</p> <p>* This setting is enabled when "#8021 COMP_CHANGE" is set to "1".</p> <p>---Setting range---</p> <p>-1000 to 99 (%)</p>
#42607	P3-fwd_g	Feed forward gain for machining condition selection I
		<p>Feed forward gain for machining condition selection I</p> <p>Set the feed forward gain for the machining condition selection I function. This is equivalent to the parameter "#2010 fwd_g".</p> <p>---Setting range---</p> <p>0 to 200 (%)</p>
#42608	P3-fcorn	Corner deceleration angle for machining condition selection I
		<p>Corner deceleration angle for machining condition selection I</p> <p>Set the corner deceleration angle for the machining condition selection I function. This is equivalent to the parameter "#8020 DCC ANGLE".</p> <p>---Setting range---</p> <p>0 to 89 (°)</p>
#42609	P3-spcanag	Cancel angle for machining condition selection I
		<p>Cancel angle for machining condition selection I</p> <p>Set the cancel angle for the machining condition selection I function. This is equivalent to the parameter "#8026 CANCEL ANG".</p> <p>---Setting range---</p> <p>0 to 180 (°)</p>
#42610	P3-distth1	Chord error 1 for machining condition selection I
		<p>Chord error 1 for machining condition selection I</p> <p>Set the chord error 1 for the machining condition selection I function. This is equivalent to the parameter "#8027 Toler-1".</p> <p>---Setting range---</p> <p>0.000 to 100.000 (mm)</p>
#42611	P3-distth2	Chord error 2 for machining condition selection I
		<p>Chord error 2 for machining condition selection I</p> <p>Set the chord error 2 for the machining condition selection I function. This is equivalent to the parameter "#8028 Toler-2".</p> <p>---Setting range---</p> <p>0.000 to 100.000 (mm)</p>

14 User Parameters

14.14 Machining Condition Selection Parameters

#42612	P3-minute	Fine segment length for machining condition selection I
		<p>Fine segment length for machining condition selection I</p> <p>Set the fine segment length for the machining condition selection I function. This is equivalent to the parameter "#8030 MINUTE LENG".</p> <p>---Setting range---</p> <p>-1 to 127 (mm)</p>
#42613	P3-fairing	Fairing ON for machining condition selection I
		<p>Fairing ON for machining condition selection I</p> <p>Set whether to enable the fairing function for the machining condition selection I function. This is equivalent to the parameter "#8033 Fairing ON".</p> <p>---Setting range---</p> <p>0/1</p>
#42614	P3-minleng	Fairing L for machining condition selection I
		<p>Fairing L for machining condition selection I</p> <p>Set the fairing length for the machining condition selection I function. This is equivalent to the parameter "#8029 FairingL".</p> <p>---Setting range---</p> <p>0 to 100.000 (mm)</p>
#42615	P3-cordeclen	Corner judgment length for machining condition selection I
		<p>Corner judgment length for machining condition selection I</p> <p>Set the corner judgment length for the machining condition selection I function. This is equivalent to the parameter "#8037 CorJudgeL".</p> <p>---Setting range---</p> <p>0 to 99999.999 (mm)</p>
#42616	P3-sss_prcm	SSS/EasySSS control ON for machining condition selection I
		<p>SSS/EasySSS control ON for machining condition selection I</p> <p>Set whether to enable the SSS/EasySSS control for the machining condition selection I function. This is equivalent to the parameter "#8090 SSS ON".</p> <p>---Setting range---</p> <p>0/1</p>
#42617	P3-std_length	Standard length for machining condition selection I
		<p>Standard length for machining condition selection I</p> <p>Set the standard length for the machining condition selection I function. This is equivalent to the parameter "#8091 StdLength".</p> <p>---Setting range---</p> <p>0 to 100.000 (mm)</p>
#42618	P3-step_length	Step width for machining condition selection I
		<p>Step width for machining condition selection I</p> <p>Set the width of the step for the machining condition selection I function. This is equivalent to the parameter "#8093 StepLeng".</p> <p>---Setting range---</p> <p>-1.000 to 0.100 (mm)</p>
#42619	P3-tolerance	Tolerance for machining condition selection I
		<p>Set the tolerance for machining condition selection parameter group for machining condition selection I function. This is equivalent to the parameter "#2659 tolerance".</p> <p>---Setting range---</p> <p>0 to 100.000 (mm)</p>

14 User Parameters

14.14 Machining Condition Selection Parameters

#42620	P3-G1bF	Machining condition selection I: maximum speed
Specify the maximum speed for the machining condition parameters of the machining condition selection I function (equivalent to "#1206 G1bF").		
---Setting range---		
1 to 1000000 (mm/min)		
#42621	P3-Sfilt2_tol	Machining condition selection I: tolerance control soft accel/decel filter 2
Specify the tolerance control soft acceleration/deceleration filter 2 for the machining condition parameters of the machining condition selection I function (equivalent to "#12070 Sfilt2_tol").		
---Setting range---		
0 to 200 (ms)		

14 User Parameters

14.15 Menu Selection Parameters

14.15 Menu Selection Parameters

(PR)	#10501- 10540	Monitr main menu 1 to 40
------	------------------	--------------------------

Select the menu Nos. to be displayed on Monitor screen's main menus.

Set the menu No. (numbered in the initial order) which you wish to set first from the left of Monitor's main menus in #10501, second in the next parameter and likewise afterwards.

(E.g.) When you set the parameter #10501 to 11, the menu initially displayed at the left end of Monitor main menu's 2nd page is displayed at the left end of the 1st page.

(Note) If you set the No. of menu which is not displayed in the initial state (without setting the menu selection parameters), the menu won't be displayed after this parameter setting.

-- Menu No. --

-1: Not display

0: Default

1: Search

2: Restart

3: Edit

4: Trace

5: Check

6: Offset

7: Coord

8: W-shift

10: Dsp.Chg

11: Modal

12: Tree

13: Time

14: Com var

15: Loc var

16: P corr

17: PLC SW

18: G92 set

19: Col stp

20: LdMeter

21: Sp-stby

22: TipDisp

23: All sp

26: S-sel

27: Next Ax

28: Cnt exp

29: Cnt set

30: MST

32: Laser

14 User Parameters


14.15 Menu Selection Parameters

(PR)	#10551-10580	Setup main menu 1 to 30
		<p>Select the menu Nos. to be displayed on Setup screen's main menus.</p> <p>Set the menu No. (numbered in the initial order) which you wish to set first from the left of Setup's main menus in #10551, second in the next parameter and likewise afterwards.</p> <p>(E.g.) When you set the parameter #10551 to 11, the menu initially displayed at the left end of Setup main menu's 2nd page is displayed at the left end of the 1st page.</p> <p>(Note) If you set the No. of menu which is not displayed in the initial state (without setting the menu selection parameters), the menu won't be displayed after this parameter setting.</p> <p>-- Menu No. --</p> <ul style="list-style-type: none"> -1: Not display 0: Default 1: T-ofs 2: T-meas 3: T-reg 4: T-life 5: Coord 6: W-meas 7: T-Mng. 8: MDI 9: Cnt set 10: MST 11: T-list 12: Pallet 13: User 15: Storage 16: Surf 17: MacCond 22: Barrier 23: WE mea. 26: E-mail 27: Range 28: History 29: LsrCond
(PR)	#10601-10630	Edit main menu 1 to 30
		<p>Select the menu Nos. to be displayed on Edit screen's main menus.</p> <p>Set the menu No. (numbered in the initial order) which you wish to set first from the left of Edit's main menus in #10601, second in the next parameter and likewise afterwards.</p> <p>(E.g.) When you set the parameter #10601 to 11, the menu initially displayed at the left end of Edit main menu's 2nd page is displayed at the left end of the 1st page.</p> <p>(Note) If you set the No. of menu which is not displayed in the initial state (without setting the menu selection parameters), the menu won't be displayed after this parameter setting.</p> <p>-- Menu No. --</p> <ul style="list-style-type: none"> -1: Not display 0: Default 1: Edit 2: Check 3: NAVI (NAVI MILL) 4: NAVI (NAVI LATHE) 5: I/O

14 User Parameters

14.16 Tolerance Parameters

14.16 Tolerance Parameters
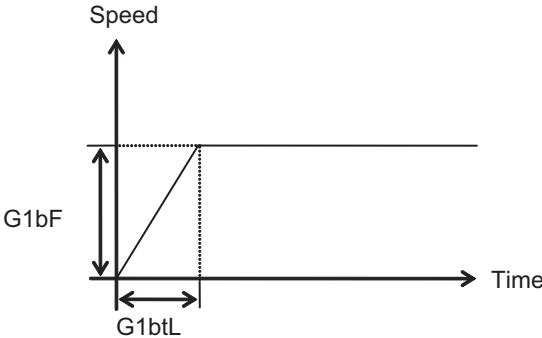
#2659	tolerance	Tolerance
	Specify a tolerance (tolerable error) to be used under tolerance control. Set a tolerable error for fine segment program created by CAM. (Usually around 0.01(mm)) If 0.000 is set, it is operated with the tolerance of 0.01(mm). When designating the tolerance amount with the ", K address", this parameter is not used.	
	---Setting range---	
	0.000 to 100.000 (mm)	
#1206	G1bF	Maximum speed
	Set a cutting feedrate when applying pre-interpolation acceleration/deceleration. When high-accuracy control time constant expansion is valid, set the maximum of cutting feed clamp speed of each axis.	
	---Setting range---	
	1 to 999999 (mm/min)	
#1207	G1btL	Time constant
	Set a cutting feed time constant when applying pre-interpolation acceleration/deceleration. When set to "0", the time constant will be clamped at 1ms.	
		
	---Setting range---	
	Without high-accuracy control time constant expansion: 1 to 5000 (ms)	
	With high-accuracy control time constant expansion: 1 to 30000 (ms)	
	Cutting feed Acc	Cutting feed acceleration
	Displays cutting feed acceleration.	
#1568	SfiltG1	G01 soft acceleration/deceleration filter
	Set the filter time constant for smoothly changing the acceleration rate for the cutting feed acceleration/deceleration in pre-interpolation acceleration/deceleration.	
	- Notch frequency Hz Displays the notch frequency (Hz) for the S-pattern filter set in "#1568 SfiltG1" (G01 soft acceleration/deceleration filter).	
	---Setting range---	
	0 to 200 (ms)	
#12051	Jerk_filtG1	G01 jerk filter
	Specify the time constant of filter that is used for smoothing the change of jerk when pre-interpolation acceleration/deceleration is performed in cutting feed.	
	This filter causes no path error, as the filter is applied to the resultant speed calculated before interpolation.	
	If you specify the jerk filter time constant, the time constants of each filter will be as follows:	
	- S-shape filter time constant "#1568 SfiltG1" - "Jerk_filtG1"	
	- Jerk filter time constant "Jerk_filtG1"	
	---Setting range---	
	0 to 50 (ms)	

14 User Parameters

14.16 Tolerance Parameters

#12066	Tolerance ctrl ON	
	Select whether to enable the tolerance control. 0: Disable 1: Enable (Note) Tolerance control is available only under SSS control. To enable this function, set "#8090 SSS ON" to "1".	
#12070	Sfilt2_tol	Tolerance control: Soft acceleration/deceleration filter 2
	Specify the time constant of the filter that smoothes out fluctuations in acceleration under the tolerance control. Basically set to 0. ---Setting range--- 0 to 200 (ms)	

14 User Parameters

14.17 Wireless LAN Parameters

14.17 Wireless LAN Parameters

(PR)	#75000	WLAN STA/AP mode
Specify the operation mode of wireless LAN. 0: No mode (Wireless LAN function invalid) 1: Station (STA) mode 2: Access point (AP) mode		
(PR)	#75001	WLAN IP address
Set the IP address for the wireless LAN. (Note) This parameter is ignored when "#75050 DHCP client" is enabled. ---Setting range--- 0.0.0.0 to 255.255.255.255		
(PR)	#75002	WLAN Subnet mask
Set the subnet mask for the wireless LAN. (Note) In Station (STA) mode, this parameter is ignored when "#75050 DHCP client" is enabled. ---Setting range--- 0.0.0.0 to 255.255.255.255		
(PR)	#75003	connect SSID
For Station (STA) mode Specify the SSID of the access point to be connected. (Note) Spaces cannot be set. ---Setting range--- Up to 32 characters in length, containing alphanumeric characters and symbols		
(PR)	#75004	connect BSSID
For Station (STA) mode Specify the BSSID of the access point to be connected. When this parameter is not set, the access point that has the strongest radio wave intensity is connected. ---Setting range--- 00:00:00:00:00:00 to FF:FF:FF:FF:FF:FF 0: No setting		
(PR)	#75005	SSID
For Access Point (AP) mode Specify the SSID used when a station connects to the CNC. (Note) Spaces cannot be set. ---Setting range--- Up to 32 characters in length, containing alphanumeric characters and symbols		
(PR)	#75006	Encryption mode
For Access Point (AP) mode Specify the data encryption and authentication method for the wireless communications. 0: WPA-PSK TKIP 1: WPA2-PSK AES		
(PR)	#75007	Encryption key
In Access point (AP) mode, specify the encryption key to be used when the station is connecting to CNC. In Station (STA) mode, specify the encryption key of the access point to be connected. ---Setting range--- 8 or more to 32 characters in alphanumeric characters or symbols		

14 User Parameters

14.17 Wireless LAN Parameters

(PR)	#75008	WLAN channel
		<p>For Access Point (AP) mode Specify the channel (frequency band) to be used for the wireless communication.</p> <p>0: Automatic 1 to 13: Channel for 2.4 GHz 36, 40, 44 and 48: Channel for 5 GHz (W52) 149, 153, 157, 161 and 165: Channel for 5 GHz (W58)</p> <p>(Note) Only channels that correspond to the country code are enabled. JP, CH, GB, IS, LI, NO, TR and EU countries: 1 to 13, 36, 40, 44 and 48 CN, KR and TH: 1 to 13, 36, 40, 44, 48, 149, 153, 157, 161 and 165 IN, TW and US: 1 to 11, 36, 40, 44, 48, 149, 153, 157, 161 and 165</p> <p>---Setting range---</p> <p>0, 1 to 13, 36, 40, 44, 48, 149, 153, 157, 161, 165</p>
(PR)	#75009	Frequency band
		<p>For Access Point (AP) mode Specify the operation frequency band for the wireless communication.</p> <p>0: 2.4 (GHz) 1: 5 (GHz)</p>
(PR)	#75010	ESSID stealth
		<p>For Access Point (AP) mode Specify whether to enable ESSID stealth.</p> <p>0: Disable 1: Enable</p>
(PR)	#75011	AP isolation OFF
		<p>For Access Point (AP) mode Specify whether to disable AP isolation.</p> <p>0: Enable 1: Disable</p>
(PR)	#75012	abg mode
		<p>For Access Point (AP) mode Specify whether to enable abg mode.</p> <p>0: Disable 1: Enable (not communicate with IEEE802.11n)</p> <p>(Note) Set this parameter if the station to be communicated malfunctions when communicating with IEEE802.11n.</p>
(PR)	#75050	DHCP client
		<p>Specify whether to enable DHCP client.</p> <p>0: Disable 1: Enable</p> <p>(Note) This parameter is enabled when station (STA) mode is valid.</p>
(PR)	#75051	DHCP server
		<p>Specify whether to enable DHCP server.</p> <p>0: Disable 1: Enable</p> <p>(Note) This parameter is enabled when access point (AP) mode is valid.</p>

14 User Parameters

14.17 Wireless LAN Parameters

(PR)	#75052	StartIP DHCPserver
		Specify the beginning of the IP addresses to be allocated to devices in the LAN by DHCP. (Note) If the IP addresses used by the CNC are included in the allocatable IP addresses, they are not allocated. ---Setting range--- 0.0.0.0 to 255.255.255.255
(PR)	#75053	IP num DHCPserver
		Specify the number of IP addresses to be allocated to devices in the LAN by DHCP. When "0" is set, the IP num DHCPserver is "20". (Note) If the IP addresses used by the CNC are included in the allocatable IP addresses, they are not allocated. ---Setting range--- 0 to 20
(PR)	#75100	IP Filter for WLAN
		Select whether to allow or block access from IP addresses within the specified range for the wireless LAN network. When not using IP address filtering, enter "0". 0: Disable the filtering function 1: Allow 2: Block
(PR)	#75101	StartFiltIP WLAN-1
		Specify the IP address of the beginning of the 1st IP address range to be filtered on the wireless LAN. ---Setting range--- 0.0.0.0 to 255.255.255.255
(PR)	#75102	EndFiltIP WLAN-1
		Specify the IP address of the end of the 1st IP address range to be filtered on the wireless LAN. ---Setting range--- 0.0.0.0 to 255.255.255.255
(PR)	#75103	StartFiltIP WLAN-2
		Specify the IP address of the beginning of the 2nd IP address range to be filtered on the wireless LAN. ---Setting range--- 0.0.0.0 to 255.255.255.255
(PR)	#75104	EndFiltIP WLAN-2
		Specify the IP address of the end of the 2nd IP address range to be filtered on the wireless LAN. ---Setting range--- 0.0.0.0 to 255.255.255.255
(PR)	#75105	StartFiltIP WLAN-3
		Specify the IP address of the beginning of the 3rd IP address range to be filtered on the wireless LAN. ---Setting range--- 0.0.0.0 to 255.255.255.255
(PR)	#75106	EndFiltIP WLAN-3
		Specify the IP address of the end of the 3rd IP address range to be filtered on the wireless LAN. ---Setting range--- 0.0.0.0 to 255.255.255.255
(PR)	#75107	StartFiltIP WLAN-4
		Specify the IP address of the beginning of the 4th IP address range to be filtered on the wireless LAN. ---Setting range--- 0.0.0.0 to 255.255.255.255

14 User Parameters

14.17 Wireless LAN Parameters

(PR)	#75108	EndFiltIP WLAN-4
Specify the IP address of the end of the 4th IP address range to be filtered on the wireless LAN.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#75109	StartFiltIP WLAN-5
Specify the IP address of the beginning of the 5th IP address range to be filtered on the wireless LAN.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#75110	EndFiltIP WLAN-5
Specify the IP address of the end of the 5th IP address range to be filtered on the wireless LAN.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#75111	StartFiltIP WLAN-6
Specify the IP address of the beginning of the 6th IP address range to be filtered on the wireless LAN.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#75112	EndFiltIP WLAN-6
Specify the IP address of the end of the 6th IP address range to be filtered on the wireless LAN.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#75113	StartFiltIP WLAN-7
Specify the IP address of the beginning of the 7th IP address range to be filtered on the wireless LAN.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#75114	EndFiltIP WLAN-7
Specify the IP address of the end of the 7th IP address range to be filtered on the wireless LAN.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#75115	StartFiltIP WLAN-8
Specify the IP address of the beginning of the 8th IP address range to be filtered on the wireless LAN.		
---Setting range---		
0.0.0.0 to 255.255.255.255		
(PR)	#75116	EndFiltIP WLAN-8
Specify the IP address of the end of the 8th IP address range to be filtered on the wireless LAN.		
---Setting range---		
0.0.0.0 to 255.255.255.255		

14 User Parameters

14.17 Wireless LAN Parameters

Machine Parameters

15 Machine Parameters

15.1 Base System Parameters

The parameters with "(PR)" requires the CNC to be turned OFF after the settings. Turn the power OFF and ON to enable the parameter settings.

15.1 Base System Parameters

(PR)	#1001	SYS_ON	System validation setup
			<p>Select the existence of PLC axes and part systems.</p> <p>0: Not exist 1: Exist</p>
(PR)	#1002	axisno	Number of axes
			<p>Set the number of control axes and PLC axes.</p> <p>A total of 32 axes can be set.</p> <p>Control axis: 0 to 16 PLC axis: 0 to 8</p> <p>When set to "0", the number of control axes in the part system will be "0". Do not set the number of control axes of the first part system to "0".</p> <p>(Note) The setting range differs according to the model.</p>
(PR)	#1003	iunit	Input setup unit
			<p>Select the input setting value for each part system and the PLC axis.</p> <p>Increments in parameters will follow this selection.</p> <p>B: 1 μm C: 0.1 μm D: 0.01 μm (10 nm) E: 0.001 μm (1 nm)</p>
(PR)	#1004	ctrl_unit	Control unit
			<p>Set the unit for the NC internal position data, data communicated between the NC and drive unit, and the servo movement data.</p> <p>Some parameter units, such as the pitch error and backlash, follow this specification.</p> <p>The standard value is "E"; however, set the optimum value according to the machine model and specifications.</p> <p>B: 1 μm C: 0.1 μm D: 0.01 μm (10 nm) E: 0.001 μm (1 nm) F: 0.0001 μm (0.1 nm)</p>
(PR)	#1005	plcunit	PLC unit
			<p>Select the PLC interface setting and display increment.</p> <p>The PLC interface setting and display increment will follow this specification. Note that the PLC axis will follow "#1003 iunit".</p> <p>B: 1 μm C: 0.1 μm D: 0.01 μm (10 nm) E: 0.001 μm (1 nm) F: 0.0001 μm (0.1 nm)</p>

15 Machine Parameters

15.1 Base System Parameters

(PR)	#1006	mcmpunit	Machine error compensation unit
		<p>Select the machine error compensation setting and display increment.</p> <p>The parameters related to machine error compensation (backlash, pitch error compensation, etc.) and PLC interface (external machine coordinate system compensation) will follow this selection.</p> <p>B: 1 μm C: 0.1 μm D: 0.01 μm (10 nm) E: 0.001 μm (1 nm) F: 0.0001 μm (0.1 nm)</p>	
(PR)	#1007	System type select	System type select
		<p>Select the NC system type.</p> <p>0: Machining center system (M system) 1: Lathe system (L system)</p> <p>(Note 1) If the setting value is out of range, M system will be selected.</p>	
	#1025	I_plane	Initial plane selection
		<p>Select the plane to be selected when the power is turned ON or reset. When 0 is specified, 1 is assumed (X-Y plane).e model and specifications.</p> <p>1: X-Y plane (G17 command state) 2: Z-X plane (G18 command state) 3: Y-Z plane (G19 command state)</p>	
	#1026	base_I	Base axis I
		<p>Set the names of the basic axes that compose the plane.</p> <p>Set the axis name set in "#1013 axname".</p> <p>If all three items ("base_I", "base_J" and "base_K") do not need to be set, such as for 2-axis specifications, input "0", and the parameter will be blank.</p> <p>Normally, when X, Y and Z are specified respectively for base_I, _J, _K, the following relation will be established:</p> <p>G17: X-Y G18: Z-X G19: Y-Z</p> <p>Or specify any other axis name desired.</p> <p>---Setting range---</p> <p>Axis names such as X, Y or Z</p>	
	#1027	base_J	Base axis J
		<p>Set the names of the basic axes that compose the plane.</p> <p>Set the axis name set in "#1013 axname".</p> <p>If all three items ("base_I", "base_J" and "base_K") do not need to be set, such as for 2-axis specifications, input "0", and the parameter will be blank.</p> <p>Normally, when X, Y and Z are specified respectively for base_I, _J, _K, the following relation will be established:</p> <p>G17: X-Y G18: Z-X G19: Y-Z</p> <p>Or specify any other axis name desired.</p> <p>---Setting range---</p> <p>Axis names such as X, Y or Z</p>	

15 Machine Parameters

15.1 Base System Parameters

#1028	base_K	Base axis K																					
	<p>Set the names of the basic axes that compose the plane.</p> <p>Set the axis name set in "#1013 axname".</p> <p>If all three items ("base_I", "base_J" and "base_K") do not need to be set, such as for 2-axis specifications, input "0", and the parameter will be blank.</p> <p>Normally, when X, Y and Z are specified respectively for base_I, _J, _K, the following relation will be established:</p> <p>G17: X-Y</p> <p>G18: Z-X</p> <p>G19: Y-Z</p> <p>Or specify any other axis name desired.</p> <p>---Setting range---</p> <p>Axis names such as X, Y or Z</p>																						
#1029	aux_I	Flat axis I																					
	<p>Set the axis name when there is an axis parallel to "#1026 base_I".</p> <p>---Setting range---</p> <p>Axis names such as X, Y or Z</p>																						
#1030	aux_J	Flat axis J																					
	<p>Set the axis name when there is an axis parallel to "#1027 base_J".</p> <p>---Setting range---</p> <p>Axis names such as X, Y or Z</p>																						
#1031	aux_K	Flat axis K																					
	<p>Set the axis name when there is an axis parallel to "#1028 base_K".</p> <p>---Setting range---</p> <p>Axis names such as X, Y or Z</p>																						
(PR)	#1037	cmdtyp	Command type																				
	<p>Set the G code list and compensation type for programs.</p> <table><tr><td>1: List1 (for M)</td><td>Type I (one compensation amount for one compensation No.)</td></tr><tr><td>2: List1 (for M)</td><td>Type II (shape and wear compensation amounts for one comp. No.)</td></tr><tr><td>3: List2 (for L)</td><td>Type III (shape and wear compensation amounts for one comp. No.)</td></tr><tr><td>4: List3 (for L)</td><td>Ditto</td></tr><tr><td>5: List4 (for special L)</td><td>Ditto</td></tr><tr><td>6: List5 (for special L)</td><td>Ditto</td></tr><tr><td>7: List6 (for special L)</td><td>Ditto</td></tr><tr><td>8: List7 (for special L)</td><td>Ditto</td></tr><tr><td>9: List8 (for M)</td><td>M2 form at type Type I (one compensation amount for one compensation No.)</td></tr><tr><td>10: List8 (for M)</td><td>M2 form at type Type II (shape and wear compensation amounts for one compensation No.)</td></tr></table> <p>There are some items in the specifications that can be used or cannot be used according to the value set in this parameter.</p> <p>The file structure may also change depending on the compensation data type.</p> <p>(Note) When this parameter is changed, the file system will be changed after the power is turned ON. So always execute format. The new format will be enabled after turning the power ON again.</p> <p>Setting order</p> <p>(1) cmdtyp changeover -> (2) Turn power ON again -> (3) Format -> (4) Turn power ON again</p> <p>(Note) Compensation type III can be selected for M system by setting #1046.</p>			1: List1 (for M)	Type I (one compensation amount for one compensation No.)	2: List1 (for M)	Type II (shape and wear compensation amounts for one comp. No.)	3: List2 (for L)	Type III (shape and wear compensation amounts for one comp. No.)	4: List3 (for L)	Ditto	5: List4 (for special L)	Ditto	6: List5 (for special L)	Ditto	7: List6 (for special L)	Ditto	8: List7 (for special L)	Ditto	9: List8 (for M)	M2 form at type Type I (one compensation amount for one compensation No.)	10: List8 (for M)	M2 form at type Type II (shape and wear compensation amounts for one compensation No.)
1: List1 (for M)	Type I (one compensation amount for one compensation No.)																						
2: List1 (for M)	Type II (shape and wear compensation amounts for one comp. No.)																						
3: List2 (for L)	Type III (shape and wear compensation amounts for one comp. No.)																						
4: List3 (for L)	Ditto																						
5: List4 (for special L)	Ditto																						
6: List5 (for special L)	Ditto																						
7: List6 (for special L)	Ditto																						
8: List7 (for special L)	Ditto																						
9: List8 (for M)	M2 form at type Type I (one compensation amount for one compensation No.)																						
10: List8 (for M)	M2 form at type Type II (shape and wear compensation amounts for one compensation No.)																						

15 Machine Parameters

15.1 Base System Parameters

#1073	I_Absm	Initial absolute setting
	Select the mode (absolute or incremental) at turning ON the power or reset. 0: Incremental setting 1: Absolute setting	
#1074	I_Sync	Initial synchronous feed
	Select the feedrate mode at turning ON the power or reset. 0: Asynchronous feed (feed per minute) 1: Synchronous feed (feed per revolution)	
#1075	I_G00	Initial G00
	Select the linear command mode at turning ON the power or reset. 0: Linear interpolation (G01 command state) 1: Positioning (G00 command state)	
#1076	AbsInc	ABS/INC address (for L system only)
	Select the command method for the absolute and incremental commands. The absolute command/incremental command can be issued by using the absolute command address and incremental command address for the same axis. 0: Use G command for the absolute and incremental commands. 1: Use axis name for the absolute and incremental commands. (The axis name in "#1013 axname" will be the absolute command, "#1014 incax" will be the incremental command.)	
#1085	G00Drn	G00 dry run
	Select whether to apply dry run (feed at manual setting speed instead of command feedrate) to the G00 command. 0: Not apply to G00. (move at rapid traverse rate) 1: Apply to G00. (move at manual setting speed)	
#1086	G0Intp	G00 non-interpolation
	Select the G00 travel path type. 0: Move linearly toward the end point. (interpolation type) 1: Move to the end point of each axis at the rapid traverse feedrate for each axis. (non-interpolation) (Note) If this parameter is set to "1", neither of the following functions will be available: rapid traverse constant-gradient acceleration/deceleration and rapid traverse constant-gradient multi-step acceleration/deceleration.	
#1109	subs_M	Validate substitute M code
	Select the user macro interrupt with the substitute M code. 0: Disable substitute M code 1: Enable substitute M code	
#1110	M96_M	M96 substitute M code
	Set an M code to replace M96 when "#1109 subs_M" is set to "1". ---Setting range--- 3 to 97 (excluding 30)	
#1111	M97_M	M97 substitute M code
	Specify an M code to replace M97 when "#1109 subs_M" is set to "1". ---Setting range--- 3 to 97 (excluding 30)	

15 Machine Parameters

15.1 Base System Parameters

#1148	I_G611	Initial hi-precis
	Select the modal state at power ON from among the following: high-accuracy control mode, high-speed high-accuracy control I mode, high-speed high-accuracy control II mode or high-speed high-accuracy control III mode. 0: G08P0/G64 (cutting) mode 1: G08P1/G61.1 (high-accuracy control) mode 2: G05.1Q1 (high-speed high-accuracy control I) mode 3: G05P10000 (high-speed high-accuracy control II) mode 4: G05P20000 (high-speed high-accuracy control III) mode	
#1151	rstint	Reset initial
	Select whether to initialize (power ON state) the modals by resetting. 0: Not initialize modal state 1: Initialize modal state	
#1169	system name	Part system name
	Set the name of each part system. This setting is only relevant if the system has multiple part systems. This name appears on the screen when the part systems need to be differentiated. The name must be a combination of alphanumeric characters. It can be up to 4 characters long. ---Setting range--- 4 or less characters consisting of both alphabets and numbers	
#1170	M2name	Second miscellaneous code
	Set this address code when using the 2nd miscellaneous command. Set an address with A, B or C that is not used for "#1013 axname" or "#1014 incax". ---Setting range--- A, B, C	
#1171	taprov	Tap return override
	Set the tap return override value for the synchronous tapping. When "0" is set, it will be regarded as 100%. ---Setting range--- 0 to 100 (%)	
#1172	tapovr	Tap return override
	Set the override value applied during a retract operation in synchronous tapping. When set to "0", 100% is applied. ---Setting range--- 0 to 999 (%)	
#1173	dwlskp	G04 skip condition
	Set the skip signal for ending the G04 (dwell) command. PLC interface input signal Skip3 Skip2 Skip1 0: - - - 1: - - * 2: - * - 3: - * * 4: * - - 5: * - * 6: * * - 7: * * * (*: Enable, -: Disable)	

15 Machine Parameters

15.1 Base System Parameters

#1174	skip_F	G31 skip speed
Set the feedrate when there is no F command in the program at G31 (skip) command.		
---Setting range---		
1 to 999999 (mm/min)		
#1175	skip1	G31.1 skip condition
Designate the skip signal in multi-step skip G31.1.		
The setting method is same as "#1173 dwlskip".		
#1176	skip1f	G31.1 skip speed
Set the skip feedrate in multi-step skip G31.1.		
---Setting range---		
1 to 999999 (mm/min)		
#1177	skip2	G31.2 skip condition
Set the skip signal in multi-step skip G31.2.		
The setting method is same as "#1173 dwlskip".		
#1178	skip2f	G31.2 skip speed
Set the skip feedrate in multi-step skip G31.2.		
---Setting range---		
1 to 999999 (mm/min)		
#1179	skip3	G31.3 skip condition
Set the skip signal in multi-step skip G31.3.		
The setting method is same as "#1173 dwlskip".		
#1180	skip3f	G31.3 skip speed
Set the skip feedrate in multi-step skip G31.3.		
---Setting range---		
1 to 999999 (mm/min)		
#1181	G96_ax	Constant surface speed axis
Select the axis to be targeted for constant surface speed control.		
0: Program setting will be disabled, and the axis will always be fixed to the 1st axis		
1: 1st axis		
2: 2nd axis		
3: 3rd axis		
:		
16: 16th axis		
However, when set to other than "0", the priority will be on the program setting.		
#1182	thr_F	Thread cutting speed
Set the retract speed when not using chamfering in the thread cutting cycle.		
0: Cutting feed clamp feedrate		
1 to 60000 mm/min: Setting feedrate		
---Setting range---		
0 to 60000 (mm/min)		
#1183	clmp_M	M code for clamp
Set the M code for C axis clamp in hole drilling cycle.		
---Setting range---		
0 to 99999999		

15 Machine Parameters

15.1 Base System Parameters

	#1184	clmp_D	Dwelling time after outputting M code for unclamp
			Set the dwell time after outputting the M code for C axis unclamp in hole drilling cycle.
			---Setting range---
			0.000 to 99999.999 (s)
	#1185	spd_F1	F1 digit feedrate F1
			Set the feedrate for the F command in the F 1-digit command ("#1079 F1digit" is set to "1").
			Feedrate when F1 is issued (mm/min).
			When "#1246 set08/bit6" is set to "1" and F 1-digit feed is commanded, the feedrate can be increased/decreased by operating the manual handle.
			---Setting range---
			0 to 1000000 (mm/min)
	#1186	spd_F2	F1 digit feedrate F2
			Set the feedrate for the F command in the F 1-digit command ("#1079 F1digit" is set to "1").
			Feedrate when F2 is issued (mm/min).
			When "#1246 set08/bit6" is set to "1" and F 1-digit feed is commanded, the feedrate can be increased/decreased by operating the manual handle.
			---Setting range---
			0 to 1000000 (mm/min)
	#1187	spd_F3	F1 digit feedrate F3
			Set the feedrate for the F command in the F 1-digit command ("#1079 F1digit" is set to "1").
			Feedrate when F3 is issued (mm/min).
			When "#1246 set08/bit6" is set to "1" and F 1-digit feed is commanded, the feedrate can be increased/decreased by operating the manual handle.
			---Setting range---
			0 to 1000000 (mm/min)
	#1188	spd_F4	F1 digit feedrate F4
			Set the feedrate for the F command in the F 1-digit command ("#1079 F1digit" is set to "1").
			Feedrate when F4 is issued (mm/min).
			When "#1246 set08/bit6" is set to "1" and F 1-digit feed is commanded, the feedrate can be increased/decreased by operating the manual handle.
			---Setting range---
			0 to 1000000 (mm/min)
	#1189	spd_F5	F1 digit feedrate F5
			Set the feedrate for the F command in the F 1-digit command ("#1079 F1digit" is set to "1").
			Feedrate when F5 is issued (mm/min).
			When "#1246 set08/bit6" is set to "1" and F 1-digit feed is commanded, the feedrate can be increased/decreased by operating the manual handle.
			---Setting range---
			0 to 1000000 (mm/min)
(PR)	#1190	s_xcnt	Validate inclined axis control (for L system only)
			Select whether to enable or disable inclined axis control.
			0: Disable inclined axis control
			1: Enable inclined axis control
(PR)	#1191	s_angl	Inclination angle (for L system only)
			Set the inclination angle (°).
			(Note) When set to "0", the angle determined by three-side setting will be applied.
			---Setting range---
			-80.000 to 80.000 (°)

15 Machine Parameters

15.1 Base System Parameters

(PR)	#1192	s_zrmv	Compensation at reference position return (for L system only)
			<p>Select whether to perform compensation for the basic axis corresponding to the inclined axis at reference position return.</p> <p>0: Perform compensation</p> <p>1: Not perform compensation</p>
	#1193	inpos	Deceleration check method 1
			<p>The setting is selected with the parameter "#1306 InpsTyp".</p> <p>0: Deceleration check method 1</p> <p>Select the deceleration check method for G0.</p> <p>0: Command deceleration check</p> <p>1: In-position check</p> <p>2: Smoothing check</p> <p>1: Validate in-position check</p> <p>Specify the deceleration confirmation method for the positioning or cutting command.</p> <p>0: G0, G1+G9 Command deceleration check</p> <p>1: G0, G1+G9 In-position check</p> <p>2: G0, G1+G9 Smoothing check</p>
	#1194	H_acdc	Time constant 0 for handle feed
			<p>Select the time constant for manual handle feed.</p> <p>0: Use time constant for G01</p> <p>1: Time constant 0 (step)</p>
	#1195	Mmac	Macro call for M command
			<p>Select whether to enable or disable M command macro call of user macro.</p> <p>0: Disable</p> <p>1: Enable</p>
	#1196	Smac	Macro call for S command
			<p>Select whether to enable or disable S command macro call of user macro.</p> <p>0: Disable</p> <p>1: Enable</p>
	#1197	Tmac	Macro call by command T
			<p>Select whether to enable a call of user macro using command T.</p> <p>0: Disable macro call</p> <p>1: Enable macro call, irrespective of the number of command T digits</p> <p>2: Enable macro call when a tool No. (excluding 0) is given to the upper digit of command T</p> <p>3: Enable macro call when a tool No. (including 0) is given to the upper digit of command T.</p>
	#1198	M2mac	Macro call with 2nd miscellaneous code
			<p>Select whether to enable or disable 2nd miscellaneous command macro call of user macro.</p> <p>0: Disable</p> <p>1: Enable</p>
	#1199	Sselect	Select initial spindle control
			<p>Select the initial condition of spindle control after power is turned ON.</p> <p>0: 1st spindle control mode (G43.1)</p> <p>1: 2nd spindle control mode (G44.1)</p> <p>2: All spindle simultaneously control mode (G47.1)</p> <p>(Note) While G43.1 or G44.1 command is given, the spindle No. is selected with "#12090 SnG43.1" or "#1534 SnG44.1".</p>

15 Machine Parameters

15.1 Base System Parameters


(PR)	#1200	G0_acc	Validate acceleration and deceleration with constant-gradient G0
Select the acceleration and deceleration type when a rapid traverse command is issued. 0: Acceleration and deceleration with constant time (conventional) 1: Acceleration and deceleration with constant gradient (Note) When rapid traverse constant-gradient multi-step acceleration/deceleration is valid, this parameter will be invalid.			
(PR)	#1201	G1_acc	Validate acceleration and deceleration with constant-gradient G1
Select the acceleration and deceleration type when a linear interpolation command is issued. 0: Acceleration and deceleration with constant time (conventional) 1: Acceleration and deceleration with constant gradient			
	#1202	mirofs	Distance between facing turrets (for L system only)
Set the distance between tools (edges) (between facing turrets). ---Setting range--- 0 to 99999.999 (mm)			
	#1203	TmirS1	Select turrets as facing turrets with T command (for L system only)
Select the turrets, which correspond to the tool Nos. 1 to 32, as facing turrets for T code mirror image. ---Setting range--- 0 to FFFFFFFF			
	#1204	TmirS2	Select turrets as facing turrets with T command (for L system only)
Select the turrets, which correspond to the tool Nos. 33 to 64, as facing turrets for T code mirror image. ---Setting range--- 0 to FFFFFFFF			
	#1205	G0bdcc	Acceleration and deceleration before G0 interpolation
0: Post-interpolation acceleration/deceleration is applied to G00. 1: Pre-interpolation acceleration/deceleration is applied to G00 even in the high accuracy control mode. 2: Rapid traverse constant-gradient multi-step acceleration/deceleration is enabled.			
When the multi-part system simultaneous high-accuracy control option is enabled, "1" can be set for the 2nd part system and the following.			
	#1206	G1bF	Maximum speed
Set a cutting feedrate when applying pre-interpolation acceleration/deceleration. When high-accuracy control time constant expansion is valid, set the maximum of cutting feed clamp speed of each axis. ---Setting range--- 1 to 999999 (mm/min)			

15 Machine Parameters

15.1 Base System Parameters

#1207	G1btL	Time constant
-------	-------	---------------

Set a cutting feed time constant when applying pre-interpolation acceleration/deceleration.
When set to "0", the time constant will be clamped at 1ms.

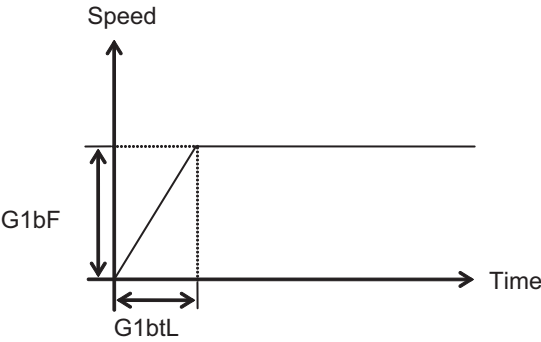

---Setting range---

Without high-accuracy control time constant expansion: 1 to 5000 (ms)

With high-accuracy control time constant expansion: 1 to 30000 (ms)

Cutting feed Acc Cutting feed acceleration

Displays cutting feed acceleration.

#1208	RCK	Arc radius error compensation factor
-------	-----	--------------------------------------

Set a coefficient for arc radius error compensation.
An arc radius error compensation amount can be increased or decreased between -60.0 and +20.0%.

---Setting range---

-60.0 to +20.0 (%)

#1209	cirdcc	Arc deceleration speed
-------	--------	------------------------

Set the deceleration speed at the arc entrance or exit.

---Setting range---

1 to 999999 (mm/min)

15 Machine Parameters

15.1 Base System Parameters

#1210	RstGmd	Modal G code reset
Select whether to initialize G code group modals and H and D codes, which corresponds to bits as follows, when the system is reset.		
0: Initialize.		
1: Not initialize.		
<Description of bits for M system>		
1F 1E 1D 1C	1B 1A 19 18	17 16 15 14 13 12 11 10
0 0 0 0	0 0 * *	0 * 0 0 * * * *
F E D C	B A 9 8	7 6 5 4 3 2 1 0
* * 0 *	* 0 * 0	* * * * 0 * * *
<p>bit 1F: (Not used)</p> <p>bit 1E: (Not used)</p> <p>bit 1D: (Not used)</p> <p>bit 1C: (Not used)</p> <p>bit 1B: (Not used)</p> <p>bit 1A: (Not used)</p> <p>bit 19: Spindle clamp rotation speed initialization</p> <p>bit 18: H, D codes initialization</p> <p>bit 17: (Not used)</p> <p>bit 16: Group23</p> <p>bit 15: (Not used)</p> <p>bit 14: (Not used)</p> <p>bit 13: Group 20 2nd spindle control modal initialization</p> <p>bit 12: Group 19 G command mirror modal initialization</p> <p>bit 11: Group 18 Polar coordinate command modal initialization</p> <p>bit 10: Group 17 Constant surface speed control command modal initialization</p> <p>bit F: Group 16 Retains inclined surface machining modal</p> <p>bit E: Group 15 Normal line control modal initialization</p> <p>bit D: (Not used)</p> <p>bit C: Group 13 Cutting modal initialization</p> <p>bit B: Group 12 Workpiece coordinate system modal initialization</p> <p>bit A: (Not used)</p> <p>bit 9: Group 10 Fixed cycle return command modal initialization</p> <p>bit 8: (Not used)</p> <p>bit 7: Group 8 Length compensation modal initialization</p> <p>bit 6: Group 7 Radius compensation modal initialization</p> <p>bit 5: Group 6 Inch/metric modal initialization</p> <p>bit 4: Group 5 Feed G modal initialization</p> <p>bit 3: (Not used)</p> <p>bit 2: Group 3 Absolute/incremental command modal initialization</p> <p>bit 1: Group 2 Plane selection modal initialization</p> <p>bit 0: Group 1 Move G modal initialization</p>		

15 Machine Parameters

15.1 Base System Parameters

The H code indicates the tool length offset number, and the D code indicates the tool radius compensation number.

When bit 18 is set to ON, the H and D codes and group 8 G modal are retained.

When bit 7 is set to ON, the H code and group 8 G modal are retained.

<Description of bits for L system>

1F	1E	1D	1C	1B	1A	19	18	17	16	15	14	13	12	11	10
0	0	0	0	0	0	*	0	0	0	0	0	*	0	*	*
F	E	D	C	B	A	9	8	7	6	5	4	3	2	1	0
*	*	0	*	*	0	*	0	0	*	*	*	*	*	*	*

bit 1F: (Not used)

bit 1E: (Not used)

bit 1D: (Not used)

bit 1C: (Not used)

bit 1B: (Not used)

bit 1A: (Not used)

bit 19: Spindle clamp rotation speed initialization

bit 18: (Not used)

bit 17: (Not used)

bit 16: (Not used)

bit 15: (Not used)

bit 14: (Not used)

bit 13: Group 20 2nd spindle control modal initialization

bit 12: (Not used)

bit 11: Group 18 Balance cut initialization

bit 10: Group 17 Constant surface speed control command modal initialization

bit F: Group 16 Retains inclined surface machining modal

bit E: Group 15 Facing turret mirror image initialization

bit D: (Not used)

bit C: Group 13 Cutting modal initialization

bit B: Group 12 Workpiece coordinate system modal initialization

bit A: (Not used)

bit 9: Group 10 Fixed cycle return command modal initialization

bit 8: (Not used)

bit 7: (Not used)

bit 6: Group 7 Nose R compensation modal initialization

bit 5: Group 6 Inch/metric modal initialization

bit 4: Group 5 Feed G modal initialization

bit 3: Group 4 Barrier check modal initialization

bit 2: Group 3 Absolute/incremental command modal initialization

bit 1: Group 2 Plane selection modal initialization

bit 0: Group 1 Move G modal initialization

15 Machine Parameters

15.1 Base System Parameters

(PR)	#1213	proaxy	Side 1 of inclination angle (for L system only)
		Specify the length of the side of the triangle formed by the tilt angle in line with the rectangular coordinate system of the inclined axis.	
		---Setting range---	
		-9999.999 to 9999.999	
(PR)	#1214	macaxy	Side 2 of inclination angle (for L system only)
		Specify the length of the side of the triangle formed by the tilt angle in line with the actual axis of the inclined axis.	
		---Setting range---	
		-9999.999 to 9999.999	
(PR)	#1215	macaxx	Side 3 of inclination angle (for L system only)
		Specify the length of the side of the triangle formed by the tilt angle in line with the actual axis of the base axis corresponding to the inclined axis.	
		---Setting range---	
		-9999.999 to 9999.999	
	#1216	extdcc	External deceleration speed
		Set the upper limit value of the feedrate when the external deceleration signals are enabled.	
		---Setting range---	
		1 to 999999 (mm/min)	
	#1501	polyax	Rotational tool axis number
		Specify the number of the rotational tool axis (servo axis) used for polygon machining (G51.2).	
		Set "0" when not using polygon machining (spindle-servo axis), or when using spindle-spindle polygon machining.	
		A value exceeding the base specification parameter "#1002 axisno" cannot be specified.	
		This parameter is valid when the G code system is 1, 6 or 7 ("1", "2", "7" or "8" is set in the parameter "#1037 cmdtyp").	
		---Setting range---	
		0 to controlled axis number	
	#1502	G0lpfg	G1 -> G0 deceleration check
		Select whether to perform a deceleration check when the travel direction is changed from G1 to G0.	
		0: Not perform	
		1: Perform	
	#1503	G1lpfg	G1 -> G1 deceleration check
		Select whether to perform a deceleration check when the travel direction is changed from G1 to G1.	
		0: Not perform	
		1: Perform	
	#1505	ckref2	Second reference position return check
		Select whether the check is carried out at the specified position in manual second reference position return mode upon completion of spindle orientation or at second reference position return interlock signal.	
		0: Upon completion of spindle orientation	
		1: At second reference position return interlock signal	
	#1506	F1_FM	Upper limit of F 1-digit feedrate
		Set the maximum value up to which the F 1-digit feedrate can be changed.	
		---Setting range---	
		0 to 1000000 (mm/min)	
	#1507	F1_K	F 1-digit feedrate change constant
		Set the constant that determines the speed change rate per manual handle graduation in F 1-digit feedrate change mode.	
		---Setting range---	
		0 to 32767	

15 Machine Parameters

15.1 Base System Parameters

#1510	DOOR_H	Shorten door interlock II axis stop time
<p>Select whether to shorten the time during which the axis is stopped when the door is opened.</p> <p>0: Use the conventional axis stop time.</p> <p>1: Shorten the axis stop time.</p> <p>(Note) When the door interlock II signal is input via a ladder, the conventional axis stop time will be used.</p>		
#1511	DOORPm	Signal input device 1 for door interlock II: for each part system
<p>Set the fixed device number for door interlock II signal input for each part system.</p> <p>A device number from X001 to X3FF can be specified. (Except X100.)</p> <p>Device number "000" is invalid.</p> <p>Set device number "100" when using no fixed device number for door interlock II signal input.</p> <p>Related parameter: "#1154 pdoor" (Door interlock II for each part system)</p> <p>---Setting range---</p> <p>000 to 3FF (hexadecimal)</p>		
#1512	DOORPs	Signal input device 2 for door interlock II: for each part system
<p>Set the fixed device number for door interlock II signal input for each part system.</p> <p>(Set the same value as that of "#1155 DOOR_m".)</p> <p>Related parameter: "#1154 pdoor" (Door interlock II for each part system)</p> <p>---Setting range---</p> <p>000 to 3FF (hexadecimal)</p>		
#1513	stapM	M code for synchronous tap selection
<p>Set the M code for the synchronous tapping selection.</p> <p>Select the synchronous tapping mode using the miscellaneous function code of the value set in this parameter. The M function command can be issued immediately before the tap command or in the same block.</p> <p>This function is valid only when "1" is set in "#1272 ext08/bit1" (M-function synchronous tap cycle).</p> <p>(Note) Do not use M00, 01 02, 30, 98, and 99.</p> <p>---Setting range---</p> <p>0 to 99999999</p>		
#1514	expLinax	Exponential function interpolation linear axis
<p>Set the axis name for the linear axis used in exponential function interpolation.</p> <p>---Setting range---</p> <p>A to Z</p>		
#1515	expRotax	Exponential function interpolation rotary axis
<p>Set the axis name for the rotary axis used in exponential function interpolation.</p> <p>---Setting range---</p> <p>A to Z</p>		
#1516	mill_ax	Milling axis name
<p>Set the name of the rotary axis used in milling interpolation. Only one rotary axis can be set.</p> <p>When there is no E command in issuing the G12.1 command, this parameter will be followed.</p> <p>For the axis name of the rotary axis, set the axis name of "#1013 axname", or the name extension axis (2-letter axis) combining "#1013 axname" and "#1601 axnameEX".</p> <p>The incremental command axis name in "#1014 incax" cannot be used.</p> <p>---Setting range---</p> <p>A to Z, or AA to ZZ</p>		

15 Machine Parameters

15.1 Base System Parameters

#1517	mill_C	Milling interpolation hypothetical axis name
	Select the hypothetical axis command name for milling interpolation. When there is no D command in issuing the milling interpolation command, this parameter will be followed. (Note) The setting value "2" cannot be used for Milling interpolation. 0: Y axis command (Fixed) 1: Command rotary axis name 2: Base axis corresponding to hypothetical axis	
#1518	polm	Spindle-spindle polygon Workpiece spindle No.
	Set the name or No. of the spindle which controls the workpiece used in spindle-spindle polygon machining. (Note 1) The 1st spindle will be selected when "0" is set. (Note 2) There are 2 spindle designation methods: spindle No. method and spindle name method. When names (any of 1 to 9) are set by the parameter "#3077 Sname" (Spindle command name) for all spindles, spindle name method is applied. Otherwise, spindle No. method is applied. ---Setting range--- 0 to 9	
#1519	pols	Spindle-spindle polygon Tool spindle No.
	Set the name or No. of the spindle which controls the rotary tool used in spindle-spindle polygon machining. (Note 1) The 2nd spindle will be selected when "0" is set. (Note 2) There are 2 spindle designation methods: spindle No. method and spindle name method. When names (any of 1 to 9) are set by the parameter "#3077 Sname" (Spindle command name) for all spindles, spindle name method is applied. Otherwise, spindle No. method is applied. ---Setting range--- 0 to 9	
(PR) #1520	Tchg34	Additional axis tool compensation operation (for L system only)
	Select axis to carry out the additional axis' tool compensation function. 0: 3rd axis. 1: 4th axis.	
#1521	C_min	Minimum turning angle
	Set the minimum turning angle of the normal line control axis at the block joint during normal line control. ---Setting range--- 0.000 to 360.000 (°) (Input setting increment applies)	
(PR) #1522	C_axis	Normal line control axis
	Set the number of the axis for normal line control. Set a rotary axis No. 0: Normal line control disabled 1 to 16: Axis No. (number of control axes)	
#1523	C_feed	Normal line control axis turning speed
	Set the turning speed of the normal line control axis at the block joint during normal line control. Set a value that does not exceed the normal line control axis' clamp speed ("#2002 clamp"). This is enabled during the normal line control type I. ---Setting range--- 0 to 100000 (°/min)	
#1524	C_type	Normal line control type
	Select the normal line control type. 0: Normal line control type I 1: Normal line control type II	

15 Machine Parameters

15.1 Base System Parameters

#1533	millPax	Polar coordinate linear axis name
Set the linear axis name used for polar coordinate interpolation.		
---Setting range---		
Axis names such as X, Y or Z		
(PR) #1534	SnG44.1	Spindle No. for G44.1 command
Specify which spindle to be selected when G44.1 is commanded.		
<Spindle No. type>		
Specify by the spindle No. 1 to 8.		
The 2nd spindle is selected if you specify a nonexistent spindle No.		
<Spindle name type>		
Specify by the spindle name 1 to 9.		
The 2nd spindle is selected if you specify a nonexistent spindle name.		
(Note) When names (any of 1 to 9) are for all spindles by the parameter "#3077 Sname" (Spindle command name), "Spindle name type" is applied.		
---Setting range---		
0 to 9		
#1535	C_leng	Minimum turning movement amount
Set the minimum turning movement amount of the normal line control axis at the block joint during normal line control.		
---Setting range---		
0.000 to 99999.999 (mm) (Input setting increment applies)		
#1537	crsax[1]	Mixed control (cross axis control) axis
Set the axis to be interchanged during the mixed control (cross axis control).		
Using two digits, set the name of the axis to be interchanged with the axis in the part system where the mixed control (cross axis control) request signal is input, or the name of the axis to be shifted to that part system.		
---Setting range---		
Two digits between A to Z and 1 to 9		
(Setting is cleared when "0" is set)		
#1538	crsax[2]	Mixed control (cross axis control) axis
Set the axis to be interchanged during the mixed control (cross axis control).		
Using two digits, set the name of the axis to be interchanged with the axis in the part system where the mixed control (cross axis control) request signal is input, or the name of the axis to be shifted to that part system.		
---Setting range---		
Two digits between A to Z and 1 to 9		
(Setting is cleared when "0" is set)		
#1539	crsax[3]	Mixed control (cross axis control) axis
Set the axis to be interchanged during the mixed control (cross axis control).		
Using two digits, set the name of the axis to be interchanged with the axis in the part system where the mixed control (cross axis control) request signal is input, or the name of the axis to be shifted to that part system.		
---Setting range---		
Two digits between A to Z and 1 to 9		
(Setting is cleared when "0" is set)		
#1540	crsax[4]	Mixed control (cross axis control) axis
Set the axis to be interchanged during the mixed control (cross axis control).		
Using two digits, set the name of the axis to be interchanged with the axis in the part system where the mixed control (cross axis control) request signal is input, or the name of the axis to be shifted to that part system.		
---Setting range---		
Two digits between A to Z and 1 to 9		
(Setting is cleared when "0" is set)		

15 Machine Parameters

15.1 Base System Parameters

#1541	crsax[5]	Mixed control (cross axis control) axis
Set the axis to be interchanged during the mixed control (cross axis control). Using two digits, set the name of the axis to be interchanged with the axis in the part system where the mixed control (cross axis control) request signal is input, or the name of the axis to be shifted to that part system. ---Setting range--- Two digits between A to Z and 1 to 9 (Setting is cleared when "0" is set)		
#1542	crsax[6]	Mixed control (cross axis control) axis
Set the axis to be interchanged during the mixed control (cross axis control). Using two digits, set the name of the axis to be interchanged with the axis in the part system where the mixed control (cross axis control) request signal is input, or the name of the axis to be shifted to that part system. ---Setting range--- Two digits between A to Z and 1 to 9 (Setting is cleared when "0" is set)		
#1543	crsax[7]	Mixed control (cross axis control) axis
Set the axis to be interchanged during the mixed control (cross axis control). Using two digits, set the name of the axis to be interchanged with the axis in the part system where the mixed control (cross axis control) request signal is input, or the name of the axis to be shifted to that part system. ---Setting range--- Two digits between A to Z and 1 to 9 (Setting is cleared when "0" is set)		
#1544	crsax[8]	Mixed control (cross axis control) axis
Set the axis to be interchanged during the mixed control (cross axis control). Using two digits, set the name of the axis to be interchanged with the axis in the part system where the mixed control (cross axis control) request signal is input, or the name of the axis to be shifted to that part system. ---Setting range--- Two digits between A to Z and 1 to 9 (Setting is cleared when "0" is set)		
#1558	lvOMin	Involute interpolation override lower limit value
Set the lower limit of the override for involute interpolation override. ---Setting range--- 0 to 100 (%)		
#1559	lvAMax	Involute interpolation allowable acceleration speed
Set the maximum acceleration (time constant) for the acceleration clamping during involute interpolation. ---Setting range--- 0 to 32767 (ms)		
#1560	lvFMin	Involute interpolation minimum feedrate
Set the minimum feedrate for the acceleration clamping during involute interpolation. ---Setting range--- 0 to 999999 (mm/min)		
#1561	3Dcdc	Switch workpiece coordinate display during 3D coordinate conversion
The workpiece coordinate display during 3D coordinate conversion is switched to the workpiece coordinate system or G68 program coordinate system. 0: Workpiece coordinate system 1: G68 program coordinate system (Note) The special display unit's absolute coordinates also follow this parameter setting.		

15 Machine Parameters

15.1 Base System Parameters

#1562	3Dremc	Switch remaining command display during 3D coordinate conversion
<p>The remaining command display during 3D coordinate conversion is switched to the workpiece coordinate system or G68 program coordinate system.</p> <p>0: Workpiece coordinate system 1: G68 program coordinate system</p>		
#1563	3Dcdrc	Switch coordinate reading during 3D coordinate conversion
<p>The coordinate system of the workpiece/skip coordinate read value in the 3D coordinate conversion modal is switched.</p> <p>0: Workpiece (local) coordinate system 1: G68/G68.1 program coordinate system</p>		
#1564	3Dspd	Hole drilling speed during 3D coordinate conversion
<p>Set the rapid traverse rate for the hole drilling cycle during 3D coordinate conversion.</p> <p>0: The cutting feed clamp speed is used. Other than 0: The set speed is used.</p> <p>Note that if the rapid traverse rate is exceeded, the speed will be clamped at the rapid traverse rate.</p> <p>---Setting range--- 0 to 1000000mm/min</p>		
#1565	helgear	Helical machining base axis
<p>Set the base axis for helix angle calculation in helical machining. If no setting, Z axis will be used.</p> <p>---Setting range--- Axis address such as X, Y, Z, U, V, W, A, B, C or H</p>		
#1566	3DSelctDrillaxMode	Switch drill axis's mode from rapid traverse during 3D coordinate conversion
<p>Switch the rapid traverse mode in non-drilling blocks among a drilling cycle to the cutting feed mode during 3-dimensional coordinate conversion.</p> <p>0: Rapid traverse mode. The speed follows the setting of "#2001 rapid". 1: Cutting feed mode. The speed follows the setting of "#1564 3Dspd".</p>		
#1568	SfiltG1	G01 soft acceleration/deceleration filter
<p>Set the filter time constant for smoothly changing the acceleration rate for the cutting feed acceleration/deceleration in pre-interpolation acceleration/deceleration.</p> <p>- Notch frequency Hz Displays the notch frequency (Hz) for the S-pattern filter set in "#1568 SfiltG1" (G01 soft acceleration/deceleration filter).</p> <p>---Setting range--- 0 to 200 (ms)</p>		
#1569	SfiltG0	G00 soft acceleration/deceleration filter
<p>Set the filter time constant for smoothly changing the acceleration rate for the rapid traverse acceleration/deceleration in pre-interpolation acceleration/deceleration.</p> <p>---Setting range--- 0 to 200 (ms)</p>		
#1570	Sfilt2	Soft acceleration/deceleration filter 2
<p>Set the filter time constant for smoothly changing the acceleration rate in pre-interpolation acceleration/deceleration.</p> <p>This will be disabled when "0" or "1" is set.</p> <p>- Notch frequency Hz Displays the notch frequency (Hz) for the S-shape filter set in "#1570 Sfilt2" (Soft acceleration/deceleration filter 2).</p> <p>---Setting range--- 0 to 200 (ms)</p>		

15 Machine Parameters

15.1 Base System Parameters

#1571	SSSdis	SSS control adjustment coefficient fixed value selection
	Fix the shape recognition range for SSS control. ---Setting range--- 0/1	
#1572	Cirorp	Arc command overlap
	This eliminates speed fluctuations at the joint of the arc and straight line and arc and arc. Set as a bit unit. 0: Do not overlap the arc command blocks 1: Overlap the arc command blocks bit0: Arc command during high-speed high-accuracy control II bit1: Arc command during high-speed machining mode II bit2: Arc command during high-accuracy control (G61.1) bit3: Arc command during cutting mode (G64) The line command block and arc command block won't be overlapped during G61.2 modal regardless of this setting. (Note) This parameter is invalid during SSS control. ---Setting range--- 0 to F (HEX)	
#1573	Ret1	Return type 1
	Select the axis to be moved later after tool return. This is referred to with the movement path (transit point #1 -> interrupt point). Up to eight axes can be specified by expressing one axis with one bit. bit0: Transit point #1 1st axis bit1: Transit point #1 2nd axis bit2: Transit point #1 3rd axis bit3: Transit point #1 4th axis bit4: Transit point #1 5th axis bit5: Transit point #1 6th axis bit6: Transit point #1 7th axis bit7: Transit point #1 8th axis ---Setting range--- 00000000 to 11111111 (Binary)	
#1574	Ret2	Return type 2
	Select the axis to be moved later after tool return. This is referred to with the movement path (return start point -> transit point #2). Up to eight axes can be specified by expressing one axis with one bit. bit0: Transit point #2 1st axis bit1: Transit point #2 2nd axis bit2: Transit point #2 3rd axis bit3: Transit point #2 4th axis bit4: Transit point #2 5th axis bit5: Transit point #2 6th axis bit6: Transit point #2 7th axis bit7: Transit point #2 8th axis ---Setting range--- 00000000 to 11111111 (Binary)	

15 Machine Parameters

15.1 Base System Parameters

#1595	hobm	Hobbing rotary tool axis No.
Specify the spindle No. or spindle name of rotary tool in "MITSUBISHI CNC Special Format (G81.4)" of hobbing command. (Note) There are 2 spindle designation methods: spindle No. method and spindle name method. When names (any of 1 to 9) are set by the parameter "#3077 Sname" (Spindle command name) for all spindles, spindle name method is applied. Otherwise, spindle No. method is applied. ---Setting range--- 0 to 9		
#1596	hobs	Hobbing workpiece axis No.
Specify the NC axis No. of workpiece axis (in a part system) in "MITSUBISHI CNC Special Format (G81.4)" of hobbing command. This parameter is valid when "#1292 ext28/bit4" (Hobbing workpiece axis selection switch) is "0". ---Setting range--- 1 to the number of NC axes (in a part system)		
#1597	rpcNoMove	No axis travel with compensation amount change for rotary axis workpiece position
Set whether to enable the axis travel for the compensation change when the compensation amount of rotary axis workpiece position is changed. 0: Enable 1: Disable * Regardless of the parameter setting, the axis travel is not enabled at reset.		
#1599	3DEndPointErr	End point error in 3D coordinate conversion
Specify the tolerable range for an error of the end point of travel command which is deviated from the tool path direction during the G68.1 ,E1 command. ---Setting range--- 0.000 to 100.000 (mm)		
#12001	ManualB RectanA xH	Manual feed rate B constant surface control intersecting part system axis name (horizontal)
Set the part system axis name ("#1013 axname") for the two axes that intersect with the rotary axis direction. When one of the two axes is blank, a constant speed will be applied without using constant surface speed control. ---Setting range--- Axis addresses such as X, Y, Z, U, V, W, A, B, and C		
#12002	ManualB RectanA xV	Manual feed rate B constant surface control intersecting part system axis name (vertical)
Set the part system axis name ("#1013 axname") for the two axes that intersect with the rotary axis direction. When one of the two axes is blank, a constant speed will be applied without using constant surface speed control. ---Setting range--- Axis addresses such as X, Y, Z, U, V, W, A, B, and C		
#12003	ManualB RotCent erH	Manual feed rate B constant surface control rotation center machine position (horizontal)
Set the machine coordinate position (horizontal axis) at the center of the rotary axis. ---Setting range--- -99999.999 to 99999.999 (mm)		
#12004	ManualB RotCent erV	Manual feed rate B constant surface control rotation center machine position (vertical)
Set the machine coordinate position (vertical axis) at the center of the rotary axis. ---Setting range--- -99999.999 to 99999.999 (mm)		

15 Machine Parameters

15.1 Base System Parameters

(PR)	#12005	Mfig	Number of M
		Set the number of M codes that can be specified within the same block.	
		---Setting range---	
		1 to 4	
(PR)	#12006	Mbin	M binary
		Data type 0: BCD	
		Data type 1: Unsigned binary	
		Data type -1: Singed binary	
		<For unsigned binary>	
		The absolute value "1" is output for "-1".	
		<For singed binary>	
		"-1" is output as "0xFFFFFFFF".	
		---Setting range---	
		Data type	
		(-1,0,1)	
(PR)	#12007	Sfig	Number of S
		Set the number of spindles.	
		(Note 1) The setting range differs according to the model.	
		(Note 2) "Sfig" is set in the range of 1 to 8. However, the number of outputs by "Sfig" cannot be controlled.	
		Thus, only one S command is output regardless of the Sfig setting value.	
		---Setting range---	
		1 to 8	
(PR)	#12008	Sbin	S binary
		Data type 0: BCD	
		Data type 1: Unsigned binary	
		Data type -1: Singed binary	
		<For unsigned binary>	
		The absolute value "1" is output for "-1".	
		<For singed binary>	
		"-1" is output as "0xFFFFFFFF".	
		(Note 1) Sbin can be set with "-1", "0" and "1", but the S command cannot be BCD output.	
		If BCD (0) is selected for Sbin, it will be handled as a singed binary (-1).	
		---Setting range---	
		Data type	
		(-1,0,1)	
(PR)	#12009	Tfig	Number of T
		Set the number of T codes that can be specified within the same block.	
		---Setting range---	
		1 to 4	

15 Machine Parameters

15.1 Base System Parameters

(PR)	#12010	Tbin	T binary
		Data type 0: BCD Data type 1: Unsigned binary Data type -1: Singed binary <For unsigned binary> The absolute value "1" is output for "-1". <For singed binary> "-1" is output as "0xFFFFFFFF". ---Setting range--- Data type (-1,0,1)	
(PR)	#12011	Bfig	Number of B
		Set the number of B codes that can be specified within the same block. ---Setting range--- 1 to 4	
(PR)	#12012	Bbin	B binary
		Data type 0: BCD Data type 1: Unsigned binary Data type -1: Singed binary <For unsigned binary> The absolute value "1" is output for "-1". <For singed binary> "-1" is output as "0xFFFFFFFF". ---Setting range--- Data type (-1,0,1)	
#12013	G33.n rot	G33.n rotary axis name	
		Select the axis to use as C axis with its axis name. ---Setting range--- A to Z	
#12014	G33.n ovr	G33.n override	
		Not used.	
#12022	skipF_spec		
		bit0: Skip speed spec: Cutting feed override ON Select whether to enable cutting feed override for a skip command. 0: Disable cutting feed override 1: Enable cutting feed override bit1: Skip speed spec: Dry run ON Select whether to enable dry run for a skip command. 0: Disable dry run 1: Enable dry run bit2: Skip speed spec: Feed rate selection Select the feed rate for a skip command. 0: A feed rate given to address F of the G31 block. If the G31 block has no address F, the value specified by "#1174 skip_F" is applied. In either case the F modal status is unchanged. 1: A feed rate programmed as an F modal value. F modal status is updated by the address F given to the G31 block.	

15 Machine Parameters

15.1 Base System Parameters

(PR)	#12023	Mblkstp1	Pre-read prohibited M code 1
		Set M codes to which pre-read will not be applied.	
		---Setting range---	
		0 to 99999999	
(PR)	#12024	Mblkstp2	Pre-read prohibited M code 2
		Set M codes to which pre-read will not be applied.	
		---Setting range---	
		0 to 99999999	
(PR)	#12025	Mblkstp3	Pre-read prohibited M code 3
		Set M codes to which pre-read will not be applied.	
		---Setting range---	
		0 to 99999999	
(PR)	#12026	Mblkstp4	Pre-read prohibited M code 4
		Set M codes to which pre-read will not be applied.	
		---Setting range---	
		0 to 99999999	
(PR)	#12027	Mblkstp5	Pre-read prohibited M code 5
		Set M codes to which pre-read will not be applied.	
		---Setting range---	
		0 to 99999999	
(PR)	#12028	Mblkstp6	Pre-read prohibited M code 6
		Set M codes to which pre-read will not be applied.	
		---Setting range---	
		0 to 99999999	
(PR)	#12029	Mblkstp7	Pre-read prohibited M code 7
		Set M codes to which pre-read will not be applied.	
		---Setting range---	
		0 to 99999999	
(PR)	#12030	Mblkstp8	Pre-read prohibited M code 8
		Set M codes to which pre-read will not be applied.	
		---Setting range---	
		0 to 99999999	
(PR)	#12031	Mblkstp9	Pre-read prohibited M code 9
		Set M codes to which pre-read will not be applied.	
		---Setting range---	
		0 to 99999999	
(PR)	#12032	Mblkstp10	Pre-read prohibited M code 10
		Set M codes to which pre-read will not be applied.	
		---Setting range---	
		0 to 99999999	
(PR)	#12033	MblkstpMin1	Minimum value of the pre-read prohibited M code range setting 1
		Set the minimum value of the M code to which pre-read will not be applied.	
		---Setting range---	
		0 to 99999999	

15 Machine Parameters

15.1 Base System Parameters

(PR)	#12034	MblkstpMax1	Maximum value of the pre-read prohibited M code range setting 1
Set the maximum value of the M code to which pre-read will not be applied.			
---Setting range---			
0 to 99999999			
(PR)	#12035	MblkstpMin2	Minimum value of the pre-read prohibited M code range setting 2
Set the minimum value of the M code to which pre-read will not be applied.			
---Setting range---			
0 to 99999999			
(PR)	#12036	MblkstpMax2	Maximum value of the pre-read prohibited M code range setting 2
Set the maximum value of the M code to which pre-read will not be applied.			
---Setting range---			
0 to 99999999			
(PR)	#12037	MblkstpMin3	Minimum value of the pre-read prohibited M code range setting 3
Set the minimum value of the M code to which pre-read will not be applied.			
---Setting range---			
0 to 99999999			
(PR)	#12038	MblkstpMax3	Maximum value of the pre-read prohibited M code range setting 3
Set the maximum value of the M code to which pre-read will not be applied.			
---Setting range---			
0 to 99999999			
(PR)	#12039	MblkstpMin4	Minimum value of the pre-read prohibited M code range setting 4
Set the minimum value of the M code to which pre-read will not be applied.			
---Setting range---			
0 to 99999999			
(PR)	#12040	MblkstpMax4	Maximum value of the pre-read prohibited M code range setting 4
Set the maximum value of the M code to which pre-read will not be applied.			
---Setting range---			
0 to 99999999			
(PR)	#12041	MblkstpMin5	Minimum value of the pre-read prohibited M code range setting 5
Set the minimum value of the M code to which pre-read will not be applied.			
---Setting range---			
0 to 99999999			
(PR)	#12042	MblkstpMax5	Maximum value of the pre-read prohibited M code range setting 5
Set the maximum value of the M code to which pre-read will not be applied.			
---Setting range---			
0 to 99999999			
(PR)	#12043	MblkstpMin6	Minimum value of the pre-read prohibited M code range setting 6
Set the minimum value of the M code to which pre-read will not be applied.			
---Setting range---			
0 to 99999999			

15 Machine Parameters

15.1 Base System Parameters

(PR)	#12044	MblkstpMax6	Maximum value of the pre-read prohibited M code range setting 6
Set the maximum value of the M code to which pre-read will not be applied.			
---Setting range---			
0 to 99999999			
	#12049	SBS_no	Sub part system I identification No.
Specify the ID number (address B value) to be used when activating this part system as a sub part system during G122 command. Set to "0" when this part system is not used as a sub part system.			
---Setting range---			
0 to 7			
	#12050	SBS_pro	Sub part system I standard program No.
Specify the No. of program to be called when activating this part system as a sub part system during G122 command. This parameter setting is used when a program designation (address A value/<file name>) is omitted.			
---Setting range---			
0 to 99999999			
	#12051	Jerk_filtG1	G01 jerk filter
Specify the time constant of filter that is used for smoothing the change of jerk when pre-interpolation acceleration/deceleration is performed in cutting feed.			
This filter causes no path error, as the filter is applied to the resultant speed calculated before interpolation.			
If you specify the jerk filter time constant, the time constants of each filter will be as follows:			
- S-shape filter time constant			
"#1568 SfiltG1" - "Jerk_filtG1"			
- Jerk filter time constant			
"Jerk_filtG1"			
---Setting range---			
0 to 50 (ms)			
	#12052	Jerk_filtG0	G00 jerk filter
Specify the time constant of filter that is used for smoothing the change of jerk when pre-interpolation acceleration/deceleration is performed in cutting feed.			
This filter causes no path error, as the filter is applied to the resultant speed calculated before interpolation.			
If you specify the jerk filter time constant, the time constants of each filter will be as follows:			
- S-shape filter time constant			
"#1569 SfiltG0" - "Jerk_filtG0"			
- Jerk filter time constant			
"Jerk_filtG0"			
---Setting range---			
0 to 50 (ms)			
	#12053	EachAxAccCntrl	Enable axis-specific acceleration tolerance control
Select how to calculate the deceleration speed for a corner between the blocks where the high-accuracy control is enabled.			
0: Optimal corner deceleration			
(calculate the deceleration speed using the acceleration tolerance common for all the axes determined by G1bF and G1btL)			
1: Axis-specific acceleration tolerance control			
(calculate the deceleration speed using acceleration tolerances of each axis determined by G1bFx and G1btLx)			
(PR)	#12054	Tol-Ofsnum	Number of tool offset sets for allocation
Specify the number of offset sets to be allocated when the arbitrary allocation method is selected for offset sets.			
---Setting range---			
0 to 999			

15 Machine Parameters

15.1 Base System Parameters

(PR)	#12055	Tol-lifenum	Number of life management tools for allocation
		Specify the number of life management tools to be allocated when the arbitrary allocation method is selected for life management tools.	
		---Setting range---	
		0 to 1000	
	#12056	I_G0ol	Initial rapid traverse block overlap for G00
		Select whether to enable the rapid traverse block overlap function at power ON or at reset.	
		0: Disabled	
		1: Enabled	
	#12057	OT_prechkON	Enabling stroke check before travel for stored stroke limit
		Select the entry inhibition area for stroke check before travel.	
		0: Perform stroke check before travel for the area specified by G22.	
		1: Perform stroke check before travel for the area set by the stored stroke limit function, with or without G22.	
	#12058	OT_prechkTYPE	Stroke check before travel for skip and automatic tool length measurement
		Select whether to enable or disable the stroke check before travel for skip (G31 or G31.n) and automatic tool length measurement (G37).	
		0: Disable	
		1: Enable	
		(Note) This parameter is enabled when #12057=1 and the option "Stroke check before travel" is ON.	
	#12059	SBS_name	Sub part system name
		Specify each sub part system name.	
		This name is displayed when the part system acts as a sub part system.	
		---Setting range---	
		4 or less characters consisting of both alphabets and numbers	
	#12060	VblAccPreInt	Variable-acceleration pre-interpolation acceleration/deceleration ON
		Select whether to enable variable-acceleration pre-interpolation acceleration/deceleration control while high-accuracy control is ON.	
		0: Pre-interpolation acceleration/deceleration	
		(Apply the acceleration rate that is determined by G1bF and G1btL and is common for all the axes)	
		1: Variable-acceleration pre-interpolation acceleration/deceleration	
		(Apply the acceleration rate that is determined by G1bFx and G1btLx for each axis)	
		(Note) Variable-acceleration pre-interpolation acceleration/deceleration is a function available under SSS control. To enable this function, set "#8090 SSS ON" to "1".	
	#12070	Sfilt2_tol	Tolerance control: Soft acceleration/deceleration filter 2
		Specify the time constant of the filter that smoothes out fluctuations in acceleration under the tolerance control.	
		Basically set to 0.	
		---Setting range---	
		0 to 200 (ms)	

15 Machine Parameters

15.1 Base System Parameters

(PR)	#12071-12078	adr_abs[1]-[8]	Command address for arbitrary axis exchange
			<p>Specify the axis address to be given in an arbitrary axis exchange command for the part system.</p> <p>(Note 1) This parameter is disabled when the arbitrary axis exchange function is unused.</p> <p>(Note 2) Do not give an identical name to two or more of the parameters adr_abs[1] to adr_abs[8].</p> <p>(Note 3) Do not leave any unspecified parameter in the middle between adr_abs[1] and [8].</p> <p>(Note 4) Set the addresses of adr_abs[] in the same order as of the axis names (#1013 axname). Note that you can set a nonexistent axis name in the middle.</p> <p>(Note 5) If there are 9 or more control axes per part system, specify the axis address that is programmed based on the basic axis configuration.</p> <p>---Setting range---</p> <p>Axis address such as X, Y, Z, U, V, W, A, B, C or H</p>
(PR)	#12079-12086	adr_inc[1]-[8]	Incremental command address for arbitrary axis exchange
			<p>Specify the incremental command address for each of the axes to be used in an arbitrary axis exchange command.</p> <p>(Note 1) This parameter is disabled when the arbitrary axis exchange function is unused.</p> <p>(Note 2) There is no need to set this parameter when command type (absolute or incremental) is not distinguished by the axis address (when "#1076 AbsInc" = "0").</p> <p>(Note 3) Do not give an identical name to two or more of the parameters adr_inc[1] to adr_inc[8]. If there is any overlap, priority is given in the ascending order (adr_inc[1] to adr_inc[8]).</p> <p>---Setting range---</p> <p>Axis address such as X, Y, Z, U, V, W, A, B, C or H</p>
(PR)	#12087	I_spCode	Initial spindle selection code when spindle selection by address P is valid
			<p>Specify the spindle selection code to be applied when spindle selection by address P has never been made after power ON under Multiple-spindle control I.</p> <p>(Note) This parameter is valid when "#1300 ext36/bit4" is specified to "1". (Spindle selection by address P is valid)</p> <p>---Setting range---</p> <p>0 to 65535</p>
	#12088	Drn_F	Dry run speed
			<p>Specify a dry run speed for each part system.</p> <p>When "0" is set, the manual feed rate selected by Manual feedrate method selection (JVS) signal is applied.</p> <p>---Setting range---</p> <p>0 to 1000000 (mm/min)</p>
	#12089	M2adr	2nd miscellaneous function address type
			<p>Select the address type of the 2nd miscellaneous function.</p> <p>0: One-letter command for the 2nd miscellaneous function</p> <p>1: Two-letter command for the 2nd miscellaneous function</p>
(PR)	#12090	SnG43.1	Spindle designation for G43.1
			<p>Specify which spindle to be selected when G43.1 is commanded.</p> <p><Spindle No. type></p> <p>Specify by the spindle No. 1 to 8.</p> <p>The 1st spindle is selected if you specify a nonexistent spindle No.</p> <p><Spindle name type></p> <p>Specify by the spindle name 1 to 9.</p> <p>The 1st spindle is selected if you specify a nonexistent spindle name.</p> <p>(Note) When names (any of 1 to 9) are for all spindles by the parameter "#3077 Sname" (Spindle command name), "Spindle name type" is applied.</p> <p>---Setting range---</p> <p>0 to 9</p>

15 Machine Parameters

15.1 Base System Parameters

(PR)	#12103	2nd add T-ofs ON	2nd additional axis tool offset ON (for L system only)
Select whether to enable tool offset on the 2nd additional axis. 0: Disable 1: Enable			
(PR)	#12104	2nd add T-ofs set	2nd additional axis tool offset setting (for L system only)
Select on which axis to perform the 2nd additional axis tool offset. Specify the axis address set in "#1013 axname". ---Setting range--- A to Z			
	#12105	C_minTyp	Operation selection of minimum turning angle or less
Specify the operation when the turning angle is set the minimum turning angle (#1521 C_min) or less and the turning operation is not inserted, in the seams of the arc blocks during normal line control. 0: Interpolate before reaching arc end point. 1: Do not interpolate.			
(PR)	#12107	Teaching-DataNum	Number of teaching data points to be allocated to each part system
Specify the number of teaching data points to be allocated to each part system for load monitor. This parameter is enabled when "#1491 Teaching-SysAssign" (Load monitor: Teaching data allocation method) is "1". (Note 1) Load monitor is disabled for the part system to which no teaching data is assigned. (Note 2) Total number of data points allocated to each part system must not exceed 1024. If the number of total data points exceeds the maximum, Initial parameter error (Y05 12107) occurs. ---Setting range--- 0 to 1024			
	#12110	Ret3	Return type
Specify the axis to be moved later after tool return. This is referred to with the movement path (transit point #2 to transit point #1). One bit represents one axis. Up to eight axes can be specified. ---Setting range--- 00000000 to 11111111 (Binary)			
	#12111	Var protect Top1	Common variable setting protection - Top variable No. (1st group)
Specify the head of the common variables which are protected from setting operation. (Note 1) If #12111 or #12112 is 0 or is greater than the bottom No. (#12112), this setting is disabled. (Note 2) For the common variables shared by part systems, the protection takes effect in a part system set by this parameter. (Note 3) It is possible to set an unspecified variable, but the protection covers the specified variables only. ---Setting range--- 0: Disabled 100 to 199, 400 to 999			
	#12112	Var protect Btm1	Common variable setting protection - Bottom variable No. (1st group)
Specify the end of the common variables which are protected from setting operation. (Note 1) If #12111 or #12112 is 0 or is smaller than the top No. (#12111), this setting is disabled. (Note 2) For the common variables shared by part systems, the protection takes effect in a part system set by this parameter. (Note 3) It is possible to set an unspecified variable, but the protection covers the specified variables only. ---Setting range--- 0: Disabled 100 to 199, 400 to 999			

15 Machine Parameters

15.1 Base System Parameters

#12113	Var protect Top2	Common variable setting protection - Top variable No. (2nd group)
		<p>Specify the head of the common variables which are protected from setting operation.</p> <p>(Note 1) If #12113 or #12114 is 0 or is greater than the bottom No. (#12114), this setting is disabled.</p> <p>(Note 2) For the common variables shared by part systems, the protection takes effect in a part system set by this parameter.</p> <p>(Note 3) It is possible to set an unspecified variable, but the protection covers the specified variables only.</p> <p>---Setting range---</p> <p>0: Disabled</p> <p>100 to 199, 400 to 999</p>
#12114	Var protect Btm2	Common variable setting protection - Bottom variable No. (2nd group)
		<p>Specify the end of the common variables which are protected from setting operation.</p> <p>(Note 1) If #12113 or #12114 is 0 or is smaller than the top No. (#12113), this setting is disabled.</p> <p>(Note 2) For the common variables shared by part systems, the protection takes effect in a part system set by this parameter.</p> <p>(Note 3) It is possible to set an unspecified variable, but the protection covers the specified variables only.</p> <p>---Setting range---</p> <p>0: Disabled</p> <p>100 to 199, 400 to 999</p>
#12116	CutOvrZeroMovRap	Rapid traverse operation when cutting feedrate override is 0%
		<p>Select whether to stop rapid traverse when the cutting feedrate override is 0% during rapid traverse.</p> <p>0: Stop rapid traverse</p> <p>1: Not stop rapid traverse</p> <p>(Note) This parameter is invalid when the code method for rapid traverse override is selected.</p>
(PR) #12117	T-ofs hide axis	Hiding tool compensation data of specific axis
		<p>Specify whether to show or hide the tool compensation data for each axis.</p> <p>0: Show</p> <p>1: Hide</p> <p>Specify the setting individually for each axis assigned to the hexadecimal bits.</p> <p>bit0: axis in the 1st column</p> <p>bit1: axis in the 2nd column</p> <p>bit2: axis in the 3rd column</p> <p>bit3: axis in the 4th column</p> <p>(Note 1) The setting of bit3 is enabled for L system when "#12103 2nd add T-ofs ON" is "1".</p> <p>(Note 2) This parameter is invalid for the tool compensation type I or II.</p> <p>---Setting range---</p> <p>0 to F (hexadecimal)</p>
#12121	REM Mcr No	Macro No. for rotation center error measurement
		<p>Specify the name of macro program for the rotation center error measurement.</p> <p>The macro program name is input at initialization of rotation center error measurement macro.</p> <p>If 0 is set, the macro program for the measurement is not input to the part system.</p> <p>The macro program is used for execution of the measurement.</p> <p>---Setting range---</p> <p>0, 9000 to 9099, 9300 to 9999,</p> <p>100010000 to 100018999,</p> <p>100030000 to 199999998</p>

15 Machine Parameters

15.1 Base System Parameters

#12122	REM PrimAx Rot Dir	Primary axis rotation direction for rotation center error measurement
	Rotation direction of primary axis for rotation center error measurement. Select the direction, allowing for the rotary axis stroke limit, etc. 0: Positive direction 1: Negative direction	
#12131	FrqClmpSys_VCC	Upper limit of frequency (per part system)
	Set the upper frequency limit. If "#11686 Spec_VCC/bit5" is set to "0", the setting unit is 1 (Hz). If "#11686 Spec_VCC/bit5" is set to "1", the setting unit is 0.01 (Hz). (Example) If the frequency limit of the machine is 29.5 (Hz), set as follow: ♦#11686/bit5 = 0, #12131 = 29 -> Upper limit is 29 (Hz) ♦#11686/bit5 = 1, #12131 = 2950 -> Upper limit is 29.5 (Hz) If this parameter is set to "0", the upper limit is 40 (Hz) regardless of "#11686 Spec_VCC/bit5". ---Setting range--- 0 to 30000 (Hz)	
#12139	SrvAdjst_Tconst	Time constant for servo adjustment
	This setting value is used as a reference value to determine the adjustment range of "#1207 G1btL" in the High-accuracy parameter adjustment screen. Enter the value of "#1207 G1btL" for servo adjustment. When "0" is set, the parameter adjustment mode cannot be selected from the High-accuracy parameter adjustment screen. ---Setting range--- Without extension of high-accuracy control time constant: 1 to 5000 (ms) With extension of high-accuracy control time constant: 1 to 30000 (ms)	
#12140	MacVib_Tconst	Machine vibration filter time constant
	This setting value is used as a reference value to determine the adjustment range of "#1568 SfiltG1" and "#12070 Sfilt2_tol" in the High-accuracy parameter adjustment screen. Specify the filter time constant according to the machine vibration frequency. When "0" is set, the parameter adjustment mode cannot be selected from the High-accuracy parameter adjustment screen. ---Setting range--- 1 to 200 (ms)	
#12144	system name2	part system name 2
	Set the name of each part system. This setting is only relevant if the system has multiple part systems. This name appears on the screen when the part systems need to be differentiated. The name must be a combination of alphanumeric characters. It can be up to 6 characters long. (*) This name is displayed with priority over the name that is set in #1169 system name. (*) Even if this parameter is set, the name that is set in #1169 system name is displayed in some cases. ---Setting range--- A combination of alphanumeric characters up to 6 characters in length	
#12145	SBS_name2	Sub part system name 2
	Set the name of each sub part system. This name appears when it serves as a sub part system. (*) This name is displayed with priority over the name that is set in "#12059 SBS_name". (*) Even if this parameter is set, the name that is set in "#12059 SBS_name" is displayed in some cases. ---Setting range--- A combination of alphanumeric characters up to 6 characters in length	

15 Machine Parameters

15.1 Base System Parameters

(PR)	#12146	I_Ax_Dsp_Name	Axis counter: Display axis name selection_Initial axis name
<p>Select the axis name to be displayed in axis counter at power-on and reset.</p> <p>0: Display the axis name set in parameter "#1022 axname2".</p> <p>1-5: Display the axis name set in parameter "#1611, #1613, #1615, #1617, #1619 Ax_Dsp_Name[1]-[5]".</p> <p>(Note 1) This parameter is valid when "#1753 cfgPR03/bit5" is "1".</p> <p>(Note 2) If "#1753 cfgPR03/bit6" is "1", the axis name at reset is retained.</p> <p>(Note 3) If "#1753 cfgPR03/bit7" is "1", the axis name at emergency stop or power-off is retained.</p>			
(PR)	#12150	MCR Coord Tr	Motion control release (coordinate transformation function) valid
<p>Select whether to enable the motion control release (coordinate transformation function).</p> <p>0: Disable</p> <p>1: Enable</p>			
(PR)	#12163	NCAID TWDTN_Reg	NC MachiningAID tool wear diagnostics: tool No. R register No.
<p>Specify the R register No. in the user area to be used as "NC MachiningAID tool wear diagnostics: tool No.".</p> <p>(Note 1) This parameter is enabled only when "#11858 NCAID Diagn method" is set to "1" and the R register No. is within the user area.</p> <p>(Note 2) The specified R register No. and the next number are used.</p> <p>When the specified number is an odd number, the operation message "Setting error" appears.</p> <p>---Setting range---</p> <p>0, 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899</p>			
(PR)	#12164	NCAID TWDTSREQ_Reg	NC MachiningAID tool wear diagn.: tool status update request R register No.
<p>Specify the R register No. of the user area to be used as "NC MachiningAID tool wear diagnostics: tool status update request".</p> <p>(Note) This parameter is enabled only when "#11858 NCAID Diagn method" is set to "1" and the R register No. is within the user area.</p> <p>---Setting range---</p> <p>0, 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899</p>			
(PR)	#12165	NCAID TWDTSACK_Reg	NC MachiningAID tool wear diagn.: tool status update response R register No.
<p>Specify the R register No. in the user area to be used as "NC MachiningAID tool wear diagnostics: tool status update response".</p> <p>(Note) This parameter is enabled only when "#11858 NCAID Diagn method" is set to "1" and the R register No. is within the user area.</p> <p>---Setting range---</p> <p>0, 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899</p>			
(PR)	#12391	ref_wk0pt_x	Base workpiece zero point X
<p>Specify the offset amount from the machine coordinate zero point to the base workpiece zero point X.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p>			

15 Machine Parameters

15.2 Base Axis Specification Parameters

15.2 Base Axis Specification Parameters

(PR)	#1010	srvunit	Output unit (servo)
			<p>Specify the unit for data communicated with the servo drive unit. The data communicated between the NC and servo drive unit, and the servo movement data unit follow this specification. The standard value is "E"; however, set the optimum value according to the machine model and specifications.</p> <p>B: 1 μm C: 0.1 μm D: 0.01 μm (10 nm) E: 0.001 μm (1 nm) F: 0.0001 μm (0.1 nm)</p>
(PR)	#1013	axname	Axis name
			<p>Set each axis' name with an alphabetic character. Use the characters X, Y, Z, U, V, W, A, B or C. (Note 1) Do not set the same name twice in one part system. The same name which is used in another part system can be set. (Note 2) The PLC name does not need to be set. (Numbers 1 to 8 are shown as the axis names.) (Note 3) "H" can be specified only with L system.</p> <p>---Setting range--- X, Y, Z, U, V, W, A, B, C or H</p>
(PR)	#1014	incax	Incremental command axis name
			<p>Set the axis name when commanding an incremental value for the axis travel amount. (Note 1) Set an alphabet that is different from that of "#1013 axname". (Note 2) Setting is not required if absolute/incremental specification with axis names is not performed ("#1076 AbsInc" = "0").</p> <p>---Setting range--- X, Y, Z, U, V, W, A, B, C or H</p>
(PR)	#1015	cunit	Program command unit
			<p>Set the minimum increment of program travel command. <Travel amount for travel command 1> 0: Follow "#1003 iunit" 1: 0.0001 mm (0.1 μm) 10: 0.001 mm (1 μm) 100: 0.01 mm (10 μm) 1000: 0.1 mm (100 μm) 10000: 1.0 mm</p> <p>If there is a decimal point in travel command, the decimal point position will be handled as 1 (mm) regardless of this setting.</p>
(PR)	#1017	rot	Rotational axis
			<p>Select whether the axis is a rotary axis or linear axis. When rotary axis is set, the axis will be controlled with the rotary axis's coordinate system. Set the rotary axis type with "#8213 Rotation axis type".</p> <p>0: Linear axis 1: Rotary axis</p>
(PR)	#1018	ccw	Motor CCW
			<p>Select the direction of the motor rotation to the command direction.</p> <p>0: Clockwise (looking from motor shaft) with the forward rotation command 1: Counterclockwise (looking from motor shaft) with the forward rotation command</p>

15 Machine Parameters

15.2 Base Axis Specification Parameters

(PR)	#1019	dia	Diameter specification axis
			<p>Select the command method of program travel amount.</p> <p>When the travel amount is commanded with the diameter dimensions, the travel distance will be 5mm when the command is 10mm of travel distance.</p> <p>The travel amount per pulse will also be halved during manual pulse feed.</p> <p>If diameter is selected, tool length, the wear compensation amount, and the workpiece coordinate offset will be displayed in diameter value. Other parameters concerning length will always be displayed in radius value.</p> <p>0: Command with travel amount</p> <p>1: Command with diameter dimension</p>
(PR)	#1020	sp_ax	Spindle interpolation
			<p>Select "1" when using the spindle for contour control of NC axis (C-axis).</p> <p>Select "2" to implement the spindle-mode rotary axis control.</p> <p>0: Servo axis is used for contour control.</p> <p>1: Spindle is used for contour control.</p> <p>2: Spindle-mode rotary axis control.</p>
(PR)	#1021	mcp_no	Drive unit I/F channel No. (servo)
			<p>Using a 4-digit number, set the drive unit interface channel No. and which axis in that channel is to be used when connecting a servo drive unit.</p> <div data-bbox="311 873 793 1016"> <p>Axis No.</p> <p>Not used (Set to "0")</p> <p>Drive unit interface channel No.</p> </div>
(PR)	#1022	axname2	2nd axis name
			<p>Set the name of the axis displayed on the screen with two characters. (X1, Z2, etc.)</p> <p>Always use an alphabetic character (A to Z) for the first character.</p> <p>---Setting range---</p> <p>A to Z and 1 to 9 (Two digits)</p> <p>(Setting is cleared when "0" is set)</p>
(PR)	#1023	crsadr	Command address during mixed control (cross axis control)
			<p>Set the axis name for issuing a command to this axis during mixed control (cross axis control).</p> <p>---Setting range---</p> <p>A to Z</p> <p>(Setting is cleared when "0" is set)</p>
(PR)	#1024	crsinc	Incremental command address during mixed control (cross axis control)
			<p>Set the axis name for issuing an incremental command to this axis during mixed control (cross axis control).</p> <p>---Setting range---</p> <p>A to Z</p> <p>(Setting is cleared when "0" is set)</p>
(PR)	#1061	intabs	Manual ABS updating
			<p>Select whether to update the absolute position data during automatic handle interrupt.</p> <p>This parameter is enabled only when "#1145 I_abs" is set to "1".</p> <p>0: Do not update (coordinate system shifted the amount of the interruption)</p> <p>1: Update (same coordinates as when interrupt did not occur will be applied)</p>

15 Machine Parameters

15.2 Base Axis Specification Parameters

#1062		T_cmp	Tool compensation function
		Select whether the tool length compensation and wear compensation are enabled during T command execution.	
		0: Tool length compensation enable	Wear compensation enable
		1: Tool length compensation enable	Wear compensation disable
		2: Tool length compensation disable	Wear compensation enable
		3: Tool length compensation disable	Wear compensation disable
#1063		mandog	Manual dog-type
		Select the manual reference position return method for the second return (after the coordinate system is established) and later.	
		The initial reference position return after the power ON is performed with dog-type return, and the coordinate system will be established.	
		(This setting is not required when the absolute position detection is used.)	
		0: High speed return	
		1: Dog-type	
(PR)	#1064	svof	Error correction
		Select whether to correct the error when the servo is OFF.	
		0: Not correct the error	
		The command value will not change during servo OFF, and the movement amount during servo OFF will be handled as droop. When the servo is turned ON the next time, the axis will move to the command position where it used to be when the servo was turned OFF.	
		1: Correct the error	
		The command value and the current position will follow the feedback position. When the servo is turned ON the next time, the axis will not move.	
		During servo READY OFF, the operation will be always the same as of "Correct the error". (The current position will follow the position of the axis.)	
(PR)	#1068	slavno	Slave axis number
		Set the axis number of the slave axis in synchronous control.	
		The axis number is an NC axis number excluding the spindle and PLC axis.	
		Two or more slave axis cannot be set for one master axis.	
		This parameter cannot be set for a slave axis.	
		When using the multi-part system, the relation of the master axis and slave axis cannot extend over part systems.	
		You cannot set the No. of the axis targeted for the multiple axis synchronization control.	
		You cannot set this parameter for the axis targeted for the multiple axis synchronization control.	
		0: No slave axis	
		1 to 32: 1st to 32nd axis	
#1069		no_dsp	Axis with no counter display
		Select whether to display the axis counter or not.	
		This setting is enabled on the counter display screen (relative position counter, etc.).	
		0: Display	
		1: Not display	
#1070		axoff	Axis removal
		Select whether to enable or disable axis removal control.	
		0: Disable	
		1: Enable	
#1072		chop_ax	Chopping axis
		Select the chopping axis.	
		0: Non-chopping axis	
		1: Chopping axis	

15 Machine Parameters

15.2 Base Axis Specification Parameters

(PR)	#1493	ref_syn	Synchronization at zero point initialization
			<p>0: Master axis and slave axis determine their zero points individually.</p> <p>1: The zero points of both master and slave axes are determined by initializing the master axis' zero point.</p> <p>The slave axis moves in perfect synchronization with the master axis.</p> <p>Set this to "1" for speed/current command synchronization control.</p>
(PR)	#1494	dsp_ax_change	Axis order of counter display
			<p>Set this in order to change the axis order of counter display.</p> <p>If this is set, the axes will be displayed in ascending order.</p> <p>However, axis whose setting is "0" will be displayed after axes whose settings are between "1" and "16" are displayed.</p> <p>(Note 1) When the same value is set for more than one axis, axis that is displayed on the left side on the parameter screen will be first displayed.</p> <p>(Note 2) When both of the mixed control (cross axis control) and interchange coordinate position display ("1280 ext16/bit2" OFF) are valid, and when there are two or more valid part systems, this parameter will be ignored.</p> <p>(Note 3) When the arbitrary axis exchange control (option) is ON, and when there are two or more valid part systems, this parameter will be ignored.</p> <p>---Setting range---</p> <p>0: The axis is displayed after the axes whose settings are between "1" and "16" are displayed.</p> <p>1 to 16: Axes are displayed in ascending order.</p> <p>If the number other than "1" to "16" is set, it is dealt as "0" setting.</p>
(PR)	#1495	grf_ax_direction	Axis travel direction in 2D graphic
			<p>Select the axis travel direction in the 2D graphic drawing (trace, check).</p> <p>If set to 1, the positive/negative directions are reversed.</p> <p>---Setting range---</p> <p>0/1</p>
(PR)	#1497	sync_sub	Sub axis number
			<p>Specify the sub axis for the simple synchronous control using its NC axis number.</p> <p>This parameter can be set for the master axis and the slave axis of the synchronous control, because the axes act as main axis of the simple synchronous control.</p> <p>Before setting this parameter, set the synchronous control parameter (#1068 slavno) first, and then turn OFF and ON the power.</p> <p>The sub axis number must be greater than that of the main axis of the same part system.</p> <p>Neither a spindle C-axis nor a PLC indexing axis can be designated as main or sub axis.</p> <p>---Setting range---</p> <p>0: No sub axis</p> <p>1 to 32: 1st axis to 32nd axis</p>
(PR)	#1601	axnameEx	Axis name extension letter
			<p>Specify the second letter of command axis name when the axis name extension parameter is valid (#1266 ext02/bit0 = 1).</p> <p>The command axis name is not extended if this parameter is unspecified, and the only one letter set in "#1013 axname" or "#1014 incax" respectively is the absolute command axis name or incremental command axis name.</p> <p>Axis configuration should not be as the non-name extension axis (1-letter axis) after the name extension axis (2-letter axis) in the part system.</p> <p>(Configure the 2-letter axis after the 1-letter axis)</p> <p>---Setting range---</p> <p>A to Z (Setting is cleared when "0" is set)</p>
(PR)	#1603	PLCdev_no	Axis device assignment No.
			<p>Specify the PLC I/F device assignment No. for the axis.</p> <p>---Setting range---</p> <p>0: No designation for assignment</p> <p>1 to 32: Axis device assignment No.</p>

15 Machine Parameters

15.2 Base Axis Specification Parameters

(PR)	#1605	mgrnum	Machine group No.
Specify the machine group No. to which each axis belongs.			
---Setting range---			
0 to 32			
(PR)	#1611	Ax_Dsp_Name[1]	Axis counter: Display axis name
Set the axis name to be displayed in axis counter when display axis name selection is used.			
Set the axis name for all axes.			
If display axis name selection is not used, enter "0" to make the parameter blank for all axes.			
(Note 1) This parameter is valid when "#1753 cfgPR03/bit5" is "1".			
(Note 2) Setting for a PLC axis is invalid.			
(Note 3) This parameter sets the axis name for axis counter display.			
The axis name displayed in alarms, etc. is the axis name set in parameter "#1022 axname2".			
When using the axis name for other functions or other parameters, use "#1022 axname2".			
(Note 4) Axis names using only numbers (e.g., 1, 99) cannot be set.			
Be sure to include at least one alphabetic character (A to Z).			
---Setting range---			
Two characters (A-Z and 1-9)			
(PR)	#1613	Ax_Dsp_Name[2]	Axis counter: Display axis name
The setting method is same as "#1611".			
(PR)	#1615	Ax_Dsp_Name[3]	Axis counter: Display axis name
The setting method is same as "#1611".			
(PR)	#1617	Ax_Dsp_Name[4]	Axis counter: Display axis name
The setting method is same as "#1611".			
(PR)	#1619	Ax_Dsp_Name[5]	Axis counter: Display axis name
The setting method is same as "#1611".			

15 Machine Parameters

15.3 Base Common Parameters

15.3 Base Common Parameters

	#1038	plcsl	Ladder selection
			Not used. Set to "0".
(PR)	#1039	spinno	Number of spindles
			Select the number of spindles. 0: No spindle 1 to 8: One to eight spindles
			(Note) The setting range differs according to the model.
(PR)	#1040	M_inch	Constant input (inch)
			Select the unit system for setting and display regarding machine parameter and PLC interface's position, length and speed. 0: Metric system 1: Inch system
(PR)	#1041	I_inch	Initial state (inch)
			Select the unit system for the program travel amount when the power is turned ON or reset and for position display. 0: Metric system 1: Inch system
			(Note) The units of the following data are converted by "#1041 I_inch". - Command unit at power ON and reset (Inch/metric command mode) But under the following conditions, the unit will follow G20/G21 command modal even at reset. When reset modal is retained ("#1151 rstint"="0") When G code group 06 reset modal is retained ("#1210 RstGmd/bit5" ON) - Unit system for position display (counter, user parameter, tool, work offset) - User parameter I/O unit - Parameter unit of user parameters concerning length and speed - Arc error parameter (#1084 RadErr)
(PR)	#1042	pcinch	PLC axis command (inch)
			Select the unit system for the commands to the PLC axis. 0: Metric system 1: Inch system

15 Machine Parameters

15.3 Base Common Parameters

#1043	lang	Select language displayed	
		Select the display language. 0: English 1: Japanese 11: German 12: French 13: Italian 14: Spanish 15: Traditional Chinese 16: Korean 17: Portuguese 18: Dutch 19: Swedish 20: Hungarian 21: Polish 22: Simplified Chinese 23: Russian 24: Turkish 25: Czech 31: Indonesian 32: Vietnamese (Note) NC displays in English, when it doesn't equip language option.	
(PR)	#1044	auxno	MR-J2-CT Connections
		Set the number of MR-J2-CTs connected. (Note) The number of MR-J2-CTs possible to connect and setting range are different according to the model. Check the specifications of each series.	
(PR)	#1045	nskno	Megatorque motor connections
		Specify the number of NSK megatorque motors connected. When a value other than 0 is specified, 2nd miscellaneous function data is output as signed binary data. ---Setting range--- 0 to 16	
(PR)	#1046	T-ofs disp type	Tool compensation display type switch (for M system only)
		Set this parameter to 1 when you use the L system's tool compensation type (e.g. when using a turning tool) in the M system. 0: Use the compensation type specified by "#1037 cmdtyp" 1: Use the tool compensation type III, irrespective of "#1037 cmdtyp" (Note that the type is not switched to III on the tool measurement screen.)	
(PR)	#1047	G_Chg_En_Sno	Select program format switch-enabled part system
		Select the part system for which you enable the program format switch. 0: Part system 1 (default) 1: Part system 1 2: Part system 2 If G188 is given to any other part system, a program error (P29) occurs. If PFCHR is turned ON in any other part system, it is ignored.	
(PR)	#1049	mmac_R	Machine tool builder macro SRAM/ROM switch
		Select for the machine tool builder macro program storage area. 0: SRAM area 1: ROM area	

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1051	MemTol	Tool compensation memory common for part systems
			0: Tool compensation memory separate for part systems 1: Tool compensation memory common for part systems
(PR)	#1052	MemVal	No. of common variables shared in part system designation
			0: Common variables common for part systems (number fixed) #100 -: Per part system #500 -: Common for part systems 1: Common variables common for part systems (number designation) #100 -: Designate with V1comN #500 -: Designate with V0comN
			(Note 1) When this parameter is changed, the file system will be changed after the power is turned ON. So always execute format. The new format will be enabled after turning the power ON again. Setting order (1) MemVal changeover -> (2) Turn power ON again -> (3) Format -> (4) Turn power ON again (Note 2) When this parameter is set to "1", #900000 to #907399 are not available even if the number of common variables is 8000.
(PR)	#1057	disp_input	Selection of screen for Image input I/F
			Select which screen should be displayed while the image input expansion card is connected. When no image expansion card is connected, the Mitsubishi Electric standard screen will be displayed regardless of the setting of this parameter. 0: Always displays the Mitsubishi Electric standard screen 1: Always displays the screen sent from IPC 2: Screen can be switched with a PLC signal (displays the Mitsubishi Electric standard screen at power up) 3: Screen can be switched with a PLC signal (displays the screen sent from IPC at power up) 4: Screen can be switched with a PLC signal (partial display of either the screen sent from IPC or the video from the camera at power up)
	#1077	radius	Incremental command for diameter specification axis
			Select whether the incremental command of the diameter specification axis ("#1019 dia" is set to "1") uses the diameter value or radius value. 0: Diameter value 1: Radius value
	#1078	Decpt2	Decimal point type 2
			Select the increment of position commands that do not have a decimal point. 0: Minimum input command unit (follows "#1015 cunit") 1: 1mm (or 1inch) unit (For the dwell time, 1s unit is used.)
	#1079	F1digt	Validate F1 digit
			Select the F command method. 0: Direct numerical command (command feedrate during feed per minute or rotation) 1: 1-digit code command (feedrate set with "#1185 spd_F1" to "#1189 spd_F5")
	#1080	Dril_Z	Drilling Z fixed
			Select a fixed cycle hole drilling axis. 0: Use an axis vertical to the selected plane as hole drilling axis. 1: Use the Z axis as the hole drilling axis regardless of the selected plane.
	#1081	Gmac_P	Give priority to G code parameter
			Select the G code priority relationship during the macro call with G command. 0: Priority is on G code used in the system 1: Priority is on registered G code for call

15 Machine Parameters

15.3 Base Common Parameters

#1082	Geomet	Geometric
	<p>Select the type of geometric to use.</p> <p>0: Not use</p> <p>1: Use only geometric I</p> <p>2: Use geometric I and IB</p> <p>With geometric, specific address codes are used for exclusive meanings. Thus, if A or C is used for the axis name or 2nd miscellaneous command code, the A used for the axis name may function as the geometric's angle designation. Pay special attention to axis names, etc., when using this function.</p>	
#1084	RadErr	Arc error
	<p>Set the tolerable error range when the end point deviates from the center coordinate in the circular command.</p> <p>---Setting range---</p> <p>0 to 1.000 (mm)</p>	
#1087	G96_G0	Constant surface speed control by rapid traverse feed command
	<p>Select how to handle the surface speed for the G00 command when using the constant surface speed control function.</p> <p>0: Calculate the surface speed constantly even during G00 movement</p> <p>1: Calculate the surface speed at the block end point in the G00 command</p>	
#1088	G30SL	Disable G30 soft limit
	<p>Select how to handle the soft limit during G30 (2nd reference position return).</p> <p>0: Enable</p> <p>1: Disable</p>	
#1091	Mpoint	Ignore middle point
	<p>Select how to handle the middle point during G28 and G30 reference position return.</p> <p>0: Pass the middle point designated in the program and move to the reference position.</p> <p>1: Ignore the middle point designated in the program and move straight to the reference position.</p>	
#1092	Tchg_A	Replace tools for additional axis
	<p>Select the movement of the additional axis at the tool change position return command.</p> <p>0: The additional axis will not move</p> <p>1: After the standard axis returns, the additional axis will also return to the tool change position</p>	
#1093	Wmvfin	Synchronization between part systems method
	<p>Select the timing of synchronization between part systems when using the multi-part system.</p> <p>When the travel command is found in the synchronization command (I, M) block:</p> <p>0: Synchronize before executing travel command</p> <p>1: Synchronize after executing travel command</p>	
#1094	TI_SBK	Select life count for single block (for L system only)
	<p>Select whether to count the data units to be used for single block operation when using the tool life management II function (L system).</p> <p>0: Not count</p> <p>1: Count</p>	
#1095	T0tfof	TF output (for L system only)
	<p>Select how to handle TF for T00 command.</p> <p>0: TF will be output</p> <p>1: TF wont be output</p>	

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1096	T_Ltyp	Tool life management type
		Select the tool life management type. 1: Life management I The cutting hours or number of cuttings of the tool that is commanded in the program is accumulated to monitor the usage state. 2: Life management II The same as tool life management I, but with the spare tool selection function. A spare tool is selected from a group of tool commands commanded in the program. Tool compensations (tool length and radius compensations) are carried out for the selected tool. 3: Life management III (for M system only) The cutting hours or number of cuttings of the tool that is commanded in the program is accumulated to monitor the usage state. The group No. is not used to manage the tool life. (Note) When "3" is set for the L system, the tool life management I is selected.	
	#1097	Tldigt	Tool offset No. digits selection
		Select the number of digits for an offset No. in command T. 0: Lower two digits of command T serve as an offset No.; the remaining upper digits as a tool No. 1: Lower one digit of command T serves as an offset No.; the remaining upper digits as a tool No. 2: Lower two digits of command T serve as an offset No., the remaining upper digits as a tool No. 3: Lower three digits of command T serve as an offset No.; the remaining upper digits as a tool No.	
	#1098	Tlno.	Tool length offset number
		Select the number of digits of the tool length compensation No. in the T command. 0: Lower 3 digits in T code serve as a tool length and wear offset Nos.; the remaining upper digits as a tool No. 1: Lower 3 digits in T code serve as a tool wear offset No.; the remaining upper digits as a tool No. and tool length offset No.	
	#1099	Treset	Cancel tool compensation amount
		Select how to handle the tool compensation vector when resetting the system. 0: Clear the tool length and wear compensation vectors when resetting 1: Hold the tool length and wear compensation vectors when resetting When the values are cleared, the compensation will not be applied. So the axis will be shifted by the compensation amount in the next compensation operation. When the values are kept, the compensation will be applied, so the axis will shift the differential amount of the compensation amount in the next compensation operation.	
	#1100	Tmove	Tool compensation
		Select when to perform tool length compensation and wear compensation. 0: Compensate when T command is executed. 1: Superimpose and compensate with the travel command in the block where the T command is located. If there is no travel command in the same block, compensation will be executed after the travel command is superimposed in the next travel command block. 2: Compensate the wear amount when the T command is executed. Superimpose and compensate the tool length compensation amount with the travel command in the same block. If there is no travel command in the same block, compensation will be executed after the travel command is superimposed in the next travel command block.	
	#1101	Tabsmv	Tool compensation method
		Select the type of travel command when "#1100 Tmove" is set to "1" or "2". 0: Compensate regardless of the travel command type (absolute or incremental) 1: Compensate only at the travel command in the absolute command	
	#1103	T_Life	Validate life management
		Select whether to use the tool life management. 0: Not use tool life management. 1: Use tool life management.	

15 Machine Parameters

15.3 Base Common Parameters

#1104	T_Com2	Tool command method 2
	Select how to handle the tool command in the program when "#1103 T_Life" is set to "1". 0: Handle the command as group No. 1: Handle the command as tool No. (Note) In the case of the tool life management III, the program tool command will be handled as the tool No. regardless of the setting.	
#1105	T_sel2	Tool selection method 2
	Select the tool selection method when "#1103 T_Life" is set to "1". 0: Select in order of registered No. from the tools used in the same group. 1: Select the tool with the longest remaining life from the tools used or unused in the same group.	
#1106	Tcount	Life management (for L system only)
	Select the input method when address N is omitted in inputting the data (G10 L3 command) for tool life management function II. 0: Time specified input 1: Number of times specified input	
#1107	Tlifsc	Split life management display screen (for L system only)
	Set the number of groups to be displayed on the tool life management II (L system) screen. 0: Displayed group count 1, maximum number of registered tools: 16 1: Displayed group count 2, maximum number of registered tools: 8 2: Displayed group count 4, maximum number of registered tools: 4	
#1108	TirectM	Life management re-count M code (for L system only)
	Set the M code for tool life management II (L system) re-count. ---Setting range--- 0 to 99	
(PR) #1112	S_TRG	Validate status trigger method
	Select the enable conditions for the user macro interrupt signal (UIT). 0: Enable when interrupt signal (UIT) turns ON 1: Enable when interrupt signal (UIT) is ON	
(PR) #1113	INT_2	Validate interrupt method type 2
	Select the performance after user macro interrupt signal (UIT) input. 0: Execute interrupt program without waiting for block being executed to end 1: Execute interrupt program after completing block being executed	
#1114	mcrint	Macro argument initialization
	Select whether to clear statements other than specified arguments by macro call. Also select whether to clear local variables by power-ON and resetting. 0: Clear the non-specified arguments by macro call. 1: Hold non-specified arguments by macro call 2: Hold non-specified arguments by macro call, and clear local variables by power-ON and resetting	
#1115	thwait	Waiting for retract
	Set the number of waits for retract when chamfering is OFF in thread cutting. ---Setting range--- 0 to 99 (Approx. 4 ms) Standard setting value: 4	
#1116	G30SLM	Invalidate soft limit (manual operation)
	Enable this function when disabling the soft limit check function at the second to fourth reference position return. 0: Enable soft limit function 1: Disable soft limit function	

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1117	H_sens	
			Not used.
	#1118	mirr_A	Select how to set up the length of tools on cutter tables (opposed tables) (for L system only)
			<p>Select one of the following two methods:</p> <ul style="list-style-type: none"> - Set the current length of tools on each facing turret. - Set a value, assuming that the tools on each facing turret are in the same direction as that of those on the base turret. <p>0: Current length of the tools on each facing turret</p> <p>1: Value, assuming that the tools on each facing turret are in the same direction as that of those on the base turret</p>
	#1119	Tmiron	Select the mirror image of each facing turret with T command (for L system only)
			<p>Select whether to enable the mirror image of each facing turret with the T command.</p> <p>0: Disable</p> <p>1: Enable</p>
(PR)	#1120	TofVal	Change macro variable
			<p>Select whether to change the macro variable (tool offset) numbers for shape compensation and wear compensation.</p> <p>0: Not change (Conventional specification)</p> <p>1: Change the shape and wear compensation variable numbers each for X, Z, and R</p>
	#1121	edlk_c	Edit lock C
			<p>Specify whether to prohibit editing of program Nos. 9000 to 9999.</p> <p>0: Editing possible</p> <p>1: Editing prohibited</p> <p>(Note) If "#1122 pglk_c" is set to "1" or "2", "1" will be set in "#1121 edlk_c" when the power is turned ON.</p>
(PR)	#1122	pglk_c	Program display lock C
			<p>The display and search of program Nos. 9000 to 9999 can be prohibited. Specify whether to prohibit display and search.</p> <p>0: Display and search is possible.</p> <p>1: Program details are not displayed.</p> <p>2: Program details are not displayed, and operation/restart search is prohibited.</p> <p>The program details will not be displayed, but the program No. and sequence No. will display in the prohibited state.</p> <p>(Note) If "#1122 pglk_c" is set to "1" or "2", "1" will be set in "#1121 edlk_c" when the power is turned ON.</p>
	#1123	origin	Origin set prohibit
			<p>Select whether to use the origin set function.</p> <p>0: Use</p> <p>1: Not use</p>
	#1124	ofsfix	Fix tool compensation No.
			<p>Select how to handle the compensation No. when the input key is pressed on the tool compensation screen.</p> <p>0: Increment the compensation No. by 1 (Same as general parameters)</p> <p>1: # compensation No. does not change</p> <p>When setting in sequence, "0" is handler.</p> <p>When changing and setting repeatedly while adjusting one compensation value, "1" is handler.</p> <p>(Note) When base common parameter "#1759 cfgPR09/bit1" is set to "1", the cursor does not move regardless of this parameter setting.</p>
	#1125	real_f	Actual feedrate display
			<p>Select the feedrate display on the monitor screen.</p> <p>0: Command speed</p> <p>1: Actual travel feedrate</p>

15 Machine Parameters

15.3 Base Common Parameters

#1126	PB_G90	Playback G90
Select the method to command the playback travel amount in the playback editing. 0: Incremental value 1: Absolute value		
#1127	DPRINT	DPRINT alignment
Select the alignment for printing out with the DPRINT function. 0: No alignment, output s printed with left justification 1: Align the minimum digit and output		
#1128	RstVCI	Clear variables by resetting
Select how to handle the common variables when resetting. 0: Common variables won't change after resetting. 1: Common variables will be cleared #100 to #199 by resetting.		
#1129	PwrVCI	Clear variables by power-ON
Select how to handle the common variables when the power is turned ON. 0: The common variables are in the same state as before turning the power OFF. 1: Common variables will be cleared #100 to #199 when the power is turned ON.		
#1130	set_t	Display selected tool number
Select the tool command value display on the monitor screen. 0: Display T-modal value of program command 1: Display Tool No. sent from PLC		
#1132	brightness	Brightness control
Select the brightness of display unit. 1: High brightness (in bright state) 0: Medium brightness -1: Low brightness (in dim state) (*) This parameter is enabled for M800VW/M80VW/M800VS/M80V Series.		
#1133	ofsmem	
Not used. Set to "0".		
#1134	LCDneg	
Not used. Set to "0".		
#1135	unt_nm	Unit name
Set the unit name. Use 4 or less characters consisting of both alphabets and numbers. If "0" is set, the unit name won't be displayed. ---Setting range--- 4 or less characters consisting of both alphabets and numbers		
#1136	optype	
Not used. Set to "0".		
#1137	Cntsel	
Not used. Set to "0".		
#1138	Pnosel	
Not used. Set to "0".		
#1139	edtype	
Not used. Set to "0".		
#1140	Mn100	M code number
Set the first number of M code that corresponds to the setup Nos. from 100 to 199. ---Setting range--- 0 to 99999999		

15 Machine Parameters

15.3 Base Common Parameters

	#1141	Mn200	M code number
		Set the first number of M code that corresponds to the setup Nos. from 200 to 299.	
		---Setting range---	
		0 to 99999999	
	#1142	Mn300	M code number
		Set the first number of M code that corresponds to the setup Nos. from 300 to 399.	
		---Setting range---	
		0 to 99999999	
	#1143	Mn400	M code number
		Set the first number of M code that corresponds to the setup Nos. from 400 to 499.	
		---Setting range---	
		0 to 99999999	
	#1144	mdlkof	MDI setup lock
		Select whether to enable MDI setting in non-MDI mode.	
		0: Disable MDI setting	
		1: Enable MDI setting	
	#1145	I_abs	Manual ABS parameter
		Select how to handle the absolute position data during automatic handle interrupt.	
		0: Absolute position data will be renewed if manual ABS switch is ON. If it is OFF, data won't be renewed.	
		1: Follow the "intabs" state when "#1061 intabs" is enabled	
	#1146	Sclamp	Spindle rotation speed clamp function
		Select how to handle the spindle rotation speed clamp function with the G92/G50S command.	
		0: G92/G50S command is handled as a clamp command only in the G96 state (during constant surface speed control).	
		G92S will be handled as normal S command in G97 state (constant surface speed OFF).	
		1: The S command in the same block as G92/G50 is constantly handled as a clamp command	
	#1147	smin_V	Minimum spindle rotation speed clamp type
		Specify the type of spindle min. rotation speed clamp value.	
		0: Rotation speed setting	
		1: Output voltage coefficient setting	
		Set "#3023 smini" according to this type setting.	
	#1149	cireft	Arc deceleration speed change
		Select whether to decelerate at the arc entrance or exit.	
		0: Not decelerate	
		1: Decelerate	
	#1153	FixbDc	Hole bottom deceleration check
		Select whether to perform a deceleration check or in-position check at the hole bottom in a hole drilling cycle. This parameter is enabled only for a hole drilling cycle in which no dwell command can be issued at the hole bottom.	
		0: Perform no deceleration check and in-position check	
		1: Perform deceleration check	
		2: Perform in-position check	
(PR)	#1154	pdoor	
		Not used. Set to "0".	
	#1155	DOOR_m	
		Not used. Set to "100".	
	#1156	DOOR_s	
		Not used. Set to "100".	

15 Machine Parameters

15.3 Base Common Parameters

	#1157	F0atr	
			Not used. Set to "0".
	#1158	F0atno	
			Not used. Set to "0".
(PR)	#1163	No rio	RIO connection detection invalid
			Select whether to enable or disable RIO connection detection. 0: Enable 1: Disable If your I/O consists of only cards such as CC-LINK, setting this parameter to "1" will avoid the RIO communication cutoff alarm.
(PR)	#1164	ATS	Automatic tuning function
			Select whether to enable or disable the automatic tuning function. 0: Disable 1: Enable (Note 1) Enable this parameter when using MS Configurator. (Note 2) Disable this parameter during normal operation. (Note 3) Search & start function is disabled for safety when this parameter is set to "1".
	#1166	fixpro	Fixed cycle editing
			Select the type of programs handled on the Edit/Program list/Data in/out screen from the following: general programs, fixed cycles, or machine tool builder macro programs. ♦When Machine tool builder macro password management method type 1 is selected ("#1761 cfgPR11/bit6" = 0) 0: General programs can be edited, etc. 1: Fixed cycles can be edited, etc. Password No.: The machine tool builder macro programs can be edited, etc. ♦When Machine tool builder macro password management method type 2 is selected ("#1761 cfgPR11/bit6" = 1) 0: General programs can be edited, etc. 1: Fixed cycles can be edited, etc. 2: Machine tool builder macro programs can be edited, etc. (*) "2" can be set only when a password is authenticated in "#11796 mmacro". ---Setting range--- 0 to 99999999
	#1167	e2rom	
			Not used. Set to "0".
	#1168	test	Simulation test
			Select the test mode for the control unit. In the test mode, test is performed with a hypothetical reference position return complete even though the real reference position return hasn't been completed. This is limited to test operation of the control unit itself, and must not be used when the machine is connected. 0: Normal operation mode 1: Test mode
	#1217	aux01	
			Not used. Set to "0".

15 Machine Parameters

15.3 Base Common Parameters

#1218

aux02

bit3: Parameter input/output format

Select the parameter input/output format.

0: Type I

Displayed on one line per parameter.

(Example)

N1001T1P1

N1001T2P1

N1001T3P0

1: Type II

Data with the same parameter number is displayed on the same line.

(Example)

N1001 T1 P1 T2 P1 T3 P0

bit4: External workpiece coordinate offset tool number selection

Select the R register that contains the tool number used for automatic calculation when measuring the coordinate offset of an external workpiece.

0: Follow the setting of "#1130 set_t".

1: Use the tool number indicated by user PLC.

bit5: Parameter I/O II spindle specification address

Select the spindle specification address of parameter I/O type II.

0: C

1: T

This parameter is also applied to the spindle specification address for input and verification.

(Note) This parameter is valid only for parameter I/O type II (when "#1218 aux02/bit3" is set to "1").

#1219

aux03

bit1: Stop high-speed PC monitoring function

Set "1" to disable the function that triggers the emergency stop when the PC high-speed processing time is extended.

Disable the monitoring function only as a temporary measure.

bit5: Dog-type intermediate point

Select whether to move to the intermediate point during automatic dog-type reference position return.

0: Not move.

1: Move.

bit7: Time constant setting changeover for soft acceleration/deceleration


0: Accelerating time is $G0tL(G1tL)$.

When the G00 pre-interpolation acceleration/deceleration and the soft acceleration/deceleration are used together, the inclination of soft acceleration/deceleration will be steeper by setting a time to the soft acceleration/deceleration 2nd step time constant (#2005 G0t1). Consequently, the acceleration for G28/G30 will be larger than that for G00.

(1) Total accelerating time is " $G0tL$ ".

(2) The time for curve part is " $G0t1$ ".

(3) The time for linear part is obtained by " $G0tL - (2 \times G0t1)$ ".

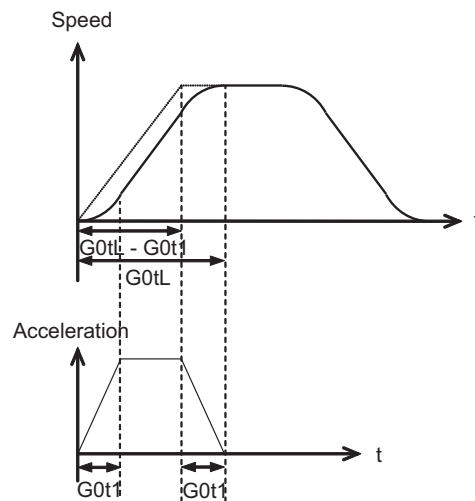


1: Accelerating time is obtained by $G0tL + G0t1 (G1tL + G1t1)$.

When the G00 pre-interpolation acceleration/deceleration and the soft acceleration/deceleration are used together, you can attain the G28/G30 acceleration that is equal to G00, by setting the same value to G00 soft acceleration/deceleration filter (#1569 SfiltG0) as well as to the soft acceleration/deceleration 2nd step time constant (#2005 G0t1).

(1) Total accelerating time is obtained by " $G0tL + G0t1$ ".

(2) The time for curve part is " $G0t1$ ".

(3) The time for linear part is obtained by " $G0tL - G0t1$ ".

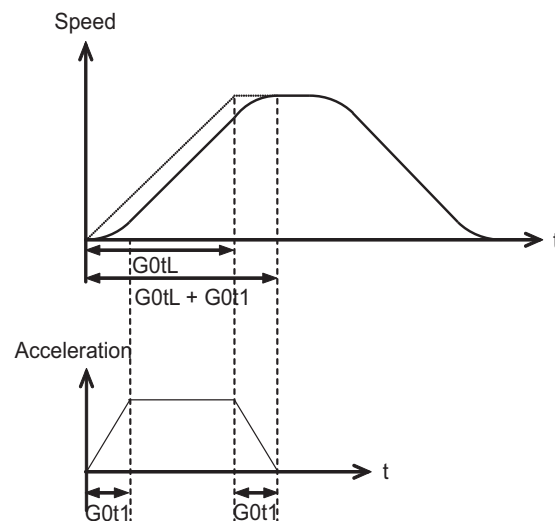

15 Machine Parameters

15.3 Base Common Parameters

#1220	aux04	(for L system only)
bit0: Tool life check timing selection		
Select the criterion to judge the end of tool life when the cumulative number of cuttings is incremented in tool life management II.		
0: Determine the tool life end when the incremented cumulative number of cuttings has exceeded the estimated number of cuttings. (Default) (cumulative number of cuttings > estimated number of cuttings)		
1: Determine the tool life end when the incremented cumulative number of cuttings has reached the estimated number of cuttings. (cumulative number of cuttings >= estimated number of cuttings)		
#1221	aux05	
bit0: Workpiece coordinate/ Absolute coordinate display switching (for L system only)		
Select the coordinate to display when workpiece coordinate position counter is selected for the Monitor screen counter display.		
0: Workpiece coordinate		
1: Absolute coordinate		
#1222	aux06	
bit3: Enable setup parameter lock		
Select whether to enable the setup parameter lock.		
0: Disable		
1: Enable		
bit4: Minimum cut-in amount selection		
Select the minimum cut-in amount command value for the compound thread cutting cycle (G76 command).		
0: The minimum cut-in amount (Q) will be "0".		
1: The minimum cut-in amount (Q) will be set in the last command value (it is retained even after the NC power has been turned off).		
bit5: Fixed cycle for compound lathe command format check selection		
Select the operation when the 1st block of the fixed cycle for compound lathe is omitted while the conventional format is selected ("#1265 ext01/bit0" is set to "0").		
0: Program error (P33) will occur.		
1: Parameter setting value will be used.		
bit7: Reference position return deceleration check method		
Select the deceleration check method to be used during automatic reference position return.		
0: In-position check		
1: Commanded deceleration check		

#1223

aux07

bit1: Deceleration check method 2

Select the deceleration check method in G1+G9.

- 0: Command deceleration check in G1+G9
- 1: In-position check in G1+G9

The deceleration check is not performed for the commands except G1+G9.

When "#1306 InpsTyp deceleration check specification type" is set to "1" (Deceleration check specification type 2), this parameter will be invalid.

bit2: Synchronous tap R-point in-position check

Select whether to enable the synchronous tap I-point -> R-point in-position check.

- 0: Disable
- 1: Enable

(Note) This parameter is valid only when "1" (Enable in-position check) is set for "#1223 aux07/bit3 Synchronous tap in-position check improvement".

bit3: Synchronous tap in-position check improvement

Select whether to enable the synchronous tap in-position check improvement.

- 0: Disable
- 1: Enable

Related parameters:

- #1223/bit2 Synchronous tap R-point in-position check
- #1223/bit4 Synchronous tap hole bottom in-position check
- #1223/bit5 Synchronous tap R-point in-position check 2

bit4: Synchronous tap hole bottom in-position check

Select whether to enable the synchronous tap hole bottom in-position check.

- 0: Disable
- 1: Enable

(Note) This parameter is valid only when "1" (Enable in-position check) is set for "#1223 aux07/bit3 Synchronous tap in-position check improvement".

bit5: Synchronous tap R-point in-position check 2

Select whether to enable the synchronous tap R-point in-position check.

- 0: Disable
- 1: Enable

(Note) This parameter is valid only when "1" (Enable in-position check) is set for "#1223 aux07/bit3 Synchronous tap in-position check improvement".

bit6: Cancel synchronous tap (, S) return

- 0: Retain the spindle speed (,S) in synchronous tap return
- 1: Cancel the spindle speed (,S) in synchronous tap return with G80

bit7: Synchronous tap method

Specify a synchronous tap method.

- 0: Synchronous tap with multi-step acceleration deceleration
- 1: Conventional type synchronous tap

#1224

aux08

bit0: Sampling data output

Select whether to enable the sampling data output.

- 0: Disable
- 1: Enable

15 Machine Parameters

15.3 Base Common Parameters

#1225	aux09
bit7: Enable/disable spindle rotation speed clamp	
Select whether to enable the spindle rotation speed clamp by the G92 S or Q command for the spindle command rotation speed (R7000) set with the user ladder.	
0: Enable	
1: Disable	
#1226	aux10
bit0: Tool compensation data for external workpiece coordinate offset measurement	
Select the tool compensation data to be used for external workpiece coordinate offset measurement.	
0: Tool length data and tool nose wear data	
1: Tool length data	
bit1: Optional block skip type	
Select whether to enable the optional block skip in the middle of a block.	
0: Enable only at the beginning of a block.	
1: Enable in the middle of a block, as well as at the beginning of the block.	
Note that a slash "/" in an equation between [] is handled as division operator.	
(Note) This parameter is enabled when "#1274 ext10/bit4" is "0".	
bit2: Single block stop timing	
Select the timing at which the "Single block" signal is activated.	
0: When the signal goes ON while automatic operation is starting, the block will stop after finished.	
1: When the signal is ON at the end of the block, the block will stop.	
bit3: C-axis reference position return type	
Select the C-axis reference position return type.	
0: Basic position return is performed by the G28 reference position return command or by activating the manual reference position return. The basic point dog is used.	
1: When the first C-axis command is issued after the C-axis mode is entered in automatic mode, reference position return is performed before the execution of the block. The reference position return is also performed by the G28 reference position return command or by activating the manual reference position return. The Z phase of the encoder is used.	
bit4: S command during constant surface speed	
Select whether to output a strobe signal when the S command is issued in constant surface speed mode.	
0: Not output any strobe signal in constant surface speed mode.	
1: Output strobe signals in constant surface speed mode.	
bit5: Arbitrary allocation of dog signal	
Select whether to enable the arbitrary allocation parameter for "Reference position return near-point detection" signal and "Stroke end" signal.	
0: Disable (Fixed device is used.)	
1: Enable (Device is specified by the parameter.)	
bit7: Shorten JOG stop time	
Specify whether to shorten the JOG stop time.	
0: Do not shorten the JOG stop time. (Same as before)	
1: Shorten the JOG stop time.	

#1227	aux11
--------------	--------------

bit0: Select PLC signal or spindle feedrate attained

Set up this option when disabling the cutting start interlock by spindle feedrate attained.

- 0: Cutting start interlock by PLC signal
- 1: Cutting start interlock by spindle feedrate attained

bit1: Select H or D code

Set up this option to validate the data that is set up on the tool life management screen when issuing the H99 or D99 command.

- 0: The H and D codes validate the data that is set up on the management setup screen.
- 1: Validates the data that is set up on the management setup screen when issuing the H99 or D99 command.

bit2: Measures against tool setter chattering

Select a condition where a relieving operation completes after measurement with tools.

- 0: Sensor signals have stopped for 500 (ms) or longer.
- 1: 100 (μm) or longer has passed after sensor signals stopped.

bit4: Word command check

Select whether to output an error when no numeric value follows a program address during execution of a machining program.

- 0: Not check
- 1: Check

bit5: Spindle rotation speed clamp

Specify whether to clamp the rotation speed in constant surface speed mode when the spindle rotation clamp command is issued.

- 0: Clamps the rotation regardless of the constant surface speed mode.
- 1: Clamps the rotation only in constant surface speed mode.

bit7: Switch the range of tool life data to be input

Set up the range of tool life data to be input or compared.

- 0: Inputs or compares all of the data output.
- 1: Inputs or compares part of the data output
 - (1) Tool life management I data to be input or compared
Tool number (D), lifetime (E), life count (F), and auxiliary data (B).
 - (2) Tool life management II data to be input or compared
Group number (G), method (M), life (E/F), tool number (D), and compensation number (H)

15 Machine Parameters

15.3 Base Common Parameters

#1228

aux12

bit0:

When not using, set to "0".

bit1: Switch "offset and parameter" screen

Select to switch the "offset and parameter" screen to the parameter screen.

0: Display the "offset and parameter" screen.

1: Display the "parameter" screen.

bit2: Switch data protection in data transmission mode

Select the range of data protection in data transmission mode.

0: Enable the protection for both send and receive data.

1: Enable the protection for receive data only.

bit3: Nose R specification

Select whether to specify the nose R compensation by shape or wear number.

0: Specifies the nose R compensation by shape number.

1: Specifies the nose R compensation by wear number.

bit4: Select operation error or stop code

Select operation error or stop code to provide for both block start and cutting start interlocks.

0: Operation error

1: Stop code

bit5: Select constant surface speed coordinates (for L system only)

Select the constant surface speed coordinate.

0: Workpiece coordinate

1: Absolute value coordinate

bit6: Switch relative values displayed

Select whether to preset the relative coordinates with workpiece coordinate preset (G92.1) or counter preset (G92).

0: Preset the relative coordinates.

1: Not preset the relative coordinates.

bit7: Protection with manual value command

Select whether to protect a manual value command.

0: Not protect. (Conventional specification)

1: Protect.

#1229

set01

bit0: Subprogram interrupt

Select the type of the user macro interrupt.

- 0: Macro type user macro interrupt
- 1: Sub-program type user macro interrupt

bit1: Accurate thread cutting E

Select what the address E specifies in inch screw cutting.

- 0: Number of threads per inch
- 1: Precision lead

bit2: Radius compensation type B (for M system only)

Select the method of the arithmetic processing for the intersection point when the start-up or cancel command is operated during radius compensation.

- 0: The processing does not handle the start-up or cancel command block: handle the offset vector in the direction vertical to that of the command instead.
- 1: The processing is executed for the intersection point between the command block and the next block.

bit2: Nose R compensation type B (for L system only)

Select the method of the arithmetic processing for the intersection point when the start-up or cancel commands are operated during nose R or radius compensation.

- 0: The processing does not handle the start-up or cancel command block: handle the offset vector in the direction vertical to that of the command instead.
- 1: The processing is executed for the intersection point between the command block and the next block.

bit3: Initial constant surface speed

Select the initial state after the power-ON.

- 0: Constant surface speed control cancel mode
- 1: Constant surface speed control mode

bit4: Synchronous tap

Select the operation when ",R" is omitted in G74/G84 tapping cycle.

- 0: Asynchronous tap
- 1: Synchronous tap

bit5: Start point alarm

Select the operation when the operation start point cannot be found while executing the next block of G115, G116 or G117.

- 0: (G115/G116)Starts after the block has been moved.
(G117)Enables an auxiliary function after the block has been moved.
- 1: (G115)Waits until reaching start point at the movement after next block when the operation start point is not found.
(G116/G117)Outputs an program error (P33) when the operation start point is not found.

bit6: Grid display selection

Select the grid display type on the servo monitor screen during the dog type reference position return.

- 0: Distance between dog OFF and basic point (including a grid mask amount)
- 1: A value given by reducing a grid mask amount from the distance between dog OFF and basic point

bit7: Command switch during fixed cycle with label O

Select the condition to handle the address E or P given during fixed cycle mode as a command of fixed cycle.

- 0: When a G-code from group 0, 1, 4, 8 or 11 is not given
- 1: When a G-code from group 0, 1, 4, 8, 11 or 12 is not given

* This parameter is enabled when "#11009 M2 label O" (Program number label for M2-format) is "1" (Label O).

15 Machine Parameters

15.3 Base Common Parameters

#1230

set02

bit2: Proximity switch spindle orientation: Z phase re-detection request type

Select when to request Z phase re-detection for proximity switch type spindle orientation.

0: After confirming the spindle has reached the Z phase detection speed.

1: Right after Servo ON of the spindle.

bit4: Tolerance control mode selection

Select the tolerance control mode. When you give higher priority to the tolerable acceleration rate in the speed control, set "0". When giving priority to the tolerance, set "1".

0: Give priority to the speed for the tolerable acceleration rate

1: Give priority to the speed for the tolerance

bit7: Macro interface input/output for each part system

Select the specification of the macro interface input/output.

0: Shared by all part systems.

1: Used independently by the part systems.

#1231

set03

bit0: Graphic check compatibility parameter

Select whether to return the data to the pre-starting data after having checked a machining program that re-writes the common variables, workpiece offsets and tool offsets.

0: Return the data.

1: Not return the data.

bit1: Switch graphic coordinates

Select whether to use machine coordinate value or tool position coordinate value (position being machined, obtained by subtracting the tool compensation amount from machine coordinate values) for drawing with trace display.

0: Machine coordinates zero point (same as conventional method)

1: Tool position coordinate value

bit2: Switch graphic check trace

Select the coordinates to draw at program check: both machine coordinate value (tool center path) and tool position coordinate value (program path) simultaneously, or only the coordinates selected with "#1231 set03/bit1" (Switch graphic trace coordinates).

0: Both machine coordinates and tool position coordinates (conventional method)

1: Only coordinates designated with switch graphic coordinates

bit4: Switch zero point mark display position

Select the position for displaying the zero point mark in the graphic display.

0: Machine coordinates zero point (same as conventional method)

1: Workpiece coordinate zero point

bit5: Switch graphic check counter display

Select the type of counter displayed on the Graphic Check screen with the combination of "#1231 set03/bit1". If the drawing coordinate system is other than "all workpiece coordinates", the counter displayed is workpiece coordinate position counter or tool position (workpiece coordinate) regardless of this setting.

0: (When "#1231 set03/bit1" is set to "0") Machine position counter
(When "#1231 set03/bit1" is set to "1") Tool position (machine coordinate) counter

1: (When "#1231 set03/bit1" is set to "0") Workpiece coordinate counter
(When "#1231 set03/bit1" is set to "1") Tool position (workpiece coordinate) counter

bit6: Initialization of drawing in graphic check

Select whether to initialize the workpiece drawing automatically when you change any data in the 3D check workpiece setup screen.

0: Initialize the workpiece drawing (conventional specifications)

1: Not initialize the workpiece drawing

Note that if you change the workpiece shape or dimensions, the workpiece drawing is automatically reset, irrespective of this parameter.

bit7: Disable switching of graphic check method

Select whether to enable or disable switching of the 3D check method.

0: Enable

1: Disable

If you choose Disable, the last selected check method remains selected.

15 Machine Parameters

15.3 Base Common Parameters

#1232	set04
bit0: Exclude acceleration/deceleration in load monitor	
Select whether or not to exclude acceleration/deceleration when detecting the load in load monitoring.	
0: Acceleration/Deceleration is included	
1: Acceleration/Deceleration is excluded	
(Note) When "Exclude acceleration/deceleration in load monitor" ("#1232 set04/bit0") is enabled, "Spindle function 8" ("#13228 SP228/bit2") needs to be set to "1" (load display, high-cycle motor output effective value).	
Not used. Set to "0".	
bit4: Load monitor: Enabled part system selection	
Select whether to use the load monitor function in two part systems or in a single part system.	
This parameter is enabled when "#1491 Teaching-SysAssign" (Load monitor: Teaching data allocation method) is "0".	
0: Use load monitor in the 1st and 2nd part systems. (Teaching data are equally allocated to the 1st and 2nd part systems)	
1: Use load monitor in the 1st part system only. (All the teaching data are allocated to the 1st part system)	
(Note) Load monitor is disabled for the part system to which no teaching data is assigned.	
bit5: Actual load selection	
Load fluctuation due to speed change is excluded from the actual load.	
0: Disable	
1: Enable	
(Note) When "Actual load selection" ("#1232 set04/bit5") is enabled, "Spindle function 8" ("#13228 SP228/bit2") needs to be set to "1" (load display, high-cycle motor output effective value).	
bit7: Spindle unit disturbance torque display selection	
Select display contents on "estimated disturbance torque" and "MAX disturbance torque" of the drive unit (spindle unit).	
0: Estimated disturbance torque	
1: Cutting torque	
#1233	set05
When not using, set to "0".	
#1234	set06
bit3: Interlock when tap retract enabled	
Select whether to enable automatic/manual interlock for the part system with "Tap retract enable" signal ON.	
0: Interlock all the axes	
1: Disable the interlock	
bit4: Tap retract possible state cancel signal operation selection	
Specify the behavior after "Tap retract possible" signal (TRVE) is turned OFF with "Tap retract possible state cancel" signal (TRVEC).	
0: After reset, "Tap retract possible" signal (TRVE) is turned ON.	
1: "Tap retract possible" signal (TRVE) remains OFF state after reset.	

15 Machine Parameters

15.3 Base Common Parameters

#1235	set07
bit0: Helical interpolation/Helical involute interpolation speed 2 0: Designated with the resultant velocity of all programmed axes 1: Designated with the velocity component in the plane of the circle/involute	
bit2: Fixed type chopping compensation valid only at start When the fixed type compensation value is selected, the method can be changed to the compensation value sequential update type after the first four cycles. 0: Disable the method changeover 1: Enable the method changeover	
bit4: Condition to select multi-step acceleration/deceleration synch tap gear step Select the parameters that determine the gear step for multi-step acceleration/deceleration synchronous tapping ("#1223 aux07/bit7" = 0). 0: #3005 to #3008 (smax1 to 4) when "#1245 set17/bit2" = 0 #43046 to #43049 (smax_tap1 to 4) when "#1245 set17/bit2" = 1 1: #3013 to #3016 (stap1 to 4), #3037 to #3040 (taps21 to 24) and #43046 to #43049 (smax_tap1 to 4)	
bit5: Tool wear data clear on tool length measurement (For L system only) Select whether to clear tool wear data to zero when the tool length is set using [Measure] menu on the [T-ofs] screen. 0: Not clear tool wear data to zero 1: Clear tool wear data to zero (Note) This parameter is invalid for the tool compensation type I or II.	
#1236	set08
bit0: Manual rotary axis feedrate unit Select the unit of manual rotary axis feedrate. 0: Fixed to [°/min] 1: Same speed as before (When inch command, the speed is the command speed divided by 25.4.)	
bit1: Spindle speed detection Select the pulse input source of actual spindle rotation speed (R6506/R6507) when the spindle encoder serial connection is selected ("#3025 enc-on" is set to "2"). 0: Serial input 1: Encoder input connector	
bit2: Current limit droop cancel invalid Select whether to cancel the position droop when the current limit changeover signal is canceled. 0: Cancel the droop. 1: Not cancel the droop.	
bit3: Rotary axis command speed scale Select to multiply the rotary axis command speed by 10 times. 0: Invalid 1: During initial inching, the rotary axis command speed is multiplied by 10. In other words, if "F100" is commanded, the speed will be the same as when 1000°/min is commanded. The rotary axis speed display unit will be 10°/min.	
(PR) #1237	set09
Not used. Set to "0".	

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1238	set10
		<p>bit0: Switch G36 function</p> <p>Select the function, the automatic tool length measurement or arc thread cutting (CCW), to be applied to G36 when the G code system 6 or 7 is selected.</p> <p>0: Automatic tool length measurement</p> <p>1: Arc thread cutting (CCW)</p> <p>bit3: Ignoring input from RIO</p> <p>Select whether to ignore the input from RIO.</p> <p>0: Output the input from RIO to X or ZR device.</p> <p>1: Ignore the input from RIO, and not output it to X or ZR device.</p> <p>(*) Normally set this parameter to "0".</p> <p>(*) The devices corresponding to the system-occupied stations of RIO3 or operation panel connection channel are used exclusively by the NC system. These devices are excluded from the target.</p> <p>bit6: Switch absolute position detection alarm</p> <p>Select the output destination of the absolute position detection alarm.</p> <p>0: NC alarm 4 (AL4)</p> <p>1: NC alarm 5 (AL5)</p> <p>(Note) The absolute position detection alarm is listed in the alarm history regardless of this parameter setting.</p> <p>bit7: Switch operation alarm</p> <p>Select whether to enable the NC alarm 5 (AL5) signal output.</p> <p>0: Disable NC alarm 5 (AL5)</p> <p>All operation alarms will be output to NC alarm 4 (AL4).</p> <p>1: Enable NC alarm 5 (AL5)</p> <p>The following operation alarms will be output to NC alarm 5 (AL5), not to NC alarm 4 (AL4).</p> <ul style="list-style-type: none"> •External interlock axis exists (M01 0004) •Cutting override zero (M01 0102) •External feedrate zero (M01 0103) •Block start interlock (M01 0109) •Cutting block start interlock (M01 0110) •Interference check disabled (M01 0200) •Cutting interlock for spindle-spindle polygon (G51.2) (M01 1033) <p>The above alarms are not recorded in the alarm history regardless of the setting value of this parameter.</p>

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1239	set11
		<p>bit0: Coil switching method</p> <p>Select the coil switching method.</p> <p>0: Via PLC. (Y189F)</p> <p>1: NC internal processing. (Y189F is invalid.)</p> <p>bit1: Handle I/F selection</p> <p>Select the handle connection destination.</p> <p>0: Use the handle connected to the encoder communication connector.</p> <p>1: Use the remote I/O unit as a priority.</p> <p>(Note) When the operation panel I/O unit is mounted, the handle connected to the unit will be used regardless of this parameter setting.</p> <p>bit3: Polygon machining mode at reset</p> <p>Select whether to cancel the polygon machining mode when reset is applied.</p> <p>0: Not cancel.</p> <p>1: Cancel.</p> <p>bit4: Invalidate G51.1 phase command</p> <p>Select whether to enable the phase control with the spindle-spindle polygon function.</p> <p>0: Always enable. (When R is not commanded, it will be handled as R0.)</p> <p>1: Enable only at the R command.</p> <p>bit5: Door interlock spindle speed clamp valid</p> <p>Select whether to enable the spindle clamp speed changeover by the PLC signal.</p> <p>0: Disabled</p> <p>1: Enabled</p> <p>bit6: External deceleration axis compliance valid</p> <p>Designate the method for setting the external deceleration speed.</p> <p>0: Set speed common for all axes ("#1216 extdcc" (external deceleration speed))</p> <p>1: Set speed for each axis ("#2086 exdcax" (external deceleration speed))</p>
(PR)	#1240	set12
		<p>bit0: Handle input pulse</p> <p>Select the handle input pulse.</p> <p>0: MITSUBISHI CNC standard handle pulse (25 pulse/rev)</p> <p>1: Handle 400 pulse (100 pulse/rev)</p> <p>bit2: Zero point shift amount magnification</p> <p>If "1" is set, the following magnification will be applied on the #2027 G28sft reference point shift amount, #2057 zero point proximity + and #2058 zero point proximity - settings.</p> <p>For 0.1μm: 10-fold</p> <p>For 0.01μm: 100-fold</p> <p>bit4: Optical communication automatic channel detection invalid</p> <p>Select whether to enable the optical communication automatic channel detection.</p> <p>0: Enable</p> <p>1: Disable</p>

15 Machine Parameters

15.3 Base Common Parameters

#1241	set13
bit0: Prevention of program error due to incorrect G code combination When a G code from some modal groups is commanded in the same block as an unmodal G code, a program error due to incorrect G code combination occurs. This parameter is used to avoid this program error. 0: The program error (P45) will occur. 1: The program error is avoided, however, a G code from an uncombinable modal group is ignored.	
bit1: Interference check at starting up radius compensation (for M system only) Interference check at starting up nose R compensation (for L system only) 0: In a start-up block, an interference check is not carried out. 1: An error occurs even at a start-up block if an interference occurs. The error occurs even when the interference avoidance is set to ON (#8102="1"). However, an interference check is not carried out when it is set to OFF (#8103="1").	
bit4: Plane axis check invalid in fixed cycle for turning machining Select whether to raise a program error when a fixed cycle for turning machining is commanded in either of the following conditions: * The commanded axis does not coincide with the selected plane * One or both of the selected plane axes have no movement 0: Raise a program error 1: Not raise a program error	
bit5: Macro argument L/P valid Select whether to enable L and P to be used as argument of G(MSTB) macro command or ASCII code macro command. 0: L and P commands cannot be used. 1: L and P commands can be used as argument.	
bit7: Spindle rotation speed during synchronous tap return Specify how to operate in a sync tap command block if the tap return spindle rotation speed (,S) is lower than the tap spindle rotation speed (S). 0: Operate at the tap return spindle rotation speed (,S) 1: Operate at the tap spindle rotation speed (S)	
#1242	set14
bit0: Ignoring timing sync in multi-system simultaneous thread cut cycle I (G76.1) Select whether to execute timing synchronization during multi-part system simultaneous thread cut cycle I (G76.1). 0: Execute timing synchronization at the start and end of thread cutting. 1: Ignore the timing synchronization given during the cycle.	
bit1: G92.1 single command error check ON Select whether to enable the error check when G92.1 (G50.3) is given alone in a block. 0: Disable the error check 1: Enable the error check	
bit2: Spindle rotation speed fluctuation alarm selection Select whether to output an operation error upon detection of spindle speed fluctuation (G162). 0: Output an operation error 1: Not output an operation error	
bit6: G113 command type when multiple spindle synchronization set valid Specify the G113 command type of when multiple spindle synchronization set is valid. 0: Cancels all the spindle synchronization by issuing G113H0 or G113D0. 1: Cancels all the spindle synchronization by issuing G113.	
#1243	set15
Not used. Set to "0".	

#1244

set16

bit0: No superimposition of timing synchronization block onto subsequent block

- 0: Superimpose a block, where timing synchronization command is given as a single command, onto the subsequent block, and treat the blocks as one block
- 1: Treat a block, where timing synchronization command is given as a single command, as one block.

bit1: Enable automatic re-calculation after timing synchronization

- 0: Look-ahead a block next to the timing synchronization command block
- 1: Automatically re-calculate a block next to the timing synchronization command block after the synchronization has been completed.

bit2: Balance cut in all the blocks

Select in which block(s) to execute synchronization between part systems when a balance cut command is given.

- 0: Execute synchronization in cutting feed command block(s)
- 1: Execute synchronization in all the blocks

bit3: Enable tool offset at start/stop of arbitrary axis superimposition

Select whether or not to apply tool offset to a travel at workpiece coordinate system switch or a travel toward the superimposition start/end position when the arbitrary axis superimposition control start/stop command is issued.

- 0: Not apply
- 1: Apply

bit4: Speed clamp method under superimposition control

- 0: Apply a fixed superimposition clamp speed to the superimposition-related axes. This clamp speed takes effect irrespective of the feed status (feed direction and mode) of the superimposition-related axes. When this method is chosen, the clamp speed is unchanged during block execution.
- 1: Apply the optimal clamp speed according to the real-time monitored feed status of the superimposition-related axes (feed direction and mode). When this method is chosen, the clamp speed is changed even during block execution. This method helps reduce the cycle time.

bit5: Read of position info with superimposing travel distance taken into account

Select whether to take into account the superimposing travel distance (travel distance of the reference axis) when reading position info (machine coordinates/skip coordinates) using a variable under control axis superimposition or arbitrary axis superimposition control.

- 0: Not take the distance into account
- 1: Take the distance into account

bit6: Axis address check ON

Select whether to output a program error (P32) when any address other than those specified by "#1013 ax-name" and "#1014 incax" is given as an axis address.

If the arbitrary axis exchange function is ON, select whether to output a program error (P32) when any address other than those specified by "#12071-12078 adr_abs[1]-[8]" and "#12079-12086 adr_inc[1]-[8]" is given as an axis address.

- 0: Not output a program error (P32). (Ignore the axis address.)
- 1: Output a program error (P32)

#1245

set17

bit2: Speed to select multi-step acceleration/deceleration synch tap gear step

Specify the rotation speeds that determine the gear step for multi-step acceleration/deceleration synchronous tapping ("#1223 aux07/bit7" = 0).

0: #3005 to #3008 (smax1 to 4)

1: #43046 to #43049 (smax_tap1 to 4)

(Note) This parameter is enabled when "#1235 set07/bit4" = 0.

bit7: Synchronous tap spindle rotation direction type

Select whether the spindle's rotation direction is determined by the synchronous tapping axis' travel direction.

0: The spindle's rotation direction is determined by the synchronous tapping axis' travel direction.

When the travel direction is negative, the spindle rotates forward.

When the travel direction is positive, the spindle rotates in reverse.

1: The spindle always rotates forward regardless of the synchronous tapping axis' travel direction.

(Note) When a reverse tap is commanded, the spindle rotates in an opposite direction to that mentioned above.

#1246

set18

bit0: Thread cut override ON

Select whether to enable spindle override during thread cutting.

0: Disabled

1: Enabled

bit1: Thread cut override feed hold

Select whether to perform feed hold when spindle override is changed during thread cutting.

0: Not perform feed hold

1: Perform feed hold

bit2: Switch coordinate systems for radius compensation

Select the coordinate system for radius compensation.

0: Type 1 (conventional specification)

Perform radius compensation with reference to a position on the workpiece coordinate system.

1: Type 2

Perform radius compensation with reference to a position on the program coordinate system.

bit3: Change repetition final return position at M2L

Select the final return position after repetition, when in G99 modal and in M2 format with the label L.

0: Initial point

1: R point

bit4: T-lifeover signal output

Select the timing at which the "Tool life over" signal is output when using the M system tool life management I/II/III.

0: Turn the signal ON when a selected tool has reached the lifetime.

1: Turn the signal ON when any of tools (in the case of the tool life management III, all the registered tools) in a selected group has reached the lifetime.

bit5: Tool status update type

Select whether to update tool status automatically when estimated tool life data/cumulative usage data is changed on the screen in the M system tool life management I/II/III.

0: Do not update

1: Update.

(Note) When "1" is selected, tool status will be updated as follows.

•When usage data is "0", tool status will be "0".

•When usage data is smaller than lifetime data, tool status will be "1".

•When usage data is the same as or larger than lifetime data, tool status will be "2".

bit6: Switch F 1-digit feedrate change method

Set whether to enable feedrate change with handle until power OFF, or change the parameters #1185 to #1189 with change of speed.

0: Enabled until power OFF

1: Change "#1185 spd_F1" to "#1189 spd_F5"

bit7: PLC axis random device assignment

Select whether to enable PLC axis random device assignment for "Reference position return near-point detection" signal and "Stroke end" signal.

0: Disable (Fixed device is used.)

1: Enable (Device is specified by the parameter.)

15 Machine Parameters

15.3 Base Common Parameters

#1247	set19
bit0: Movement by tool length compensation command (for M system only)	
Select whether or not to move the axis by the compensation amount when tool length compensation/cancel is independently commanded.	
0: Move	
1: Not move	
bit1: Thread cutting operation when manual speed command enabled	
Select the thread cutting operation in manual speed command.	
0: The axis travels at the handle feed rate, jog feed rate, or manual rapid traverse rate	
1: The axis travels following the program command	
bit2: Inclined surface machining mode hold	
Select whether to hold or cancel the inclined surface machining mode at an emergency stop or power OFF.	
0: Cancel the inclined surface machining mode.	
1: Hold the inclined surface machining mode.	
#1248	set20
Not used. Set to "0".	
#1249	set21
bit2: Encryption key setting	
Select whether to enable the encryption key for System lock to be entered.	
0: Disable the encryption key entry	
1: Enable the encryption key entry	
bit5: Warning on 24Hr continuous ON display	
Select whether to show or hide the alarm (V53 0001).	
0: Not display	
1: Display	
#1250	set22
bit0: Enable cycle operation after turning OFF manual arbitrary reverse run mode	
Select whether to enable automatic cycle operation after turning OFF the manual arbitrary reverse run mode.	
0: Disable	
1: Enable	
bit3: Switch acceleration rate for rapid traverse	
Select how to determine the acceleration rate for rapid traverse (G0) in high-accuracy control.	
This parameter is enabled during tool center point control, tool cutting point control, workpiece installation error compensation or inclined surface machining command.	
0: The acceleration/deceleration determined by "#1206 G1bF Maximum speed" and "#1207 G1btL Time constant" is applied. The acceleration/deceleration is common to all axes.	
1: The acceleration/deceleration determined by "#2001 Rapid traverse rate" and "#2004 G0tL G0 time constant (linear)" is applied. The acceleration/deceleration is specific to each axis.	
bit7: Movement at command of workpiece position offset for rotary axis	
Select whether to move the machine by the workpiece position offset when the workpiece position offset for rotary axis is started or cancelled.	
0: Move	
1: Not move	

15 Machine Parameters

15.3 Base Common Parameters

#1251 set23

bit0: Load inertia ratio display

Select whether to show the load inertia ratio of servo and spindle units on the drive monitor screen.

- 0: Display
- 1: Not display (Show zero)

bit1: Spindle temperature display

Select whether or not to display the spindle unit temperature on the drive monitor screen.

- 0: Display according to "#13225 SP225/bit2"
- 1: Not display (Show zero)

(Note) Regardless of the setting of this parameter, the temperature of the spindle for which "1" is set in "#43105 sp_temp_hide" is hidden (blank).

bit2: Warning of "WCS offset not reflected"

This parameter specifies whether to enable the warning that informs that any of the following items being selected has not been reflected in the workpiece position counter or in the program position counter:

- Workpiece coordinate system offset
- Extended workpiece coordinate system offset
- External workpiece coordinate system offset
- Workpiece coordinate system shift
- Workpiece base point offset

- 0: Disable
- 1: Enable

bit4: Speed indication when selection of axis for feedrate command is valid

Select which speed is to be displayed on the screen when the axis (axes) for feedrate command is (are) being selected with G130.

- 0: Display the resultant speed of the axis (axes) designated with G130
- 1: Display the resultant speed of all the axes

bit5: Warning "Continuous write of parameter" invalid

Select whether to indicate the warning when write of parameter is being continuously executed through a "write window" of the PLC window function.

- 0: Indicate the warning
- 1: Not indicate the warning

bit6: Retention of directory path invalid

Select whether to enable/disable the function of retaining the previous directory path.

- 0: Enable
- 1: Disable

(Note) The function supports the following screens: Operation search, Collation and stop, T-list search and Check search.

bit7: 3D machine interference check: pinch gesture

Switch the pinch-to-zoom gesture on the model for 3D machine interference check.

- 0: Pinch in to zoom in on the model, and pinch out to zoom out on the model.
- 1: Pinch in to zoom out on the model, and pinch out to zoom in on the model.

#1252 set24

bit3: Number of file input/output points for PLC constant (extension)

Specify the number of file I/O points for the PLC constant (extension) at the time of parameter input/output (ALL.PRM).

- 0: All the points of file input/output (ALL.PRM) for the PLC constant (extension)
- 1: The number of points specified by #1326 (PLC Const Ext. Num) for the PLC constant (extension)

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1253	set25
		<p>bit0: Number of machine tool builder macro definition files</p> <p>Select the number of definition files for machine tool builder macro.</p> <p>0: One (O199999999)</p> <p>1: Ten (O199999990 to O199999999)</p> <p>bit2: Acceleration/Deceleration mode change in hole drilling cycle</p> <p>Change the acceleration/deceleration mode of hole drilling cycle.</p> <p>0: The operation follows the parameter setting. The setting of #1153 is enabled.</p> <p>1: A constant-gradient acceleration/deceleration and an acceleration/deceleration after interpolation are applied to the hole drilling cycle. The setting of #19417 is enabled.</p> <p>bit4: Clearing data at fixed cycle mode switch</p> <p>Select whether to zero clear the argument data at the time of fixed cycle mode switch.</p> <p>0: Do not zero clear the argument data</p> <p>1: Zero clear the argument data</p> <p>bit5: G53 motion type</p> <p>Change the motion type for G53 command.</p> <p>0: Cutting feed or rapid traverse is determined by the active modal status.</p> <p>1: Fixed to rapid traverse.</p> <p>bit6: Switch G68/G69 function</p> <p>Select whether to use G68/G69 as tool post mirror image function or balance cut function when the selected G code system is 6 or 7.</p> <p>0: Facing turret mirror image</p> <p>1: Balance cut</p>
(PR)	#1254	set26
		<p>bit0: Reducing processing time of zero-travel-distance block (for L system only)</p> <p>Select whether to reduce the processing time of a zero-travel-distance block.</p> <p>0: Disable the reduction of non-travel block processing time.</p> <p>1: Enable the reduction of non-travel block processing time.</p> <p>bit1: Program format switch</p> <p>Enable the program format switch function.</p> <p>0: Disable the function</p> <p>1: Enable the function</p> <p>bit3: Select timing for updating axis parameter</p> <p>Select the timing for when to update axis parameter.</p> <p>0: Update after All axes smoothing zero turns ON for all the part systems.</p> <p>1: Update after All axes smoothing zero turns ON for each part system.</p> <p>bit4: Reference of zero point shift distance for spindle C axis</p> <p>Select the reference method for zero point shift distance when C axis returns to zero under spindle C axis control.</p> <p>0: Use "#2027 G28sft" as the zero point shift distance.</p> <p>1: Use "#3113 cax_sft" as the zero point shift distance.</p>

(PR)	#1255	set27
		<p>bit0: High-accuracy calculation during constant surface speed control</p> <p>Enable the high-accuracy spindle speed calculation under constant surface speed control.</p> <p>0: Calculate the speed with the tolerance of plus or minus 10r/min (same as conventional specifications).</p> <p>1: Calculate the speed with the tolerance of plus or minus 1r/min.</p> <p>bit1: MTB macro M99 command single block stop</p> <p>For M99 command during MTB macro, select whether to execute single block stop or not.</p> <p>0: Not execute single block stop in the M99 command</p> <p>1: Execute single block stop in M99 command</p> <p>(Note 1) During Suppression of single block stop (#3003/bit0 = 1) of system variable, single block stop is not applied in the M99 command even if this parameter is valid.</p> <p>(Note 2) While single block is suppressed by the A1 command of macro definition program (O199999999), single block stop is applied if this parameter is valid.</p> <p>bit3: Holding diameter/radius designation after NC reset</p> <p>Select whether to hold the diameter/radius designation of each axis selected in G10.9 after NC reset.</p> <p>0: Diameter/radius designation is initialized by NC reset.</p> <p>1: Diameter/radius designation is held after NC reset.</p> <p>bit4: Tool retraction from hole bottom in boring cycle</p> <p>0: Move at the rapid traverse rate (G0 interpolation feed).</p> <p>1: Move with linear interpolation (at the feedrate commanded with F).</p> <p>bit5: Tool length offset for multiple axis synchronization control</p> <p>Select whether to enable the tool length offset dedicated to the multiple axis synchronization control.</p> <p>0: Disable</p> <p>1: Enable</p> <p>bit6: Acc/Dec pattern applied until rotation sync when sync SP start signal is OFF</p> <p>Select the acceleration/deceleration pattern to be applied until the synchronized spindle attains rotation synchronization, when spindle synchronization command is given with the spindle start signal of the synchronized spindle OFF (servo OFF).</p> <p>0: Linear acceleration/deceleration</p> <p>1: Spindle synchronization multi-step acceleration/deceleration</p>

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1256	set28
		<p>bit0: Switch to C axis mode at cancel of EMG stop/door open under spindle C axis</p> <p>Select whether to switch the control to C axis mode when you execute and cancel emergency stop, or turn ON and OFF the door open signal under spindle C axis control mode. (This takes effect when spindle/C axis switch method is PLC signal type.)</p> <p>0: Not switch to C axis mode. Control is switched to C axis mode when C axis' Servo OFF signal is turned OFF and ON after cancel of emergency stop or door open.</p> <p>1: Switch to C axis mode when emergency stop or door open is cancelled.</p> <p>bit1: Position loop gain in C axis zero return/orientation/synch tap zero return</p> <p>Select the position loop gain to be applied when the interpolation mode is selected for the spindle C axis, spindle orientation or synchronous tap zero return that is executed when the spindle stops (when "#3106 zrn_typ/bitE"="0").</p> <p>0: SP003 PGS 1: SP002 PGN</p> <p>bit2: Change current FB (load) output unit</p> <p>Select the units in which the current FB (load) is output to a register. When output in units of 0.01%, the output range is from 0 to 327.67%.</p> <p>0: Default (Output in units of 1%). 1: Output in units of 0.01%.</p> <p>bit3: Tool shape compensation in 3D coordinate conversion mode (For L system only)</p> <p>Select whether to apply tool shape compensation before or after executing 3D coordinate conversion.</p> <p>0: Apply tool shape compensation before 3D coordinate conversion 1: Apply tool shape compensation after 3D coordinate conversion</p>
	#1257	set29
		Not used. Set to "0".
(PR)	#1258	set30
		<p>bit0: Skip I/F switch</p> <p>Select A or B contact for the skip interface.</p> <p>0: A contact (Skip operation starts at rising edge of a signal) 1: B contact (Skip operation starts at falling edge of a signal)</p> <p>(Note) This parameter is not applied to PLC skip.</p> <p>bit3: System lock warning selection</p> <p>Set this parameter to "1" if you choose to have the system alarm message (Z64) cleared by NC reset.</p> <p>0: Not clear the message by NC reset 1: Clear the message by NC reset</p> <p>bit4: Thread recut command</p> <p>Specify through which interface to give a thread recut command.</p> <p>0: Through HMI screen 1: Through PLC I/F</p> <p>bit5: Addition of command Q to thread recut</p> <p>Select whether to add the command Q's data to the spindle angle to be compensated during thread recut of a stored thread section.</p> <p>0: Not add the command Q's data 1: Add the command Q's data</p> <p>bit6: Spindle compensation angle in thread recut mode</p> <p>Select whether to calculate the spindle compensation angle when a thread cut command is given during the thread recut mode.</p> <p>0: Calculate the angle for the initial thread cut command in automatic operation. (The initially calculated angle is used for the 2nd and subsequent thread cut commands.) 1: Calculate the angle every time a thread cut command is given.</p>

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1259	set31
		<p>bit0: Enable normal life tool's data count (for M system only)</p> <p>Select whether to enable or disable tool use data counting when the tool status is 2 (normal life tool).</p> <p>0: Not count the use data of normal life tool.</p> <p>1: Count the use data of normal life tool.</p> <p>bit2: Disabling decimal point for PLC window</p> <p>Select the input/output specifications of fraction data for PLC window.</p> <p>0: Enable decimal point Fraction data is output as the fixed fraction information. (The numbers of digits in the integer and fraction parts are the same as of the on-screen specifications.)</p> <p>1: Disable decimal point (cut off all digits after decimal point) Only the integer part is input/output.</p> <p>bit7: Macro processing method</p> <p>Select the macro processing method.</p> <p>0: High speed</p> <p>1: Compatible with conventional models</p> <p>(*) Remarks</p> <p>Select whether to refresh the display data at regular intervals of a certain number of macro blocks when processing successive macro blocks.</p> <p>Selecting "0" enables high-speed macro processing, because it creates no data for refreshing display.</p> <p>Selecting "1" enables most of the blocks under processing to be viewed, because it creates display refresh data at regular intervals even for successive macro blocks.</p> <p>When "1" is selected, the operation is the same as of M700 Series control.</p>

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1260	set32
		<p>bit0: Switching to actual cutting mode during automatic operation</p> <p>0: Unable to switch to actual cutting mode or no-load operation mode during automatic operation. Block stop is executed before a speed change-disabled command (thread cut or tap).</p> <p>1: Able to switch to actual cutting mode or no-load operation mode during automatic operation. Block stop is not executed before a speed change-disabled command (thread cut or tap).</p> <p>bit1: Speed selection for other part systems during actual cutting mode</p> <p>0: Other part systems operate at the programmed speed in the same manner as the part system where a speed change-disabled command (thread cut or tap) is given.</p> <p>1: Other part systems operate at the program check speed.</p> <p>bit2: Prohibit reverse run of fixed cycle</p> <p>Select whether to prohibit reverse run of a fixed cycle during manual arbitrary reverse run.</p> <p>0: Permit reverse run</p> <p>1: Prohibit reverse run</p> <p>(Note) Even when the parameter is "1", reverse run is enabled during fixed cycle operation.</p> <p>bit3: Prohibit MSTB reverse run</p> <p>Select whether to prohibit reverse run of MSTB during the manual arbitrary reverse run.</p> <p>0: Enable MSTB reverse run</p> <p>1: Disable MSTB reverse run</p> <p>(Note) Even when the parameter is "0", MSTB reverse run is disabled while the MSTB reverse run prohibit signal (MRPSG) is ON.</p> <p>bit4: Thread cut start shift angle operation</p> <p>Select the operation to be performed at the start of thread cutting when a thread cut start shift angle command is issued.</p> <p>0: Start thread cut from the thread cut start shift angle after phase Z has been detected once.</p> <p>1: Start thread cut from the thread cut start shift angle, independently of phase Z detection.</p> <p>bit7: Storage of spindle C axis coordinate system</p> <p>Select whether to automatically insert zero return to spindle/C axis control at the initial servo ON or at every servo ON.</p> <p>This parameter is enabled when spindle/C axis deceleration stop type (#3106 zrn_tpy/bit8=1) and zero point return automatic insertion (#1226 aux10/bit3=1) are selected.</p> <p>0: Execute automatic zero return before C axis rotation for the first C axis command given after every servo ON.</p> <p>1: Execute automatic zero return before C axis rotation for the first C axis command given after the initial servo ON. For the 2nd and subsequent servo ON, the coordinate system is retained after servo OFF, and zero return is not automatically inserted.</p>

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1261	set33
		<p>bit1: Operation panel I/O emergency stop function OFF</p> <p>Select whether to disable the emergency stop function when an operation panel I/O unit is disconnected. (This setting is enabled for separated-type NC only)</p> <p>0: Enable the emergency stop function 1: Disable the emergency stop function</p> <p>(*) While the operation panel I/O unit is connected to the NC unit, the emergency stop function is enabled irrespective of this parameter.</p> <p>bit2: Synchronized turning ON/OFF of NC and display</p> <p>Select whether to synchronize the turning ON/OFF of the M800VW/M80VW Series NC controller and display.</p> <p>0: NC and display turn ON/OFF independently. 1: NC and display turn ON/OFF in synchronization with each other.</p> <p>(*) If no operation panel I/O unit is connected, the NC and display turn ON/OFF independently, irrespective of this parameter.</p> <p>bit3: PLC high-speed process start timing selection</p> <p>Select the type of PLC high-speed process start timing.</p> <p>0: Type 1 (default) 1: Type 2</p> <p>bit4: High-speed ladder execution cycle</p> <p>Specify the high-speed ladder execution cycle. (Standard value: 0)</p> <p>0: Default (equivalent to Mitsubishi Electric M700V Series) 1: Twice the default</p> <p>(Note) When the parameter "#1261 set33/bit4" is set to its default value, the high-speed ladder execution cycle differs according to the model and the number of part systems.</p> <p>bit5: Operation switch at OT and soft limit in synchronous operation method</p> <p>This parameter switches the axis operation at stroke end and soft limit for slave axis in the synchronous operation method. When independent operation method or correction mode is set, the operation will be the same as #1261=0 (disable).</p> <p>0: When "Stroke end" signal is turned ON for only slave axis by stroke end or soft limit, the slave axis stops but master axis does not stop. 1: When one of master axis or slave axis is in the stroke end or soft limit, both master and slave axes stop.</p>
(PR)	#1262	set34
		<p>bit2: Disable warning for coordinate system selection without 3D manual feed spec.</p> <p>Select whether to display a warning when hypothetical coordinate system has been selected although 3D manual feed is not included in the specifications.</p> <p>0: Display 1: Not display</p> <p>bit3: Condition of turning OFF Tool life end signal (for L system only)</p> <p>Select when to turn OFF the tool life end signal in the tool life management 1 for L system.</p> <p>0: When M function finish signal (FIN) is turned ON 1: When a tool that has not reached the end of life is selected</p>

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1263	set35
		<p>bit1: Show/Hide history clear menus</p> <p>Show/Hide operation menus for data clear of collection setting screen, history clear of alarm history screen, history start, and history stop.</p> <p>0: Show history clearing operation menus</p> <p>1: Hide history clearing operation menus</p> <p>bit2: Hide the alarm category of PLC message</p> <p>Select whether to hide the alarm category of PLC message (alarm or operator message).</p> <p>0: Display the alarm category</p> <p>1: Hide the alarm category</p> <p>bit3: Overvoltage alarm switch</p> <p>Select the alarm for overvoltage.</p> <p>0: Display the warning upon occurrence of overvoltage alarm.</p> <p>1: Execute emergency stop upon occurrence of overvoltage alarm.</p>
	#1264	set36
		<p>bit2: Disabling manual numerical value command during automatic operation</p> <p>Specify whether manual numerical commands should be disabled during automatic operation.</p> <p>0: Enable manual numerical command during automatic operation</p> <p>1: Disable manual numerical command during automatic operation</p>
(PR)	#1265	ext01
		<p>bit0: Command format 1</p> <p>Select the command format for the fixed cycle for compound lathe.</p> <p>0: Conventional format</p> <p>1: MITSUBISHI CNC special format (1 block command method)</p> <p>bit1: Command format 2</p> <p>Select the command format for the lathe fixed cycle.</p> <p>0: Conventional format</p> <p>1: MITSUBISHI CNC special format</p> <p>bit2: Command format 3</p> <p>Select the command format for the fixed cycle for drilling.</p> <p>0: Conventional format</p> <p>1: MITSUBISHI CNC special format</p> <p>bit3: F-command unit 2 (for L system only)</p> <p>Specify the unit to be used if a synchronous feed or thread cutting lead command contains no decimal point.</p> <p>0: Type 1 (conventional specifications) or Type 2 Type 1 or Type 2 is selected by the parameter "#1271 ext07/bit2".</p> <p>1: Type 3 F command 0.01 mm/rev, 0.0001 inch/rev E command Sync feed (corner chamfer/corner R feedrate) 0.01 mm/rev, 0.0001 inch/rev Thread cut (fine thread cut lead) 0.0001 mm/rev, 0.000001 inch/rev</p> <p>(Note) Type 3 is independent of the input unit.</p>
(PR)	#1266	ext02
		<p>bit0: Axis name extension valid</p> <p>0: "Axis name extension" invalid</p> <p>1: "Axis name extension" valid</p>
(PR)	#1267	ext03
		<p>bit0:</p> <p>Not used.</p>

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1268	ext04
		<p>bit2: Enable synchronous tapping per minute</p> <p>Select whether to enable feed per minute with the F command of synchronous tapping cycle.</p> <p>0: Disable (Command in pitch regardless of "G group 5" modal)</p> <p>1: Enable (Follow "G group 5" modal)</p> <p>bit4: Enable address K to specify the repetition count in G76/G87</p> <p>Select whether to enable address K to be used for specifying the repetition count in G76/G87 command.</p> <p>0: Disable</p> <p>1: Enable</p> <p>When "1" is set in this parameter with "#1271 ext07/bit1" (Specifying repetition count with address K) set to "1", the address K given to G76/G87 is treated as the number of repetitions.</p> <p>bit5: Compensation type for tool offset changing value (M system only)</p> <p>Set the compensation operation when changing the tool offset amount during tool offset compensation (G43/G44) of the tool length offset by coordinate shift.</p> <p>0: Compensation by axis movement</p> <p>1: Compensation by coordinate shift</p> <p>(Note) This parameter is enabled only when "1268 ext04/bit6" is "1".</p> <p>bit6: Tool length compensation behavior (for M system only)</p> <p>Select how tool length offset is performed when a tool length offset command is issued.</p> <p>0: Axis movement</p> <p>1: Coordinate shift</p> <p>bit7: Retain tool L offset at auto ref. position return (for M system only)</p> <p>Select whether to retain the G43/G44 modal when G28, G30 or G30.1 is commanded.</p> <p>0: Not retain (Cancel)</p> <p>1: Retain</p>
(PR)	#1269	ext05
		<p>bit0: Inverse tangent (ATAN) command format</p> <p>Select the command format of ATAN operation.</p> <p>0: Format 1</p> <p>Either the ratio of two sides or the whole expression is enclosed in square brackets "[]".</p> <p>ATAN[#k] or ATAN[#]/[#k]</p> <p>1: Format 2</p> <p>Two sides are enclosed in "[]" respectively and also divided by a slash "/".</p> <p>ATAN[#j]/[#k]</p> <p>bit1: Range of inverse tangent (ATAN) calculation result</p> <p>Select the range of calculation result for inverse tangent (ATAN) to be applied when Format 2 is selected for inverse tangent (ATAN) command (when #1269/bit0 = 1).</p> <p>0: -180 to 180°</p> <p>1: 0 to 360°</p>

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1270	ext06
bit2: Select finished shape program search method		
Select how to search a finished shape program to be called by G70, G71, G72 or G73 command.		
0: Search from the top of the currently executed program or from the top of the program specified with the address A.		
1: <G71, G72, G73>		
Search from a block following G71, G72 or G73.		
<G70>		
Search from the same start sequence No., if it exists, as that of the finished shape program where G71, G72 or G73 has been executed.		
In the other cases, search from the top of the currently executed program or from the top of the program specified with the address A.		
bit4: Switch chamfering operation		
Select the operation to be performed when the cycle start point is exceeded as a result of chamfering in a thread cutting cycle.		
0: Output a program error (P192).		
1: Stop chamfering upon arrival at the cycle start point, and then move to the end point of the thread cutting block at a rapid traverse rate.		
bit5: Coordinate rotation angle without command (for L system only)		
Select the operation when there is no rotation angle command R for the coordinate rotation.		
0: Use the previously commanded value (modal value). If the command is the first issued command, the rotation angle will be 0°.		
1: Use the set value in "#8081 Gcode Rotat".		
bit6: Switch continuous thread cutting Z phase wait operation		
Select when to start the 2nd block thread cutting when there is a command with no movement (MST command, etc.) between the thread cutting blocks.		
0: Wait for the spindle's single rotation synchronization signal before starting the movement.		
1: Start movement without waiting for the spindle's single rotation synchronization signal.		
bit7: Handle C axis coordinate during cylindrical interpolation		
Specify whether to keep the rotary axis coordinate as before the cylindrical interpolation start command is issued during the cylindrical interpolation.		
0: Not keep		
1: Keep		

(PR)	#1271	ext07
------	-------	-------

bit0: Mirror image operation

Select the type of mirror image operation.

0: Type 1

- The program mirror image, external mirror image, and parameter mirror image are exclusive to each other.
- An incremental command moves the image to the position indicated by the travel amount with the sign inverted.

1: Type 2

- Mirror image operation is enabled when the program mirror image (G51.1) command is issued or when the external signal or parameter is ON.
- An incremental command moves the image to the position determined by applying the mirror image to the absolute program coordinates.

bit1: Address specifying fixed cycle repetition count (for M system only)

Select the address that specifies the fixed cycle repetition count.

0: Address L only (Default)

1: Addresses K and L

If addresses K and L are specified simultaneously, the data at address K will be used for operation.

bit2: F-command unit

(M system)

Specify the unit to be used if a thread cutting lead command contains no decimal point.

* This setting is independent of the input unit.

0: Type 1 (conventional specifications)

F1: 1 mm/rev, 1 inch/rev

1: Type 2

F1: 0.01 mm/rev, 0.0001 inch/rev

(L system)

Specify the unit to be used if a synchronous feed or thread cutting lead command contains no decimal point.

0: Type 1 (conventional specifications)

[Input unit B] F1: 0.0001 mm/rev, 0.000001 inch/rev

[Input unit C] F1: 0.00001 mm/rev, 0.0000001 inch/rev

1: Type 2

F1: 0.0001 mm/rev, 0.000001 inch/rev

* Type 2 is independent of the input unit.

bit3: G-code group for unidirectional positioning (for M system only)

Select the G-code group for unidirectional positioning.

0: Unmodal G code (group 00)

1: Modal G code (group 01)

Related parameter: "#8209 G60 Shift" (Set the last positioning direction and distance for each axis applicable when the unidirectional positioning command is issued.)

bit4: Operation by independent G40 command

Select whether the radius compensation vector is canceled by the independent G40 command.

0: Type 1 (conventional specification) (Default)

The radius compensation vector will be canceled by the independent G40 command.

1: Type 2

The radius compensation vector won't be canceled by the independent G40 command: it will be canceled by the next travel command for the radius compensation plane.

bit5: Cut start position (for L system only)

Select the position from where cutting begins in a fixed cycle for compound lathe.

0: Conventional specification (Default)

The cut start position will be determined by the final shaping program.

1: Extended specifications

Determined from the cycle start point.

15 Machine Parameters

15.3 Base Common Parameters

bit6: Nose R compensation (for L system only)

Select whether to apply nose R compensation for shapes in a rough cutting cycle.

0: Conventional specification (Default)

The shape after nose R compensation in the final shaping program will be used as rough cutting shape. (when the nose R compensation for the final shaping program).

1: Extended specifications

The shape without nose R compensation in the final shaping program will be used as rough cutting shape.

bit7: Cut amount (for L system only)

Select the operation to be performed when the program-specified cut amount exceeds the cut amount of the final shaping program.

0: Conventional specification (Default)

A program error will occur when the program-specified cut amount exceeds the cut amount of the final shaping program.

1: Extended specifications

Rough cutting will be performed by one cut when the program-specified cut amount exceeds the cut amount of the final shaping program.

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1272	ext08
		<p>bit0: Switch pocket machining operation</p> <p>Select the pocket machining specification.</p> <p>0: Conventional specification Pocket machining will be selected with the H designation. The pull direction when pocket machining is ON will be the Z direction.</p> <p>1: Extended specifications Pocket machining will start only when both X and Z axes are specified in the first travel block after the finished shape start block. The pull direction when pocket machining is ON will be the X direction.</p> <p>bit1: M function synchronous tap cycle</p> <p>Specify whether to enable the M function synchronous tapping cycle.</p> <p>0: Disable 1: Enable</p> <p>bit2: Spiral/conical interpolation command format 2</p> <p>Select the command format for spiral and conical interpolation.</p> <p>0: Type 1 (conventional specification) 1: Type 2 (with the number of spiral rotation L designation and the increment designation)</p> <p>bit3: Switch macro call function</p> <p>Select whether to shift the argument to the subprogram if nests are overlapped when per block call (G66.1) is commanded.</p> <p>0: Shift 1: Not shift (Conventional specification)</p> <p>bit4: Tap cycle selection</p> <p>Select the tapping cycle.</p> <p>0: Pecking tapping cycle 1: Deep hole tapping cycle</p> <p>bit5: Deep hole tap cycle override selection</p> <p>Select whether to enable override on the pulling operation during synchronized tapping with the deep hole tapping cycle.</p> <p>0: Disable 1: Enable</p> <p>bit6: Switch corner chamfering/ corner R command format</p> <p>Select the command format of the corner chamfering/corner R.</p> <p>0: Command format I (conventional format) Issue a command with comma (,C and ,R).</p> <p>1: Command format II In addition to command format I, addresses without comma can be used to command. I/K or C can be used for corner chamfering, while R can be used for corner R.</p> <p>bit7: Return position after macro interrupt in fixed cycle selection</p> <p>Select the destination to return to after a macro interrupt in the fixed cycle.</p> <p>0: Return to the block in the fixed cycle. 1: Return to the block next to the fixed cycle.</p>

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1273	ext09
		<p>bit0: Switch ASIN calculation results range</p> <p>Select the notation system for operation result of ASIN.</p> <p>0: Do not switch minus figures to positive figures. (-90° to 90°)</p> <p>1: Switch minus figures to positive figures. (270° to 90°)</p> <p>bit1: Switch system variable unit</p> <p>Select the unit for the system variable #3002 (cycle start operation time).</p> <p>0: 1 ms unit</p> <p>1: 1 hour unit</p> <p>bit2: Switch G71, G72, G73 cutting direction judgment</p> <p>Select the cutting direction when the longitudinal rough cutting cycle (G71), face rough cutting cycle (G72) or closed loop cutting cycle (G73) is commanded.</p> <p>0: Conventional specification Determined according to the finished shape program.</p> <p>1: Extended specifications Determined according to the finishing allowance and cutting allowance commanded in the program.</p> <p>bit3: Facing turret mirror image coordinate value type</p> <p>Select how to show the workpiece coordinate values of the axis for which the facing turret mirror image is valid.</p> <p>0: Movements in the workpiece coordinate system are in the same direction as those in the workpiece machine coordinate system.</p> <p>1: Movements in the workpiece coordinate system are in the opposite direction to those in the workpiece machine coordinate system.</p> <p>bit4: Facing turret mirror image valid axis selection</p> <p>Select the axis for which the facing turret mirror image is valid.</p> <p>0: Fixed to 1st axis.</p> <p>1: Determined according to the plane selected when the facing turret mirror image is commanded.</p>

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1274	ext10
		<p>bit0: Decimal point command valid address</p> <p>Select the designation of the addresses which enable decimal point commands.</p> <p>0: Follows the standard specifications</p> <p>1: Whether to enable or not depends on each address (not on the function)</p> <p><L system></p> <p>Valid address: X, Y, Z, U, V, W, A, B, C, E, F, G, H, I, J, K, R</p> <p>Invalid address: D, L, M, N, O, P, Q, S, T</p> <p><M system></p> <p>Valid address: X, Y, Z, U, V, W, A, B, C, F, G, I, J, K, Q, R</p> <p>Invalid address: D, E, H, L, M, N, O, P, S, T</p> <p>bit2: M98 sequence No. address selection</p> <p>Select which address to use for calling a sequence No. in a sub program under sub program control (M98/M198).</p> <p>0: Address H is used for specifying the sequence No.</p> <p>1: Address Q is used for specifying the sequence No.</p> <p>bit3: Tool offset number H stand-alone command (for M system only)</p> <p>Select the command format of the compensation No. for tool length compensation (for M system).</p> <p>This setting also switches how to read the tool length compensation No. H by variable.</p> <p>0: Disable single command of tool length compensation No. H.</p> <p>Variable of tool length compensation No. H can be read only during G43/G44 modal. It is fixed to 0 in other situations.</p> <p>1: Enable single command of tool length compensation No. H.</p> <p>Variable of tool length compensation No. H can be read regardless of G43/G44 modal.</p> <p>bit4: Optional block skip operation changeover</p> <p>Select the optional block skip operation.</p> <p>0: Enable or disable optional block skipping in the middle of a block according to the setting of "#1226 aux10/bit1".</p> <p>1: Enable optional block skipping at the top and in the middle of a block.</p> <p>Note that a slash "/" on the right-hand side of equation or that in an equation between [] is handled as division operator.</p> <p>bit5: Use of G54Pn for selecting extended workpiece coordinate system</p> <p>Select whether to use G54Pn as a command for selecting an extended workpiece coordinate system.</p> <p>0: Not use G54Pn as a command for selecting an extended workpiece coordinate system</p> <p>1: Use G54Pn as a command for selecting an extended workpiece coordinate system</p> <p>When 1 is set in this parameter, G54Pn is treated in the same manner as G54.1Pn.</p> <p>bit7: Word range check</p> <p>Select whether to check that the operation expression of the word data in the program is enclosed in brackets [] when the machine program is executed.</p> <p>This check is also applied to the 08000 to 09999 and the machine tool builder macro program.</p> <p>0: Not check</p> <p>1: Check</p>
(PR)	#1275	ext11
		Not used. Set to "0".
(PR)	#1276	ext12
		Not used. Set to "0".

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1277	ext13
		<p>bit0: Tool life management II count type 2 (default: 0)</p> <p>Select how and when cumulative number of mountings or cuttings will be incremented in tool life management II. The condition to output "tool group life over (TGLO)" signal will be changed accordingly.</p> <p>0: Type 1 (default) Counts up when the spindle tool is used for cutting. TGLO signal will be output when the last tool in selected group is judged as expired.</p> <p>1: Type 2 Counts up by one for a tool used or mounted in a program at the time of resetting. TGLO signal will be output when any of tool groups has reached its lifetime limit.</p> <p>bit1: Tool life management II life prediction</p> <p>Select whether to enable tool life prediction function in tool life management II.</p> <p>0: Disabled 1: Enabled</p> <p>bit2: Tool life management II life end signal timing</p> <p>Select the timing in which tool life prediction signal is output in tool life management II.</p> <p>0: Output only when the ["tool life data" - "tool usage data"] matches the remaining tool life prediction setting. 1: Output when the ["tool life data" - "tool usage data"] is less than the remaining tool life prediction setting.</p> <p>bit3: Tool life management II life end signal tool</p> <p>Select the tool for which the tool life prediction signal is output in tool life management II.</p> <p>0: Output the signal tool by tool. 1: Output the signal at the last tool in the group.</p> <p>bit4: Tool life management II count changeover (For M system only)</p> <p>Select the tool life count method and its timing.</p> <p>0: Conforms to "#1227 ext13/bit0" setting. 1: When "#1227 ext13/bit0" is set to "0": Counts up by one for a tool used or mounted in a program at the time of resetting. When "#1227 ext13/bit0" is set to "1": Follow the setting of "Method (Mthd)" on Tool life screen.</p> <p>The output condition of "tool group life over" signal conforms to "#1227 ext13/bit0".</p>

(PR)	#1278	ext14
		<p>bit0: Program restart method selection</p> <p>Select the program restart type.</p> <p>0: Restart type A</p> <p>1: Restart type B</p> <p>bit1: Change miscellaneous command completion method</p> <p>Select the complete signal and completion condition.</p> <p>0: Normal method Complete at the falling edge of M function finish 1 signal (FIN1) or rising edge of M function finish 2 (FIN2).</p> <p>1: High-speed method Complete when High-speed M finish signal (MFIN1 to 4, SFIN1 to 6, TFIN1 to 4 or BFIN1 to 4) reaches the same logical level as the strobe signal.</p> <p>bit2: Change areas for stored stroke limit I</p> <p>Enable/Disable change of the areas for stored stroke limit I.</p> <p>0: Disable</p> <p>1: Enable</p> <p>bit3: Select M30 rewinding operation</p> <p>Select the operation when the miscellaneous function completed signal (FIN) is returned to M30.</p> <p>0: Not carry out automatic rewinding</p> <p>1: Carry out automatic rewinding</p> <p>bit4: Select M02 rewinding operation</p> <p>Select the operation when the miscellaneous function completed signal (FIN) is returned to M02.</p> <p>0: Not carry out automatic rewinding</p> <p>1: Carry out automatic rewinding</p> <p>bit5: M code output during high-speed simple program check</p> <p>Select whether to enable M code output during high-speed simple program check. The M codes to be output are those specified by "#1451 M[M031-000](SMLK)" to "#1466 M[M511-480](SMLK)".</p> <p>0: Disable</p> <p>1: Enable</p> <p>bit7: Operation for circular radius error at perfect circle command</p> <p>Select the operation to be performed when a perfect circle command is given and there is a difference between the start point and end point radii, but no difference between the start point and end point angles.</p> <p>0: Linear interpolation from the start to the end point</p> <p>1: Spiral interpolation from the start to the end point</p>

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1279	ext15
		<p>bit0: Part system synchronization method</p> <p>Select the part system synchronization method.</p> <p>0: If one part system is not in the automatic operation, the synchronization command will be ignored and the next block will be executed.</p> <p>1: Operate according to the "waiting ignore" signal. If the "waiting ignore" signal is set to "1", the synchronization command will be ignored. When set to "0", synchronization will be applied.</p> <p>bit1: Interrupt amount during machine lock</p> <p>Select when to cancel the interruption amount during machine lock.</p> <p>0: Canceled when resetting</p> <p>1: Canceled during manual reference position return (not when resetting)</p> <p>bit2: Selection of cutting start interlock target block</p> <p>Select whether to enable the cutting start interlock for successive cutting blocks.</p> <p>0: Enable</p> <p>1: Disable</p> <p>bit4: Dry run OFF during thread cutting</p> <p>Select whether to enable or disable dry run during thread cutting.</p> <p>0: Enable dry run</p> <p>1: Disable dry run</p> <p>bit5: Cancel G92 shift distance</p> <p>Select whether to clear the G92 (coordinate system setting) shift distance when the manual reference position is reached.</p> <p>0: Not clear</p> <p>1: Clear</p> <p>bit6: Enable single block stop at middle point</p> <p>Set whether to enable/disable single block stop at the middle point of G28/G29/G30.</p> <p>0: Disable single block stop</p> <p>1: Enable single block stop</p> <p>bit7: Retain G52 at manual reference position return</p> <p>Select whether to retain the local coordinate system setting (G52) at the time of manual reference position arrival. This parameter is enabled when #1279 ext15/bit5 is 1.</p> <p>0: Not retain (Cancel)</p> <p>1: Retain</p>

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1280	ext16
		<p>bit0: I/F per axis during mixed control (cross axis control)</p> <p>Select how to handle the following PLC interface for axes interchanged with the mixed control (cross axis control).</p> <ul style="list-style-type: none"> - Mirror image - Manual/automatic interlock - Manual/automatic machine lock <p>0: Follows axis configuration before the mixed control (cross axis control).</p> <p>1: Follows axis configuration after the mixed control (cross axis control).</p> <p>(Example)</p> <p>The device No. of automatic interlock (+) for X1 will be as follows when the mixed control (cross axis control) is executed with the 1st axis (X1) in the 1st part system and 1st axis (X2) in the 2nd part system.</p> <p>When "0" is set: YA60 (interface for 1st axis in 1st part system)</p> <p>When "1" is set: YA68 (interface for 1st axis in 2nd part system)</p> <p>(Note) If the number of axes in the part system changes with the mixed control (cross axis control), the interface of the target axis may change when this parameter is set to "1".</p> <p>bit1: Mixed control (cross axis control) cancel with reset</p> <p>Select whether to cancel the mixed control (cross axis control) when reset is applied.</p> <p>0: Cancel.</p> <p>1: Not cancel.</p> <p>bit2: Interchange coordinate position display</p> <p>Select whether to display interchanged (or moved) coordinate positions in the mixed control (cross axis control).</p> <p>This setting will be followed not only when the axes are interchanged but also when the axes are moved.</p> <p>0: Display interchanged (or moved) coordinate positions.</p> <p>1: Display coordinate positions without being interchanged (nor moved).</p> <p>(Example)</p> <p>When 1st part system's C axis is moved to 2nd part system with a 1st part system (X, Z, C, Y) and 2nd part system (X, Z) configuration:</p> <p>1st part system: X, Z and Y coordinate positions are displayed.</p> <p>2nd part system: X, Z and C coordinate positions are displayed.</p> <p>bit3: Reset operation for synchronization/superimposition control</p> <p>Select whether to cancel synchronization/superimposition control when reset is applied.</p> <p>0: Cancel.</p> <p>1: Not cancel.</p> <p>bit4: Mixed control (cross axis control) command method</p> <p>Select how to command mixed control (cross axis control).</p> <p>0: Use PLC interface signal for mixed control</p> <p>1: Use G command for mixed control</p> <p>bit5: Command method of control axis synchronization between part systems</p> <p>Select how to command the control axis synchronization between part systems.</p> <p>0: Use PLC I/F.</p> <p>1: Use G command.</p> <p>bit6: Interchange machine position display</p> <p>Select whether to display interchanged (or moved) machine positions in the mixed control (cross axis control).</p> <p>This setting will be followed not only when the axes are interchanged but also when the axes are moved.</p> <p>(Note 1) This parameter is enabled when "#1280 ext16/bit2 (Interchange coordinate position display)" is "0".</p> <p>0: Display interchanged (or moved) machine positions.</p> <p>1: Display machine positions without being interchanged (nor moved).</p>

15 Machine Parameters

15.3 Base Common Parameters

bit7: Control axis superimposition command method

Select how to command control axis superimposition.

- 0: Use PLC interface signal for control axis superimposition
- 1: Use G command for control axis superimposition

(PR)	#1281	ext17
------	-------	-------

bit0: Switch manual high-speed reference position return in synchronous control

Select the movement of synchronized axes in manual high-speed reference position return.

- 0: Master and slave axes start the return synchronizing. Even when one axis stops at its reference position, the other axis continues moving until it reaches its reference position.
- 1: Master and slave axes start the return synchronizing, and when the master axis stops at the reference position, the slave axis also stops. Thus, the relative position of the master and slave is kept.

bit1: Selection of additional tool offset axis (for L system only)

Select axis to carry out the additional axis' tool compensation function.

- 0: Follow the setting of "#1520 Tch34".
- 1: The axis specified by "#1027 base_J" is used as the 3rd compensation axis.

bit3: Synchronous control operation setting

Select whether or not the positioning of slave axis automatically aligns with that of master axis when the axis subject to synchronous control is changed from servo OFF to servo ON.

- 0: The positioning does not automatically align.
- 1: The positioning automatically aligns.

bit5: High-speed synchronous tapping valid

Select whether to enable the high-speed synchronous tapping.

- 0: Disable
- 1: Enable

bit6: Compensation method for external machine coordinate system/ball screw thermal expansion during synchronization

Select the method of how to compensate the slave axis when compensating external machine coordinate system or ball screw thermal expansion during synchronization control. The setting of this parameter will be validated when you select synchronous operation method by the synchronization control operation method signal.

- 0: Master axis and slave axis are independently compensated.
- 1: Master axis' compensation amount is applied to slave axis.

bit7: Switch automatic high-speed reference position return in synchronous control

Select the movement of synchronized axes in automatic high-speed reference position return.

- 0: Master and slave axes start the return synchronizing, and when the master axis stops at the reference position, the slave also stops. Thus, the relative position of the master and slave is kept.
- 1: Master and slave axes start the return synchronizing. Even when one axis stops at its reference position, the other axis continues moving until it reaches its reference position.

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1282	ext18
		<p>bit1: Condition of the reference position reached signal in synchronous control</p> <p>This parameter switches only conditions of a master axis's reference position return reached signal in synchronous operation. A slave axis's signal is output when the slave axis reaches the reference position coordinate.</p> <p>0: A master axis's reference position reached signal is output only when both of the master and slave axes reach the reference position coordinate by a reference position return.</p> <p>1: A master axis's reference position reached signal is output when the master axis reaches the reference position coordinate.</p> <p>bit3: Index table clamp type</p> <p>Set the clamp type of the index table.</p> <p>0: Type A Clamped when an unclamp command turns OFF.</p> <p>1: Type B Clamped when a clamp command turns ON.</p> <p>bit5: Automatic correction of synchronization offset at power ON</p> <p>The slave axis position is automatically corrected so that the synchronization offset before having turned the power OFF the last time can be restored at power ON.</p> <p>(Note) This parameter is enabled when the parameter "#1281 ext17/bit3" (Synchronous control operation setting) is set to "1".</p> <p>0: Disable 1: Enable</p> <p>bit6: Reset type at emergency stop cancel</p> <p>Select the type of reset to be applied when emergency stop is cancelled.</p> <p>0: Reset 1 1: Reset 2</p> <p>bit7: Functional operation inhibition during write of servo parameters</p> <p>Select whether to inhibit functional operation during write of servo parameters.</p> <p>0: Inhibit functional operation with an alarm displayed 1: Give priority to functional operation with write of servo parameters suspended</p> <p>(Note) This parameter can inhibit a start of the following four functions.</p> <ul style="list-style-type: none"> •Spindle/C axis changeover •Speed observation mode signal ON •High-speed synchronous tapping •Start of PLC indexing axis
(PR)	#1283	ext19
		Not used. Set to "0".

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1284	ext20
	bit0: Spindle speed clamp check	
	Select whether to check the spindle speed clamp under the constant surface speed control.	
	0: Check the spindle speed clamp.	
	1: Not check the spindle speed clamp.	
	(Note) This parameter is enabled when the parameter "#1146 Sclamp" is set to "1".	
	bit1: Spindle control selected in response to Z83 (NC started during SP rotation)	
	Select whether to force-stop the spindle when the alarm (Z83 0001) occurs.	
	0: Not force-stop the spindle	
	1: Force-stop the spindle	
	bit2: Manual tool length measure 1: work coordinate system offset (for L sys only)	
	Select the operation to be performed in manual tool length measurement 1 (for L system) when the workpiece coordinate system offset is used for the measurement reference point.	
	0: Workpiece coordinate system offset in measurement is used for the measurement reference point. If measurement is carried out during automatic cycle operation, the external workpiece coordinate offset, G92 offset, local coordinate offset, workpiece coordinate system shift and workpiece base point offset are all included in the workpiece coordinate system offset.	
	1: Setting values of workpiece coordinate system offset, external workpiece coordinate system offset, workpiece coordinate shift and workpiece base point offset are used for the measurement reference point. G92 offset and local coordinate offset are excluded.	
	bit3: M code output during multi-system simultaneous simulation (Check type II)	
	Select whether to enable a miscellaneous function code output during execution of multi-part system simultaneous simulation (Check type II).	
	0: Not output a miscellaneous function	
	1: Output a miscellaneous function	
	(Note) When the output is enabled, the miscellaneous codes specified in "#1406 S_mode(SMLK)", "#1407 T_mode(SMLK)", "#1408 M2_mode(SMLK)" and "#1451 M[M031-000](SMLK)" to "#1466 M[M511-480](SMLK)" can be output. M code output specification is determined by "#1405 M_mode(SMLK)".	
	bit4: Maximum life time/life count for tool life management I (for L system only)	
	Select the maximum life time and life count for tool life management I of L system.	
	0: Life time 0 to 99:59 (h:min) Life count 0 to 65000 (times)	
	1: Life time 0 to 5000:00 (h:min) Life count 0 to 99999999 (times)	
	bit6: Automatic operation handle interruption during inclined surface machining	
	Select whether to enable the automatic operation handle interruption function during inclined surface machining.	
	0: Disable	
	1: Enable	

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1285	ext21
		<p>bit0: Multi-part system program management</p> <p>Select whether to use multi-part system program management.</p> <p>0: Not use</p> <p>1: Use</p> <p>(Note) When this parameter's value is changed, the power must be turned OFF and ON, and the system formatted. Two or more part systems from [1] to [4] need to be set to "1" in "#1001 SYS_ON". Otherwise this parameter will be disabled even though set to "1".</p> <p>bit1: Switching of program search type</p> <p>Select the type of search to be performed when Operation search, Check search or Restart search is executed in the NC memory/NC memory2 while the multi-part system program management is active.</p> <p>0: Search through a program individually for each part system</p> <p>1: Search through a program for all part systems at once (Program number will be common to all part systems.)</p> <p>bit2: Multi-part system program generation and operation</p> <p>Select whether to perform the following processes for all the part systems or for each part system separately in multi-part system program management: newly create, delete or rename the machining programs in NC memory/NC memory2 or transfer, compare, merge the programs between NC memory/NC memory2 and other device.</p> <p>0: Perform these processes for the programs in all the part systems. If no subprogram contents are found by the subprogram call during automatic operation, the program will be searched for and executed from \$1.</p> <p>1: Perform these processes for the programs in the selected part system.</p>
(PR)	#1286	ext22
		<p>bit5: Selection of multi-part system program input/output method</p> <p>Select whether to perform the transfer from NC memory/NC memory2 to other device for all the part systems or for each part system separately in multi-part system program management.</p> <p>0: Output the designated programs for all the part systems. (The programs output from NC memory/NC memory2 contain the system delimiter \$ marks.)</p> <p>1: Output the programs of only the selected part system.</p>

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1287	ext23
		<p>bit1: Inclined surface coordinate display</p> <p>0: Display the position which includes tool length offset.</p> <p>1: Display the position on the program which excludes tool length offset.</p> <p>bit2: Inclined surface coordinate display (for M system only)</p> <p>0: Display the position which includes tool radius compensation.</p> <p>1: Display the position on the program which excludes tool radius compensation.</p> <p>bit4: Relative coordinate display</p> <p>(M system)</p> <p>0: Display the position which includes tool length offset.</p> <p>1: Display the position on the program which excludes tool length offset.</p> <p>(L system)</p> <p>0: Display the position which includes tool shape compensation.</p> <p>1: Display the position on the program which excludes tool shape compensation.</p> <p>bit5: Relative coordinate display</p> <p>(M system)</p> <p>0: Display the position which includes tool radius compensation.</p> <p>1: Display the position on the program which excludes tool radius compensation.</p> <p>(L system)</p> <p>0: Display the position which includes nose R compensation.</p> <p>1: Display the position on the program which excludes nose R compensation.</p> <p>bit6: Absolute coordinate display (for L system only)</p> <p>Select how coordinate values are displayed when absolute coordinate display is selected ("#1221 aux05/bit0"="1").</p> <p>0: Display the position which includes tool shape compensation.</p> <p>1: Display the position on the program which excludes tool shape compensation.</p> <p>bit7: Absolute coordinate display (for L system only)</p> <p>Select how coordinate values are displayed when absolute coordinate display is selected ("#1221 aux05/bit0"="1").</p> <p>0: Display the position which includes nose R compensation.</p> <p>1: Display the position on the program which excludes nose R compensation.</p>

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1288	ext24
		<p>bit0: MDI program clear</p> <p>Select whether to clear the MDI programs when MDI operation ends, the power is turned ON again, reset is input, or emergency stop is canceled.</p> <p>0: Not clear</p> <p>1: Clear (save only % programs).</p> <p>bit2: Restore previous program before external search by NC reset</p> <p>Select whether to restore the previous program before external search when operation is finished, power is turned OFF and ON, NC reset is input or Emergency stop is cancelled.</p> <p>0: Not restore the previous program before external search</p> <p>1: Restore the previous program before external search</p> <p>bit3: Restore previous program before external search by Program restore signal</p> <p>Select whether to restore the previous program before external search when Program restore signal is input.</p> <p>0: Not restore the previous program before external search</p> <p>1: Restore the previous program before external search</p> <p>bit7: Behavior of position counter at change in workpiece coordinate system offset</p> <p>When a change is made to the workpiece coordinate system offset, extended workpiece coordinate system offset, external workpiece coordinate system offset, workpiece coordinate system shift or workpiece base point offset being selected, the position counter will be updated in accordance with the setting of this parameter.</p> <p>The specified behavior applies to the following counters:</p> <ul style="list-style-type: none"> •Workpiece coordinate position •Program position •Tip workpiece position (*1) •Table coordinate position (*1) •Workpiece set position (*1) •Inclined surface coordinate position (*1) <p>(*1) These counters are displayed when an optional function associated with 5-axis control is active.</p> <p>0: The counter is updated when any of the following actions takes place after the change.</p> <ul style="list-style-type: none"> •Cycle start •Reset •Emergency stop <p>1: The counter is updated immediately upon the change.</p>
(PR)	#1289	ext25
		<p>bit0: Tool radius compensation switch corner judgment method (nose R compen.)</p> <p>Select the criterion to execute the outer rounding at the small corner in tool radius compensation.</p> <p>(L system)</p> <p>0: The corner angle is 0°; linear-linear; G02-G03/G03-G02; the radius is the same. (Conventional method)</p> <p>1: The corner angle is 1° or smaller; linear-linear; G02-G03/G03-G02; the radius is almost the same. (Method for rounding minute corner angle)</p> <p>(M system)</p> <p>0: The corner angle is 1° or smaller; linear-linear; G02-G03/G03-G02. (Conventional method)</p> <p>1: The corner angle is 1° or smaller; linear-linear; G02-G03/G03-G02; the radius is almost the same. (Method for rounding minute corner angle)</p>
(PR)	#1290	ext26
		Not used. Set to "0".
(PR)	#1291	ext27
		<p>bit2: Variable command: Reset operation for tool function T code (#4120/#4320)</p> <p>Select how reset operation affects the address T's modal information (#4120/#4320).</p> <p>0: Clear the information</p> <p>1: Retain the information</p>

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1292	ext28
		<p>bit1: Address F given in sync tap cycle</p> <p>Select the specification of address F given in synchronous tapping cycle.</p> <p>0: The value given to address F in synchronous tapping cycle is treated as the feed rate. Feed command follows the setting of "#1268 ext04/bit2 Enable synchronous tapping per minute". F modal status is unchanged.</p> <p>1: Follow the G code group 5 modal status, irrespective of the setting of "#1268 ext04/bit2 Enable synchronous tapping per minute". The F modal value given in the program is treated as the feed rate.</p> <p>bit3: Operation at changing tool length compensation amount (M system only)</p> <p>Select a compensation operation when changing the tool length compensation amount at returning from a temporary cancel of G53, G28, G30, G30.1 tool length compensation or during tool length compensation (G43/G44).</p> <p>0: Compensation starts from a travel command to the compensation target axis</p> <p>1: Compensation starts from the next block</p> <p>bit5: Selection of sub program call operation in fixed cycle mode</p> <p>Select the operation to be carried out when sub program call (M98/M198) and either an axis address or address R (for hole drilling cycle) are given in one block during fixed cycle for drilling or turning machining.</p> <p>0: Not execute fixed cycle operation in the sub program call block. Sub program call is executed after travelling to the position specified by the axis address in modal status of G code group 01. Neither the axis address nor address R affects the subsequent fixed cycle operation.</p> <p>1: Execute fixed cycle operation in the sub program call block before executing the sub program call. The axis address or address R is treated as the fixed cycle argument.</p>
(PR)	#1293	ext29
		<p>bit0: Synchronous feed in milling</p> <p>Select whether to enable synchronous feed in milling interpolation, cylindrical interpolation or polar coordinate interpolation mode.</p> <p>0: Disable</p> <p>1: Enable</p> <p>bit1: Enabling N0 command</p> <p>Select how to handle a command of sequence number zero (N0).</p> <p>0: N0 causes an error.</p> <p>1: N0 is ignored (causes no error).</p> <p>bit7: Compensation at T length offset change in machine coord sys (G53) (M sys only)</p> <p>Select the compensation operation to be performed when tool length offset is temporarily cancelled in the G53 block.</p> <p>0: Not start compensation</p> <p>1: If no command is given to the compensation target axis, the compensation starts with the coordinate shift type. If the said command is present, the following operation is performed:</p> <ul style="list-style-type: none"> - For absolute command (e.g. G90G53Z10.): retain temporary cancel without starting compensation, and move to the command position. - For incremental command (e.g. G91G53Z10.): start compensation with the coordinate shift type, and move by the incremental command value. <p>(Note) This parameter is enabled when "#1292 ext28/bit3" is "1".</p>
(PR)	#1294	ext30
		Not used. Set to "0".

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1295	ext31
		<p>bit5: Timing of tool offset amount change (For L system only)</p> <p>This parameter is only valid if "#1100 Tmove" = 1.</p> <p>This parameter switches the timing of the change in the tool length offset amount or the wear offset amount when the currently selected amount is modified.</p> <p>0: The new offset amount is applied when the T command is executed.</p> <p>1: The new offset amount is applied when the movement command is read to the pre-read buffer.</p> <p>bit6: Analog spindle synchronous tapping ON</p> <p>Select whether to enable analog spindle synchronous tapping.</p> <p>0: Disable</p> <p>1: Enable</p> <p>bit7: Synchronous tapping with analog I/F spindle: control switching method</p> <p>This parameter specifies the control method for the synchronous tapping with analog I/F spindle function.</p> <p>0: Not use the feedback from the encoder</p> <p>1: The rotation speed command is compensated in accordance with the difference between the command position and the actual position of the analog I/F spindle.</p>
(PR)	#1296	ext32
		<p>bit4: Behavior at the start of tool compensation (for L system only)</p> <p>Select the behavior to be executed at the start of tool compensation.</p> <p>The parameter is enabled when "#1100 Tmove" is "0".</p> <p>0: Move the axis by the offset amount</p> <p>1: Reflect the offset in the programmed position without axis travel</p> <p>bit5: Subprogram calling/return block operation switching</p> <p>Select whether the subprogram call block is interpreted as an executable statement or as a macro statement. When macro statement is selected, the block is batch processed with the adjacent macro statements.</p> <p>This parameter changes the behavior at M98, M198, M99, G65 or G66.1 command.</p> <p>0: Executable statement</p> <p>1: Macro statement</p>
(PR)	#1297	ext33
		<p>bit0: Enable omission of address P for spindle selection</p> <p>Select the behavior when address P is omitted from S command block under Multiple-spindle control I.</p> <p>0: The program error "P135 Spindle select command illegal" is generated.</p> <p>1: The S command value is applied for the last spindle selected by address P.</p> <p>If spindle selection by address P has never been made after power ON, the value of "#12087 I_spCode" applies.</p> <p>(Note) This parameter is valid when "#1300 ext36/bit4" is specified to "1" (Spindle selection by address P is valid).</p> <p>bit1: Automatic change of feedback when spindle is selected by address P</p> <p>Select the behavior of encoder selection when spindle is selected by address P under Multiple-spindle control I.</p> <p>0: Automatically switched to the spindle selected by address P</p> <p>1: Determined by the "Encoder selection (R2567)" signal</p> <p>(Note) This parameter is valid when "#1300 ext36/bit4" is specified to "1" (Spindle selection by address P is valid).</p> <p>bit2: Specify a spindle with address P after address M</p> <p>This parameter is used to specify whether or not the address "P" can be used to specify a spindle after M3, M4 or M5 in an "M_P_" format block in Multiple-spindle Control I.</p> <p>0: Address "P" cannot be used in combination with address "M" to specify a spindle.</p> <p>1: Address "P" can be used in combination with address "M" to specify a spindle. (The format is "M_P_;".)</p> <p>(Note) This parameter is valid when "#1300 ext36/bit4" is set to "1".</p>
(PR)	#1298	ext34
		Not used. Set to "0".

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1299	ext35	
Not used. Set to "0".			
(PR)	#1300	ext36	
bit0: Multiple spindle control II			
Select multiple spindle control I or II.			
0: Multiple spindle control I (L system only)			
1: Multiple spindle control II (select from ladder)			
bit1: Spindle control for each part system			
Select whether to set spindle control command (S code/G96/G92) to be common in the part systems or to be separated by each part system when multiple spindle control II is enabled (#1300 ext36/bit0 = 1).			
0: Common in the part systems			
1: Separated by each part system			
bit2: Part system-based spindle clamp speed management			
Select how to manage the spindle clamp speed data.			
0: Manage the data of all part systems collectively			
1: Manage the data of each part system individually			
bit3: Spindle command rotation speed input timing selection			
When multiple-spindle control II is enabled (#1300 ext36/bit0 = 1), switch the timing to update the spindle command rotation speed input when performing the spindle selection(SWS) or spindle command selection(SLSP) with M command given in the same block as S command.			
0: S command updates the spindle command rotation speed input for the spindle which is before the selection by the spindle selection(SWS) or spindle command selection(SLSP).			
1: S command updates the spindle command rotation speed input for the spindle which is after the selection by the spindle selection(SWS) or spindle command selection(SLSP).			
bit4: Enable/disable spindle selection by Address P			
Switch the command method of spindle selection for Multi-spindle control 1 to the spindle selection by address P.			
0: Select the spindle by G code or Sx=***** command. (Spindle selection by address P is invalid)			
1: Select the spindle by address P issued along with S command. (Spindle selection by G code and Sx=***** command is invalid)			
(Note) This parameter is valid when "#1300 ext36/bit0" is specified to "0" (Multi-spindle control 1).			
bit7: Spindle synchronization command method			
Select the spindle synchronization command method.			
0: Spindle synchronization with PLC I/F			
1: Spindle synchronization with machining program			
	#1301	nrfchk	Near reference position check method
Select the high-speed check method of the origin neighboring signal.			
0: Do not check positions near the origin at high speeds. (Conventional specifications)			
1: Check positions near the origin at high speeds using command machine positions.			
2: Check positions near the origin at high speeds using encoder feedback positions.			
	#1302	AutoRP	Automatic return by program restart
Select the method to move to the restart position when restarting the program.			
0: Move the system to the restart position manually.			
1: For program restarting, the first activation automatically moves the system to the restart position.			
(PR)	#1303	V1comN	No. of #100 address part system common variables
Set the number of common variables, common for part systems, starting from address #100.			
This is valid only when "#1052 MemVal" is set to "1".			
---Setting range---			
0 to 100			

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1304	V0comN	No. of #500 address part system common variables
		Set the number of common variables, common for part systems, starting from address #500. This is valid only when "#1052 MemVal" is set to "1". ---Setting range--- 0 to 500	
	#1306	InpsTyp	Deceleration check specification type
		Select the parameter specification type for the G0 or G1 deceleration check. 0: Deceleration check specification type 1 G0 is specified with "#1193 inpos", and G1+G9 with "#1223 aux07/bit1". 1: Deceleration check specification type 2 G0 or G1+G9 is specified with "#1193 inpos".	
(PR)	#1307	G0acc_plc	PLC axis G00 constant-gradient acceleration/deceleration valid
		Set a type of acceleration/deceleration for the rapid traverse command. 0: Constant-time acceleration/deceleration (conventional method) 1: Constant-gradient acceleration/deceleration	
(PR)	#1308	G1acc_plc	PLC axis G01 constant-gradient acceleration/deceleration valid
		Select the type of acceleration/deceleration for a cutting feed command. 0: Constant-time acceleration/deceleration (conventional method) 1: Constant-gradient acceleration/deceleration	
(PR)	#1309	GType	Switch command format
		Select which is used to command the reverse tap. 0: G84.1/G88.1 1: D command with the value changed to negative	
	#1310	WtMmin	Minimum value for synchronization M code
		Set the minimum value for the M code. When "0" is set, the synchronization M code will be invalid. ---Setting range--- 0, 100 to 99999999	
	#1311	WtMmax	Maximum value for synchronization M code
		Set the maximum value for the M code. When "0" is set, the synchronization M code will be invalid. ---Setting range--- 0, 100 to 99999999	
	#1312	T_base	Tool life management standard number
		Set the standard No. for the tool life management. When the value specified by the T code command exceeds the set value in this parameter, the set value will be subtracted from the command value, which will be used as tool group No. for tool life management. When the value specified by the T code command is equal to or less than the set value, the T code will be handled as a normal T code and not subjected to tool life management. When "0" is set in this parameter, the T code command will always specify a group No. (Valid for M-system tool life management II.) ---Setting range--- 0 to 9999	
	#1313	TapDw1	Synchronous tap hole bottom wait time
		Set the hole bottom wait time for synchronous tapping. When P address is specified, the greater value will be used as the hole bottom wait time. When an in-position check is performed at the hole bottom, the wait time will be provided after the completion of the in-position check. (Note) This parameter is valid only when "1" is set in "#1223 aux07/bit3" (synchronous tap in-position check improvement) and "#1223 aux07/bit4" (synchronous tap hole bottom in-position check). ---Setting range--- 0 to 999 (ms)	

15 Machine Parameters

15.3 Base Common Parameters

	#1314	TapInp	Synchronous tap in-position check width (tap axis)
			<p>Set the hole bottom in-position check width for synchronous tapping.</p> <p>(Note) This parameter is valid only when "1" is set in "#1223 aux07/bit3" (synchronous tap in-position check improvement) and "#1223 aux07/bit4" (synchronous tap hole bottom in-position check).</p> <p>---Setting range---</p> <p>0.000 to 99.999</p>
	#1315	RcmpBlk	Maximum number of pre-read blocks for Tool radius compensation
			<p>Specify the maximum number of pre-read blocks for Tool radius compensation.</p> <p>(Note) When "0" or a value out of the setting range is set, the maximum number of pre-read blocks is "4".</p> <p>---Setting range---</p> <p>0, 2 to 4</p>
(PR)	#1316	CrossCom	Reference of common variables common for part systems
			<p>Select whether to use the common variables from #100100 to #800199.</p> <p>0: Not use</p> <p>1: Use</p> <p>This parameter is valid only when the number of variable sets is set to 600 or more.</p> <p>When this parameter is set to "1", variables from #100100 to #100110 will not be available as the system variables for PLC data read function, and the setting of "#1052 MemVal" will be invalid.</p>
(PR)	#1318	MacVcom	Machine tool builder macro variables for each part system
			<p>In a multi-part system configuration, select whether to use the machine tool builder macro variables (#450 to #499, #80000 to #80049 and #80500 to #80649) in common to all part systems or individually for each part system.</p> <p>0: #450 to #499, #80000 to #80049 and #80500 to #80649 are used in common.</p> <p>1: #450 to #499 are used in common to part systems. #80000 to #80049 and #80500 to #80649 are individual for each part system.</p> <p>2: #450 to #499 are individual for each part system. #80000 to #80049 and #80500 to #80649 are common to part systems.</p> <p>3: #450 to #499, #80000 to #80049 and #80500 to #80649 are used individually for each part system.</p>
	#1319	Grp24_mdrst_off	G group 24 modal retention reset OFF
			<p>Select whether or not to retain the G group 24 modal state (G188/G189) after modal retention reset.</p> <p>0: Not initialize the G group 24 modal state even when you turn OFF the program format change request signal (PFCHR) and press Cycle Start.</p> <p>1: Determine the G group 24 modal state according to the program format change request signal (PFCHR) when Cycle Start is pressed.</p>
(PR)	#1324	chop_R	Chopping compensation value fixing method
			<p>Set the head No. of the R register used as the compensation amount save area during fixed compensation amount method.</p> <p>When the first number is an odd number, the operation message "Setting error" appears.</p> <p>When the value overlaps with the chopping control data area, the operation message "Setting error" appears.</p> <p>---Setting range---</p> <p>8300 to 9782</p> <p>(Only the even number)</p> <p>(Within backup area)</p>
(PR)	#1326	PLC Const Ext. Num	PLC constant extension number
			<p>Set the number of PLC constant extension points.</p> <p>---Setting range---</p> <p>0 to 750</p>

15 Machine Parameters

15.3 Base Common Parameters

	#1327	3D ATC type	Tool change method specification
			<p>Select the tool change method for determining the tool to draw solids.</p> <p>With 3D drawing, the tool will be changed by the method designated with this parameter, and then the image will be drawn.</p> <p>0: With one standby tool 1: With two standby tools 2: With no standby tool</p>
	#1328	TLM type	Reference position for tool measurement
			<p>Select the reference position for tool measurement.</p> <p>0: The machine position at the time when TLM is turned ON 1: The machine zero point</p>
	#1329	Emgcnt	Emergency stop contactor shut-off time
			<p>Set the time taken for the drive section's main power to be shut-off when the confirmation of all the axes' stop failed after the emergency stop state.</p> <p>The contactor shut-off signal is output as soon as all the axes are confirmed stopped if the confirmation is done prior to the set time.</p> <p>When there is no safety observation option or "0" is set, the shut-off time will be 30 (s).</p> <p>---Setting range---</p> <p>0 to 60 (s)</p>
(PR)	#1330	MC_dp1	Contactor weld detection device 1
			<p>When safety observation is executed, set the remote I/O device to input the contactor's auxiliary b contact signal used for the contactor weld detection.</p> <p>If "0" is set, weld detection will not be executed.</p> <p>Thus, "X0" cannot be used as contactor weld detection device.</p> <p>---Setting range---</p> <p>0000 to 03FF (hexadecimal)</p>
(PR)	#1331	MC_dp2	Contactor weld detection device 2
			<p>When safety observation is executed, set the remote I/O device to input the contactor's auxiliary b contact signal used for the contactor weld detection.</p> <p>If "0" is set, weld detection will not be executed.</p> <p>Thus, "X0" cannot be used as contactor weld detection device.</p> <p>---Setting range---</p> <p>0000 to 03FF (hexadecimal)</p>
(PR)	#1332	F-bus init delay	Fieldbus communication error invalid time
			<p>Specify a period of time during which the control does not detect a Fieldbus communication error of the Fieldbus expansion card mounted in the slot EXT3 (or EXT1 for M80V/M800VS), after startup of the NC is completed.</p> <p>Set this in 0.1-second increments.</p> <p>(Note) PROFIBUS-DP communication expansion card refers to this parameter, whichever slot (EXT3 or EXT4 (or EXT1 or EXT2 for M80V/M800VS)) the card is mounted in. It does not refer to the parameter #1490.</p> <p>---Setting range---</p> <p>0 to 60000 (0.1s)</p>
	#1333	LMC restrain	Lost motion compensation restraint in handle mode
			<p>Select whether to restrain the lost motion compensation in handle mode.</p> <p>0: Not restrain 1: Restrain</p>

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1334	DI/DO refresh cycl	DI/DO refresh cycle
		<p>Select the start cycle of PLC main processing program. When wait time until the next start cycle from 1 scan end is long, the wait time can be shortened by adjusting the start cycle.</p> <p>-1: Low-speed mode (2 fold) 0: Standard mode 1: High-speed mode 1 (1/2 fold) 2: High-speed mode 2 (1/4 fold)</p> <p>(Note 1) The refresh cycle of M80V(typeB) is fixed regardless of the setting value of this parameter. (Note 2) When the high-speed mode is selected, the fine segment processing performance may degrade due to the increased processing load of the system. (Note 3) When the high-speed mode 2 is selected, the scan time should be 1/4 or less of the base interruption cycle as a standard. If the standard is exceeded, the update of all the DI/DOs in refresh cycle may not be able to be performed. (Note 4) If the number of RIO stations connected is large, the update of all the RIO in refresh cycle may not be able to be performed. Make the setting according to the number of stations per RIO channel.</p>	
	#1335	man_smg	Manual feed acceleration/deceleration selection
		<p>Select the acceleration/deceleration mode in jog feed, incremental feed and manual reference position return (when rapid traverse signal OFF).</p> <p>0: Acceleration/Deceleration for rapid traverse 1: Acceleration/Deceleration for cutting feed</p>	
(PR)	#1336	#400_Valtype	#400 address variable type
		<p>Select whether the #400-level variables are used as machine tool builder macro variables or as common variables.</p> <p>0: #400 to #449 are not available; #450 to #499 are used as machine tool builder macro variables. 1: #400 to #499 are used as common variables</p> <p>(Note) 700 sets or more of common variables are required for using #400 to #499 as common variables. If this parameter is set to "1" while the number of common variables is set to less than 700, this parameter setting will be regarded as "0".</p>	
(PR)	#1338	rev data save trg	Trigger switching to save arbitrary reverse run data
		<p>Select the condition to start/stop saving reverse run data.</p> <p>0: Starts when the reverse run control mode signal is turned ON, and stops when turned OFF. 1: Start when the reverse run control mode signal is ON and macro interrupt is valid (M96/ION). Stop when the reverse run control mode signal is OFF or macro interruption is finished (M97/IOF). (compatible with M500M)</p>	
(PR)	#1339	MC_dp3	Contactor weld detection device 3
		<p>When safety observation is executed, set the remote I/O device to input the contactor's auxiliary b contact signal used for the contactor weld detection.</p> <p>If "0" is set, weld detection will not be executed. Thus, "X0" cannot be used as contactor weld detection device.</p> <p>---Setting range---</p> <p>0000 to 03FF (hexadecimal)</p>	
(PR)	#1340	MC_dp4	Contactor weld detection device 4
		<p>When safety observation is executed, set the remote I/O device to input the contactor's auxiliary b contact signal used for the contactor weld detection.</p> <p>If "0" is set, weld detection will not be executed. Thus, "X0" cannot be used as contactor weld detection device.</p> <p>---Setting range---</p> <p>0000 to 03FF (hexadecimal)</p>	

15 Machine Parameters

15.3 Base Common Parameters

#1342		AlmDly	Alarm display delay time
		<p>Set a period of time by which alarm display is delayed. Set a time between when an operation alarm occurs and when the alarm display and signal turn ON. When set to "0", the alarm display and signal will turn ON immediately after the alarm occurrence. When set to "-1", the alarm display and signal will not turn ON after the alarm occurrence.</p> <p>Target alarms: M01 External interlock axis exists 0004 M01 Internal interlock axis exists 0005 M01 Sensor signal illegal ON 0019 M01 No operation mode 0101</p> <p>This parameter is disabled if "#1343 DlyReg" is set.</p> <p>---Setting range--- -1 to 30000 (ms)</p>	
(PR)	#1343	DlyReg	R register for delayed alarm display setting
		<p>Set the head No. of the R register to be used for delayed display of an operation alarm. If any R register outside the user area is specified, delayed alarm display is disabled. If this parameter is set, the setting of #1342 AlmDly is disabled. When not using, set to "0".</p> <p>---Setting range--- 0 to 29899</p>	
(PR)	#1349	DOOR_1	Door 1 switch input device
		<p>Set a remote I/O device to input the door sensor signal to detect Door 1's status in safety observation. When "0" is set, the door is always detected to be open. Thus, "X0" cannot be used as Door 1 switch input device.</p> <p>---Setting range--- 0000 to 03FF (hexadecimal)</p>	
(PR)	#1350	DOOR_2	Door 2 switch input device
		<p>Set a remote I/O device to input the door sensor signal to detect Door 2's status in safety observation. When "0" is set, the door is always detected to be open. Thus, "X0" cannot be used as Door 2 switch input device.</p> <p>---Setting range--- 0000 to 03FF (hexadecimal)</p>	
(PR)	#1353	MC_ct1	Contactor shutoff output 1 device
		<p>Set a device of an output remote I/O device to control contactor in safety observation. When set to "0", contactor shutoff output is disabled. Thus, "Y0" cannot be used as contactor shutoff output device.</p> <p>---Setting range--- 0000 to 03FF (hexadecimal)</p>	
(PR)	#1357	mchkt1	Contactor operation check allowed time 1
		<p>Set a period of time until emergency stop is issued when a contactor does not operate even though contactor shutoff output 1 is output. If the vertical axis drop prevention function is used, set a value bigger than the vertical axis drop prevention time (SV048 EMGrT). When "0" is set, the contactor operation check will be disabled.</p> <p>---Setting range--- 0 to 30000 (ms)</p>	
(PR)	#1361	aux_acc	Auxiliary axis acceleration/deceleration type
		<p>Select the acceleration/deceleration type of auxiliary axis in PLC axis indexing.</p> <p>0: Acceleration/deceleration with constant time 1: Acceleration/deceleration with constant gradient</p>	

15 Machine Parameters

15.3 Base Common Parameters

	#1365	manualFtype	Manual speed command type
			<p>Select the manual speed command type.</p> <p>0: Manual speed command The axis travels at the handle/jog feed rate. Reverse run is performed for each part system independently of the other ones.</p> <p>1: Manual speed command 2 In a multi-part system configuration, the axis travels at the handle/jog feed rate multiplied by the ratio of each part system's program command speeds. When the block start point is reached in reverse run in any of the part systems, the axes in the other part systems stop simultaneously.</p>
	#1366	skipExTyp	Multi-system simultaneous skip command
			<p>Select the operation when G31 is commanded in more than one part system.</p> <p>0: Carry out G31 command in one part system, while the G31 is kept in an interlocked state in the other systems.</p> <p>1: Carry out G31 command simultaneously in more than one part system.</p>
	#1367	G1AccOVRMax	Max. override value for cutting feed constant-gradient acc./dec.
			<p>Set the maximum override value to be applied to the cutting feed that is in constant-gradient acceleration/ deceleration.</p> <p>When the setting of this parameter is between 0 and 99, the override value is handled as 100% even though the specified cutting feed override is over 100%.</p> <p>---Setting range---</p> <p>0 to 300 (%)</p>
(PR)	#1369	S_Sig1	Safety observation signal device 1
			<p>Set the remote I/O device to input the observation speed change signal 1 during executing the safety observation function.</p> <p>When set to "0", there is no observation speed change signal input. Therefore "X0" cannot be used as safety observation signal device.</p> <p>---Setting range---</p> <p>0000 to 03FF (hexadecimal)</p>
(PR)	#1370	S_Sig2	Safety observation signal device 2
			<p>Set the remote I/O device to input the observation speed change signal 2 during executing the safety observation function.</p> <p>When set to "0", there is no observation speed change signal input. Therefore "X0" cannot be used as safety observation signal device.</p> <p>---Setting range---</p> <p>0000 to 03FF (hexadecimal)</p>
(PR)	#1371	PwrIntegIntvl	Power consumption accumulation interval
			<p>Specify the intervals of accumulating power consumption to create the history.</p> <p>The accumulated power consumption history can be obtained according to this parameter along with "#1392 StartTimeIPC" (Power consumption accumulation start time).</p> <p>When 0 is set, power consumption is not accumulated.</p> <p>---Setting range---</p> <p>0 to 999 (hr)</p>
	#1372	DrvBasePwr	Fixed drive system power consumption
			<p>Specify the fixed power consumption of the drive system.</p> <p>This value is used for calculating the power consumption.</p> <p>---Setting range---</p> <p>0 to 99999999 (W)</p>
(PR)	#1373	mstpssc	Multi-step speed monitor enabled
			<p>Enable the multi-step speed monitor.</p> <p>0: Disable the multi-step speed monitor</p> <p>1: Enable the multi-step speed monitor</p> <p>* When enabling the multi-step speed monitor, setting values for SV238, SV239, SP238 and SP239 will be ignored.</p>

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1379	S_Sig3	Safety observation signal device 3
Set the remote I/O device to input the observation speed change signal 3 during executing the safety observation function. When set to "0", there is no observation speed change signal input. Therefore "X0" cannot be used as safety observation signal device.			
---Setting range---			
0000 to 03FF (hexadecimal)			
(PR)	#1380	TolOfsVal_M	Tool compensation variable change
Not used. Set to "0".			
(PR)	#1381	TolOfsCmdCheck_M	Tool offset command check (for M system only)
Specify the zero check type (either the compensation No. or compensation amount) of a compensation command (*1) for each bit. bit0: Enable compensation No. zero check bit1: Enable compensation amount zero check (*1) Compensation command means the followings: <ul style="list-style-type: none"> ♦Tool radius compensation (G41, G42, G41.2, G42.2, G43.8, G43.9), the address D ♦Tool length compensation (G43, G44, G43.1, G43.4, G43.5, G43.7, G43.8, G43.9), the address H ♦Tool position offset (G45, G46, G47, G48), the address D 			
---Setting range---			
0000 to FFFF			
	#1389	G1SmthChk	Smoothing check method in cutting block
Select whether to apply smoothing check method to a cutting block for deceleration check, when deceleration check method is selected individually for G0 and G1 (when "#1306 InpsTyp" = 0). 0: Follow the setting of "#1223 aux07/bit1" 1: Apply smoothing check method			
(PR)	#1390	BackUSBUseNum	Number of backside USB ports occupied
Specify the number of the display's rear USB ports occupied by a machine tool builder. Using this setting the control determines the drive to be used for the front SD and USB memory. (Note) This parameter is enabled for a Windows-based display of M800VW/M80VW.			
---Setting range---			
0 to 6			
(PR)	#1391	User level protect	Enable Data protection by user's level
Enable the function of Data protection by user's level. 0: Use a machine user password to switch the protection of each operation (same as the conventional models) 1: Switch the protection according to the protective levels (0 to 7) specified for each operation through the protection setting screen (Note) You are authorized to change this parameter from 1 to 0 only if your operation level is the same or higher than that of "Available level" on the protection setting screen.			
(PR)	#1392	StartTimeIPC	Power consumption accumulation start time
Specify when to start accumulating power consumption to create the history. The accumulated power consumption history can be obtained according to this parameter along with "#1371 PwrIntegIntvl" (Power consumption accumulation interval).			
---Setting range---			
0 to 23 (o'clock)			
	#1393	Efficiency (PwrCal)	Efficiency for power consumption computation
Specify the efficiency for calculating power consumption. This value is used for calculating the drive system power consumption. When 0 is set, the efficiency is treated as 70 (%). If the drive system power consumption computed by the NC is different from that measured by a measuring device, this parameter is used to adjust the drive system power consumption of the NC.			
---Setting range---			
0 to 100 (%)			

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1395	H1_pno	1st handle selection
		Specify the connection destination of the 1st handle. bit0 to bit3: Handle connection channel 1 to 4 ("3" is only valid for operation panel) bit4 to bit7: Handle connection destination 0: CNC unit 1 to 4: Remote I/O unit 5: Expansion unit D to F: Operation panel I/O unit bit8 to bitF: Remote I/O unit station 1 to 40 (hexadecimal) (Example) 0001: Handle 1 connected to the CNC unit 2421: Handle 1 of 36th station for remote I/O unit connected to RIO2 00D3: Handle 3 of operation panel I/O unit connected to RIO1 (Note 1) When the specified destination is not implemented, handle movement is not performed. (Note 2) When all the "H1_pno" to "H3_pno" are set to "0000", handles are automatically allocated. Other than above, "0000" setting is the same connection as "0001" setting. ---Setting range--- 0000 to FFFF (hexadecimal)	
(PR)	#1396	H2_pno	2nd handle selection
		Specify the connection destination of the 2nd handle. Refer to "#1395 H1_pno" (1st handle selection) for further details.	
(PR)	#1397	H3_pno	3rd handle selection
		Specify the connection destination of the 3rd handle. Refer to "#1395 H1_pno" (1st handle selection) for further details.	
#1399	sp_filt	Spindle's actual rotation speed filter	
		Specify the average filter scale factor for the spindle's actual rotation speed data. If the scale factor increases, fluctuations in speed display are mitigated. 0: Standard setting 1: 0.5-fold 2: 1-fold 3: 2-fold 4: 4-fold 5: 8-fold	
#1401	M_mode	M command operation selection	
		Select the M command operation. (Note) Register M codes in the special operation registration M codes (#1411 to #1426). 0: Not wait for the completion of registered M codes, but wait for the completion of the other M codes 1: Wait for the completion of registered M codes, but not wait for the completion of the other M code	
#1402	S_mode	S command completion method selection	
		Select the S command completion method. 0: Wait for the complete signal from PLC 1: Not wait for the complete signal from PLC	
#1403	T_mode	T command completion method selection	
		Select the T command completion method. 0: Wait for the complete signal from PLC 1: Not wait for the complete signal from PLC	

15 Machine Parameters

15.3 Base Common Parameters

#1404	M2_mode	2nd miscellaneous command completion method selection
Select the 2nd miscellaneous command completion method. 0: Wait for the complete signal from PLC 1: Not wait for the complete signal from PLC		
#1405	M_mode(SMLK)	M code output (during high-speed simple program check)
M code output (during high-speed simple program check) Select the M code output method to be applied during high-speed simple program check. 0: Output the M codes registered in #1449 to #1464 M[M511-000](SMLK), but not output unregistered M codes. M512 or subsequent M codes are not output. 1: Output the M codes unregistered in #1449 to #1464 M[M511-000](SMLK), but not output those registered. M512 and subsequent M codes are all output.		
#1406	S_mode(SMLK)	S code output (during high-speed simple program check)
S code output (during high-speed simple program check) Select the S code output method to be applied during high-speed simple program check. 0: Not output S code 1: Output S code		
#1407	T_mode(SMLK)	T code output (during high-speed simple program check)
T code output (during high-speed simple program check) Select the T code output method to be applied during high-speed simple program check. 0: Not output T code 1: Output T code		
#1408	M2_mode(SMLK)	2nd miscellaneous code output (during high-speed simple program check)
2nd miscellaneous code output (during high-speed simple program check) Select the 2nd M code output method to be applied during high-speed simple program check. 0: Not output 2nd M code 1: Output 2nd M code		
#1411	M_wait[M031-000]	Special operation registration M code
Register an M code that needs special operation. Each bit of the set value corresponds to the M code number. (Example) To register M05, set 00000020 in #1411. (Note) Note that the registered M code operation varies according to M_mode (#1401). ---Setting range--- 0 to FFFFFFFF Set this in hexadecimal format.		
#1412	M_wait[M063-032]	Special operation registration M code
Register an M code (32 to 63) that needs special operation. Each bit of the set value corresponds to the M code number. (Example) To register M05, set 00000020 in #1411. (Note) Note that the registered M code operation varies according to M_mode (#1401). ---Setting range--- 0 to FFFFFFFF Set this in hexadecimal format.		

15 Machine Parameters

15.3 Base Common Parameters

#1413	M_wait[M095-064]	Special operation registration M code
	Register an M code (64 to 95) that needs special operation. Each bit of the set value corresponds to the M code number. (Example) To register M05, set 00000020 in #1411. (Note) Note that the registered M code operation varies according to M_mode (#1401). ---Setting range--- 0 to FFFFFFFF Set this in hexadecimal format.	
#1414	M_wait[M127-096]	Special operation registration M code
	Register an M code (96 to 127) that needs special operation. Each bit of the set value corresponds to the M code number. (Example) To register M05, set 00000020 in #1411. (Note) Note that the registered M code operation varies according to M_mode (#1401). ---Setting range--- 0 to FFFFFFFF Set this in hexadecimal format.	
#1415	M_wait[M159-128]	Special operation registration M code
	Register an M code (128 to 159) that needs special operation. Each bit of the set value corresponds to the M code number. (Example) To register M05, set 00000020 in #1411. (Note) Note that the registered M code operation varies according to M_mode (#1401). ---Setting range--- 0 to FFFFFFFF Set this in hexadecimal format.	
#1416	M_wait[M191-160]	Special operation registration M code
	Register an M code (160 to 191) that needs special operation. Each bit of the set value corresponds to the M code number. (Example) To register M05, set 00000020 in #1411. (Note) Note that the registered M code operation varies according to M_mode (#1401). ---Setting range--- 0 to FFFFFFFF Set this in hexadecimal format.	
#1417	M_wait[M223-192]	Special operation registration M code
	Register an M code (192 to 223) that needs special operation. Each bit of the set value corresponds to the M code number. (Example) To register M05, set 00000020 in #1411. (Note) Note that the registered M code operation varies according to M_mode (#1401). ---Setting range--- 0 to FFFFFFFF Set this in hexadecimal format.	
#1418	M_wait[M255-224]	Special operation registration M code
	Register an M code (224 to 255) that needs special operation. Each bit of the set value corresponds to the M code number. (Example) To register M05, set 00000020 in #1411. (Note) Note that the registered M code operation varies according to M_mode (#1401). ---Setting range--- 0 to FFFFFFFF Set this in hexadecimal format.	
#1419	M_wait[M287-256]	Special operation registration M code
	Not used.	

15 Machine Parameters

15.3 Base Common Parameters

	#1420	M_wait[M319-288]	Special operation registration M code
		Not used.	
	#1421	M_wait[M351-320]	Special operation registration M code
		Not used.	
	#1422	M_wait[M383-352]	Special operation registration M code
		Not used.	
	#1423	M_wait[M415-384]	Special operation registration M code
		Not used.	
	#1424	M_wait[M447-416]	Special operation registration M code
		Not used.	
	#1425	M_wait[M479-448]	Special operation registration M code
		Not used.	
	#1426	M_wait[M511-480]	Special operation registration M code
		Not used.	
(PR)	#1427	RT2AftG1	RT2: Enable switching of acce/dece time constant after G1 interpolation
		Select whether to enable switching of acceleration/deceleration time constant after G1 interpolation. 0: Disable switching of acceleration/deceleration time constant after G1 interpolation. 1: Enable switching of acceleration/deceleration time constant after G1 interpolation.	
(PR)	#1428	RT2rst	RT2: Enable changing acce/dece time constant back when NC is reset
		Select whether to change acceleration/deceleration time constant back to parameter value when NC is reset. 0: Disable changing acceleration/deceleration time constant back when NC is reset. 1: Enable changing acceleration/deceleration time constant back when NC is reset.	
(PR)	#1431	Ax_Chg	Selection of mixed control (cross axis control) or arbitrary axis exchange control
		Choose which of the following controls to enable; Mixed control (Cross axis control) I, II or arbitrary axis exchange control. Set this parameter to "1" to enable the arbitrary axis exchange control function with M80VtypeA (M system) and M80VW (M system). 0: Mixed control (Cross axis control) I or II 1: Arbitrary axis exchange control	
	#1432	Ax_Chg_Spec	
		bit0: Selection of alarm when axis exchange is disabled Select whether to issue an alarm or wait until the axis becomes exchangeable when axis exchange is disabled. 0: Wait until the axis becomes exchangeable when the axis declared in an axis exchange command is incapable of being exchanged. * The parameter #1433 (G140TimeOut) determines the operation to be carried out during the waiting time. 1: Output the alarm (M01 1101) when the axis declared in an axis exchange command is incapable of being exchanged.	
		bit1: Compensation cancel after arbitrary axis exchange Select whether to enable canceling of compensation after an arbitrary axis exchange. 0: Not cancel compensation after arbitrary axis exchange 1: Cancel compensation after arbitrary axis exchange	

15 Machine Parameters

15.3 Base Common Parameters

#1433	G140TimeOut	G140 timeout period
	<p>Specify a period of time to wait before outputting the alarm (M01 1101) when an axis declared in the axis exchange command is unexchangeable.</p> <p>If the specified time elapses with the axis remaining unexchangeable, the alarm (M01 1101) is output. However this alarm is cancelled and axis exchange is carried out once the axis becomes capable of being exchanged.</p> <p>0 to 254: Period of time to wait before timeout (sec)</p> <p>255: Wait until the axis becomes exchangeable without executing timeout check</p> <p>(Note) This parameter is enabled when the alarm is not caused by an axis' unexchangeable state (when #1432 Ax_Chg_Spec(bit0) = 0).</p> <p>---Setting range---</p> <p>0 to 254 (s)</p> <p>255: No timeout</p>	
#1434	G140Type2	G140 command type 2
	<p>Select which axis address(es) can be commanded under G140 (Arbitrary axis exchange) control.</p> <p>0: The axis (or axes) specified in the G140 block can be commanded.</p> <p>1: Not only the axis (or axes) specified in the G140 block but those unspecified in the block can also be commanded.</p>	
#1435	crsman	Manual interruption during cross machining
	<p>Select whether to enable manual interruption for an axis being under cross machining control.</p> <p>0: Disable</p> <p>1: Enable</p>	
#1436	mstsyn	Enable override for dwell and miscellaneous function time
	<p>Select whether to enable override for the dwell time and miscellaneous function time.</p> <p>0: Disable (Override takes no effect.)</p> <p>1: Enable (Override takes effect.)</p>	
#1437	SBS2_Spec	Selection of alarm when sub part system II start is disabled
	<p>bit0: Selection of alarm when sub part system II start is disabled</p> <p>Select the type of operation to be carried out when the sub part system specified by G144 is incapable of being activated.</p> <p>0: Wait until the system becomes capable of being activated</p> <p>1: Output an alarm</p> <p>bit1: Sub part system control II: Reset type selection</p> <p>Select how to reset the sub part system control II.</p> <p>0: Reset sub part system at the same time as main part system reset.</p> <p>1: Not reset sub part system at the time of main part system reset.</p>	
(PR) #1438	Ofs-SysAssign	Enable part system allocation of tool offset sets
	<p>Select the allocation method of tool offset sets.</p> <p>0: Automatic equal allocation</p> <p>1: Arbitrary allocation</p> <p>The setting of "1" is enabled for a system configured with two or more part systems.</p> <p>When "1" is selected for a system configured with a single part system, all the offset sets of the system are allocated to the 1st part system.</p>	
(PR) #1439	Tlfe-SysAssign	Part system allocation of life management tools
	<p>Select the allocation method of the life management tools.</p> <p>0: Automatic equal allocation</p> <p>1: Arbitrary allocation</p> <p>The setting of "1" is enabled for a system configured with two or more part systems.</p> <p>When "1" is selected for a system configured with a single part system, all the life management tools of the system are allocated to the 1st part system.</p>	

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1440	multi_sp_syn	Multiple spindle synchronization valid
Select whether to enable multiple spindle synchronization. 0: Disable multiple spindle synchronization. 1: Enable multiple spindle synchronization.			
(PR)	#1441	Tcode_Method_Chg	T command method selection
Select the tool command method. 0: Tool life management II format 1: Tool function			
	#1442	G0ol	Enable G00 rapid traverse block overlap
Select whether to enable the G00 rapid traverse block overlap function. 0: Disable 1: Enable			
	#1443	G28ol	Enable G28 rapid traverse block overlap
Select whether to enable the G28 rapid traverse block overlap function. 0: Disable 1: Enable			
	#1444	otsys	Stop all part systems at OT
Select whether to stop all the part systems or only the part system where H/W stroke end, soft limit or interference check alarm has occurred. (Note) If H/W stroke end, soft limit or interference check alarm has occurred on an axis related to superimposition, synchronization, arbitrary axis superimposition, or synchronization during axis traveling, the part system to which the superimposition (synchronous) and reference axes belong is treated as the one where the alarm has occurred. 0: Stop each part system 1: Stop all the part systems			
(PR)	#1445	Tol-Custom-nondisp	Non-display of additional info on tool management screen
Select whether to display or hide additional information on the tool management screen. 0: Display 1: Not display			
	#1446	Tino.hold	Tool length offset No. retention
Select the operation to be performed when command T has no tool length offset No. 0: Tool length offset No. is deemed as 0. 1: Last commanded tool length offset No. is applied. (Tool length offset No. is unchanged.)			
	#1447	G96_tmp_cancel	Temporary cancel of constant surface speed control
0: Disable a spindle rotation command given in another part system 1: Enable a spindle rotation command given in another part system			
	#1448	Sclamp_err_cancel	Cancel of the error for absence of spindle speed clamp
0: Disable cancel of the error 1: Enable cancel of the error			
	#1449	m_clamp_on	Manual feed rate clamp ON
0: Rapid traverse rate (#2001 rapid) serves as the maximum speed in jog, handle, incremental or manual reference position return (high-speed) mode. However you can use a PLC device to switch the maximum speed to the manual feed clamp speed (#2614 m_clamp). 1: Manual feed clamp speed (#2614 m_clamp) serves as the maximum speed in jog, handle, incremental, or manual reference position return (high-speed) mode.			

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1450	5axis_Spec
		<p>bit0: Axis name setting method of rotary axis configuration parameter</p> <p>Select the axis name setting method for rotary axis configuration parameter (#7900, #7901, #7902, #7922, #7932, #7942, #7952).</p> <p>0: Set by axis name 1: Set by 2nd axis name</p> <p>bit1: Using G174 tool axis rotation angle as compensation amount</p> <p>0: Specify the compensation amount using the address R and R register. 1: Use the tool axis rotation angle of G174 as the compensation amount.</p> <p>bit2: Application of rotary axis configuration parameters</p> <p>Select the method of applying the rotary axis configuration parameters.</p> <p>0: Automatic selection method 1: PLC signal method</p> <p>(Note) This parameter is enabled when "#1450 5axis_Spec/bit0 (Axis name setting method of rotary axis configuration parameter)" is "1".</p> <p>bit3: Select specifications of rotation direction parameter</p> <p>Select the specifications of rotation direction parameter (#7923, #7933, #7943, #7953).</p> <p>0: The parameter specifications vary for each function. 1: The parameter specifications are common to the functions.</p> <p>"#7923 DIR_T1", "#7933 DIR_T2", "#7943 DIR_W1", "#7953 DIR_W2"</p> <p>0: When the tool motion viewed from the workpiece is in right-hand screw direction, it is taken as the positive direction. 1: When the tool motion viewed from the workpiece is in left-hand screw direction, it is taken as the positive direction.</p> <p>bit5: Rotation center error compensation: restraint of machine movement</p> <p>Select whether to enable restraint of machine movement when the rotation center error compensation is used in combination with any of the following multi-part system functions:</p> <ul style="list-style-type: none"> ♦Arbitrary axis exchange control ♦Mixed control I or II ♦Control axis synchronization between part systems I or II ♦Control axis superimposition ♦Arbitrary axis superimposition <p>0: Enable restraint of machine movement</p> <ul style="list-style-type: none"> ♦Retain the multi-part system function at reset or emergency stop ♦Perform error check when multi-part system function is commanded <p>1: Disable restraint of machine movement</p> <ul style="list-style-type: none"> ♦Not retain the multi-part system function at reset or emergency stop ♦Not perform error check when multi-part system function is commanded <p>(Note) This parameter is enabled when "#1450 5axis_Spec/bit0" (Axis name setting method of rotary axis configuration parameter) is "1".</p>
#1451	M[M031-000](SMLK)	Special operation registration M code (High-speed simple program check)
		<p>Register an M code to be output during high-speed simple program check.</p> <p>Each bit of the set value corresponds to the M code number.</p> <p>(Example) To register M05, set 00000020 in #1451.</p> <p>Note that operation of the registered M code varies according to #1405 M_mode(SMLK).</p> <p>---Setting range---</p> <p>0 to FFFFFFFF</p> <p>Set this in hexadecimal format.</p>

15 Machine Parameters

15.3 Base Common Parameters

#1452	M[M063-032](SMLK)	Special operation registration M code (High-speed simple program check)
	<p>Register an M code to be output during high-speed simple program check.</p> <p>Each bit of the set value corresponds to the M code number.</p> <p>(Example) To register M05, set 00000020 in #1451.</p> <p>Note that operation of the registered M code varies according to #1405 M_mode(SMLK).</p> <p>---Setting range---</p> <p>0 to FFFFFFFF</p> <p>Set this in hexadecimal format.</p>	
#1453	M[M095-064](SMLK)	Special operation registration M code (High-speed simple program check)
	<p>Register an M code to be output during high-speed simple program check.</p> <p>Each bit of the set value corresponds to the M code number.</p> <p>(Example) To register M05, set 00000020 in #1451.</p> <p>Note that operation of the registered M code varies according to #1405 M_mode(SMLK).</p> <p>---Setting range---</p> <p>0 to FFFFFFFF</p> <p>Set this in hexadecimal format.</p>	
#1454	M[M127-096](SMLK)	Special operation registration M code (High-speed simple program check)
	<p>Register an M code to be output during high-speed simple program check.</p> <p>Each bit of the set value corresponds to the M code number.</p> <p>(Example) To register M05, set 00000020 in #1451.</p> <p>Note that operation of the registered M code varies according to #1405 M_mode(SMLK).</p> <p>---Setting range---</p> <p>0 to FFFFFFFF</p> <p>Set this in hexadecimal format.</p>	
#1455	M[M159-128](SMLK)	Special operation registration M code (High-speed simple program check)
	<p>Register an M code to be output during high-speed simple program check.</p> <p>Each bit of the set value corresponds to the M code number.</p> <p>(Example) To register M05, set 00000020 in #1451.</p> <p>Note that operation of the registered M code varies according to #1405 M_mode(SMLK).</p> <p>---Setting range---</p> <p>0 to FFFFFFFF</p> <p>Set this in hexadecimal format.</p>	
#1456	M[M191-160](SMLK)	Special operation registration M code (High-speed simple program check)
	<p>Register an M code to be output during high-speed simple program check.</p> <p>Each bit of the set value corresponds to the M code number.</p> <p>(Example) To register M05, set 00000020 in #1451.</p> <p>Note that operation of the registered M code varies according to #1405 M_mode(SMLK).</p> <p>---Setting range---</p> <p>0 to FFFFFFFF</p> <p>Set this in hexadecimal format.</p>	

15 Machine Parameters

15.3 Base Common Parameters

#1457	M[M223-192](SMLK)	Special operation registration M code (High-speed simple program check)
	<p>Register an M code to be output during high-speed simple program check.</p> <p>Each bit of the set value corresponds to the M code number.</p> <p>(Example) To register M05, set 00000020 in #1451.</p> <p>Note that operation of the registered M code varies according to #1405 M_mode(SMLK).</p> <p>---Setting range---</p> <p>0 to FFFFFFFF</p> <p>Set this in hexadecimal format.</p>	
#1458	M[M255-224](SMLK)	Special operation registration M code (High-speed simple program check)
	<p>Register an M code to be output during high-speed simple program check.</p> <p>Each bit of the set value corresponds to the M code number.</p> <p>(Example) To register M05, set 00000020 in #1451.</p> <p>Note that operation of the registered M code varies according to #1405 M_mode(SMLK).</p> <p>---Setting range---</p> <p>0 to FFFFFFFF</p> <p>Set this in hexadecimal format.</p>	
#1459	M[M287-256](SMLK)	Special operation registration M code (High-speed simple program check)
	<p>Register an M code to be output during high-speed simple program check.</p> <p>Each bit of the set value corresponds to the M code number.</p> <p>(Example) To register M05, set 00000020 in #1451.</p> <p>Note that operation of the registered M code varies according to #1405 M_mode(SMLK).</p> <p>---Setting range---</p> <p>0 to FFFFFFFF</p> <p>Set this in hexadecimal format.</p>	
#1460	M[M319-288](SMLK)	Special operation registration M code (High-speed simple program check)
	<p>Register an M code to be output during high-speed simple program check.</p> <p>Each bit of the set value corresponds to the M code number.</p> <p>(Example) To register M05, set 00000020 in #1451.</p> <p>Note that operation of the registered M code varies according to #1405 M_mode(SMLK).</p> <p>---Setting range---</p> <p>0 to FFFFFFFF</p> <p>Set this in hexadecimal format.</p>	
#1461	M[M351-320](SMLK)	Special operation registration M code (High-speed simple program check)
	<p>Register an M code to be output during high-speed simple program check.</p> <p>Each bit of the set value corresponds to the M code number.</p> <p>(Example) To register M05, set 00000020 in #1451.</p> <p>Note that operation of the registered M code varies according to #1405 M_mode(SMLK).</p> <p>---Setting range---</p> <p>0 to FFFFFFFF</p> <p>Set this in hexadecimal format.</p>	

15 Machine Parameters

15.3 Base Common Parameters

#1462	M[M383-352](SMLK)	Special operation registration M code (High-speed simple program check)
	<p>Register an M code to be output during high-speed simple program check.</p> <p>Each bit of the set value corresponds to the M code number.</p> <p>(Example) To register M05, set 00000020 in #1451.</p> <p>Note that operation of the registered M code varies according to #1405 M_mode(SMLK).</p> <p>---Setting range---</p> <p>0 to FFFFFFFF</p> <p>Set this in hexadecimal format.</p>	
#1463	M[M415-384](SMLK)	Special operation registration M code (High-speed simple program check)
	<p>Register an M code to be output during high-speed simple program check.</p> <p>Each bit of the set value corresponds to the M code number.</p> <p>(Example) To register M05, set 00000020 in #1451.</p> <p>Note that operation of the registered M code varies according to #1405 M_mode(SMLK).</p> <p>---Setting range---</p> <p>0 to FFFFFFFF</p> <p>Set this in hexadecimal format.</p>	
#1464	M[M447-416](SMLK)	Special operation registration M code (High-speed simple program check)
	<p>Register an M code to be output during high-speed simple program check.</p> <p>Each bit of the set value corresponds to the M code number.</p> <p>(Example) To register M05, set 00000020 in #1451.</p> <p>Note that operation of the registered M code varies according to #1405 M_mode(SMLK).</p> <p>---Setting range---</p> <p>0 to FFFFFFFF</p> <p>Set this in hexadecimal format.</p>	
#1465	M[M479-448](SMLK)	Special operation registration M code (High-speed simple program check)
	<p>Register an M code to be output during high-speed simple program check.</p> <p>Each bit of the set value corresponds to the M code number.</p> <p>(Example) To register M05, set 00000020 in #1451.</p> <p>Note that operation of the registered M code varies according to #1405 M_mode(SMLK).</p> <p>---Setting range---</p> <p>0 to FFFFFFFF</p> <p>Set this in hexadecimal format.</p>	
#1466	M[M511-480](SMLK)	Special operation registration M code (High-speed simple program check)
	<p>Register an M code to be output during high-speed simple program check.</p> <p>Each bit of the set value corresponds to the M code number.</p> <p>(Example) To register M05, set 00000020 in #1451.</p> <p>Note that operation of the registered M code varies according to #1405 M_mode(SMLK).</p> <p>---Setting range---</p> <p>0 to FFFFFFFF</p> <p>Set this in hexadecimal format.</p>	
#1467	Manual MSTB macro	MSTB macro call via manual numerical value command
	<p>Select whether to enable a miscellaneous command macro call through the manual numerical value command.</p> <p>0: Disable</p> <p>1: Enable</p> <p>When Disable is selected, the commanded MSTB code and strobe are output.</p>	

15 Machine Parameters

15.3 Base Common Parameters

	#1468	ctrl period	Control period
		Set the standard value "0".	
(PR)	#1469	P-BUS dev assign	PROFIBUS device allocation method
		Select how to allocate the PLC devices that are used for PROFIBUS-DP(DPV0): fixed allocation (512 points) or arbitrary allocation (8192 points).	
		0: Fixed	
		1: Arbitrary	
(PR)	#1471	mgralmstp	Enable machine groupwise alarm stop
		Select whether to enable the machine groupwise alarm stop function.	
		0: Disable	
		1: Enable	
(PR)	#1472	mgralmrestart	Allowing automatic operation to start after machine groupwise alarm stop
		Select whether to allow automatic operation to be activated after machine groupwise alarm stop.	
		0: Not allow automatic operation to start after machine groupwise alarm stop	
		1: Allow automatic operation to start after machine groupwise alarm stop	
(PR)	#1473	mgralmcont	Allowing operation to continue after machine groupwise alarm stop
		When any alarm causes an axis that is in the midst of program execution to stop, this parameter allows you to select the behavior of axes that belong to machine groups other than that of the said axis.	
		0: Feed hold	
		1: The operation is allowed to continue.	
(PR)	#1474	SBS2_sys num	Number of sub systems to use in sub part system control II
		Specify the number of sub part systems to use in sub part system control II.	
		The specified number of part systems counted from the end of the system's effective part systems are treated as sub part systems.	
		---Setting range---	
		0 to 7	
(PR)	#1475	MES-IF_on	MES-IF ON
		Set whether to enable the MES interface function.	
		0: Disable	
		1: Enable	
	#1476	ComErrDly	Delayed display and storage of communication error
		Specify a period of time by which to delay the error display and the storage to the alarm history, when the communication error (Y02 System error 0051) occurs.	
		Set this time when the communication error is stored in the history at the power OFF.	
		If it does not occur (if unused), set to "0".	
		---Setting range---	
		0 to 5000 (ms)	
	#1477	SrvAlmDly	Delayed display and storage of servo/spindle alarm
		Specify a period of time by which to delay the alarm display and the storage to the alarm history, when a servo/spindle alarm occurs.	
		Set this time when a servo/spindle alarm is stored in the history at the power OFF.	
		If it does not occur (if unused), set to "0".	
		---Setting range---	
		0 to 5000 (ms)	

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1478	F-bus Card 1 OFF	Fieldbus communication extension card 1 OFF
		Select whether to enable or disable the Fieldbus communication expansion card mounted in the slot EXT3 (or EXT1 for M80V/M800VS). 0: Enable (default) 1: Disable (Note) This parameter is enabled for all the communication expansion cards, except CC-Link expansion card.	
(PR)	#1479	F-bus Card 2 OFF	Fieldbus communication extension card 2 OFF
		Select whether to enable or disable the Fieldbus communication expansion card mounted in the slot EXT4 (or EXT2 for M80V/M800VS). 0: Enable (default) 1: Disable (Note) This parameter is enabled for all the communication expansion cards, except CC-Link expansion card.	
	#1480	tp_invalid	Disable touch panel operation
		Select whether to disable input via touch panel. 0: Enable touch panel operation 1: Disable touch panel operation	
(PR)	#1481	Enable S-Safety	Enable smart safety observation
		Select whether to enable smart safety observation. 0: Disable 1: Enable	
(PR)	#1483	SBS1_sys num	Number of sub systems to use in sub part system control I
		Specify the number of sub part systems to be used for Sub part system control I in M80V or M80VW. The specified number of part systems counted from the end of the system's effective part systems are treated as sub part systems. (Note) For M800V, this setting is ignored. (All the effective part systems can be used as main or sub part system.) ---Setting range--- 0 to 7	
	#1487	ITF3_Spec	Interference check III specification
		bit0: Speed clamp specifications at entering the interference warning area In interference check III, select whether to perform speed clamp and torque limit in only the part systems relating to the interference warning or in all the part systems at entering the interference warning area. 0: Perform in only the part systems relating to the interference warning 1: Perform in all the part systems and axes	
(PR)	#1488	ITF3 valid	Interference check III valid
		Interference check III is validated. When interference check III is invalid, interference check between part systems is valid. 0: Interference check III invalid 1: Interference check III valid	
(PR)	#1489	SLMP_on	SLMP_on
		Select whether to enable or disable the SLMP server function. 0: Disable 1: Enable	

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1490	F-bus init delay 2	Field bus communication error invalid time 2
		<p>Specify a period of time during which the control does not detect a Fieldbus communication error of the Fieldbus expansion card mounted in the slot EXT4 (or EXT2 for M80V/M800VS), after startup of the NC is completed.</p> <p>Set this in 0.1-second increments.</p> <p>(Note 1) This parameter is enabled for all the communication expansion cards except PROFIBUS-DP communication expansion card.</p> <p>(Note 2) PROFIBUS-DP communication expansion card does not refer to this parameter, whichever slot (EXT3 or EXT4 (or EXT1 or EXT2 for M80V/M800VS)) the card is mounted in. It refers to the parameter #1332.</p> <p>---Setting range---</p> <p>0 to 60000 (0.1s)</p>	
(PR)	#1491	Teaching-SysAssign	Load monitor: Teaching data allocation method
		<p>Select the method of how to allocate the teaching data for load monitor.</p> <p>0: Allocate the data according to "#1232 set04/bit4"</p> <p>1: Allocate the data arbitrarily using "#12107 Teaching-DataNum"</p> <p>(Note) When "0" is set, the 1st and 2nd part systems are subject to load monitor. If you perform load monitor for the 3rd or subsequent part system, select "1".</p>	
	#1702	cfg02	In-position check for Punch Tap
		<p>Select whether to perform the in-position check for each block of the Punch Tap cycle.</p> <p>bit0-5:</p> <p>0: Not perform in-position check</p> <p>1: Perform in-position check</p>	
	#1703	cfg03	
		<p>bit3: Hobbing (phase alignment control) phase difference attainment level weight</p> <p>Select the weight applied to the value of phase difference attainment level (parameter "#3051 spplv") for phase alignment control in hobbing.</p> <p>0: Phase difference attainment level converted to the weight of the workpiece axis</p> <p>1: Phase difference attainment level converted to the weight of either the hobbing axis or the workpiece axis, whichever has the larger rotation ratio</p>	
	#1711	cfg11	
		<p>bit1: Disabling movement in prohibited area of stored stroke limit IB/IIB</p> <p>Specify whether axis movement is disabled or not when the tool is in the prohibited area of stored stroke limit IB/IIB.</p> <p>0: Not disable movement.</p> <p>1: Disable movement, except for movements towards the nearest permitted area.</p> <p>bit2: Mode of rapid traverse block overlap for G00/G28</p> <p>Select the mode of rapid traverse block overlap for G00 and G28. When pre-interpolation acceleration/deceleration is used, Mode 2 is recommended. This parameter is valid when rapid traverse block overlap for G00 is enabled ("#1442 G0ol" = 1) or rapid traverse block overlap for G28 is enabled ("#1443 G28ol" = 1).</p> <p>0: Mode 1 (compatible with post-interpolation acceleration/deceleration)</p> <p>1: Mode 2 (optimized for post-/pre-interpolation acceleration/deceleration)</p> <p>bit3: Spindle position control: Program command method Zero point return spec</p> <p>Specify the zero point return type of the program command method in Spindle position control.</p> <p>0: Zero point return type</p> <p>1: Follow the parameter setting in "#3106 zrn_typ/bit8" (Spindle/C axis zero point return)</p> <p>bit4: Behavior of Optional block skip in high-speed mode</p> <p>Select how the program blocks skipped with Optional block skip are handled while any of the following modes is enabled: High-speed machining mode II, High-speed high-accuracy control II or High-speed high-accuracy control III.</p> <p>0: The blocks are handled as those with no motion.</p> <p>1: The blocks are skipped.</p>	

15 Machine Parameters

15.3 Base Common Parameters

#1712	cfg12
bit0: Rapid traverse rate: PR display	
Specify whether to display PR when Command speed monitoring function is enabled and Rapid traverse rate is changed.	
0: Not display	
1: Display	
bit1: Load monitoring I: torque output switch	
Specify how torque is output in Load monitoring I	
0: Only during automatic operation (the estimated disturbance torque of the servo axis is always output)	
1: Always output	
#1725	cfg25
bit0: Confirmation about formatting at edit of SRAM open parameter	
Select whether to display a confirmation message at the setting of SRAM open parameter data, notifying that the NC memory needs to be formatted.	
0: Not display the confirmation message	
1: Display the confirmation message	
bit1: Displaying of FIN in status field	
Specify whether to display FIN that indicates Waiting for miscellaneous function.	
0: Disable FIN display	
1: Enable FIN display	
bit2: Measurement coordinate system switch during inclined axis control	
This parameter switches the coordinate system in which to perform measurement during inclined axis control.	
0: Program coordinate system (orthogonal coordinate system)	
1: Machine coordinate system (actual axis)	
bit3: NCAID backup selection	
Select whether to perform all backup/restoration for NC MachiningAID data.	
0: Perform all backup/restoration	
1: Not perform all backup/restoration	
(PR) #1751	cfgPR01
bit1: Selection of coordinate system for shift amount of G76/G87	
Select in which coordinate system the tool-tip shift amount is interpreted for G76 fine boring cycle or G87 back boring cycle. The shift amount is specified with address Q or I/J/K.	
(Note) When "Machine coordinate system" is selected, do not perform figure rotation.	
0: Currently active coordinate system	
1: Machine coordinate system	
bit4: Behavior for G92 (G50) and G53 in the same block	
Select the behavior for G92 (G50) and G53 commands in the same block specifying an axis address other than "0".	
0: Output a program error (P35)	
1: Process the commands by treating the axis address as "0"	

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1752	cfgPR02
		<p>bit0: PLC window diameter specification valid</p> <p>Enable input/output in diameter value for the data of "Diameter specification axis" ("#1019 dia" is set to "1") in PLC window.</p> <p>0: Input/output is executed in radius value.</p> <p>1: Input/output is executed in diameter value.</p> <p>bit2: Constant-gradient acc/dec behavior switch when G0 non-interpolation is enabled</p> <p>Switch how acceleration/deceleration works while the following modes are active when "#1086 G0Intp" = 1 (G0 non-interpolation) and "#1200 G0_acc" = 1 (G0 constant-gradient acceleration/deceleration).</p> <ul style="list-style-type: none"> ♦Inclined surface machining ♦Tool center point control ♦Simple inclined surface machining ♦Simple tool center point control ♦Workpiece installation error compensation ♦Tool cutting point control ♦L system and coordinate rotation by program <p>0: Constant-time acceleration/deceleration</p> <p>1: Constant-gradient acceleration/deceleration</p> <p>bit4: Prioritization of G0 constant-gradient acc/dec time constant</p> <p>When "#1200 G0_acc" = 1 (G0 constant-gradient acceleration/deceleration), even if the time constant for G0 constant-gradient acceleration/deceleration is greater than the G0 time constant (axis specification parameter "#2004 G0tL"), acceleration/deceleration is performed based on the time constant for G0 constant-gradient acceleration/deceleration.</p> <p>When this setting is used, the G0 time constant is limited to 2000 ms.</p> <p>This setting is applied to the following parameters.</p> <ul style="list-style-type: none"> ♦#2004 G0tL ♦#2005 G0t1 ♦#2092 pIG0tL ♦#2093 pIG0t1 ♦#2598 G0tL_2 ♦#2599 G0t1_2 ♦#2622 pI3G0tL ♦#2623 pI3G0t1 <p>(Note) When "#1752 cfgPR02/bit4" = 1, even if "#1200 G0_acc" = 0 (G0 constant-gradient acceleration/deceleration invalid), the setting of these parameters is limited.</p> <p>0: Perform acceleration/deceleration based on the shorter of the G0 constant-gradient acceleration/deceleration time constant and the G0 time constant</p> <p>1: Perform acceleration/deceleration based on the G0 constant-gradient acceleration/deceleration time constant</p> <p>bit5: System variable (feedrate F) value to be read</p> <p>Select the value to be read from the system variables #4109 and #4309 (Feedrate F).</p> <p>0: The programmed feed-per-minute F value is read, regardless of the feed mode.</p> <p>1: Depending on the feed mode, either the programmed feed-per-minute or feed-per-revolution F value is read.</p> <p>bit7: M98 device setting prohibited</p> <p>Select whether to allow the setting of M98 subprogram storage location parameters (#8880 to #8894).</p> <p>0: Allow the setting</p> <p>1: Prohibit the setting of the above parameters.</p>

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1753	cfgPR03
		<p>bit0: The enhanced surface quality mode for OMR-CC</p> <p>Select whether to enable the enhanced surface quality mode for OMR-CC.</p> <p>0: Disable</p> <p>1: Enable</p> <p>bit2: Disable extension of encoder input frequency</p> <p>Specify whether to disable the extension of encoder input frequency range.</p> <p>0: Enable</p> <p>1: Disable</p> <p>bit3: Retention of arbitrary axis exchange control after emergency stop/power off</p> <p>Select whether to retain the axis exchange status by arbitrary axis exchange control after emergency stop or power off.</p> <p>0: Not retain (return to the basic axis configuration)</p> <p>1: Retain</p> <p>bit5: Axis counter: Display axis name selection</p> <p>Select the axis name to be displayed in axis counter.</p> <p>0: Display the axis name set in parameter "#1022 axname2".</p> <p>1: Display the axis name set in parameter "#1022 axname2" or "#1611, #1613, #1615, #1617, #1619 Ax-_Dsp_Name[1]-[5]".</p> <p>bit6: Axis counter: Display axis name retention at reset</p> <p>Select whether to retain the axis name displayed in axis counter at reset.</p> <p>0: Not retain. (The axis name selected with parameter "#12146 I_Ax_Dsp_Name" is displayed.)</p> <p>1: Retain.</p> <p>(Note) This parameter is valid when "#1753 cfgPR03/bit5" is "1".</p> <p>bit7: Axis counter: Display axis name retention at emergency stop/power off</p> <p>Select whether to retain the axis name displayed in axis counter at emergency stop or power-off.</p> <p>0: Not retain. (The axis name selected with parameter "#12146 I_Ax_Dsp_Name" is displayed.)</p> <p>1: Retain.</p> <p>(Note) This parameter is valid when "#1753 cfgPR03/bit5" is "1".</p>
(PR)	#1754	cfgPR04
		<p>bit1: 3-dimensional coordinate conversion_Coordinate system in manual feed</p> <p>This parameter is used to set the coordinate system to be used at power-up in the manual feed mode.</p> <p>0: Machine coordinate system</p> <p>1: The program coordinate system (G68/G68.1) used before power-off</p> <p>bit2: M system tool life management II: tool error status priority</p> <p>Select the tool status update operation by resetting after turning ON the tool error 1 signal (TAL1) or tool error 2 signal (TAL2).</p> <p>0: The tool status changes depending on whether or not a cutting command was issued before the tool error signal was turned ON.</p> <p>•With cutting command: (Used data is less than tool life data) : "1" (Tool in use) (Used data is greater than tool life data) : "2" (Normal life tool)</p> <p>•Without cutting command: "3" (Tool error 1) or "4" (Tool error 2)</p> <p>1: "3" (Tool error 1) or "4" (Tool error 2)</p> <p>(Note) This parameter is valid only when "#1277 ext13/bit0" is set to "1" and M system tool life management II is used.</p>
(PR)	#1756	cfgPR06
		<p>bit1: Improvement of Compound type fixed cycle for turning machining I</p> <p>0: Disable</p> <p>1: Enable</p>

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1759	cfgPR09
		<p>bit0: Disable screen list display</p> <p>Turn off the screen list display via multi-touch gesture (grab operation with four or more points).</p> <p>0: Screen list display ON</p> <p>1: Screen list display OFF</p> <p>bit1: Fixed cursor position</p> <p>Select where the cursor is located after data entry.</p> <p>0: Cursor moves to the next data entry position.</p> <p>1: Unchanged from the original position.</p> <p>bit2: Operation search from Edit screen</p> <p>Specify whether to enable the operation search from Edit screen function.</p> <p>0: Disable</p> <p>1: Enable</p> <p>bit3: Individual NC data backup valid</p> <p>Select whether to output the following NC data individually during backup.</p> <ul style="list-style-type: none"> ♦Program batch file in NC memory/NC memory 2 ♦Tool compensation amount data ♦Common variable data ♦Extended common variable data ♦Workpiece offset data ♦All tool data <p>0: Not output</p> <p>1: Output</p> <p>(Note) Not backed up by automatic backup/master backup.</p> <p>bit4: Edit area change menu additional display</p> <p>Enable/disable the additional display of the edit area change menu ([<--> change]).</p> <p>0: Disable</p> <p>1: Enable</p> <p>(Note) This parameter is valid only when the operation search from Edit screen function is not used ("#1759 cfgPR09/bit2" is "0").</p>

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1760	cfgPR10
		<p>bit0: Machining condition selection screen - Disable setting of condition names</p> <p>Select whether to allow setting of names for the machining conditions.</p> <p>0: Enable the setting</p> <p>1: Disable the setting</p> <p>bit2: Enable HD mode on IPC</p> <p>This parameter specifies whether the NC can run a program stored in the IPC which is connected to the same network.</p> <p>0: A program stored in the IPC cannot be run.</p> <p>1: A program stored in the IPC can be run.</p> <p>(Note 1) This parameter is valid for M80V.</p> <p>(Note 2) The parameter "#11005 PC IP address" needs to be set to enable program operations.</p> <p>bit4: Hide motor temperature</p> <p>Select whether to show/hide the item of the servo unit "Motor temp. (degC)" on the drive monitor screen.</p> <p>0: Show</p> <p>1: Hide</p> <p>bit5: Whether to count a comment block in searching</p> <p>Select whether to count a comment block as one block when searching is performed within a program, including Operation search and Cursor position search.</p> <p>0: Count a comment block as one block</p> <p>1: Not count a comment block</p> <p>bit6: Wear compensation amount edit in Data protection ON</p> <p>Specify whether to enable or disable editing of Wear compensation amount.</p> <p>0: When the data protection key 1 (KEY1) is turned OFF (0), editing is disabled.</p> <p>1: Editing is enabled regardless of whether the data protection key 1 (KEY1) is turned ON or OFF.</p> <p>bit7: Interactive cycle insertion feedrate command selection</p> <p>Specify the command method for the item "Feedrate" of Turning hole cycle and Turning cycle in Interactive cycle insertion.</p> <p>0: Feed per revolution (mm/rev)</p> <p>1: Feed per minute (mm/min)</p>
(PR)	#1761	cfgPR11
		<p>bit0: Plane selection method for Polar coordinate interpolation</p> <p>Specify the selection method of Polar coordinate interpolation plane (G17 - G19).</p> <p>0: The plane whose 1st plane axis is equal to the parameter "#1533 millPax" is specified as a command plane for Polar coordinate interpolation.</p> <p>When the X axis is set, G17 (XY plane) is specified as the Polar coordinate interpolation plane.</p> <p>1: The plane whose 2nd plane axis is equal to the parameter "#1533 millPax" is specified as a command plane for Polar coordinate interpolation.</p> <p>When the Y axis is set, G17 (XY plane) is specified as the Polar coordinate interpolation plane.</p> <p>bit1: Cogging torque compensation ON</p> <p>Select whether to enable cogging torque compensation.</p> <p>0: Disable</p> <p>1: Enable</p> <p>bit6: Machine tool builder macro password management method</p> <p>0: MTB macro password management method type 1</p> <p>Password authentication is set with "#1166 fixpro".</p> <p>1: MTB macro password management method type 2</p> <p>Password authentication is set with "#11796 mmacro".</p>

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1762	cfgPR12
		<p>bit0: NC-HPU optical communication: communication function valid</p> <p>Specify whether to disable/enable communication function in the NC-HPU optical communication.</p> <p>0: Disable (not communicate)</p> <p>1: Enable (communicate)</p> <p>bit1: NC-HPU optical communication: error type</p> <p>Specify the error type of NC-HPU optical communication.</p> <p>0: Z107 0001 "NC-HPU optical communication warning"</p> <p>1: Z107 0002 "NC-HPU optical communication alarm"</p> <p>bit2: NC-HPU optical communication: received data initialization at error</p> <p>Specify whether to initialize the received data or not at the NC-HPU optical communication error.</p> <p>0: Not initialize</p> <p>1: Initialize</p> <p>bit4-3: NC-HPU optical communication: send/receive data size selection</p> <p>Specify the send/receive data size in the NC-HPU optical communication.</p> <p>00: 512 Bytes</p> <p>01: 1024 Bytes</p> <p>10: 2048 Bytes</p> <p>11: 512 Bytes</p> <p>bit5: BiSS encoder I/F valid</p> <p>Specify whether to enable/disable BiSS encoder I/F.</p> <p>0: Disable</p> <p>1: Enable</p> <p>(Note) When "1" is set, external encoder I/F and external encoder position output I/F are invalid.</p> <p>bit6: Z phase detection speed limit</p> <p>Specify whether to limit the Z phase detection speed with S command speed in Spindle/C axis control for Z phase detection.</p> <p>0: Z phase detection speed is not limited with S command speed (conventional operation).</p> <p>1: Z phase detection speed is limited with S command speed.</p> <p>(*) This setting is valid when "1" is set to the parameter "#3106 zrn_tpy/bit3" (Z phase detection operation ON).</p>

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1766	cfgPR16	
bit0: HPU custom module: notification data invalid			
Select whether to reflect the data notified from HPU custom module in NC.			
When Disable is selected, all the data notified from HPU custom module will be invalid, and will not be reflected in NC.			
0: Enable (default)			
1: Disable			
bit2: Suppression of recalculation after FH cancellation			
Recalculation after feed-hold cancellation is suppressed during SSS control to improve response speed.			
0: Do not suppress			
1: Suppress			
bit3: Workshift measurement tool offset No. obtain source selection (For L system only)			
In workpiece coordinate system shift measurement, select the destination for obtaining the tool offset No. that the T command was issued to.			
0: Tool offset No. set on the tool management screen			
1: Tool offset No. set in the PLC device			
(Note) If "#1766 cfgPR16/bit3" is "1" and the tool offset No. is not designated (if the contents are 0), the tool length and tool wear amount will follow the T command modal.			
The T command modal will also be followed if the designated offset No.is not within the specified range.			
If the T command modal value is "0", the compensation amount will be treated as "0".			
bit4: Tool management screen custom data extension			
Select whether to extend custom data of the tool management screen.			
0: Not extend			
1: Extend			
bit6: Customized screen: write detailed screen number			
Select whether to write the detailed screen number in the R register (R216) during a screen transition within one project.			
0: Not write the detailed screen number			
1: Write the detailed screen number			
	#1925	EtherNet	Start of service
Start or stop the Ethernet communication function.			
0: Stop			
1: Start			
(PR)	#1926	Global IP address	IP address
Set the main CPU's IP address.			
Set the NC IP address seen from an external source.			
---Setting range---			
Set these parameters in accordance with the network rules in the connection environment.			
(PR)	#1927	Global Subnet mask	Subnet mask
Set the subnet mask for the IP address.			
---Setting range---			
Set these parameters in accordance with the network rules in the connection environment.			
(PR)	#1928	Global Gateway	Gateway
Set the IP address for the gateway.			
---Setting range---			
Set these parameters in accordance with the network rules in the connection environment.			
	#1929		
Not used. Set to "0".			
	#1930		
Not used. Set to "0".			

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1931	Host number	Host No.
		Set the host's port No.	
		---Setting range---	
		1 to 9999	
(PR)	#1934	Local IP address	
		Set the HMI side CPU's IP address.	
		(Note) This parameter is dedicated to M800VW/M80VW with Windows-based display.	
		---Setting range---	
		Set these parameters in accordance with the network rules in the connection environment.	
(PR)	#1935	Local Subnet mask	
		Set the HMI side CPU's subnet mask.	
		(Note) This parameter is dedicated to M800VW/M80VW with Windows-based display.	
		---Setting range---	
		Set these parameters in accordance with the network rules in the connection environment.	
(PR)	#1953	Intra IP address	IP address on non-Windows-based display unit (LAN1) side
		Specify the IP address on the non-Windows-based display unit (LAN1) side.	
		---Setting range---	
		Set these parameters in accordance with the network rules in the connection environment.	
(PR)	#1954	Intra Subnet mask	Subnet mask on non-Windows-based display unit (LAN1) side
		Specify the IP address of subnet mask on the non-Windows-based display unit (LAN1) side.	
		---Setting range---	
		Set these parameters in accordance with the network rules in the connection environment.	
(PR)	#1955	Intra Gateway	Gateway on non-Windows-based display unit (LAN1) side
		Specify the gateway IP address on the non-Windows-based display unit (LAN1) side.	
		---Setting range---	
		Set these parameters in accordance with the network rules in the connection environment.	
(PR)	#1958	Ext Unit1 IP Addr	Field network communication expansion unit: IP address 1
		Specify the IP address of the field network communication expansion unit installed in the slot EXT3 (or EXT1 for M80V/M800VS).	
		---Setting range---	
		0.0.0.0 to 255.255.255.255	
(PR)	#1959	Ext Unit1 Sub mask	Field network communication expansion unit: subnet mask 1
		Specify the subnet mask of the field network communication expansion unit installed in the slot EXT3 (or EXT1 for M80V/M800VS).	
		---Setting range---	
		0.0.0.0 to 255.255.255.255	
(PR)	#1960	Ext Unit1 Gateway	Field network communication expansion unit: gateway 1
		Specify the gateway of the field network communication expansion unit installed in the slot EXT3 (or EXT1 for M80V/M800VS).	
		---Setting range---	
		0.0.0.0 to 255.255.255.255	

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#1961	Ext Unit2 IP Addr	Field network communication expansion unit: IP address 2
Specify the IP address of the field network communication expansion unit installed in the slot EXT4 (or EXT2 for M80V/M800VS).			
---Setting range---			
0.0.0.0 to 255.255.255.255			
(PR)	#1962	Ext Unit2 Sub mask	Field network communication expansion unit: subnet mask 2
Specify the subnet mask of the field network communication expansion unit installed in the slot EXT4 (or EXT2 for M80V/M800VS).			
---Setting range---			
0.0.0.0 to 255.255.255.255			
(PR)	#1963	Ext Unit2 Gateway	Field network communication expansion unit: gateway 2
Specify the gateway of the field network communication expansion unit installed in the slot EXT4 (or EXT2 for M80V/M800VS).			
---Setting range---			
0.0.0.0 to 255.255.255.255			
(PR)	#11001	APC type	APC screen display type selection
Set the type of screen displayed with the pallet program registration screen.			
0: Standard pallet registration screen			
1: Pallet 4-page registration screen			
(PR)	#11002	Valid pallet num	Number of pallets setting
Set the number of pallets validated on the pallet program registration screen.			
---Setting range---			
2 to 12 (Interpreted as 2 when 0 is set.)			
(PR)	#11003	APLC valid	APLC valid
Temporarily disable APLC.			
Normally set "1".			
0: Disable			
1: Enable			
(PR)	#11004	PLCauto-run enable	PLC automatic startup valid
Select starting condition of the built-in PLC.			
0: Start PLC after NC screen startup			
1: Start PLC at NC startup			
(Note) When standard NC screen is not used, set "1".			
(PR)	#11005	PC IP address	IP address setting
Set the IP address of the display unit or the PC in which machining programs are stored (or the IP address of the IPC for M80V).			
Set the IP address of the display unit which is powered OFF with the Auto power OFF function.			
When the 3D machine interference check function is enabled, set the IP address of the display unit to be used for the 3D machine interference check (for M800VW only).			
(Note) When "0.0.0.0" is entered, "192.168.100.2" is automatically assigned.			
PC Subnet			
Set the subnet mask for the display unit or PC in which machining programs are stored.			
PC Gateway			
Set the gateway for the display unit or PC in which machining programs are stored.			
---Setting range---			
0.0.0.0 to 255.255.255.255			

15 Machine Parameters

15.3 Base Common Parameters

	#11006	PC Port number	Port No. setting
			<p>Set the port No. for the display unit or PC in which machining programs are stored.</p> <p>(Note 1) When "0" is input, "55555" is automatically set.</p> <p>(Note 2) When changing the parameter, set the same value in "PD_Control_Port" in the PC side environment setting file.</p> <p>---Setting range---</p> <p>0 to 65535</p>
(PR)	#11007	PC Timeout	Communication timeout time setting
			<p>Set the NC side communication timeout time.</p> <p>Set the timeout time for the display unit to be shut down upon automatic power OFF request.</p> <p>(Note 1) When "0" is input, "120" is automatically set.</p> <p>(Note 2) When the value greater than "300" is set, a setting error occurs.</p> <p>(Note 3) When changing the parameter, set the same value in "PD_Time_out" in the PC side environment setting file.</p> <p>---Setting range---</p> <p>0 to 300 (s)</p>
(PR)	#11009	M2 label O	M2 label O
			<p>Select the program number label when using the M2 format.</p> <p>0: Label L</p> <p>1: Label O</p>
(PR)	#11010	Software keyboard	Software keyboard
			<p>Select whether or not to use a software keyboard on a touchscreen.</p> <p>0: Not use (Note 1)</p> <p>1: Use (no automatic display)</p> <p>2: Use (The keyboard appears automatically on a specific screen or upon Y/N confirmation)</p> <p>3: Use (The keyboard appears automatically upon Y/N confirmation)</p> <p>(Note 1) If no NC keyboard is connected, the screen shows the software keyboard button.</p>
	#11011	Handy TERM. PW.	Handy terminal password
			<p>Set the password used for the handy terminal customized downloading.</p> <p>Blank (when "0" is set) and "0000" are regarded as no password.</p> <p>Not the password of a new customizing file but the password of the customizing file downloaded to the last handy terminal is set.</p> <p>Set blank or "0000" when initially downloading.</p> <p>---Setting range---</p> <p>0000 to 9999</p>
(PR)	#11012	16 axes for 1ch	Connecting 16 axes for 1ch
			<p>Select the maximum number of axes (sum of the NC axis, spindle, and PLC axis) connected to the drive unit interface (channel 1).</p> <p>0: Up to 8 axes can be connected to channel 1.</p> <p>1: Up to 16 axes can be connected to channel 1. This parameter is disabled when the extension unit is connected. It is possible to connect only up to eight axes or less per channel.</p>
	#11013	3D_MChk	Invalidate 3D machine interference check
			<p>Select whether to enable the 3D machine interference check function.</p> <p>0: Enable</p> <p>1: Disable</p>
	#11014	Chk_len1	1st-step interference check distance
			<p>Set the 1st-step check distance when in 3D machine interference check mode.</p> <p>The standard value is "30.000".</p> <p>---Setting range---</p> <p>0.000 to 99999.999 (mm)</p>

15 Machine Parameters

15.3 Base Common Parameters

#11015		Chk_len2	2nd-step interference check distance
		Set the 2nd-step check distance when in 3D machine interference check mode. The standard setting value is "5.000".	
		---Setting range---	
		0.000 to 99999.999 (mm)	
#11016		Expand_Rate	Shape expansion rate
		Set the model shape expansion rate to be used for 3D machine interference check. This parameter is used for expanding a model shape to be used for 3D machine interference check. The interference check is performed using a shape expanded by the amount of [Check length (mm) x Shape expansion rate (%)].	
		---Setting range---	
		0 to 300 (%)	
#11017		T-ofs set at run	Tool compensation amount setting during automatic operation enabled
		Select whether to enable the tool compensation amount setting and life value setting during automatic operation and operation pause.	
		0: Disable	
		1: Enable	
#11018		M password hold	Machine user password is held
		When set to "1", the "Machine user" (operation level 6) password will be held even if the NC is restarted.	
		0: Do not hold	
		1: Machine user password is held	
(PR)	#11019	2-system display	2-part system simultaneous display
		Select whether to enable simultaneous display of multiple part systems on the monitor screen.	
		0: Display one part system on the monitor screen.	
		1, 2: Display two part systems simultaneously on the monitor screen.	
		3: Display three part systems simultaneously on the monitor screen. Note that this is enabled for a 15- or 19-type display unit only.	
		4: Display four part systems simultaneously on the monitor screen. Note that this is enabled for a 15- or 19-type display unit only.	
		(Note 1) If the number of part systems to display is smaller than that of the simultaneous display, a single part system display is selected.	
		(Note 2) If you select "3" or "4" for any display unit other than 15- or 19-type, a single part system display is selected.	
#11021		PLC mesg disp type	Format of PLC alarm and operator message
		Select the format of PLC alarms and operator messages to be displayed on the bottom right of the screen.	
		0: Display up to the first 40 characters.	
		1: If text is longer than 40 characters, divide it into two and display separately. (Supplementary information is displayed together)	
#11022		SRAM Output Type	
		Not used. Set to "0".	
#11023		G33.n Drn	
		Not used. Set to "0".	
#11024		G33.n fhd	
		Not used. Set to "0".	

15 Machine Parameters

15.3 Base Common Parameters

	#11028	Tolerance Arc Cent	Tolerable correction value of arc center error
		Set the tolerable correction value for the calculated coordinate value error of R-specified circular center. When a difference between "a line between the start and end points" and "commanded radius x 2" is the tolerance or smaller, the error is corrected so that the middle of a line between the start and end points will be the arc center. When [Setting value < 0]: 0 (Not correct arc center error) When [Setting value = 0]: 0.002 mm When [Setting value > 0]: Setting value ---Setting range--- <Metric system> -1 to 0.100 (mm) <Inch system> -0.0393 to 0.0039 (inch)	
	#11029	Arc to G1 no Cent	Change command from arc to linear when no arc center designation
		When arc center or radius designation is omitted from arc command, change the arc command into linear without causing program error. 0: Program error 1: Change into linear command	
	#11030	Man tap sync cancel	Synchronization cancel in manual synchronous tapping
		Select whether handle feed of the tapping axis in manual synchronous tapping synchronizes with the spindle or not. 0: Synchronize with the spindle 1: Not synchronize with the spindle	
(PR)	#11031	Cursor pos search	Cursor position search
		Select the cursor position searching method. 0: Disable 1: Pressing the INPUT key in [Monitr] - [Edit] menu starts the operation search for the block with the cursor. 2: Turning ON/OFF the "Edit/Search" signal in [Monitr] - [Edit] menu starts the operation search for the block with the cursor. 3: Turning ON/OFF the "Edit/Search" signal in [Monitr] - [Edit] menu starts the operation search for the block with the cursor. Pressing the reset key shows the top of the program on the [Edit/Search] window.	
(PR)	#11032	Menu sel para lkof	Validate menu selection parameter setting
		Enable the setting of the menu selection parameters, with which the order of main menus on Monitor, Setup and Edit screens can be rearranged. And also select who is allowed to do this setting. 0: Disable 1: Enable (machine tool builder password is required) 2: Enable (users are allowed to set)	

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#11033	skipB_no_sens	Unconnected sensor selection when skip is set to contact B
			<p>Select the contact of the sensor which you wish to set as unconnected, when the skip signal is set to contact B. Set "1" for the contact to be unconnected.</p> <p>bit0: Skip input 1 bit1: Skip input 2 bit2: Skip input 3 bit3: Skip input 4 bit4: Skip input 5 bit5: Skip input 6 bit6: Skip input 7 bit7: Skip input 8</p> <p>(Note 1) This parameter is enabled when "#1258 set30/bit0" is set to "1". (Note 2) This parameter is independent of PLC skip.</p> <p>---Setting range--- 00000000 to 11111111 (Binary)</p>
	#11034	G12AddrCheckType	Command address type to check in circular cutting
			<p>Select the type of command address to check in circular cutting.</p> <p>0: Regard command addresses other than D, F, I as illegal. 1: Regard the command address H as illegal. And commands other than D,F,I and M,S,T,B are disabled.</p>
	#11035	Sys. change limit	Part system switching restriction
			<p>This restricts switching the part systems displayed on screen.</p> <p>0: Not restrict 1: Disable the part system switching by pressing [\$<->\$] key on touch panel. 2: Disable the part system switching by display switch signals(Y730 to Y733).</p>
	#11036	meas dir judge	Non-sensitive band for manual measurement direction judgment (for M system only)
			<p>Set the non-sensitive band to be used for judging the manual measurement direction. If the feedback position fluctuates widely at the axis stop, set the fluctuation width or larger value in this set the parameter. When set to "0", the band will be 1 (μm).</p> <p>---Setting range--- 0 to 1000 (μm) 0: 1 (μm)</p>
	#11037	R-Navi Index Type	R-Navi machining surface indexing type
			<p>Select the machining surface indexing type in the R-Navi function.</p> <p>0: Indexing type 1 (Only rotary axes move to perform indexing) 1: Indexing type 2 (Indexing is performed with the tool center point fixed to the position seen from the work-piece)</p>
	#11038	T disp typ	T display (tool command value) type (For L system only)
			<p>Select the T display (tool command value) type on the monitor screen between displaying tool No. only or displaying tool No. and compensation No. (L system only)</p> <p>0: Display tool No. only 1: Display the tool command value (the combined value consisting of the tool No. and compensation No.) last commanded by the program. Even in a manual value command, the program's tool command value is displayed.</p>

15 Machine Parameters

15.3 Base Common Parameters

	#11039	Cusr pos srch type	Cursor position search type
		Set the availability of the cursor position search during single block stop when "#11031 Cursor pos search" is any of "1" to "3". 0: Disable cursor position search during single block stop. 1: Enable cursor position search during single block stop. Sub-program is displayed when selecting menus [Monitr]-[Edit] while single block stop is carried out during sub-program with this parameter set to 1.	
	#11051	Direct Socket ON	Direct Socket communication I/F ON
		Select ON/OFF of the Direct Socket communication I/F. 0: OFF (Default) 1: ON (Note) When the Direct Socket communication I/F is ON, applications that uses "#1926 Global IP address" such as MS Configurator and GX Developer cannot be used.	
	#11052	LOG Sort Order	Log data sorting order
		Select in which order to sort the operation log files (all logs) to be output. 0: Sort the data in chronologically ascending order separately for each log type. 1: Sort the data in chronologically ascending order for all the log types. If the times and dates logged are identical, the log files are output in the order of key, touchscreen, alarm, PLC signal, tool offset change, workpiece offset change and AC power.	
(PR)	#11053	UserProgramStorage	User program storage destination
		Specify the device to store user programs. When subprogram is called, the subprograms in the device specified by this parameter are searched. Programs other than user programs (e.g., MTB macro programs, fixed cycle programs) are stored in fixed areas regardless of the setting of this parameter. 0: Memory 1: HD (Example) M98 P (Program No.) The device specified by "#11053 UserProgramStorage" is searched. (Note) If the subprogram to be called does not exist in the specified device, a program error occurs.	
	#11054	Sp-stby disp type	Spindle-standby display type
		Specify which magazine to display when Sp-stby is selected on the Spindle standby or Tool registration screen. 0: Fixed to the magazine #1 1: The magazine selected by the menu (Magazine 1 to Magazine 5).	
	#11055	Disp. sysno	Number of part systems to display
		Specify how many part systems to display on a screen. 0: The same number as that of the enabled part systems 1 or greater: The number specified by this parameter serves as that of the part systems to display. (Note) The setting range differs according to the NC model. For the number of part systems displaying in the operating state, follow this parameter setting. ---Setting range--- 0 to 8	
(PR)	#11056	Workshift invalid	Workpiece coordinate system shift OFF (For L system only)
		Set this parameter to 1 if you wish to disable the workpiece coordinate system shift function. 0: Enable the workpiece coordinate shift function 1: Disable the workpiece coordinate shift function	

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#11058	plc_opemsg0	Operator messages display device
<p>Set the No. of F device to specify the displayed operator message. Device specified with this parameter is treated as No.1, and displays up to 4 operator messages corresponding to F device that is ON. This parameter is valid when #6455/bit3 is 0. (Note 1) Use from F1024 when "0" is set. (Note 2) Set the device No. to be a multiple of 32. When other value is input, a setting error occurs.</p> <p>---Setting range--- 0 to 2016</p>			
(PR)	#11059	Remote comm enable	Remote connect enabled
<p>Select whether to enable the remote communication. 0: Disabled 1: Enabled</p>			
(PR)	#11060	Screen theme color	Select screen theme colors
<p>Select the screen theme colors. This selection affects the colors of the entire screen. 0: Standard colors (gray tone) 1: Blue tone</p>			
(PR)	#11061	Num of EcoMonitors	The Number of EcoMonitorLight connected to CNC
<p>Specify how many EcoMonitorLight units (an energy meter made by Mitsubishi Electric for measuring the consumption and regeneration) are connected to the CNC.</p> <p>---Setting range--- 0: None 1 to 16: Number of connected modules Default 0</p>			
(PR)	#11062	NoHistDevIn.1	History exclusion PLC input signal 1
<p>Specify the PLC input signal (X) that is excluded from the PLC signal log. Efficiency of the history analysis is improved by excluding the machine contact input/output signals or other frequently switched signals from the signal log. When "0" is set, the history exclusion PLC input signal is disabled. Thus X0 cannot be excluded from the signal log.</p> <p>---Setting range--- 0000 to 1FFF (hexadecimal)</p>			
(PR)	#11063	NoHistDevIn.2	History exclusion PLC input signal 2
<p>Specify the PLC input signal (X) that is excluded from the PLC signal log. Efficiency of the history analysis is improved by excluding the machine contact input/output signals or other frequently switched signals from the signal log. When "0" is set, the history exclusion PLC input signal is disabled. Thus X0 cannot be excluded from the signal log.</p> <p>---Setting range--- 0000 to 1FFF (hexadecimal)</p>			
(PR)	#11064	NoHistDevIn.3	History exclusion PLC input signal 3
<p>Specify the PLC input signal (X) that is excluded from the PLC signal log. Efficiency of the history analysis is improved by excluding the machine contact input/output signals or other frequently switched signals from the signal log. When "0" is set, the history exclusion PLC input signal is disabled. Thus X0 cannot be excluded from the signal log.</p> <p>---Setting range--- 0000 to 1FFF (hexadecimal)</p>			

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#11065	NoHistDevIn.4	History exclusion PLC input signal 4
			<p>Specify the PLC input signal (X) that is excluded from the PLC signal log.</p> <p>Efficiency of the history analysis is improved by excluding the machine contact input/output signals or other frequently switched signals from the signal log.</p> <p>When "0" is set, the history exclusion PLC input signal is disabled.</p> <p>Thus X0 cannot be excluded from the signal log.</p> <p>---Setting range---</p> <p>0000 to 1FFF (hexadecimal)</p>
(PR)	#11066	NoHistDevIn.5	History exclusion PLC input signal 5
			<p>Specify the PLC input signal (X) that is excluded from the PLC signal log.</p> <p>Efficiency of the history analysis is improved by excluding the machine contact input/output signals or other frequently switched signals from the signal log.</p> <p>When "0" is set, the history exclusion PLC input signal is disabled.</p> <p>Thus X0 cannot be excluded from the signal log.</p> <p>---Setting range---</p> <p>0000 to 1FFF (hexadecimal)</p>
(PR)	#11067	NoHistDevOut.1	History exclusion PLC output signal 1
			<p>Specify the PLC output signal (Y) that is excluded from the PLC signal log.</p> <p>Efficiency of the history analysis is improved by excluding the machine contact input/output signals or other frequently switched signals from the signal log.</p> <p>When "0" is set, the history exclusion PLC output signal is disabled.</p> <p>Thus Y0 cannot be excluded from the signal log.</p> <p>---Setting range---</p> <p>0000 to 1FFF (hexadecimal)</p>
(PR)	#11068	NoHistDevOut.2	History exclusion PLC output signal 2
			<p>Specify the PLC output signal (Y) that is excluded from the PLC signal log.</p> <p>Efficiency of the history analysis is improved by excluding the machine contact input/output signals or other frequently switched signals from the signal log.</p> <p>When "0" is set, the history exclusion PLC output signal is disabled.</p> <p>Thus Y0 cannot be excluded from the signal log.</p> <p>---Setting range---</p> <p>0000 to 1FFF (hexadecimal)</p>
(PR)	#11069	NoHistDevOut.3	History exclusion PLC output signal 3
			<p>Specify the PLC output signal (Y) that is excluded from the PLC signal log.</p> <p>Efficiency of the history analysis is improved by excluding the machine contact input/output signals or other frequently switched signals from the signal log.</p> <p>When "0" is set, the history exclusion PLC output signal is disabled.</p> <p>Thus Y0 cannot be excluded from the signal log.</p> <p>---Setting range---</p> <p>0000 to 1FFF (hexadecimal)</p>
(PR)	#11070	NoHistDevOut.4	History exclusion PLC output signal 4
			<p>Specify the PLC output signal (Y) that is excluded from the PLC signal log.</p> <p>Efficiency of the history analysis is improved by excluding the machine contact input/output signals or other frequently switched signals from the signal log.</p> <p>When "0" is set, the history exclusion PLC output signal is disabled.</p> <p>Thus Y0 cannot be excluded from the signal log.</p> <p>---Setting range---</p> <p>0000 to 1FFF (hexadecimal)</p>

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#11071	NoHistDevOut.5	History exclusion PLC output signal 5
<p>Specify the PLC output signal (Y) that is excluded from the PLC signal log.</p> <p>Efficiency of the history analysis is improved by excluding the machine contact input/output signals or other frequently switched signals from the signal log.</p> <p>When "0" is set, the history exclusion PLC output signal is disabled.</p> <p>Thus Y0 cannot be excluded from the signal log.</p> <p>---Setting range---</p> <p>0000 to 1FFF (hexadecimal)</p>			
(PR)	#11080	HomeScreen display	HomeScreen display
<p>Select whether to display the home screen.</p> <p>0: Not display</p> <p>1: Display (display at power ON)</p> <p>2: Display (not display at power ON)</p>			
(PR)	#11082	Lsys_change_Gtype	L system G code system after program format switch (for M system only)
<p>When switching the program format from M system to L system with program format switch command (G188) or when switching G code guidance from M system to L system by the menu [Edit]-[Guide M/L], the G code systems after switching follow the setting of this parameter.</p> <p>0: L system G code system 2</p> <p>1: L system G code system 3</p> <p>2: L system G code system 4</p> <p>3: L system G code system 5</p> <p>4: L system G code system 6</p> <p>5: L system G code system 7</p>			
	#11085	ExtSBSPrgSelect	Sub part system program storage location in external device
<p>Select the storage location (in an external device) of a machining program that is run in a sub part system under the sub part system control 1 or 2.</p> <p>0: The location specified by #12091 and #12092</p> <p>1: The location specified by #12093 and #12094</p> <p>(Note) This parameter is enabled when #11053 is "1".</p>			
	#11086	rot_angle_dsp	Counter display during coordinate rotation
<p>Select the type of counter display (workpiece coordinate position, relative position and absolute position) while #8116 is 0 (coordinate rotation by parameter is enabled).</p> <p>0: Display the position relative to the orthogonal coordinate system.</p> <p>1: Display the position relative to the coordinate system rotated through the coordinate rotation by parameter. (with EXT [external workpiece coordinate offset] added during automatic operation)</p> <p>2: Display the position relative to the coordinate system rotated through the coordinate rotation by parameter. (with EXT [external workpiece coordinate offset] constantly added)</p>			
(PR)	#11087	Meas basic point	Tool length measurement I reference point (for L system only)
<p>Select how to specify the measurement reference point coordinates for manual tool length measurement I (L system).</p> <p>0: Use the machine zero point as the reference point</p> <p>1: Use the coordinates of "#2015 tlmI-" as the reference point (the same operation as when #1282 bit2 = 0 for M7)</p> <p>2: Use the workpiece coordinate system offset (modal) as the reference point (the same operation as when #1282 bit2 = 1 for M7)</p>			
	#11091	PLC counter valid	Enable PLC axis counter
<p>Select whether to have the monitor screen show a PLC axis position counter.</p> <p>0: Monitor screen does not show a PLC axis position counter.</p> <p>1: Depending on the selected counter type, monitor screen is able to show.</p>			

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#11094	GX Restriction	Inhibiting GX Developer/GX Works2 connection
		Select whether to block the connection from GX Developer/GX Works2. 0: Allow the connection 1: Block the connection	
	#11100	3D_MChk_ToolAlm	Alarm when tool interference check is disabled
		Select whether the 3D machine interference check outputs an alarm or not when the tool is not mounted. 0: Not output an alarm when the tool check is disabled or the tool is not mounted. 1: Output an alarm when the tool check is disabled or the tool is not mounted.	
(PR)	#11101- 11140	Monitr menu(MTB)1-40	Monitor main menu (MTB) 1 to 40
		Designate the destination menu Nos. to move monitor screen's main menus. -1: Menu not displayed 0: No change 1 to 40: Destination menu No.	
(PR)	#11151- 11180	Setup menu (MTB) 1-30	Setup main menu (MTB) 1 to 30
		Designate the destination menu Nos. to move setup screen's main menus. -1: Menu not displayed 0: No change 1 to 30: Destination menu No.	
(PR)	#11201- 11230	Edit menu(MTB) 1-30	Edit main menu (MTB) 1 to 30
		Designate the destination menu Nos. to move edit screen's main menus. -1: Menu not displayed 0: No change 1 to 30: Destination menu No.	
(PR)	#11251- 11280	Diagn menu(MTB)1-30	Diagn main menu (MTB) 1 to 30
		Designate the destination menu Nos. to move diagn screen's main menus. -1 : Not display the menu 0: No change 1 to 30: Destination menu No.	
(PR)	#11301- 11330	Mainte menu(MTB)1-30	Mainte main menu (MTB) 1 to 30
		Designate the destination menu Nos. to move mainte screen's main menus. -1 : Not display the menu 0: No change 1 to 30: Destination menu No.	

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#11351-11366	manasel_00-manasel_15	Multi-analog input data type ch0 to ch15
			<p>Select the type of data to be input to the multi-analog input unit.</p> <p>0: Analog voltage</p> <p>1: Analog current</p> <p>2: Temperature (resistance thermometer bulb, normal, Pt100, 3-wire)</p> <p>3: Temperature (resistance thermometer bulb, normal, Pt100, 4-wire)</p> <p>4: Temperature (resistance thermometer bulb, normal, Pt1000, 3-wire)</p> <p>5: Temperature (resistance thermometer bulb, normal, Pt1000, 4-wire)</p> <p>6: Temperature (resistance thermometer bulb, high-accuracy, Pt100, 3-wire)</p> <p>7: Temperature (resistance thermometer bulb, high-accuracy, Pt100, 4-wire)</p> <p>8: Temperature (resistance thermometer bulb, high-accuracy, Pt1000, 3-wire)</p> <p>9: Temperature (resistance thermometer bulb, high-accuracy, Pt1000, 4-wire)</p> <p>10: Temperature (thermocouple (K))</p> <p>11: Temperature (thermocouple (J))</p>
(PR)	#11376	BiSS_enc_rate	BiSS encoder communication speed
			<p>Set the speed of communication with BiSS encoder.</p> <p>0: 5MHz</p> <p>1: 3.33MHz</p> <p>2: 2.5MHz</p> <p>3: 2MHz</p> <p>4: 1.67MHz</p> <p>5: 1.43MHz</p> <p>6: 1.25MHz</p> <p>7: 1.11MHz</p> <p>8: 1MHz</p> <p>9: 0.91MHz</p> <p>10: 0.83MHz</p> <p>11: 0.77MHz</p> <p>12: 0.71MHz</p> <p>13: 667kHz</p> <p>14: 625kHz</p>
(PR)	#11377	BiSS_enc1_dat_leng	BiSS encoder 1 data length
			<p>Set the data length (number of bits) for BiSS encoder.</p> <p>(Note) When "0" is set, the data length defaults to 1 bit.</p> <p>---Setting range---</p> <p>0 to 64</p>
(PR)	#11378	BiSS_enc1_CRC_slct	BiSS encoder 1 CRC selection
			<p>Select the CRC generating polynomial used for communication with BiSS encoder.</p> <p>0: CRC generating polynomial = 0x43</p> <p>1: CRC invalid</p> <p>2: CRC generating polynomial = 0xB</p> <p>3: CRC generating polynomial = 0x13</p> <p>4: CRC generating polynomial = 0x25</p> <p>5: CRC generating polynomial = 0x89</p> <p>6: CRC generating polynomial = 0x12F</p> <p>7: CRC generating polynomial = 0x190D9</p> <p>8: Custom</p> <p>(Note) When "8" is set, enter a CRC generating polynomial into parameter "#11379 BiSS_enc1_CRC_cstm".</p>

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#11379	BiSS_enc1_CRC_cstm	BiSS encoder 1 CRC (custom)
Set a CRC generating polynomial in this parameter when parameter "#11378 BiSS_enc1_CRC_slct" is set to "8: Custom". (Note) When "0" is set, the CRC generating polynomial defaults to "1". ---Setting range--- 0 to FF (HEX)			
(PR)	#11380	BiSS_enc1_CRC_init	BiSS encoder 1 CRC default value
Set the default value of CRC used in communication with BiSS encoder. ---Setting range--- 0 to FFFF (HEX)			
(PR)	#11386	BWD_INT	Brake wear diagnostics interval
Specify the period of time that the NC operates after the brake wear diagnosis is completed before the brake wear diagnostics incomplete signal (BWDNFm) is next turned on. If set to "0", the interval is 8 hours. ---Setting range--- 0 to 255 hours			
(PR)	#11387	BWD_INIT_NF	Brake wear diagnostics incomplete state at power-on
Select whether to activate the brake wear diagnostics incomplete state at power-on. 0: Activate the brake wear diagnostics incomplete state. 1: Not activate the brake wear diagnostics incomplete state.			
(PR)	#11481	MCR valid	Motion control release valid
Select whether to enable motion control release. 0: Disable 1: Enable			
	#11482	ValBlkStopSelect	System variable #3006 block stop switch
Specify the behavior when the system variable #3006 (message display and stop) is commanded during Suppression of single block stop (#3003/bit0 = 1) of system variable. 0: Block stop is not executed with #3006 command. 1: Block stop is executed with #3006 command.			
(PR)	#11484	Spec_valid	Specification valid
Specify whether to enable the specification of each function. bit0: 3D machine interference check specification enabled 0: Disable 1: Enable (Note) This parameter is valid for M80VW. ---Setting range--- 0x00 to 0xFF (hexadecimal)			
	#11669	EMG F_disp Filt	Actual feedrate detection cycle for displaying F during emergency stop
Adjust the axis travel detection cycle for displaying actual feedrate (F) during emergency stop. Increasing the magnification leads to smaller fluctuations in the actual feedrate readout (F). 0: Standard setting (1-fold) 1: 0.25-fold 2: 0.5-fold 3: 1-fold 4: 2-fold 5: 4-fold 6: 8-fold (Note) This parameter is enabled when "#1125 real_f (Actual feedrate display)" is "1".			

15 Machine Parameters

15.3 Base Common Parameters

#11670	AmpFeedRate_VCC	Vibration amplitude-to-feed ratio
	<p>This parameter specifies the ratio of vibration amplitude to feed per spindle revolution. (Vibration cutting control is conducted with the amplitude of feed per spindle revolution multiplied by the amplitude-feed ratio.) If this parameter is set to "0", the ratio will be 2.00.</p> <p>---Setting range---</p> <p>0 to 9.99</p>	
#11671	AmpFeedRateMax_VCC	Maximum value of amplitude-to-feed ratio
	<p>This parameter specifies the maximum value of the vibration amplitude-to-feed ratio. If this parameter is set to "0", the maximum value will be 9.99.</p> <p>---Setting range---</p> <p>0 to 9.99</p>	
#11673	VibType_VCC	Vibration waveform type
	<p>This parameter specifies the type of the vibration waveform.</p> <p>0: Triangular wave 1: Sine wave 2: Rectangular wave</p>	
#11678	VibPerRevMax_VCC	Maximum number of vibrations per spindle revolution
	<p>This parameter specifies the maximum number of vibrations per spindle revolution. If this parameter is set to "0", the maximum number will be 31.50.</p> <p>The frequency range selected for the VCC mode is switched as follows according to this parameter: When in the range of 0.10 to 6.50: 5.63 to 281.25 (Hz) When "0" or in the range of 6.51 to 31.50: 28.13 to 281.25 (Hz)</p> <p>---Setting range---</p> <p>0, 0.10 to 31.50 (oscillations)</p>	
#11686	Spec_VCC	
	<p>bit5: Unit for Upper limit of frequency</p> <p>Select the unit for the upper frequency limit setting (#12131). 0: 1 Hz 1: 0.01 Hz (Example) If "#12131 FrqClmpSys_VCC" is set to "300", the upper frequency limit is 300 (Hz) when this parameter is set to "0" and 3.00 (Hz) when this parameter is set to "1".</p> <p>bit6: Spindle speed control method</p> <p>Select the spindle speed control method to be used during the vibration cutting mode.</p> <p>0: The control method is automatically switched according to the constant surface speed control status of the selected spindle at the start of the vibration cutting mode.</p> <ul style="list-style-type: none"> •When constant surface speed control is ON, the variable spindle speed method is in effect. •When constant surface speed control is OFF, the fixed spindle speed selection method is in effect. <p>1: Variable spindle speed method is always in effect.</p>	
#11687	AmpDspCorrRate_VCC	Vibration amplitude-to-feed ratio: screen display compensation magnification
	<p>Specify the screen display compensation magnification for vibration amplitude-to-feed ratio when tool path is computed on the vibration cutting control screen.</p> <p>The vibration amplitude-to-feed ratio used to compute the tool path is the vibration amplitude-to-feed ratio entered on the vibration cutting control screen multiplied by this parameter.</p> <p>When "0" is set, it is treated as 1.00.</p> <p>---Setting range---</p> <p>0, 0.10 to 1.00</p>	

15 Machine Parameters

15.3 Base Common Parameters

#11700	EM Cmn No	Starting common variable No. for storage of error measurement result
		<p>Specify the starting number of common variables that store the measurement result.</p> <p>Eight common variables starting from the specified number are used.</p> <p>Specify the No. of common variable that is common to part systems.</p> <p>* Select the number so that eight common variables beginning with the selected number are all common to part systems.</p> <p>---Setting range---</p> <p>0, 100 to 142, 400 to 992, 100100 to 800192, 900000 to 907392</p>
#11701	WEM Mcr No	Macro No. for workpiece installation error measurement
		<p>Specify the name of macro program for the workpiece installation error measurement.</p> <p>The macro program name is output at initialization of workpiece installation error measurement macro.</p> <p>The macro program is used for execution of the measurement.</p> <p>---Setting range---</p> <p>0, 9000 to 9099, 9300 to 9999, 100010000 to 100018999, 100030000 to 199999998</p>
#11702	Ref Sphere Dia	Reference sphere diameter
		<p>Specify the diameter of reference sphere that is used for rotation center error measurement.</p> <p>If the set value is significantly different from the actual diameter, the sensor may be damaged.</p> <p>---Setting range---</p> <p>0.000, 1.000 to 100.000 (mm)</p>
#11704	PrcssAnalysis	
		Not used. Set to "0".
(PR) #11708	F-bus 1 Err Switch	Fieldbus communication error switch 1
		<p>Select whether to activate emergency stop or display a warning if an error occurs on the Fieldbus expansion card mounted in the slot EXT3 (or EXT1 for M80V/M800VS).</p> <p>(Note) The parameter does not apply to a CC-Link expansion card.</p> <p>0: Emergency stop</p> <p>1: Warning display</p>
(PR) #11709	F-bus 2 Err Switch	Fieldbus communication error switch 2
		<p>Select whether to activate emergency stop or display a warning if an error occurs on the Fieldbus expansion card mounted in the slot EXT4 (or EXT2 for M80V/M800VS).</p> <p>(Note) The parameter does not apply to a CC-Link expansion card.</p> <p>0: Emergency stop</p> <p>1: Warning display</p>
#11716	CutEdgeAngleType	Turning tool shape compensation: setting method of cutting-edge angle
		<p>Select the method of specifying the cutting-edge angle that is used for turning-tool shape compensation in Compound type fixed cycle for turning machining I.</p> <p>0: Tool shape method</p> <p>1: Tool compensation method</p>
(PR) #11717	astap_sysno	Analog spindle synch tap: Part system selection
		<p>Select the part system to which the analog spindle synchronous tapping cycle is applied.</p> <p>When 0 is set, the part system 1 is considered to be selected.</p> <p>---Setting range---</p> <p>0 to 8</p>

15 Machine Parameters

15.3 Base Common Parameters

	#11718	astap_timeadj	Analog spindle synch tap: Timing adjustment
			<p>This parameter enables you to adjust the motion start timing of the tap axis and the spindle in analog spindle synchronous tapping.</p> <p>(1) When the setting = 0 Not adjust the timing.</p> <p>(2) When the setting > 0 Delay the start of tap axis command by the specified length of time. This is effective when the analog spindle lags behind the tap axis.</p> <p>(3) When the setting < 0 Delay the start of analog spindle command by the specified length of time. This is effective when the analog spindle runs ahead of the tap axis.</p> <p>---Setting range---</p> <p>-50 to 50 (ms)</p>
	#11719	astap_Fbadj	Synchronous tapping with analog I/F spindle: compensation factor
			<p>When the synchronous tapping with analog I/F spindle is active, the compensation amount for the spindle rotation speed is calculated using the feedback. The compensation amount can be adjusted by the factor specified in this parameter.</p> <p>---Setting range---</p> <p>0 to 300 (%)</p>
	#11720	astap_filt	Synchronous tapping with analog I/F spindle: filter time constant
			<p>When the synchronous tapping with analog I/F spindle is active, the first-order lag filter is applied to compensate the spindle rotation speed. The time constant of the filter is specified by this parameter.</p> <p>---Setting range---</p> <p>0 to 500 (ms)</p>
	#11721	astap_Fbtime	Synchronous tapping with analog I/F spindle: feedback time lag
			<p>When the synchronous tapping with analog I/F spindle function is active, there may be a time lag between the command issued to the spindle and the feedback sent from the encoder. The time lag can be corrected by entering the length of time in this parameter.</p> <p>---Setting range---</p> <p>0 to 50 (ms)</p>
(PR)	#11761	PLC Security Mode	Enhanced PLC security mode
			<p>Select the type of the enhanced PLC security mode.</p> <p>0: No mode (invalid)</p> <p>1: Write-protection mode</p> <p>2: Read/Write-protection mode</p>
(PR)	#11762	E/U Project No.	End-user project number
			<p>Select the number of the project which can be used as "E/U project" by end users.</p> <p>When "0" is set, the end-user mode is disabled.</p> <p>When any number from 1 to 6 is selected, the end-user mode is enabled.</p> <p>While the parameter "#11761 PLC Security Mode" is "0", the end-user mode is invalid irrespective of this parameter.</p> <p>---Setting range---</p> <p>1 to 6</p> <p>0: No setting (End-user mode is invalid)</p>
(PR)	#11763	E/U Y Dev No.	Initial number of Y device for end user
			<p>Specify the initial number of the Y devices that are free to use for end users.</p> <p>The sum of this setting and "#11764 E/U Y Dev Size" cannot exceed 0600 (HEX).</p> <p>---Setting range---</p> <p>0000 to 05FF (HEX)</p>

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#11764	E/U Y Dev Size	Quantity of Y devices for end user
		Specify the quantity of the Y devices that are free to use for end users. The sum of this setting and "#11763 E/U Y Dev No." cannot exceed 0600 (HEX). ---Setting range--- 0000 to 0600 (HEX)	
(PR)	#11765	E/U M Dev No.	Initial number of M device for end user
		Specify the initial number of the M devices that are common to projects, and are free to use for end users. The sum of this setting and "#11766 E/U M Dev Size" cannot exceed 61440. ---Setting range--- 0 to 61439	
(PR)	#11766	E/U M Dev Size	Quantity of M devices for end user
		Specify the quantity of the M devices that are common to projects, and are free to use for end users. The sum of this setting and "#11765 E/U M Dev No." cannot exceed 61440. ---Setting range--- 0 to 61440	
(PR)	#11767	E/U D Dev No.	Initial number of D device for end user
		Specify the initial number of the D devices that are common to projects, and are free to use for end users. The sum of this setting and "#11768 E/U D Dev Size" cannot exceed 8192. ---Setting range--- 0 to 8191	
(PR)	#11768	E/U D Dev Size	Quantity of D devices for end user
		Specify the quantity of the D devices that are common to projects, and are free to use for end users. The sum of this setting and "#11767 E/U D Dev No." cannot exceed 8192. ---Setting range--- 0 to 8192	
(PR)	#11769	Remote I/O Clear	Initialization of remote I/O
		Select whether to clear the values of RIO output devices at PLC STOP. 0: Retain the outputs of RIO 1: Clear the outputs of RIO	
	#11771	PTapInp	In-position range for Punch Tap (tap axis)
		Specify the in-position range to be applied to the in-position check at the bottom of Punch Tap hole. ---Setting range--- 0.000 to 99.999 (mm)	
	#11772	ptapd	End point of deburring
		Specify the end point of the deburring process for the pattern PT1.5 or PT2.0, using the distance from the bottom of the hole. ---Setting range--- 0.000 to 32.767 (mm)	
	#11773	ptapag	Rotation angle of Punch Tap
		Specify the angle of the rotation of the Punch Tap tool to be applied in tapping. An angle of 180 degrees is used commonly for a double-helix Punch Tap tool. When "0" is set, the angle will be interpreted as 180 degrees. ---Setting range--- 0 to 360 (deg)	

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#11776	VDC_cntmax	Acceleration rate retaining time
		<p>Set this parameter when the workpiece has scratches during the machining that is switched from linear to circular when Variable torsion compensation function is used.</p> <p>If the machined workpiece has scratches, set the larger value in the parameter setting.</p> <p>When "0" is set, it is operated as "1".</p> <p>---Setting range---</p> <p>1 to 255</p>	
(PR)	#11788	PrcsOutput	Output Process Analysis result
		Not used. Set to "0".	
	#11790	astap_cmpmax	Factor for max speed after adjustment in sync tap w/ analog I/F spindle
		<p>This parameter determines the upper limit of output adjustment in synchronous tapping with analog I/F spindle.</p> <p>Specify a limit on the adjustment of output rotation speed in terms of the percentage of commanded spindle speed.</p> <p>If a value between 0 and 99 is specified, the system behaves as if "120" was specified.</p> <p>---Setting range---</p> <p>0 to 300 (%)</p>	
(PR)	#11791	Disp area1 sysno	Monitr-Area1 part system to display
		<p>Specify the part system to display on the [Monitr] screen after power on.</p> <p>This parameter is valid only when "#11019 2-system display" is enabled (other than "0").</p> <p>(*) When "0" is specified, the unassigned part system with the smallest part system number is set.</p> <p>---Setting range---</p> <p>0 to 8</p>	
(PR)	#11792	Disp area2 sysno	Monitr-Area2 part system to display
		<p>Specify the part system to display on the [Monitr] screen after power on.</p> <p>This parameter is valid only when "#11019 2-system display" is enabled (other than "0").</p> <p>(*) When "0" is specified, the unassigned part system with the smallest part system number is set.</p> <p>---Setting range---</p> <p>0 to 8</p>	
(PR)	#11793	Disp area3 sysno	Monitr-Area3 part system to display
		<p>Specify the part system to display on the [Monitr] screen after power on.</p> <p>This parameter is valid only when "#11019 2-system display" is enabled (other than "0").</p> <p>(*) When "0" is specified, the unassigned part system with the smallest part system number is set.</p> <p>---Setting range---</p> <p>0 to 8</p>	
(PR)	#11794	Disp area4 sysno	Monitr-Area4 part system to display
		<p>Specify the part system to display on the [Monitr] screen after power on.</p> <p>This parameter is valid only when "#11019 2-system display" is enabled (other than "0").</p> <p>(*) When "0" is specified, the unassigned part system with the smallest part system number is set.</p> <p>---Setting range---</p> <p>0 to 8</p>	
(PR)	#11795	aspect ratio	Image input I/F: Aspect ratio
		<p>Specify how to scale images when an image input expansion card is connected and the resolution of input from an IPC or a camera is different from that of the display.</p> <p>0: Maintain aspect ratio</p> <p>1: Not maintain aspect ratio</p>	

15 Machine Parameters

15.3 Base Common Parameters

#11796		mmacpro	Machine tool builder macro password
		<p>Register and authenticate a password to enable editing etc. of machine tool builder macro programs.</p> <ul style="list-style-type: none"> • If a password is unregistered, (blank display), a password consisting of one to eight alphanumeric characters can be set. (lower case letters and a password only consisting of one zero (0) cannot be set.) • If a password has been registered (displays ****), when the registered password is entered, "---OK---" will be displayed and the protection will be canceled. <p>If a wrong password is entered, "setting error" will occur.</p> <p>(Note) This parameter can be set only when Machine tool builder macro password management method type 2 is selected. (#1761 cfgPR11/bit6=1)</p> <p>---Setting range---</p> <p>One to eight alphanumeric characters (except for lower case letters and a password consisting of only one zero (0))</p>	
(PR)	#11799	lsr_sys	Laser processing control-enabled part system (For M system only)
		<p>Specify the part system number for which laser processing control is enabled.</p> <p>If "0" or a nonexistent part system is set, laser processing control is disabled for all part systems.</p> <p>---Setting range---</p> <p>0 to 8</p>	
#11801		SPRINT ON	SPRINT ON
		<p>Specify whether to enable or disable SPRINT.</p> <p>0: Disable</p> <p>1: Enable</p> <p>When SPRINT is enabled</p> <ul style="list-style-type: none"> • M codes for SPRINT control are executable. • SKIP8 is assigned to the SPRINT connector of the expansion unit FCU8-EX543. 	
#11802		SPRINT_Mcode	M codes for SPRINT control
		<p>Specify the first M code for SPRINT control.</p> <p>0: default setting</p> <p>600: Start signal ON</p> <p>601: Start signal OFF</p> <p>602: Enable signal ON</p> <p>603: Enable signal OFF</p> <p>604: Select signal ON</p> <p>605: Select signal OFF</p> <p>Other than 0: the six consecutive M codes starting from the set value are assigned as the M codes for SPRINT control.</p> <p>Set value + 0: Start signal ON</p> <p>Set value + 1: Start signal OFF</p> <p>Set value + 2: Enable signal ON</p> <p>Set value + 3: Enable signal OFF</p> <p>Set value + 4: Select signal ON</p> <p>Set value + 5: Select signal OFF</p> <p>---Setting range---</p> <p>0, 200 to 99999999</p>	
#11803		SPRINT_mcmp	Removal of machine error compensation in SPRINT
		<p>Specify whether to remove the machine error compensation amount from the feedback position retrieved from the drive unit.</p> <p>0: Not remove (when a machine end encoder is used)</p> <p>1: Remove (when a motor end encoder is used)</p>	

15 Machine Parameters

15.3 Base Common Parameters

	#11804	SPRINT_mcmpDly	Timing adjustment for removal of machine error compensation in SPRINT
	Specify the time delay after which the machine error compensation amount is removed from the feedback position data when the parameter for removal of machine error compensation in SPRINT is set to "1" (Remove).		
	---Setting range---		
	0 to 500 (ms)		
(PR)	#11805	Machine Simu Model	
	Select the machine model to be used in the 3D machining simulation.		
	0: Machine configuration file is not used, only execute work simulation.		
	1: Use the machine configuration file specified in the configuration file.		
	If the selected machine configuration file is not existed, the machine configuration file in the designated location will be used.		
	2 to 20: Use the machine configuration file specified in the configuration file.		
	(Note 1) 3D machining simulation is required (optional).		
	(Note 2) The setting range differs depending on machine tool builders.		
	(*) This parameter is for M800VW series only.		
	---Setting range---		
	0 to 20		
	#11808	proc cnd protect 1	Machining condition protection 1
	Specify the machining condition to be protected from parameter settings when the machine tool builder password is not entered in the High-accuracy parameter adjustment screen.		
	---Setting range---		
	0, 11 to 13, 21 to 23, 31 to 33		
	0: Not specified		
	11: Condition 1-1, 12: Condition 1-2, 13: Condition 1-3		
	21: Condition 2-1, 22: Condition 2-2, 23: Condition 2-3		
	31: Condition 3-1, 32: Condition 3-2, 33: Condition 3-3		
	#11809	proc cnd protect 2	Machining condition protection 2
	Specify the machining condition to be protected from parameter settings when the machine tool builder password is not entered in the High-accuracy parameter adjustment screen.		
	---Setting range---		
	0, 11 to 13, 21 to 23, 31 to 33		
	0: Not specified		
	11: Condition 1-1, 12: Condition 1-2, 13: Condition 1-3		
	21: Condition 2-1, 22: Condition 2-2, 23: Condition 2-3		
	31: Condition 3-1, 32: Condition 3-2, 33: Condition 3-3		
	#11810	proc cnd protect 3	Machining condition protection 3
	Specify the machining condition to be protected from parameter settings when the machine tool builder password is not entered in the High-accuracy parameter adjustment screen.		
	---Setting range---		
	0, 11 to 13, 21 to 23, 31 to 33		
	0: Not specified		
	11: Condition 1-1, 12: Condition 1-2, 13: Condition 1-3		
	21: Condition 2-1, 22: Condition 2-2, 23: Condition 2-3		
	31: Condition 3-1, 32: Condition 3-2, 33: Condition 3-3		
(PR)	#11811	LDR Dedicated Sys	Loader-dedicated part system (For M system only)
	Select the part system to be assigned for loader operation.		
	1 to 8: \$1 to \$8		
	When not using this parameter, set "0".		
	---Setting range---		
	0 to 8		

15 Machine Parameters

15.3 Base Common Parameters

(PR)	#11823	exComVar1DecN	Extended common variable I: number of real number data
Specify the number of real number data (8 bytes) for Extended common variable I.			
---Setting range---			
0 to 10000			
(PR)	#11824	exComVar1IntN	Extended common variable I: number of integer data
Specify the number of integer data (2 bytes) for Extended common variable I.			
---Setting range---			
0 to 40000			
(PR)	#11825	exComVar2SramOpen	Extended common variable II: SRAM open parameter No.
Specify the SRAM open parameter No. to be used for real number data of Extended common variable II.			
---Setting range---			
0, 41001 to 41100			
(PR)	#11826	exComVar2DecN	Extended common variable II: number of real number data
Specify the number of real number data (8 bytes) for Extended common variable II.			
---Setting range---			
0 to 80000			
(PR)	#11827	exComVar3DecN	Extended common variable III: number of real number data
Specify the number of real number data (8 bytes) for Extended common variable III.			
---Setting range---			
0 to 2000			
(PR)	#11828	exComVar3IntN	Extended common variable III: number of integer data
Specify the number of integer data (2 bytes) for Extended common variable III.			
---Setting range---			
0 to 8000			
(PR)	#11829	exComVar3FileN	Extended common variable III: number of data files
Specify the number of data files for Extended common variable III.			
---Setting range---			
0 to 1000			
(PR)	#11858	NCAID Diagn method	NC MachiningAID tool wear diagnostics method
Select how the NC MachiningAID uses tool wear diagnostics.			
0: Use the determined tool life to update the tool status. (The tool life determination of Tool life management is enabled.)			
1: Notifies tool life determination to the PLC signal.			
	#11895	LC_KEY	
Not used.			
---Setting range---			
0			

15.4 Axis Specifications Parameters

#2001	rapid	Rapid traverse rate
		Set the rapid traverse feedrate for each axis. (Note) The maximum value to be set depends on the machine specifications. ---Setting range--- 1 to 1000000 (mm/min)
#2002	clamp	Cutting feedrate for clamp function
		Set the maximum cutting feedrate for each axis. Even if the feedrate in G01 exceeds this value, the clamp will be applied at this feedrate. ---Setting range--- 1 to 1000000 (mm/min)

15 Machine Parameters

15.4 Axis Specifications Parameters

(PR)	#2003	smgst	Acceleration and deceleration modes															
Set acceleration and deceleration control modes. Set value is in hexadecimal.																		
HEX	4				3				2				1					
bit	F	E	D	C	B	A	9	8	7	6	5	4	3	2	1	0		
							OT2	OT1	C3	C2	C1	L	R3	R2	R1	LR		
Stroke end stop types								Cutting feed acceleration /deceleration type					Rapid traverse acceleration /deceleration type					

HEX-1 Rapid traverse acceleration/deceleration type

0 (bit3,2,1,0 = 0000): Step

1 (bit3,2,1,0 = 0001): Linear acceleration/deceleration

2 (bit3,2,1,0 = 0010): Primary delay

8 (bit3,2,1,0 = 1000): Exponential acceleration and linear deceleration

F (bit3,2,1,0 = 1111): Soft acceleration/deceleration

(Note) Primary delay is applied because R1 setting has priority over R3 setting when R1 and R3 are both set to "1".

HEX-2 Cutting feed acceleration/deceleration type

0 (bit7,6,5,4 = 0000): Step

1 (bit7,6,5,4 = 0001): Linear acceleration/deceleration

2 (bit7,6,5,4 = 0010): Primary delay

8 (bit7,6,5,4 = 1000): Exponential acceleration and linear deceleration

F (bit7,6,5,4 = 1111): Soft acceleration/deceleration


HEX-3 Stroke end stop types

0 (bit9,8 = 00): Linear deceleration (Decelerates at G0t1)

1 (bit9,8 = 01): Linear deceleration (Decelerates at 2×G0t1)

2 (bit9,8 = 10): Position loop step stop

3 (bit9,8 = 11): Position loop step stop

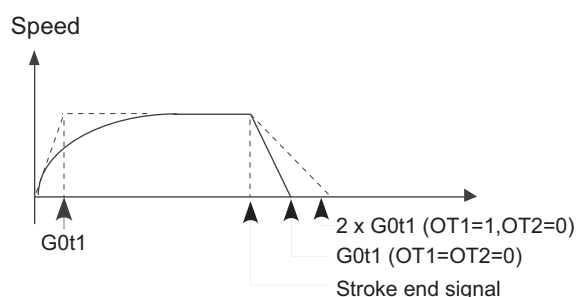

(Note) OT1(bit8) is valid under the following conditions (valid for dog type zero point return):





- Stop type: Linear deceleration
- Acceleration/deceleration mode: Exponential Acceleration and Linear deceleration

HEX-4

Not used. Set to "0".

15 Machine Parameters

15.4 Axis Specifications Parameters
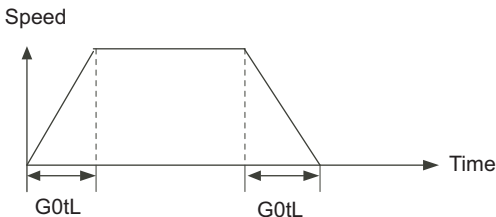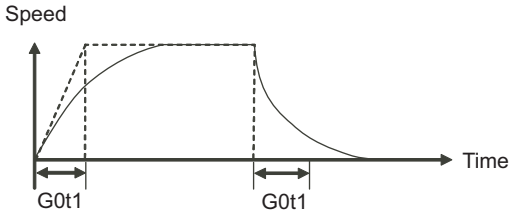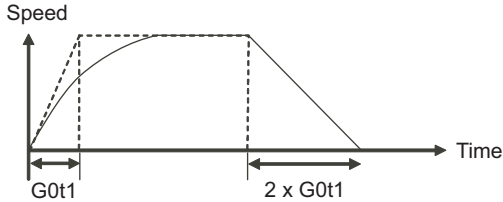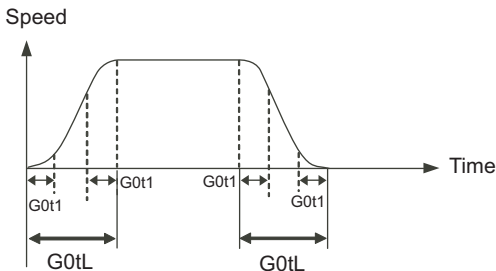
#2004	G0tL	G0 time constant (linear)
<p>Set a linear control time constant for rapid traverse acceleration and deceleration.</p> <p>This time constant is enabled when LR (rapid traverse feed with linear acceleration/deceleration) or F (soft acceleration/deceleration) is selected in "#2003 smgst" (Acceleration and deceleration modes).</p>		
		
<p>---Setting range---</p> <p>1 to 4000 (ms)</p>		
#2005	G0t1	G0 time constant(primary delay) / Second-step time constant for soft acceleration/deceleration
<p>Set a primary-delay time constant for rapid traverse acceleration and deceleration.</p> <p>This time constant is enabled when R1 (rapid traverse feed with primary delay) or R3 (exponential acceleration and linear deceleration) is selected in "#2003 smgst" (Acceleration and deceleration modes).</p> <p>When the soft acceleration/deceleration is selected, the second-step time constant will be used.</p>		
<p><Rapid traverse feed with primary delay></p> 		
<p><Rapid traverse feed with exponential acceleration and linear deceleration></p> 		
<p><Soft acceleration/deceleration></p> <p>◆When "#1219 aux03/bit7" is set to "0"</p> 		
<p>(Note) The time constant setting for the soft acceleration/deceleration can be changed by the setting of "#1219 aux03/bit7"</p>		
<p>---Setting range---</p> <p>1 to 5000 (ms)</p>		

15 Machine Parameters

15.4 Axis Specifications Parameters


#2006 G0t2

Not used. Set to "0".

#2007 G1tL G1 time constant (linear)

Set a linear control time constant for cutting acceleration and deceleration.

The time constant will be enabled when LC (cutting feed with linear acceleration/deceleration) or F (soft acceleration/deceleration) is selected in "#2003 smgst" (Acceleration or deceleration modes).

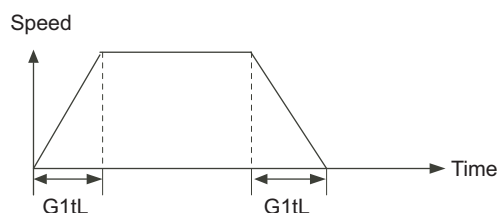

---Setting range---

1 to 4000 (ms)


#2008 G1t1 G1 time constant (primary delay)/Second-step time constant for soft acceleration/deceleration

Set the primary delay time constant for cutting acceleration and deceleration.


The time constant will be enabled when C1 (cutting feed with the primary delay) or C3 (cutting feed with exponential acceleration and linear deceleration) is selected in "#2003 smgst" (Acceleration/deceleration modes).

When the soft acceleration/deceleration is selected, the second-step time constant will be used.


<Cutting feed with primary delay>

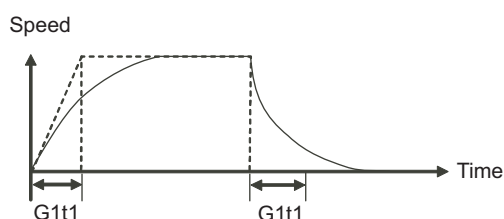

<Cutting feed with exponential acceleration and linear deceleration>

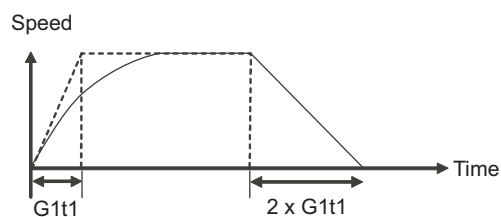

<Soft acceleration/deceleration>

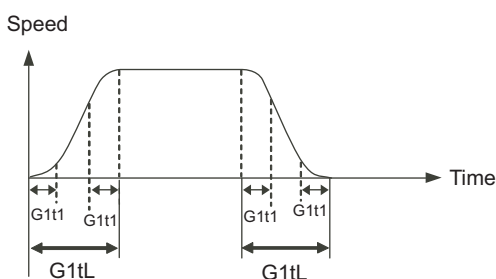


---Setting range---

1 to 5000 (ms)

15 Machine Parameters

15.4 Axis Specifications Parameters


#2009	G1t2	
Not used. Set to "0".		
#2010	fwd_g	Feed forward gain
Set a feed forward gain for pre-interpolation acceleration/deceleration.		
The larger the set value, the smaller the theoretical control error will be. However, if a machine vibration occurs, set the smaller value.		
---Setting range---		
0 to 200 (%)		
#2011	G0back	G0 backlash
Set up the backlash compensation amount when the direction is reversed with the movement command in rapid traverse feed mode or in manual mode (except for handle feed mode) .		
---Setting range---		
-9999999 to 9999999		
#2012	G1back	G1 backlash
Set up the backlash compensation amount when the direction is reversed with the movement command in cutting mode.		
G1 backlash is enabled in handle feed mode.		
---Setting range---		
-9999999 to 9999999		
#2013	OT -	Soft limit I -
Set a soft limit area with reference to the zero point of the basic machine coordinate. Set the coordinate in the negative direction for the movable area of stored stroke limit 1. The coordinate in the positive direction is set in "#2014 OT+".		
To narrow the available range in actual use, use the parameters "#8204 OT-" and "#8205 OT+".		
When the same value (other than "0") is set in this parameter and "#2014 OT+", this function will be disabled.		

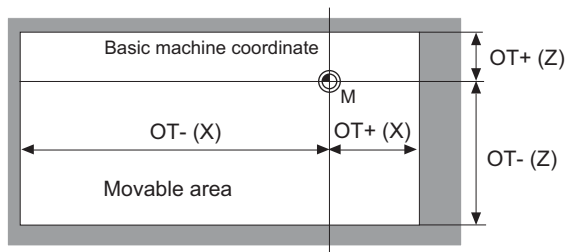

---Setting range---

-99999.999 to 99999.999 (mm)

#2014	OT +	Soft limit I +
Set a soft limit area with reference to the zero point of the basic machine coordinate. Set the coordinate in the positive direction for the movable area of stored stroke limit 1. The coordinate in the negative direction is set in "#2013 OT-".		
To narrow the available range in actual use, use the parameters "#8204 OT-" and "#8205 OT+".		
When the same value (other than "0") is set in this parameter and "#2013 OT-", this function will be disabled.		

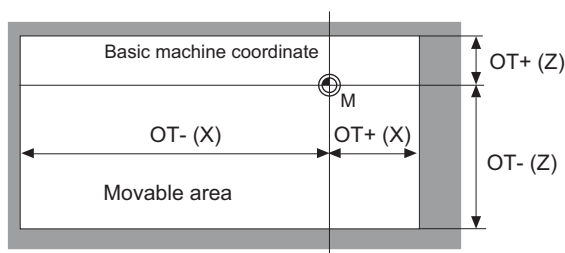

---Setting range---

-99999.999 to 99999.999 (mm)

15 Machine Parameters

15.4 Axis Specifications Parameters

	#2015	tliml-	Negative direction sensor of tool setter
			<p>Set a sensor position in the negative direction when using the tool setter.</p> <p>When the TLM is used, set up the distance of a tool replacement point (reference point) for measuring the tool length from the zero point to the measurement reference point (surface).</p> <p>(Note) In the case of the basic axis and inclined axis of the inclined axis specifications, set the position on the orthogonal coordinate.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p>
	#2016	tliml+	Positive direction sensor of tool setter or TLM standard length
			<p>Set the sensor position in the positive direction when using the tool setter.</p> <p>When the TLM is used, set the distance from a tool change point (reference position) to the measurement basic point (surface) in order to measure the tool length.</p> <p>(Note) In the case of the basic axis and inclined axis of the inclined axis specifications, set the position on the orthogonal coordinate.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p>
	#2017	tap_g	Axis servo gain
			<p>Set the position loop gain for special operations (synchronized tapping, interpolation with spindle C axis, etc.).</p> <p>Set the value in 0.25 increments.</p> <p>The standard setting value is "10".</p> <p>---Setting range---</p> <p>0.25 to 200.00 (rad/s)</p>
(PR)	#2018	no_srv	Operation with no servo control
			<p>Select when performing test operation without connecting the drive unit and motor.</p> <p>0: Normal operation</p> <p>1: Test operation</p> <p>When "1" is set, the operation will be possible even if drive units and motor are not connected, because the drive system alarm will be ignored.</p> <p>This parameter is used for test operation during start up: Do not use during normal operation. If "1" is set during normal operation, errors will not be detected even if they occur.</p>
	#2019	revnum	Return steps
			<p>Set the steps required for reference position return for each axis.</p> <p>0: Not execute reference position return.</p> <p>1 to max. number of NC axes: Steps required for reference position return</p>
	#2020	o_chkp	Spindle orientation completion check during second reference position return
			<p>Set the distance from the second reference position to the position for checking that the spindle orientation has completed during second reference position return.</p> <p>When the set value is "0", the above check will be omitted.</p> <p>---Setting range---</p> <p>0 to 99999.999 (mm)</p>
	#2021	out_f	Maximum speed outside soft limit range (For L system only)
			<p>Set the maximum speed outside the soft limit range.</p> <p>---Setting range---</p> <p>0 to 1000000 (mm/min)</p>
	#2022	G30SLX	Validate soft limit (automatic and manual)
			<p>Select whether to disable a soft limit check during the second to the fourth reference position return in both automatic and manual operation modes.</p> <p>0: Enable</p> <p>1: Disable</p>

15 Machine Parameters

15.4 Axis Specifications Parameters

#2023	ozfmin	Set up ATC speed lower limit	
Set the minimum speed outside the soft limit range during the second to the fourth reference position return.			
---Setting range---			
0 to 1000000 (mm/min)			
#2024	synerr	Allowable error	
Set the maximum synchronization error, allowable at the synchronization error check, for the master axis.			
When "0" is set, the error check will not be carried out.			
---Setting range---			
0 to 99999.999 (mm)			
During simple C-axis synchronous control: 0 to 99999.999(°)			
#2061	OT_1B-	Soft limit IB-	
Set the coordinate of the lower limit of the area where the stored stroke limit IB is inhibited.			
Set a value from zero point in the basic machine coordinate system.			
If the same value (non-zero) is set for both the sign and numeral value as "#2062 OT_1B+", the stored stroke limit IB function set with #2061 and #2062 will be disabled.			
---Setting range---			
-99999.999 to 99999.999 (mm)			
#2062	OT_1B+	Soft limit IB+	
Set the coordinate of the upper limit of the area where the stored stroke limit IB is inhibited.			
Set a value from zero point in the basic machine coordinate system.			
---Setting range---			
-99999.999 to 99999.999 (mm)			
#2063	OT_1B type	Soft limit IB type	
Select the type that applies the settings of "#2062 OT_1B+" and "#2061 OT_1B-" in stored stroke limit I.			
0: Soft limit IB			
1: Disable			
2: Soft limit IC			
3: Soft limit is checked for the inclined axis control axis with the program coordinate system.			
(Note) This is valid only for inclined axis' basic axis and inclined axis.			
#2068	G0fwdg	G00 feed forward gain	
Set a feed forward gain for G00 pre-interpolation acceleration/deceleration.			
The larger the setting value, the shorter the positioning time during in-position checking.			
If a machine vibration occurs, set the smaller value.			
---Setting range---			
0 to 200 (%)			
#2069	Rcoeff	Axis arc radius error correction coefficient	
Set the percentage to increase or decrease the arc radius error correction amount for each axis.			
---Setting range---			
-100.0 to +100.0 (%)			
(PR)	#2070	div_RT	Rotational axis division count
Set the number of divisions of one turn of the rotary axis under control.			
(Example)			
When "36" is set, one turn is supposed to be 36.000.			
(Note 1) When "0" is set, the normal rotary axis (360.000 degrees for one turn) is assumed.			
(Note 2) If this parameter is changed when the absolute position detection specification is used, absolute position data will be lost. Initialization must be performed again.			
---Setting range---			
0 to 999			

15 Machine Parameters

15.4 Axis Specifications Parameters

(PR)	#2071	s_axis	Inclined axis selection (for L system only)
			<p>Select whether the axis is to be under the inclined-axis control or to be the basic axis corresponding to the inclined axis.</p> <p>0: Not to be under the inclined-axis control</p> <p>1: Inclined axis</p> <p>2: Basic axis corresponding to inclined axis</p> <p>(Note) Each of "1" and "2" values must be set for only one axis. If either value is set for two or more axes, inclined-axis control does not work.</p>
	#2072	rslimit	Restart limit
			<p>Set the most minus (-) side position where restart search is possible.</p> <p>If the machine is positioned on the more minus (-) side than the set value in T-command restart mode, restart search in type 3 will be disabled.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p>
	#2073	zrn_dog	Origin dog Random assignment device
			<p>Under the standard specifications, the "Reference position return near-point detection" signal is assigned to a fixed device. Set the device in this parameter to assign this signal to a position other than the fixed device.</p> <p>(Note1) This parameter is enabled in the following conditions.</p> <p>NC axis: When "#1226 aux10/bit5" is set to "1".</p> <p>PLC axis: When "#1246 set18/bit7" is set to "1".</p> <p>(Note 2) When this parameter is valid, do not set the existing device number. If the existing device number is set, an emergency stop will occur. However, no device number check will be performed for an axis to which the "Near-point dog ignored" signal or the "PLC axis near-point dog ignored" signal is input.</p> <p>(Note 3) The "Reference position return near-point detection" signal is required to be directly input to the operation panel I/O unit or the remote I/O unit. The device assigned to an expansion unit such as CC-Link, Profibus, etc, cannot be used. Signals which set in a sequence program cannot be used.</p> <p>---Setting range---</p> <p>0000 to 03FF (hexadecimal)</p>
	#2074	H/W_OT+	H/W OT+ Random assignment device
			<p>Under the standard specifications, the "Stroke end (+)" signal is assigned to a fixed device. Set the device in this parameter to assign this signal to a position other than the fixed device.</p> <p>(Note1) This parameter is enabled in the following conditions.</p> <p>NC axis: When "#1226 aux10/bit5" is set to "1".</p> <p>PLC axis: When "#1246 set18/bit7" is set to "1".</p> <p>(Note 2) When this parameter is valid, do not set the existing device number. If the existing device number is set, an emergency stop will occur. However, no device number check will be performed for an axis to which the "OT ignored" signal or the "PLC axis OT ignored" signal is input.</p> <p>(Note 3) The "Stroke end" signal is required to be directly input to the operation panel I/O unit or the remote I/O unit. The device assigned to an expansion unit such as CC-Link, Profibus, etc, cannot be used. Signals which set in a sequence program cannot be used.</p> <p>---Setting range---</p> <p>0000 to 03FF (hexadecimal)</p>

15 Machine Parameters

15.4 Axis Specifications Parameters

#2075	H/W_OT-	H/W OT- Random assignment device
	<p>Under the standard specifications, the "Stroke end (-)" signal is assigned to a fixed device. Set the device in this parameter to assign this signal to a position other than the fixed device.</p> <p>(Note1) This parameter is enabled in the following conditions.</p> <p>NC axis: When "#1226 aux10/bit5" is set to "1".</p> <p>PLC axis: When "#1246 set18/bit7" is set to "1".</p> <p>(Note 2) When this parameter is valid, do not set the existing device number. If the existing device number is set, an emergency stop will occur. However, no device number check will be performed for an axis to which the "OT ignored" signal or the "PLC axis OT ignored" signal is input.</p> <p>(Note 3) The "Stroke end" signal is required to be directly input to the operation panel I/O unit or the remote I/O unit. The device assigned to an expansion unit such as CC-Link, Profibus, etc, cannot be used. Signals which set in a sequence program cannot be used.</p> <p>---Setting range---</p> <p>0000 to 03FF (hexadecimal)</p>	
#2076	index_x	Index table indexing axis
	<p>Specify the index table indexing axis.</p> <p>0: Normal axis</p> <p>1: Index table indexing axis</p> <p>(Note) This parameter is valid only for the NC axis. The parameter is invalid if set for the PLC axis.</p>	
#2077	G0inps	G0 in-position width
	<p>Set the in-position width for G0.</p> <p>Between SV024 and this parameter, the parameter with a larger value will be applied.</p> <p>When "0" is set, this parameter will be invalid. Only SV024 will be available.</p> <p>When "#1205 G0dbcc" is "1", SV024 is used as the G0 in-position width.</p> <p>---Setting range---</p> <p>0.000 to 99.999 (mm)</p>	
#2078	G1inps	G1 in-position width
	<p>Set the in-position width for G1.</p> <p>Between SV024 and this parameter, the parameter with a larger value will be applied.</p> <p>When "0" is set, this parameter will be invalid. Only SV024 will be available.</p> <p>---Setting range---</p> <p>0.000 to 99.999 (mm)</p>	
(PR) #2079	chcomp	Chopping compensation coefficient
	<p>Set the coefficient to be applied to the compensation amount for the insufficient amount caused by servo delay during chopping.</p> <p>---Setting range---</p> <p>0 to 10 (standard value: 8)</p>	
#2080	chwid	Bottom dead center position width
	<p>Set the tolerance between the commanded stroke and actual stroke.</p> <p>Compensation will be applied during chopping so that the result of [command width - maximum stroke of top or bottom dead point/ 2] will be within this tolerance.</p> <p>---Setting range---</p> <p>0 to 10.000 (mm)</p>	
#2081	chclsp	Maximum chopping speed
	<p>Set the clamp speed in chopping operation.</p> <p>When "0" is set, the clamp speed will be determined by "#2002 clamp".</p> <p>---Setting range---</p> <p>0 to 60000 (mm/min)</p>	

15 Machine Parameters

15.4 Axis Specifications Parameters

#2082	a_rstax	Restart position return order
	<p>Set the No. for each axis in order from the 1st automatically returning axis to the restart position.</p> <p>When "0" is set, the axis will not return.</p> <p>Note that when "0" is set for all axes, all of the axes will return simultaneously.</p> <p>(Note) On the absolute position system, when performing the restart search just after power ON, and when the axis that is the order 0 is moved by the follow-up, an operation error(M01 0128) may occur.</p> <p>---Setting range---</p> <p>0 to 16</p>	
#2084	G60_ax	Unidirectional positioning operation selection
	<p>Select how to operate the unidirectional positioning when the positioning command (G00) is issued.</p> <p>0: Carry out unidirectional positioning according to the command and modal.</p> <p>1: Carry out unidirectional positioning regardless of the command and modal.</p> <p>Set "1" for the axis to carry out the unidirectional positioning at every positioning command, regardless of whether the unidirectional positioning command and modal are issued.</p> <p><Related parameters></p> <p>"#8209 G60 SHIFT" and "#2076 index_x"</p>	
#2086	exdcax	External deceleration speed
	<p>Set the maximum feed rate for each axis when the external deceleration signal is ON.</p> <p>This parameter is valid when "#1239 set11/bit6" is set to "1".</p> <p>---Setting range---</p> <p>0 to 1000000 (mm/min)</p>	
#2087	syncnt	Synchronization/superimposition control setting for each axis
	<p>Set the polarity of synchronized axis with respect to reference axis to the bit corresponding to each axis.</p> <p>0: Relative to reference axis, polarity is positive</p> <p>1: Relative to reference axis, polarity is negative</p> <p>---Setting range---</p> <p>0 to FF (hexadecimal)</p>	
#2088	bsax_sy	Reference axis for synchronous control
	<p>Set the reference axis for synchronous control with the 2nd axis name (axname2). A numerical character cannot be set as the 1st character.</p> <p>---Setting range---</p> <p>1st character: A to Z</p> <p>2nd character: A to Z, 1 to 9</p>	
#2089	bsax_pl	Superimposition control reference axis
	<p>Set the reference axis of superimposition control using the 2nd axis name (axname2).</p> <p>Always use an alphabetic character (A to Z) for the first character.</p> <p>(Note) This parameter is enabled only when "#1280 ext16/bit7" (Control axis superimposition command method) is set to "0".</p> <p>---Setting range---</p> <p>Two digits between A to Z and 1 to 9</p> <p>(Setting is cleared when "0" is set)</p>	
#2090	plrapid	Rapid traverse rate for superimposition control
	<p>Set the rapid traverse rate for superimposition control.</p> <p>(Equivalent to "#2001 rapid" (Rapid traverse rate).)</p> <p>---Setting range---</p> <p>0 to 1000000 (mm/min)</p>	

15 Machine Parameters

15.4 Axis Specifications Parameters

#2091	plclamp	Cutting feed clamp speed for superimposition control
Set the cutting feed clamp speed for superimposition control. (Equivalent to "#2002 clamp" (Cutting feed clamp speed).)		
---Setting range---		
0 to 1000000 (mm/min)		
#2092	plG0tL	G0 time constant for superimposition control (linear)
Set the G0 time constant (linear) for superimposition control. (Equivalent to "#2004 G0tL G0 time constant (linear)".)		
---Setting range---		
0 to 4000 (ms)		
#2093	plG0t1	G0 time constant for superimposition control (primary delay)
Set the G0 time constant (primary delay) for superimposition control. (Equivalent to "#2005 G0t1 G0 time constant (primary delay)".)		
---Setting range---		
0 to 5000 (ms)		
#2094	plG1tL	G1 time constant for superimposition control (linear)
Set the G1 time constant (linear) for superimposition control. (Equivalent to "#2007 G1tL G1 time constant (linear)".)		
---Setting range---		
0 to 4000 (ms)		
#2095	plG1t1	G1 time constant for superimposition control (primary delay)
Set the G1 time constant (primary delay) for superimposition control. (Equivalent to "#2008 G1t1 G1 time constant (primary delay)".)		
---Setting range---		
0 to 5000 (ms)		
#2096	crncsp	Minimum corner deceleration speed
Set the minimum clamp speed for corner deceleration in the high-accuracy control mode. Normally set "0".		
(Note) This parameter is invalid during SSS control.		
---Setting range---		
0 to 1000000 (mm/min)		
#2097	tlml2-	Sub side tool setter - direction sensor
Set the sensor position (on sub side) in the (-) direction when using the tool setter on the sub spindle side. (Note) In the case of the basic axis and inclined axis of the inclined axis specifications, set the position on the orthogonal coordinate.		
---Setting range---		
-99999.999 to 99999.999 (mm)		
#2098	tlml2+	Sub side tool setter + direction sensor
Set the sensor position (on sub side) in (+) direction when using the tool setter on the sub spindle side. (Note) In the case of the basic axis and inclined axis of the inclined axis specifications, set the position on the orthogonal coordinate.		
---Setting range---		
-99999.999 to 99999.999 (mm)		
#2100	rpcax	Rotary axis workpiece position compensation valid
Set the state of the compensation of the rotary axis workpiece position.		
0: Disabled		
1: Enabled		

15 Machine Parameters

15.4 Axis Specifications Parameters

#2102	skip_tL	Skip time constant linear
	<p>Set a linear control time constant for variable speed skip acceleration and deceleration, or for an occasion where a skip command issues acceleration/deceleration time constant enabled (R1).</p> <p>The time constant will be enabled when LC (cutting feed with linear acceleration/deceleration) or F (soft acceleration/deceleration) is selected in "#2003 smgst" (Acceleration or deceleration modes).</p> <p>When set to "0", the time constant set by "#2007 G1tL" is used.</p> <p>---Setting range---</p> <p>0 to 4000 (ms)</p>	
#2103	skip_t1	Skip time constant primary delay / Second-step time constant for soft acceleration/deceleration
	<p>Set a primary-delay time constant for variable speed skip acceleration and deceleration, or for an occasion where a skip command issues acceleration/deceleration time constant enabled (R1).</p> <p>The time constant will be enabled when C1 (cutting feed with the primary delay) or C3 (cutting feed with exponential acceleration and linear deceleration) is selected in "#2003 smgst" (Acceleration/deceleration modes). When the soft acceleration/deceleration is selected, the second-step time constant will be used.</p> <p>When set to "0", the time constant set by "#2008 G1t1" is used.</p> <p>---Setting range---</p> <p>0 to 5000 (ms)</p>	
#2106	Index unit	Indexing unit
	<p>Set the indexing unit to which the rotary axis can be positioned.</p> <p>---Setting range---</p> <p>0 to 360 (°)</p>	
#2109	Rapid (H-precision)	Rapid traverse rate for high-accuracy control mode
	<p>Set the rapid traverse rate for each axis in the high-accuracy control mode. When 0 is set, "#2001 rapid" is used.</p> <p>---Setting range---</p> <p>0 to 1000000 (mm/min)</p>	
#2110	Clamp (H-precision)	Cutting feed clamp speed for high-accuracy control mode
	<p>Set the cutting feed maximum speed for each axis in the high-accuracy control mode. When 0 is set, "#2002 clamp" is used.</p> <p>---Setting range---</p> <p>0 to 1000000 (mm/min)</p>	
#2111	Blf valid	Quadrant protrusion compensation valid
	<p>Set whether to enable the quadrant protrusion compensation.</p> <p>0: Disable</p> <p>1: Enable</p> <p>If either of "#2112 Blf motor inertia", "#2115 Blf motor stl trq" or "#2113 Blf visc friction" is set to "0", quadrant protrusion compensation will not work even if this parameter is set to "1".</p>	
#2112	Blf motor inertia	Motor inertia
	<p>Set the motor inertia for quadrant protrusion compensation.</p> <p>Refer to the servo manual and input the value appropriate for the motor.</p> <p>---Setting range---</p> <p>1 to 32000 (10^{-6}kgm²)</p>	
#2113	Blf visc friction	Viscous friction
	<p>Set the viscous friction for quadrant protrusion compensation.</p> <p>After setting the other parameters to the appropriate values, monitor the machine end and gradually adjust the value.</p> <p>If this parameter setting is small, a recess will form on the inner side of the circle, and if large, a protrusion will form on the outer side of the circle. When the value is appropriate, a spike-shaped quadrant protrusion will form based on normal step-shaped backlash.</p> <p>---Setting range---</p> <p>1 to 32767 (1/16 Nm/(rad/s))</p>	

15 Machine Parameters

15.4 Axis Specifications Parameters

	#2114	Blf fwdg	Compensation FF gain
			<p>Set the feed forward gain for quadrant protrusion compensation.</p> <p>After setting the other parameters to the appropriate values, monitor the machine end and gradually adjust the value.</p> <p>If this parameter setting is small, a large quadrant protrusion will form, and if large, a recess will form on the inner side of the circle.</p> <p>---Setting range---</p> <p>0 to 1000 (%)</p>
	#2115	Blf motor stl trq	Motor stall torque
			<p>Set the motor rated current for quadrant protrusion compensation.</p> <p>Refer to the servo manual and input the value appropriate for the motor.</p> <p>---Setting range---</p> <p>1 to 16000 (1/256 Nm)</p>
(PR)	#2118	SscDrSel	Speed monitor Door selection
			<p>Select which door group of the speed monitoring the spindle belongs to.</p> <p>0000: Door 1 group.</p> <p>0001: Door 1 group.</p> <p>0002: Door 2 group.</p> <p>0003: Door 1 and 2 group.</p> <p>The speed monitoring will not be executed when "#2313 SV113 SSF8/bitF" is OFF regardless of this parameter.</p> <p>The selected door group must be set when setting the synchronous control.</p> <p>The spindle/C axis control enables the door selection in "#3071 SscDrSelSp" for the corresponding spindle.</p>
	#2121	vbacklash valid	Variable backlash valid/continuous or Variable backlash II valid
			<p>Select whether the variable backlash is to be disabled/enabled/continuous, or variable backlash II enabled.</p> <p>0: Disabled</p> <p>1: Enable</p> <p>2: Continuous</p> <p>3: Enable variable backlash II</p> <p>("#2011 G0back" and "#2012 G1back" will not work unless "0: Disable" is selected.)</p>
	#2122	G0vback+	Variable G0 backlash +
			<p>Set the compensation amount for the range of each position during rapid traverse.</p> <p>(+: B1, =: B2, -: B3 on the compensation amount table)</p> <p>---Setting range---</p> <p>-99999999 to 99999999 (Interpolation unit)</p>
	#2123	G0vback=	Variable G0 backlash =
			<p>Set the compensation amount for the range of each position during rapid traverse.</p> <p>(+: B1, =: B2, -: B3 on the compensation amount table)</p> <p>---Setting range---</p> <p>-99999999 to 99999999 (Interpolation unit)</p>
	#2124	G0vback-	Variable G0 backlash -
			<p>Set the compensation amount for the range of each position during rapid traverse.</p> <p>(+: B1, =: B2, -: B3 on the compensation amount table)</p> <p>---Setting range---</p> <p>-99999999 to 99999999 (Interpolation unit)</p>

15 Machine Parameters

15.4 Axis Specifications Parameters

#2125	G1vback+	Variable G1 backlash +
	Set the compensation amount for the range of each position during cutting feed. (+: A1, =: A2, -: A3 on the compensation amount table) ---Setting range--- -99999999 to 99999999 (Interpolation unit)	
#2126	G1vback=	Variable G1 backlash =
	Set the compensation amount for the range of each position during cutting feed. (+: A1, =: A2, -: A3 on the compensation amount table) ---Setting range--- -99999999 to 99999999 (Interpolation unit)	
#2127	G1vback-	Variable G1 backlash -
	Set the compensation amount for the range of each position during cutting feed. (+: A1, =: A2, -: A3 on the compensation amount table) ---Setting range--- -99999999 to 99999999 (Interpolation unit)	
#2128	G1vback feed1	G1 variable backlash compensation amount change-over speed 1
	Set the speed range during cutting feed. (The speed less than 1 is the low speed, and the speed exceeding 2 is the high speed.) Note that the speed range is identified in the order of low, high and medium speed. Consider whether the set value should be larger or smaller than other values. ---Setting range--- 0 to 480000 (mm/min)	
#2129	G1vback feed2	G1 variable backlash compensation amount change-over speed 2
	Set the speed range during cutting feed. (The speed less than 1 is the low speed, and the speed exceeding 2 is the high speed.) Note that the speed range is identified in the order of low, high and medium speed. Consider whether the set value should be larger or smaller than other values. ---Setting range--- 0 to 480000 (mm/min)	
#2130	G1vback dist1	G1 variable backlash compensation amount change-over distance 1
	Set the range of the distance during cutting feed. (The distance less than 1 is the small distance, and the distance exceeding 2 is the large distance.) Note that the distance range is identified in the order of small, large and medium. Consider whether the set value should be larger or smaller than other values. ---Setting range--- 0 to 999999.999999 (mm)	
#2131	G1vback dist2	G1 variable backlash compensation amount change-over distance 2
	Set the range of the distance during cutting feed. (The distance less than 1 is the small distance, and the distance exceeding 2 is the large distance.) Note that the distance range is identified in the order of small, large and medium. Consider whether the set value should be larger or smaller than other values. ---Setting range--- 0 to 999999.999999 (mm)	


15 Machine Parameters

15.4 Axis Specifications Parameters

#2132	vback pos1	Variable backlash compensation amount changeover end point position 1
<p>Set the range of the center of the end point position. (The range less than position 1 is the - range, and the range exceeding position 2 is the + range.) The end point position range is determined in the order of -, +, and center. Consider whether the set value should be larger or smaller than other values. (Note 1) If continuous variable backlash is set with "#2121 vbacklash valid", position 1 will be set as the position - point and position 2 will be set as the position + point. (Note 2) When the size relation of the compensation amount changeover speed and distance 1 and 2 is not appropriate while the variable backlash compensation is valid, the followings will be applied: If the backlash speed and distance are smaller than the compensation amount changeover speed and distance 1, both the speed and distance will be small; if larger than the compensation amount changeover speed and distance 2, both the speed and distance will be large.</p> <p>---Setting range---</p> <p>-999999.999999 to 999999.999999 (mm)</p>		
#2133	vback pos2	Variable backlash compensation amount changeover end point position 2
<p>Set the range of the center of the end point position. (The range less than position 1 is the - range, and the range exceeding position 2 is the + range.) The end point position range is determined in the order of -, +, and center. Consider whether the set value should be larger or smaller than other values. (Note 1) If continuous variable backlash is set with "#2121 vbacklash valid", position 1 will be set as the position - point and position 2 will be set as the position + point. (Note 2) When the size relation of the compensation amount changeover speed and distance 1 and 2 is not appropriate while the variable backlash compensation is valid, the followings will be applied: If the backlash speed and distance are smaller than the compensation amount changeover speed and distance 1, both the speed and distance will be small; if larger than the compensation amount changeover speed and distance 2, both the speed and distance will be large.</p> <p>---Setting range---</p> <p>-999999.999999 to 999999.999999 (mm)</p>		
#2134	vback arc K	Variable backlash arc compensation coefficient
<p>Set the arc compensation coefficient.</p> <p>---Setting range---</p> <p>0 to 300(%)</p>		
#2135	vback feed refpt	Variable backlash reference position selection (speed)
<p>Select the speed range to be used as the reference position. 0: Low speed 1: Medium speed 2: High speed</p>		
#2136	vback pos refpt	Variable backlash reference position selection (end point position)
<p>Select the end point range to be used as the reference position. 0: Position + range 1: Position center range 2: Position - range</p>		
#2137	vback dir refpt	Variable backlash reference position selection (entry direction)
<p>Select the entry direction to be used as the reference position. 0: Entry direction + 1: Entry direction -</p>		

15 Machine Parameters

15.4 Axis Specifications Parameters

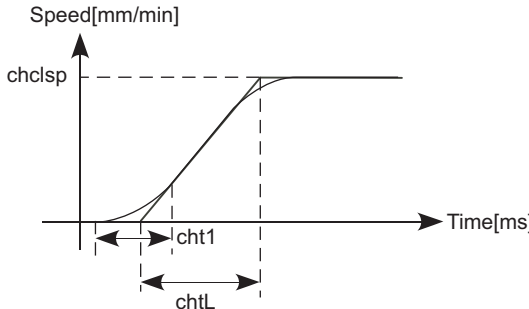
#2138	vback pos center	Continuous variable backlash position center point	
<p>Set the position center point. (This is used only when continuous variable backlash is set with "#2121 vbacklash valid".) Set a value between "#2132 vback pos1" and "#2133 vbackpos2" for the position center point.</p> <p>(Note) When the size relation of the compensation amount changeover speed and distance 1 and 2 is not appropriate while the variable backlash compensation is valid, the followings will be applied: If the backlash speed and distance are smaller than the compensation amount changeover speed and distance 1, both the speed and distance will be small; if larger than the compensation amount changeover speed and distance 2, both the speed and distance will be large.</p> <p>---Setting range---</p> <p>-999999.999999 to 999999.999999 (mm)</p>			
#2139	omrff_off	OMR-FF invalid	
<p>Select whether to enable or temporarily disable the OMR-FF control when OMR-FF is valid.</p> <p>0: Enable</p> <p>1: Temporarily disable</p> <p>When "1" is selected while OMR-FF is valid, OMR-FF can be temporarily disabled and conventional feed forward control can be applied instead.</p>			
(PR)	#2140	Ssc Svof Filter	Speed monitor Error detection time during servo OFF
<p>Set the error detection time for when an error of command speed monitoring or feedback speed monitoring is detected during servo OFF.</p> <p>An alarm will occur if the time, for which the speed has been exceeding the safe speed or safe rotation speed, exceeds the error detection time set in this parameter.</p> <p>If "0" is set, it will be handled as 200 (ms).</p> <p>---Setting range---</p> <p>0 to 9999(ms)</p>			
#2141	chtL	Chopping first-step time constant for soft acceleration/deceleration	
<p>Set the first-step time constant for the chopping axis when soft acceleration/deceleration is applied.</p> <p>Note that, however, there may be cases where actual time constant is shorter than the set time constant, because the time constant is automatically calculated according to the feedrate so that the acceleration rate during acceleration/deceleration (clamp speed/chopping time constant) will be constant.</p> <p>When "0" is set, "#2007 G1tL" will be valid.</p> <div></div> <p>---Setting range---</p> <p>0 to 4000 (ms)</p>			
#2142	cht1	Chopping second-step time constant for soft acceleration/deceleration	
<p>Set the second-step time constant for the chopping axis when soft acceleration/deceleration is applied.</p> <p>Note that, however, there may be cases where actual time constant is shorter than the set time constant, because the time constant is automatically calculated so that the ratio between first-step and second-step time constant will be constant.</p> <p>When "0" is set, "#2008 G1t1" will be valid.</p> <p>---Setting range---</p> <p>0 to 4000 (ms)</p>			

15 Machine Parameters

15.4 Axis Specifications Parameters

#2143	polar	Control axis relative polarity
-------	-------	--------------------------------


Set "0" for the reference axis, and set the polarity of the superimposed axis relative to the reference axis.
0: Relative to reference axis, polarity is positive
1: Relative to reference axis, polarity is negative

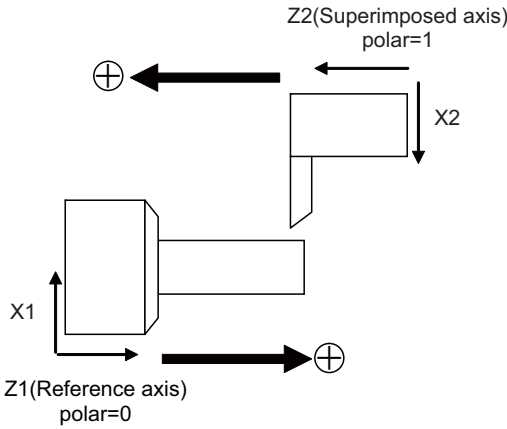

#2144	baseps	Base machine coordinate zero point relative distance
-------	--------	--

Set each axis's position of the base machine coordinate zero point when an arbitrary point M on the machine is regarded as a base point.
Unify the directions of all part systems' machine zero point positions with the direction of the machine coordinate system of the 1st part system.
If the 1st part system doesn't have a parallel axis, determine the direction arbitrarily.

Example: System1(X1, Z1), System2(X2, Z2)

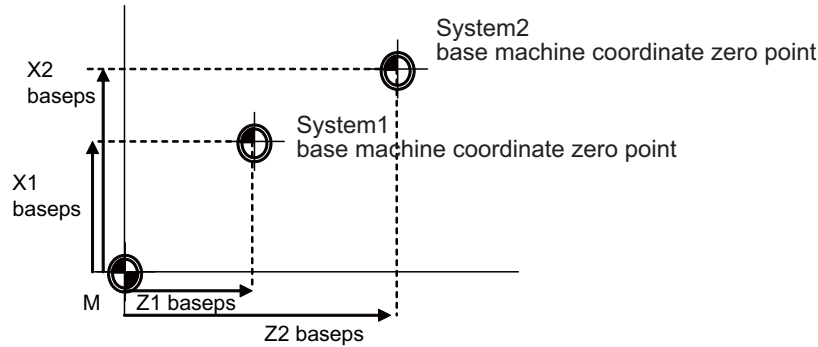

---Setting range---


-99999.999 to 99999.999 (mm)

15 Machine Parameters

15.4 Axis Specifications Parameters

#2146	Blf_L1	Reference distance for position-dependent increasing-type backlash compensation 1
-------	--------	---

Set the distance for specifying the compensation change rate in position-dependent increasing-type backlash compensation.

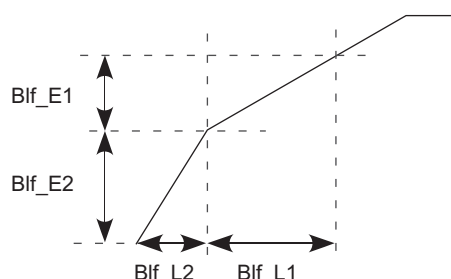


When "#2148 Blf_E1" is set to "0", the position-dependent increasing-type backlash compensation function will be disabled.

---Setting range---

0.000 to 99999.999 (mm)

#2147	Blf_L2	Reference distance for position-dependent increasing-type backlash compensation 2
-------	--------	---

Set the distance for specifying the compensation change rate in position-dependent increasing-type backlash compensation.

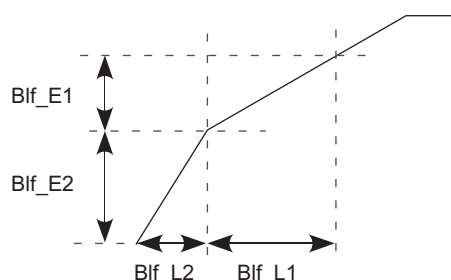


When "#2148 Blf_E1" is set to "0", the position-dependent increasing-type backlash compensation function will be disabled.

---Setting range---

0.000 to 99999.999 (mm)

#2148	Blf_E1	Reference amount of position-dependent increasing-type backlash compensation 1
-------	--------	--

Set the compensation amount for specifying the compensation change rate in position-dependent increasing-type backlash compensation.

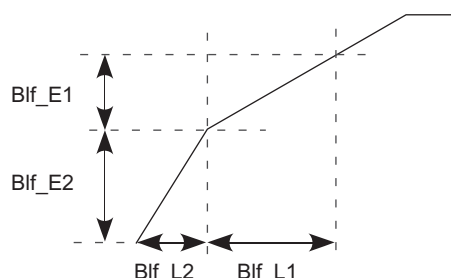

When "#2148 Blf_E1" is set to "0", the position-dependent increasing-type backlash compensation function will be disabled.

---Setting range---


0 to 9999999 (Machine error compensation unit)

15 Machine Parameters

15.4 Axis Specifications Parameters

#2149	Blf_E2	Reference amount of position-dependent increasing-type backlash compensation 2
-------	--------	--

Set the compensation amount for specifying the compensation change rate in position-dependent increasing-type backlash compensation.

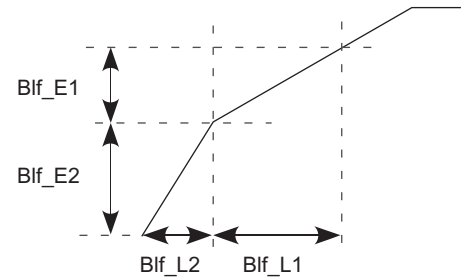

When "#2148 Blf_E1" is set to "0", the position-dependent increasing-type backlash compensation function will be disabled.

---Setting range---

0 to 9999999 (Machine error compensation unit)

#2150	Rot_len	Farthest distance from rotary axis center
-------	---------	---

Set the farthest distance of the rotating part from the rotation center for executing the 3D machine interference check. When "0" is set, the speed depends on the rotary axis' commanded speed.

---Setting range---


0.000 to 99999.999 (mm)

#2151	rated_spd	Rated speed
-------	-----------	-------------

Set the maximum speed which can be driven with the motor's maximum torque.

(Note 1) This parameter's setting value must be smaller than "#2001 rapid Rapid traverse". If bigger, constant-gradient acceleration/deceleration will be applied.

(Note 2) If rapid traverse constant-gradient multi-step acceleration/deceleration is valid, and also if this parameter is set to "0", constant-gradient acceleration/deceleration will be applied.

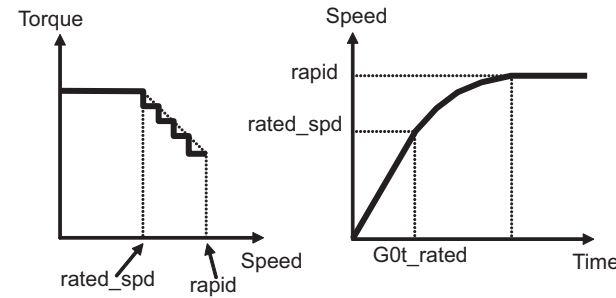


---Setting range---

0 to 1000000 (mm/min)

15 Machine Parameters

15.4 Axis Specifications Parameters
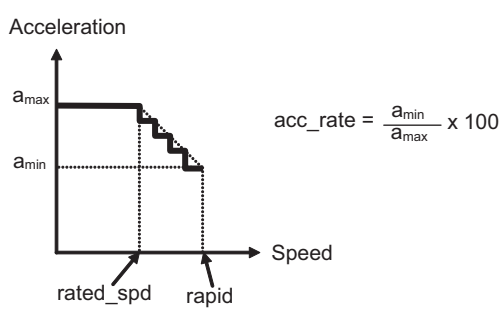
#2152	acc_rate	Acceleration rate in proportion to the maximum acceleration rate
<p>Set the rate in proportion to the maximum acceleration rate in rapid traverse.</p> <p>(Note) If this parameter is set to "0" or "100", constant-gradient acceleration/deceleration will be applied.</p>		
 <p>Acceleration</p> <p>a_{max}</p> <p>a_{min}</p> <p>Speed</p> <p>rated_spd</p> <p>rapid</p> <p>$acc_rate = \frac{a_{min}}{a_{max}} \times 100$</p>		
<p>---Setting range---</p> <p>0 to 100 (%)</p>		
#2153	G0t_rated	G0 time constant up to rated speed (multi-step acceleration/deceleration)
<p>Set the acceleration rate up to the rated speed of rapid traverse constant-gradient multi-step acceleration/deceleration.</p> <p>(Note) If this parameter is set to "0", constant-gradient acceleration/deceleration will be applied.</p>		
<p>---Setting range---</p> <p>0 to 4000 (ms)</p>		
#2155	hob_fwd_g	Feed forward gain for hobbing machining
<p>Set the feed forward gain when controlling as workpiece axis of tool spindle synchronization II (hobbing).</p>		
<p>---Setting range---</p> <p>0 to 200 (%)</p>		
#2157	G1bFx	Maximum axis-specific pre-interpolation cutting feed rate
<p>When axis-specific acceleration tolerance control is ON:</p> <p>Specify the maximum speed to be used for calculating each axis' acceleration tolerance. When "0" is set, "#2001 rapid" is used.</p> <p>When variable-acceleration pre-interpolation acceleration/deceleration is ON:</p> <p>Specify the maximum speed to be used for calculating each axis' acceleration. When "0" is set, "#1206 G1bF" is used.</p> <p>When both axis-specific acceleration tolerance control and variable-acceleration pre-interpolation acceleration/deceleration are ON:</p> <p>Specify the maximum speed to be used for calculating each axis' acceleration. When "0" is set, "#1206 G1bF" is used.</p> <p>When neither axis-specific acceleration tolerance control nor variable-acceleration pre-interpolation acceleration/deceleration is ON:</p> <p>This parameter is disabled.</p>		
<p>---Setting range---</p> <p>0 to 999999 (mm/min)</p>		

15 Machine Parameters

15.4 Axis Specifications Parameters

#2158	G1btLx	Axis-specific pre-interpolation cutting feed time constant
		<p>When axis-specific acceleration tolerance control is ON: Specify the time constant (a time to be taken until reaching the maximum speed) to be used for calculating each axis' acceleration tolerance. When "0" is set, "#2004 G0tL" is used.</p> <p>When variable-acceleration pre-interpolation acceleration/deceleration is ON: Specify the time constant (a time to be taken until reaching the maximum speed) to be used for calculating each axis' acceleration. When "0" is set, "#1207 G1btL" is used.</p> <p>When both axis-specific acceleration tolerance control and variable-acceleration pre-interpolation acceleration/deceleration are ON: Specify the time constant (a time to be taken until reaching the maximum speed) to be used for calculating each axis' acceleration. When "0" is set, "#1207 G1btL" is used.</p> <p>When neither axis-specific acceleration tolerance control nor variable-acceleration pre-interpolation acceleration/deceleration is ON: This parameter is disabled.</p> <p>---Setting range--- 0 to 5000 (ms)</p>
#2159	compX	Accuracy coefficient for each axis
		<p>Specify the compensation coefficient to be used for adjusting a path error and clamp speed at a corner for each axis during the high-accuracy control mode. If the setting value is larger, the edge accuracy will improve, but the cycle time may be longer because the corner speed will slow down.</p> <p>This parameter is disabled when the axis-specific acceleration tolerance control is OFF.</p> <p>---Setting range--- -1000 to 99 (%)</p>
#2161	exdcax1	External deceleration speed 1
		<p>Set the upper limit value of feedrate for each axis when the external deceleration signal is enabled and external deceleration speed 1 is selected.</p> <p>This parameter is valid when "#1239 set11/bit6" is set to "1".</p> <p>---Setting range--- 0 to 1000000 (mm/min)</p>
#2162	exdcax2	External deceleration speed 2
		<p>Set the upper limit value of feedrate for each axis when the external deceleration signal is enabled and external deceleration speed 2 is selected.</p> <p>This parameter is valid when "#1239 set11/bit6" is set to "1".</p> <p>---Setting range--- 0 to 1000000 (mm/min)</p>
#2163	exdcax3	External deceleration speed 3
		<p>Set the upper limit value of feedrate for each axis when the external deceleration signal is enabled and external deceleration speed 3 is selected.</p> <p>This parameter is valid when "#1239 set11/bit6" is set to "1".</p> <p>---Setting range--- 0 to 1000000 (mm/min)</p>
#2164	exdcax4	External deceleration speed 4
		<p>Set the upper limit value of feedrate for each axis when the external deceleration signal is enabled and external deceleration speed 4 is selected.</p> <p>This parameter is valid when "#1239 set11/bit6" is set to "1".</p> <p>---Setting range--- 0 to 1000000 (mm/min)</p>
#2165	exdcax5	External deceleration speed 5
		<p>Set the upper limit value of feedrate for each axis when the external deceleration signal is enabled and external deceleration speed 5 is selected.</p> <p>This parameter is valid when "#1239 set11/bit6" is set to "1".</p> <p>---Setting range--- 0 to 1000000 (mm/min)</p>

15 Machine Parameters

15.4 Axis Specifications Parameters

#2169	Man meas rtn dir	Return direction in manual measurement
	Select the direction of return operation in manual measurement. 0: Opposite to the contact direction 1: Fixed to the + direction Attempting return in the - direction will cause the operation alarm "0033 Rtn dir err in manual measure". 2: Fixed to the - direction Attempting return in the + direction will cause the operation alarm "0033 Rtn dir err in manual measure".	
#2170	Lmc1QR	Lost motion compensation gain 1 for high-speed retract
	Set the lost motion compensation gain in drilling cycle at high-speed retract (CW: - to + direction, CCW: + to - direction). Set "-1" when drilling cycle at high-speed retract is not performed. When set to 0, the performance will follow the setting of "#2171 Lmc2QR (Lost motion compensation gain 2 for high-speed retract)". ---Setting range--- -1, 0 to 200(%)	
#2171	Lmc2QR	Lost motion compensation gain 2 for high-speed retract
	Set the lost motion compensation gain in drilling cycle at high-speed retract (CW: - to + direction, CCW: + to - direction). Set "-1" when drilling cycle at high-speed retract is not performed. When set to 0, the performance will follow the setting of "#2170 Lmc1QR (Lost motion compensation gain 1 for high-speed retract)". ---Setting range--- -1, 0 to 200(%)	
#2172	LmcdQR	Lost motion compensation timing for high-speed retract
	Set the timing of the lost motion compensation in drilling cycle at high-speed retract. When set to 0, the performance will follow the setting of "#2239 SV039 LMCD (Lost motion compensation timing)". ---Setting range--- 0 to 2000 (ms)	
#2173	LmckQR	Lost motion compensation 3 spring constant for high-speed retract
	Set the machine system's spring constant when using lost motion compensation type 3 in drilling cycle with high-speed retract. When set to "0", the performance will follow the setting of "#2285 SV085 LMCK (Lost motion compensation 3 spring constant)". ---Setting range--- 0 to 32767 (0.01%/μm)	
#2174	LmccQR	Lost motion compensation 3 viscous coefficient for high-speed retract
	Set the machine system's viscous coefficient when using lost motion compensation type 3 in drilling cycle at high-speed retract. When set to "0", the performance will follow the setting of "#2286 SV086 LMCC (Lost motion compensation 3 viscous coefficient)". ---Setting range--- 0 to 32767(0.01%/μm)	
#2175	Special Ax Radius	Special diametral axis radius
	Set the radius of the special diametral axis. ---Setting range--- 0 to 99999.999 (mm)	

15 Machine Parameters

15.4 Axis Specifications Parameters

#2176		Special Ax Clamp	Special diametral axis clamp speed
		Set a clamp speed for the special diametral axis control. Set the limit speed of the drive system in this parameter.	
		---Setting range---	
		0 to 1000000 (°/min)	
		(Note) For "#2001 rapid" and "#2002 clamp", set speeds on a machining line. When the value in "#2176 Special Ax Clamp" is smaller than that in "#2001 rapid", "Special Ax Clamp" value will be applied to the clamp speed.	
#2177		ManualFeedBtL	Time constant for manual feed rate B
		Set the acceleration/deceleration time constant for manual feed rate B.	
		(Note) When set to "0", this parameter will not be used: conventional acceleration/deceleration will be performed.	
		---Setting range---	
		0 to 20000 (ms)	
(PR)	#2180	S_DIN	Speed observation input door No.
		Set the door signal input in the drive unit. Use this parameter only when the axis with a door signal belongs to several door groups. The correspondence between the door signals and bits are as follows. bit0: Door1 signal bit1: Door2 signal If the axis does not receive any door signal, set to "0". If 0 is set to the axis to which a door signal is input, the setting of #2118 is applied. Do not turn ON more than one bit. Only the door signals set in #2118 can be set.	
		---Setting range---	
		0000 to 0002 (HEX)	
(PR)	#2181	sscfeed1	Observation speed 1
		Set the observation speed, which is at the machine end, in the multi-step speed monitor. (Note 1) When the setting value is larger than 18000, the last 2 digits will be ignored. E.g.: 1234567 -> 1234500 (mm/min, °/min) (Note 2) Observation speeds (#2181 to #2186 and #2191 to #2192) need to satisfy the following condition. If not satisfied, the alarm (Y20 0007) will result.	
		$\frac{\text{sscfeed1} \sim 8}{\text{SV018:PIT}} \times \frac{\text{SV002:PC2}}{\text{SV001:PC1}} \leq 32767$	
		---Setting range---	
		0 to 6553500 (mm/min or °/min)	
(PR)	#2182	sscfeed2	Observation speed 2
		Set the observation speed, which is at the machine end, in the multi-step speed monitor. (Note 1) When the setting value is larger than 18000, the last 2 digits will be ignored. E.g.: 1234567 -> 1234500 (mm/min, °/min) (Note 2) Observation speeds (#2181 to #2186 and #2191 to #2192) need to satisfy the following condition. If not satisfied, the alarm (Y20 0007) will result.	
		$\frac{\text{sscfeed1} \sim 8}{\text{SV018:PIT}} \times \frac{\text{SV002:PC2}}{\text{SV001:PC1}} \leq 32767$	
		---Setting range---	
		0 to 6553500 (mm/min or °/min)	

15 Machine Parameters

15.4 Axis Specifications Parameters


(PR)	#2183	sscfeed3	Observation speed 3
			<p>Set the observation speed, which is at the machine end, in the multi-step speed monitor.</p> <p>(Note 1) When the setting value is larger than 18000, the last 2 digits will be ignored. E.g.: 1234567 -> 1234500 (mm/min, °/min)</p> <p>(Note 2) Observation speeds (#2181 to #2186 and #2191 to #2192) need to satisfy the following condition. If not satisfied, the alarm (Y20 0007) will result.</p> $\frac{\text{sscfeed1} \sim 8}{\text{SV018:PIT}} \times \frac{\text{SV002:PC2}}{\text{SV001:PC1}} \leq 32767$ <p>---Setting range---</p> <p>0 to 6553500 (mm/min or °/min)</p>
(PR)	#2184	sscfeed4	Observation speed 4
			<p>Set the observation speed, which is at the machine end, in the multi-step speed monitor.</p> <p>(Note 1) When the setting value is larger than 18000, the last 2 digits will be ignored. E.g.: 1234567 -> 1234500 (mm/min, °/min)</p> <p>(Note 2) Observation speeds (#2181 to #2186 and #2191 to #2192) need to satisfy the following condition. If not satisfied, the alarm (Y20 0007) will result.</p> $\frac{\text{sscfeed1} \sim 8}{\text{SV018:PIT}} \times \frac{\text{SV002:PC2}}{\text{SV001:PC1}} \leq 32767$ <p>---Setting range---</p> <p>0 to 6553500 (mm/min or °/min)</p>
(PR)	#2185	sscfeed5	Observation speed 5
			<p>Set the observation speed, which is at the machine end, in the multi-step speed monitor.</p> <p>(Note 1) When the setting value is larger than 18000, the last 2 digits will be ignored. E.g.: 1234567 -> 1234500 (mm/min, °/min)</p> <p>(Note 2) Observation speeds (#2181 to #2186 and #2191 to #2192) need to satisfy the following condition. If not satisfied, the alarm (Y20 0007) will result.</p> $\frac{\text{sscfeed1} \sim 8}{\text{SV018:PIT}} \times \frac{\text{SV002:PC2}}{\text{SV001:PC1}} \leq 32767$ <p>---Setting range---</p> <p>0 to 6553500 (mm/min or °/min)</p>
(PR)	#2186	sscfeed6	Observation speed 6
			<p>Set the observation speed, which is at the machine end, in the multi-step speed monitor.</p> <p>(Note 1) When the setting value is larger than 18000, the last 2 digits will be ignored. E.g.: 1234567 -> 1234500 (mm/min, °/min)</p> <p>(Note 2) Observation speeds (#2181 to #2186 and #2191 to #2192) need to satisfy the following condition. If not satisfied, the alarm (Y20 0007) will result.</p> $\frac{\text{sscfeed1} \sim 8}{\text{SV018:PIT}} \times \frac{\text{SV002:PC2}}{\text{SV001:PC1}} \leq 32767$ <p>---Setting range---</p> <p>0 to 6553500 (mm/min or °/min)</p>
(PR)	#2187	chgPLCax	PLC axis switchover axis No.
			<p>Specify the I/F No. of the PLC axis to use when switching between NC axis and PLC axis. Set the I/F No. of a vacant PLC axis.</p> <p>When not using, set to "0".</p> <p>---Setting range---</p> <p>0 to 8</p>

15 Machine Parameters

15.4 Axis Specifications Parameters

(PR)	#2188	S_SigIn	Safety observation signal input
			<p>This parameter specifies which observation speed change signal is input in the drive unit. The observation speed change signal corresponds to the following bits of the parameter.</p> <p>bit0: Observation speed change signal 1 is connected.</p> <p>bit1: Observation speed change signal 2 is connected.</p> <p>bit2: Observation speed change signal 3 is connected.</p> <p>If the axis receives no observation speed change signal, set to "0000".</p> <p>(Note) When a same setting value is set to more than one axis, or when more than one bit is set to turn ON for one axis, the alarm (Y20 0027) will occur.</p> <p>---Setting range---</p> <p>0000 to 0004 (HEX)</p>
(PR)	#2189	StlTrq (PwrCal)	Stall torque for power computation
			<p>Specify the stall torque of the servo motor.</p> <p>This value is used for calculating the servo motor's power consumption.</p> <p>---Setting range---</p> <p>0.000 to 1000.000 (N•m)</p>
(PR)	#2190	OT_Rreg	Designate R register for stored stroke limit I
			<p>Set the head R register No. to be used for setting/checking stored stroke limit I.</p> <p>Eight consecutive R registers from the R register No. set here will be the area for stored stroke limit I.</p> <p>Changing the areas for stored stroke limit I will be disabled if an R register that is not in the user area is set.</p> <p>In addition, make sure to set an even number for the head R register No. Changing the areas for stored stroke limit I will be disabled if an odd number is set.</p> <p>---Setting range---</p> <p>0 to 29892</p>
(PR)	#2191	sscfeed7	Observation speed 7
			<p>Set the observation speed, which is at the machine end, in the multi-step speed monitor.</p> <p>(Note 1) When the setting value is larger than 18000, the last 2 digits will be ignored. E.g.: 1234567 -> 1234500 (mm/min, °/min)</p> <p>(Note 2) Observation speeds (#2181 to #2186 and #2191 to #2192) need to satisfy the following condition. If not satisfied, the alarm (Y20 0007) will result.</p> $\frac{\text{sscfeed1} \sim 8}{\text{SV018:PIT}} \times \frac{\text{SV002:PC2}}{\text{SV001:PC1}} \leq 32767$ <p>---Setting range---</p> <p>0 to 6553500 (mm/min or °/min)</p>
(PR)	#2192	sscfeed8	Observation speed 8
			<p>Set the observation speed, which is at the machine end, in the multi-step speed monitor.</p> <p>(Note 1) When the setting value is larger than 18000, the last 2 digits will be ignored. E.g.: 1234567 -> 1234500 (mm/min, °/min)</p> <p>(Note 2) Observation speeds (#2181 to #2186 and #2191 to #2192) need to satisfy the following condition. If not satisfied, the alarm (Y20 0007) will result.</p> $\frac{\text{sscfeed1} \sim 8}{\text{SV018:PIT}} \times \frac{\text{SV002:PC2}}{\text{SV001:PC1}} \leq 32767$ <p>---Setting range---</p> <p>0 to 6553500 (mm/min or °/min)</p>

1 to 4000 (ms)

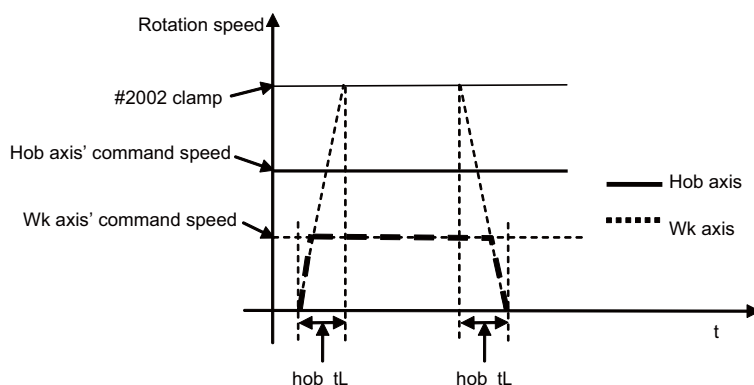0 to 4000 (ms)0 to 4000 (ms)

1 to 1000000 (mm/min)

15 Machine Parameters

15.4 Axis Specifications Parameters

#2562	VBL2 VG0	Variable backlash comp II Changeover speed 2
	Set the changeover speed at speed normalization. Set a value greater than that in "#2561 VBL2 VG1". Normally, the "#2561 VBL2 VG1" value corresponds to the cutting feedrate, the "#2562 VBL2 VG0" value to the rapid traverse rate. ---Setting range--- 1 to 1000000 (mm/min)	
#2563	VBL2 P1	Variable backlash comp II Stroke position 1
	Set the most plus (+) side stroke position among the three. Set the parameters VBL2 P1 to P3 to be "VBL2 P1 > VBL2 P2 > VBL2 P3". Normally, divide the axis's stroke by four, and set a dividing position (except for both ends) to be a stroke position. ---Setting range--- -99999.999 to 99999.999 (mm)	
#2564	VBL2 P2	Variable backlash comp II Stroke position 2
	Set the middle stroke position among the three. Set the parameters VBL2 P1 to P3 to be "VBL2 P1 > VBL2 P2 > VBL2 P3". Normally, divide the axis's stroke by four, and set a dividing position (except for both ends) to be a stroke position. ---Setting range--- -99999.999 to 99999.999 (mm)	
#2565	VBL2 P3	Variable backlash comp II Stroke position 3
	Set the most minus (-) side stroke position among the three. Set the parameters VBL2 P1 to P3 to be "VBL2 P1 > VBL2 P2 > VBL2 P3". Normally, divide the axis's stroke by four, and set a dividing position (except for both ends) to be a stroke position. ---Setting range--- -99999.999 to 99999.999 (mm)	
#2566	VBL2 BL11	Variable backlash comp II Comp data at changeover spd 1 and stroke pos 1
	Set the compensation data (backlash amount) at changeover speed 1 and stroke position 1. Calculate the current compensation data according to the current speed and position. ---Setting range--- -99999999 to 99999999 (Machine error compensation unit)	
#2567	VBL2 BL12	Variable backlash comp II Comp data at changeover spd 1 and stroke pos 2
	Set the compensation data (backlash amount) at changeover speed 1 and stroke position 2. Calculate the current compensation data according to the current speed and position. ---Setting range--- -99999999 to 99999999 (Machine error compensation unit)	
#2568	VBL2 BL13	Variable backlash comp II Comp data at changeover spd 1 and stroke pos 3
	Set the compensation data (backlash amount) at changeover speed 1 and stroke position 3. Calculate the current compensation data according to the current speed and position. ---Setting range--- -99999999 to 99999999 (Machine error compensation unit)	
#2569	VBL2 BL01	Variable backlash comp II Comp data at changeover spd 2 and stroke pos 1
	Set the compensation data (backlash amount) at changeover speed 2 and stroke position 1. Calculate the current compensation data according to the current speed and position. ---Setting range--- -99999999 to 99999999 (Machine error compensation unit)	

15 Machine Parameters

15.4 Axis Specifications Parameters

#2570	VBL2 BL02	Variable backlash comp II Comp data at changeover spd 2 and stroke pos 2
Set the compensation data (backlash amount) at changeover speed 2 and stroke position 2. Calculate the current compensation data according to the current speed and position.		
---Setting range---		
-99999999 to 99999999 (Machine error compensation unit)		
#2571	VBL2 BL03	Variable backlash comp II Comp data at changeover spd 2 and stroke pos 3
Set the compensation data (backlash amount) at changeover speed 2 and stroke position 3. Calculate the current compensation data according to the current speed and position.		
---Setting range---		
-99999999 to 99999999 (Machine error compensation unit)		
#2572	VBL2 FloatTC	Variable backlash comp II Time constant in calculating float amt
Set the time constant in calculating the float amount. Set a value greater than the calculation cycle.		
---Setting range---		
0 to 10000 (ms)		
#2573	VBL2 LMMul	Variable backlash comp II Multiplier in calculating lost motion amt
Set the multiplier in calculating the lost motion amount. When "1000" is set, the multiplier is "1".		
---Setting range---		
0 to 1000 (1/1000)		
#2574	VBL2 VBound	Variable backlash comp II Speed boundary value
Set the boundary value of the speed in calculating the compensation amount.		
---Setting range---		
1 to 1000000 (mm/min)		
#2575	VBL2 CompMag	Variable backlash comp II Compensation magnification
Set the compensation magnification in calculating the compensation amount. When "0" is set, the magnification is 100%.		
---Setting range---		
0 to 300(%)		
#2576	VBL2 CompMul	Variable backlash comp II Multiplier in calculating compensation amount
Set the multiplier in calculating the compensation amount. When "1000" is set, the multiplier is "1".		
---Setting range---		
0 to 1000 (1/1000)		
#2577	VBL2 BLE	Variable backlash comp II Gradually increase amount
Set the value to subtract from the compensation amount (CMP) at reversing the axis travel direction.		
---Setting range---		
-99999999 to 99999999 (Machine error compensation unit)		
#2578	VBL2 BLL	Variable backlash comp II Gradually increase travel distance
Set the travel distance to return to the compensation amount (CMP) from the reverse point of the axis travel direction.		
---Setting range---		
0 to 99999.999 (mm)		


15 Machine Parameters

15.4 Axis Specifications Parameters

	#2579	BLAT_feed	Feed rate for automatic backlash adjustment
		Set the feed rate in adjusting the backlash amount. It is possible to set this parameter also by carrying out a measurement condition adjustment on the backlash adjustment screen.	
		---Setting range---	
		0 to 1000000(mm/min)	
(PR)	#2580	index_Gcmd	Indexing axis G command check
		The commanded G code of the index table indexing axis is checked.	
		0: Check is not performed.	
		1: Cutting feed G command is prohibited.	
	#2581	BLAT_pos	Measurement position for automatic backlash adjustment
		Set the measurement position in measurement condition adjustment and backlash adjustment on the machine coordinate system.	
		(Note 1) Set the position so that a collision will not occur during adjustment.	
		(Note 2) Set this parameter for all the axes.	
		---Setting range---	
		-99999.999 to 99999.999 (mm)	
	#2582	BLAT_syn	Synchronization setting for automatic backlash adjustment
		0: Separate backlash adjustment for master axis and slave axis each.	
		1: Backlash adjustment is applied only to the master axis. The master axis's backlash amount is applied to the slave axis.	
		(Note 1) Set this parameter for the master axis.	
		(Note 2) In the case of synchronous control of speed/current command, set to "1".	
	#2584	VBL2 Vlimit	Variable backlash compensation 2: Speed to reset compensation scale to 100%
		Specify the speed at which compensation scale is reset to 100%.	
		When "0" is set, this parameter is disabled.	
		If a set speed is greater than "#2574 VBL2 VBound", the speed is clamped at "#2574 VBL2 VBound".	
		---Setting range---	
		0 to 1000000 (mm/min)	
	#2585	Cycncmp	Enable cyclic error compensation
		Specify whether to enable the cyclic error compensation.	
		0: Disable	
		1: Enable	
	#2586	Cycstnum	Cyclic error compensation: initial number of compensation
		Specify the initial number of the compensation amounts.	
		The compensation amounts to be applied will start from this number, and the number of compensation amounts to be applied is specified by "#2587 Cycdv" (Cyclic error compensation: number of divisions).	
		---Setting range---	
		4101 to 5999	
	#2587	Cycdv	Cyclic error compensation: number of divisions
		Specify the number of divisions per cycle of the cyclic error compensation.	
		---Setting range---	
		1 to 128	
	#2588	Cycct	Cyclic error compensation: cycle constant
		Specify the number of compensation cycles per revolution of the rotary axis.	
		---Setting range---	
		0 to 32767	

15 Machine Parameters

15.4 Axis Specifications Parameters
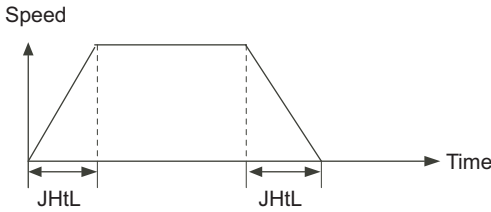
#2598		G0tL_2	G0 time constant 2 (linear)
		<p>Set a linear control time constant for rapid traverse acceleration/deceleration to be applied when the G0 time constant switchover request signal is ON.</p> <p>This time constant is enabled when LR (rapid traverse feed with linear acceleration/deceleration) or F (soft acceleration/deceleration) is selected in "#2003 smgst" (Acceleration and deceleration modes).</p> <p>If #2598 is 0, the time constant set in "#2004 G0tL (G0 time constant)" will be used.</p> <p>---Setting range---</p> <p>0 to 4000(ms)</p>	
#2599		G0t1_2	G0 time constant 2 (primary delay)/2nd-step time constant for soft acceleration/deceleration
		<p>Set a primary-delay time constant for rapid traverse acceleration/deceleration to be applied when the G0 time constant switchover request signal is ON.</p> <p>This time constant is enabled when R1 (rapid traverse feed with primary delay) or R3 (exponential acceleration and linear deceleration) is selected in "#2003 smgst" (Acceleration and deceleration modes).</p> <p>When the soft acceleration/deceleration is selected, the second-step time constant will be used.</p> <p>If #2599 is set to 0, the time constant set in "#2005 G0t1 (G0 time constant (primary delay)/2nd-step time constant for soft acceleration/deceleration)" will be used.</p> <p>---Setting range---</p> <p>0 to 5000 (ms)</p>	
(PR)	#2614	JH_smgSel	Jog/handle acceleration/deceleration selection
		<p>Switch jog/handle time constants. Set per axis.</p> <p>0: Not use</p> <p>1: (Not used)</p> <p>2: Enable for handle feed</p>	
#2616		JHtL	Jog/handle time constant (linear)
		<p>Set a linear control time constant for jog/handle feed acceleration/deceleration.</p> <p>When set to "0", the time constant will be clamped at 1 [ms].</p>	
			
		<p>---Setting range---</p> <p>0 to 4000 (ms)</p>	
#2619		thr_clamp	Thread cut clamp speed
		<p>Specify the maximum cutting feed rate to be applied to thread cutting for each axis.</p> <p>---Setting range---</p> <p>1 to 1000000</p>	
#2620		thr_t	Thread cut time constant
		<p>Specify the primary delay time constant to be used in acceleration/deceleration of a thread cut axis.</p> <p>* This parameter is enabled when either C1 (Primary delay cutting feed) or LC (Linear acceleration/deceleration cutting feed) is selected for the acceleration/deceleration mode (#2003 smgst).</p> <p>---Setting range---</p> <p>0 to 4000</p>	
#2621		plrapid2	Rapid traverse rate for superimposition control 2
		<p>Specify the rapid traverse rate to be applied under 2-axis superimposition control when the axis traverses in the same direction as the other axis that is travelling at a cutting feed rate.</p> <p>---Setting range---</p> <p>0 to 1000000 (mm/min)</p>	

15 Machine Parameters

15.4 Axis Specifications Parameters

#2622	pl3G0tL	G0 time constant (linear) for 3-axis serial superimposition control
Specify the G0 time constant (linear) to be applied under 3-axis serial superimposition control.		
---Setting range---		
0 to 4000 (ms)		
#2623	pl3G0t1	G0 time constant (primary delay) for 3-axis serial superimposition control
Specify the G0 time constant (primary delay) to be applied under 3-axis serial superimposition control.		
---Setting range---		
0 to 5000 (ms)		
#2624	pl3G1tL	G1 time constant (linear) for 3-axis serial superimposition control
Specify the G1 time constant (linear) to be applied under 3-axis serial superimposition control.		
---Setting range---		
0 to 4000 (ms)		
#2625	pl3G1t1	G1 time constant (primary delay) for 3-axis serial superimposition control
Specify the G1 time constant (primary delay) to be applied under 3-axis serial superimposition control.		
---Setting range---		
0 to 5000 (ms)		
#2626	pl3rapid	Rapid traverse rate for 3-axis serial superimposition control
Specify the rapid traverse rate to be applied when all the three superimposed axes are rapid-traversing in a single direction under 3-axis serial superimposition control.		
---Setting range---		
0 to 1000000 (mm/min)		
#2627	pl3rapid2	Rapid traverse rate for 3-axis serial superimposition control 2
Specify the rapid traverse rate to be applied under 3-axis serial superimposition control when two of the three superimposed axes are rapid-traversing while the remaining one axis is fed at a cutting feed rate in a single direction.		
---Setting range---		
0 to 1000000 (mm/min)		
#2628	pl3rapid3	Rapid traverse rate for 3-axis serial superimposition control 3
Specify the rapid traverse rate to be applied under 3-axis serial superimposition control when one of the three superimposed axes is rapid-traversing while the remaining two axes are fed at a cutting feed rate in a single direction.		
---Setting range---		
0 to 1000000 (mm/min)		
#2629	pl3clamp	Cutting feed clamp speed for 3-axis serial superimposition control
Specify the cutting feed clamp speed to be applied under 3-axis serial superimposition control when all the three superimposed axes are fed at a cutting feed rate in a single direction.		
---Setting range---		
0 to 1000000 (mm/min)		
#2630	pl3clamp2	Cutting feed clamp speed for 3-axis serial superimposition control 2
Specify the cutting feed clamp speed to be applied under 3-axis serial superimposition control when one of the three superimposed axes is rapid-traversing while the other two are fed at a cutting feed rate in a single direction.		
---Setting range---		
0 to 1000000 (mm/min)		

15 Machine Parameters

15.4 Axis Specifications Parameters

#2631	G0olnps	Rapid traverse block overlap G00 in-position width
	Specify the in-position width for the rapid traverse block overlap at the joint of consecutively given G00 blocks.	
	---Setting range---	
	0.000 to 1000.000 (mm)	
#2632	G1olnps	Rapid traverse block overlap G01 in-position width
	Specify the in-position width for the rapid traverse block overlap at the joint of two blocks where G01 is included.	
	---Setting range---	
	0.000 to 1000.000 (mm)	
#2633	G28olnps	Rapid traverse block overlap G28 in-position width
	Specify the in-position width for the rapid traverse block overlap at the joint of two blocks where G28/G30 is included.	
	---Setting range---	
	0.000 to 1000.000 (mm)	
(PR) #2634	SrvFunc01	
	bit0: Change output units of servo axis cutting torque	
	Change the output units of the servo axis cutting torque.	
	0: Output unit 1%	
	1: Output unit 0.01%	
	bit1: Select stop method at collision detection	
	Set the operation when a collision is detected.	
	0: Emergency stop.	
	1: Servo alarm occurs to an axis that the collision was detected.	
	The axes in the part system that the collision was detected will be in an automatic interlocked state.	
	Related parameters: SV035/bitE-C, SV035/bitB, SV060, CrshStpSel	
#2639	tskip_T	Non-sensitive band for torque skip
	Specify a period of time in which torque skip condition is disabled. This is effective when an improper skip is generated due to current flow during acceleration (when G160 is commanded).	
	---Setting range---	
	0 to 32767(ms)	
#2641	m_clamp	Manual feed clamp speed
	Specify the maximum speed to be applied to each axis when manual speed clamp is enabled.	
	When 0 is set, the rapid traverse rate (#2001 rapid) is applied.	
	---Setting range---	
	0 to 1000000 (mm/min)	
#2642	jogfeed	Jog feed rate
	Specify a feed rate to be applied to each axis during jog mode.	
	When 0 is set, the manual feed rate selected by Manual feedrate method selection (JVS) signal is applied.	
	---Setting range---	
	0 to 1000000 (mm/min)	
(PR) #2643	LdMeter thresholdY	Loadmeter: Caution (Yellow) threshold
	Specify the servo load current (%) at which the loadmeter displays a caution sign (yellow).	
	If servo load current exceeds the specified value, the loadmeter displays a caution (yellow).	
	If you wish to avoid showing the caution (yellow), set this parameter to be the same as "#2644 LdMeter thresholdR".	
	When "0" is set, the value becomes 100% (default).	
	---Setting range---	
	0 to 300(%)	

15 Machine Parameters

15.4 Axis Specifications Parameters

(PR)	#2644	LdMeter thresholdR	Loadmeter: Warning (Red) threshold
		Specify the servo load current (%) at which the loadmeter displays a warning sign (red). If servo load current exceeds the specified value, the loadmeter displays a warning (red). If you wish to avoid showing the warning (red), set this parameter to be the same as "#2645 LdMeter load max". When "0" is set, the value becomes 150% (default). ---Setting range--- 0 to 300(%)	
(PR)	#2645	LdMeter load max	Loadmeter: Maximum servo load current
		Specify the maximum servo load current (%) for loadmeter display. When "0" is set, the value becomes 200% (default). ---Setting range--- 0 to 300(%)	
	#2646	distt	Load observation disturbance torque filter time constant
		Set the responsiveness in detecting the disturbance torque. ---Setting range--- 0 to 1000 (ms) (Default value: 0)	
(PR)	#2651	RT2G0	RT2: Minimum value of G0 acce/dece time constant
		Select whether to enable switching of G0 acceleration/deceleration time constant. 0: Disable switching of G0 acceleration/deceleration time constant. 1: Enable switching of G0 acceleration/deceleration time constant.	
(PR)	#2652	RT2G1	RT2: Enable switching of G1 acce/dece time constant
		Select whether to enable switching of G1 acceleration/deceleration time constant. 0: Disable switching of G1 acceleration/deceleration time constant. 1: Enable switching of G1 acceleration/deceleration time constant.	
	#2653	RT2G0tL	RT2: Minimum value of G0 acce/dece time constant
		Set the minimum value of time constant when changing time constant during acceleration and deceleration of G0 command. Set the time constant which is adjusted when workpiece is not attached. Note that when 0 is set, the value will be 10 (default). ---Setting range--- 0 to 4000 (ms)	
	#2654	RT2G1tLA	RT2: Minimum value of acce/dece time constant after G1 interpolation
		Set the minimum value when changing time constant during acceleration and deceleration of G1 command after interpolation. Set the time constant which is adjusted when workpiece is not attached. Note that when 0 is set, the value will be 10 (default). ---Setting range--- 0 to 4000 (ms)	
	#2655	RT2G1tLB	RT2: Minimum value of acce/dece time constant before G1 interpolation
		Set the minimum value when changing time constant during acceleration and deceleration of G1 command before interpolation. Set the time constant which is adjusted when workpiece is not attached. Note that when 0 is set, the value will be 10 (default). ---Setting range--- 0 to 4000 (ms)	

15 Machine Parameters

15.4 Axis Specifications Parameters

#2656	RT2 G0rng	RT2: Changing amount of G0 acce/dece time constant
	Set the changing amount of time constant when changing time constant during acceleration and deceleration of G0 command based on the estimated inertia ratio. Note that when 0 is set, the value will be 10 (default).	
	---Setting range---	
	0 to 4000 (ms)	
#2657	RT2G1rngA	RT2: Changing amount of acce/dece time constant after G1 interpolation
	Set the changing amount of time constant when changing time constant during acceleration and deceleration of G1 command after interpolation based on the estimated inertia ratio. Note that when 0 is set, the value will be 10 (default).	
	---Setting range---	
	0 to 4000 (ms)	
#2658	RT2G1rngB	RT2: Changing amount of acce/dece time constant before G1 interpolation
	Set the changing amount of time constant when changing time constant during acceleration and deceleration of G1 command before interpolation based on the estimated inertia ratio. Note that when 0 is set, the value will be 10 (default).	
	---Setting range---	
	0 to 4000 (ms)	
#2659	tolerance	Tolerance
	Specify a tolerance (tolerable error) to be used under tolerance control. Set a tolerable error for fine segment program created by CAM. (Usually around 0.01(mm)) If 0.000 is set, it is operated with the tolerance of 0.01(mm). When designating the tolerance amount with the ", K address", this parameter is not used.	
	---Setting range---	
	0.000 to 100.000 (mm)	
#2660	omrff_inps	OMR-FF in-position width
	Specify the in-position width at which the standard model gain is switched under OMR-FF control. When set to "0", command deceleration check is performed.	
	---Setting range---	
	0.000 to 99.999 (mm)	
#2661	ITF3_ILMT	Interference check III torque limit at entering interference warning area
	In interference check III, select whether to limit the torque at entering the interference warning area. 0: No torque limit (Use "#2213 SV013 (Current limit value)") 1: Limit the torque (Use "#2214 SV014 (Current limit value in special control)") (Note) This setting is invalid if spindle/C axis is the target axis. (Torque cannot be limited.)	
#2662	ITF3_Clamp	Interference check III clamp speed at entering interference warning area
	In interference check III, if clamping the speed, the clamp speed is set at entering the interference warning area. (Note) When "0" is set, the speed will not be clamped.	
	---Setting range---	
	0 to 1000000 (mm/min)	

15 Machine Parameters

15.4 Axis Specifications Parameters

(PR)	#2674	primno	Multiple axis synchronization control: Master axis No.
<p>This parameter is used for the multiple axis synchronization control.</p> <p>Specify the master axis No. that corresponds to the axis.</p> <ul style="list-style-type: none"> ♦Enter the sequential NC axis No., with the 1st axis of the 1st part system set as "1". ♦You cannot set the No. of the axis targeted for the multiple axis synchronization control in "#1068 slavno". ♦You cannot set "#1068 slavno" for the axis targeted for the multiple axis synchronization control. ♦The master axis for multiple axis synchronization control cannot be set in "#2674 primno". ♦For a multi-part system configuration, you cannot set the axes across different part systems. <p>---Setting range---</p> <p>0: No master axis</p> <p>1 to 32: 1st axis to 32nd axis</p>			
(PR)	#2675	tcmp_top	Multiple axis synchronization control: starting tool off-set No.
<p>This parameter is used for the multiple axis synchronization control.</p> <p>Specify the starting tool offset No. for the axis.</p> <p>---Setting range---</p> <p>0 to 999</p>			
	#2678	OMRCC_valid	OMR-CC ON
<p>Specify whether to enable OMR-CC.</p> <p>0: Disable OMR-CC</p> <p>1: Enable OMR-CC</p>			
	#2679	OMRCC_CompMag	Factor for OMR-CC compensation amount
<p>Adjust the compensation amount output by OMR-CC.</p> <p>When "0" is specified, the compensation amount adjusted by the standard value (50%) is output.</p> <p>---Setting range---</p> <p>0 to 100 (%)</p>			
	#2680	TCMPG1	Cogging torque compensation gain 1 (fundamental wave component)
<p>Specify the amplitude of compensation signal (fundamental wave component) in the unit of 0.01% of stall current.</p> <p>When "0" is set, the compensation is disabled.</p> <p>---Setting range---</p> <p>0 to 10000 (0.01%)</p>			
	#2681	TCMPT1	Cogging torque compensation timing 1 (fundamental wave component)
<p>Set the timing of compensation signal (fundamental wave component). The signal timing is adjusted with one cycle of fundamental wave component taken as 100%.</p> <p>When "50" is set, the compensation signal is inverted.</p> <p>Setting it to "100" results in the same signal timing as when "0" is set.</p> <p>---Setting range---</p> <p>0 to 100 (%)</p>			
	#2682	TCMPG2	Cogging torque compensation gain 2 (second-order component)
<p>Specify the amplitude of compensation signal (second-order component) in the unit of 0.01% of stall current.</p> <p>When "0" is set, the compensation is disabled.</p> <p>---Setting range---</p> <p>0 to 10000 (0.01%)</p>			

15 Machine Parameters

15.4 Axis Specifications Parameters

	#2683	TCMPT2	Cogging torque compensation timing 2 (second-order component)
		<p>Set the timing of compensation signal (second-order component). The signal timing is adjusted with one cycle of fundamental wave component * 2 taken as 100%.</p> <p>When "50" is set, the compensation signal is inverted.</p> <p>Setting it to "100" results in the same signal timing as when "0" is set.</p> <p>---Setting range---</p> <p>0 to 100 (%)</p>	
	#2684	TCMPG3	Cogging torque compensation gain 3 (third-order component)
		<p>Specify the amplitude of compensation signal (third-order component) in the unit of 0.01% of stall current.</p> <p>When "0" is set, the compensation is disabled.</p> <p>---Setting range---</p> <p>0 to 10000 (0.01%)</p>	
	#2685	TCMPT3	Cogging torque compensation timing 3 (third-order component)
		<p>Set the timing of compensation signal (third-order component). The signal timing is adjusted with one cycle of fundamental wave component * 3 taken as 100%.</p> <p>When "50" is set, the compensation signal is inverted.</p> <p>Setting it to "100" results in the same signal timing as when "0" is set.</p> <p>---Setting range---</p> <p>0 to 100 (%)</p>	
	#2686	TCMPG4	Cogging torque compensation gain 4 (fourth-order component)
		<p>Specify the amplitude of compensation signal (fourth-order component) in the unit of 0.01% of stall current.</p> <p>When "0" is set, the compensation is disabled.</p> <p>---Setting range---</p> <p>0 to 10000 (0.01%)</p>	
	#2687	TCMPT4	Cogging torque compensation timing 4 (fourth-order component)
		<p>Specify the timing of compensation signal (fourth-order component). The signal timing is adjusted with one cycle of fundamental wave component * 4 taken as 100%.</p> <p>When "50" is set, the compensation signal is inverted.</p> <p>Setting it to "100" results in the same signal timing as when "0" is set.</p> <p>---Setting range---</p> <p>0 to 100 (%)</p>	
	#2695	TCMPP	Fundamental wave cycle of cogging torque
		<p>Set the fundamental wave frequency to be used for cogging torque compensation, using the electrical angle: $360[\text{deg}] * 1/N$.</p> <p>Setting it to "0" leads to the same fundamental wave frequency magnification as when "2" is set.</p> <p>For a linear motor, set "0".</p> <p>For a rotary motor, set the fundamental wave frequency magnification per electrical angle according to the motor to use.</p> <p>---Setting range---</p> <p>0 to 32</p>	
(PR)	#2699	mult syn polar	Relative polarity of secondary axis
		<p>Specify the travel direction of the secondary axis relative to the primary axis.</p> <p>0: Secondary axis travels in the same direction as the primary axis.</p> <p>1: Secondary axis travels in the opposite direction to the primary axis.</p>	

15 Machine Parameters

15.4 Axis Specifications Parameters

#2701		Work base ofs	Workpiece base point offset (for L system only)
		Set the offset amount to shift all workpiece coordinate systems. Setting this parameter enables the base point for shifting the workpiece coordinate system to be offset to any position.	
		---Setting range--- -99999.999 to 99999.999 (mm)	
#2702		exencno	External encoder No. for servo axis
		When external encoder is used to detect the FB position of the servo axis unit to be displayed on the Drive monitor screen, specify the external encoder No. When external encoder is used, the position within one revolution from 0 to 360 degrees is displayed on the Machine end FB. When you want to reverse the rotation direction of external encoder, specify the negative value of the external encoder No. When external encoder is not used, set "0".	
		---Setting range--- -1 to 1	
(PR) #2703		manual_acc	Enable constant-gradient acceleration/deceleration in manual feed
		Select the acceleration and deceleration type for jog feed and manual rapid traverse. 0: Acceleration and deceleration with constant time 1: Acceleration and deceleration with constant gradient	
(PR) #2704		MCR Coord Tr Axis	Motion control release (coordinate transformation) axis
		Specify to which axis the coordinate transformation function applies in the motion control release (coordinate transformation). 0: Not apply 1: Apply	
#2706		OT_1B[2]-	Soft limit IB[2]-
		Set the coordinates of the lower limit of the prohibited area of the stored stroke limit IB. The coordinates should be based on the origin of the basic machine coordinate system. If the same value is set for both the sign and numeral value as "#2707 OT_1B[2]+", the stored stroke limit IB function set with #2706 and #2707 will be disabled. (Note) This parameter is valid when "#2063 OT_1Btype" is "0".	
		---Setting range--- -99999.999 to 99999.999 (mm)	
#2707		OT_1B[2]+	Soft limit IB[2]+
		Set the coordinates of the upper limit of the prohibited area of the stored stroke limit IB. The coordinates should be based on the origin of the basic machine coordinate system. (Note) This parameter is valid when "#2063 OT_1Btype" is "0".	
		---Setting range--- -99999.999 to 99999.999 (mm)	
#2709		TLM_approach	Tool setter approach distance
		Specify the minimum travel distance when approaching the sensor in Manual tool length measurement 2. (radius value) Axis movement more or longer than the distance set in this parameter determines the direction of movement to the sensor and the contact surface. (Note) When "0" is set, contact surface identification is not performed after reversing the axis feed direction.	
		---Setting range--- 0 to 99999.999 (mm)	

15 Machine Parameters

15.4 Axis Specifications Parameters

	#12570	VibCutting_VCC	Vibration cutting control ON
		<p>This parameter specifies whether to enable the vibration cutting control.</p> <p>0: Disable</p> <p>1: Enable</p> <p>(*) For a rotary axis or PLC axis, the vibration cutting control is disabled irrespective of this parameter.</p>	
	#12571	VibClamp_VCC	Cutting feedrate clamp in vibration cutting mode
		<p>This parameter specifies the maximum cutting feedrate to be applied to each axis during the vibration cutting mode.</p> <p>If this parameter is set to "0" or a value greater than "#2002 clamp", the value of "#2002 clamp" will be applied.</p> <p>---Setting range---</p> <p>0 to 1000000 (mm/min)</p>	
	#12583	VibPGMsp_VCC	VCC reference model gain
		<p>This parameter specifies the reference model gain (the position response during OMR-FF) to be applied to each axis during the vibration cutting mode.</p> <p>If this parameter is set to "0", the value of SV197 (PGMsp) or SV106 (PGM) will be applied in this order.</p> <p>---Setting range---</p> <p>0 to 300 (rad/s)</p>	
	#12586	ActualClamp_VCC	Vibration axis feedrate limit in vibration cutting mode
		<p>Specify the maximum feedrate to be applied to each axis during the vibration cutting mode.</p> <p>When not using this parameter, set "0".</p> <p>---Setting range---</p> <p>0 to 1000000 (mm/min)</p>	
(PR)	#12590	BWD_Enable	Brake wear diagnostics ON
		<p>Select whether to enable brake wear diagnostics.</p> <p>0: Disable</p> <p>1: Enable (External relay circuit method)</p> <p>2: Enable (Drive unit internal control circuit method)</p>	
	#12591	BWD_ILIM	Brake wear diagnostics current limit value
		<p>Specify the current limit value during brake wear diagnostics as a percent of the stall current.</p> <p>If "0" is set, an alarm is generated when an attempt is made to start brake wear diagnostics, which will not start.</p> <p>---Setting range---</p> <p>0 to 100 (%)</p>	
(PR)	#12592	BWD_CMDWT	Brake wear diagnostics command wait time
		<p>Specify the wait time between the receipt of the brake wear diagnostics start signal (BWDSTm) by the NC and the issuance of the movement command for brake wear diagnostics.</p> <p>If set to "0", the command wait time is 400 [ms].</p> <p>---Setting range---</p> <p>0 to 30000 (ms)</p>	
(PR)	#12593	BWD_FD	Brake wear diagnostics command travel amount
		<p>Specify the amount of travel for the command given to the axis to be diagnosed during brake wear diagnostics.</p> <p>If "0" is set, an alarm is generated when an attempt is made to start brake wear diagnostics, which will not start.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm or deg)</p>	

15 Machine Parameters

15.4 Axis Specifications Parameters

(PR)	#12594	BWD_FDRATE	Brake wear diagnostics feedrate
Specify the feedrate for the command given to the axis to be diagnosed during brake wear diagnostics. If "0" is set, an alarm is generated when an attempt is made to start brake wear diagnostics, which will not start.			
---Setting range---			
0 to 1000000 (mm/min or deg/min)			
(PR)	#12595	BWD_OBTIM	Brake wear diagnostics monitoring time
Specify the duration of the axis travel amount monitoring after the output of the movement command for diagnostics is completed during brake wear diagnostics. If set to "0", the monitoring time is 1000 [ms].			
---Setting range---			
0 to 30000 (ms)			
(PR)	#12596	BWD_TOL(Warning)	Brake wear diagnostics allowable travel amount (Warning)
Specify the allowable travel amount for the axis to be diagnosed during brake wear diagnostics. (If the travel amount during brake wear diagnostics exceeds the value of this parameter, "BrakeWearDiagnostics (Warning)" is generated.) If set to "0", the allowable travel amount is 100 [mm].			
---Setting range---			
0 to 99999.999 (mm or deg)			
(PR)	#12597	BWD_TOL(Caution)	Brake wear diagnostics allowable travel amount (Caution)
Specify the allowable travel amount for the axis to be diagnosed during brake wear diagnostics. (If the travel amount during brake wear diagnostics exceeds the value of this parameter, "BrakeWearDiagnostics (Caution)" is generated.) If a value greater than or equal to "#12596 BWD_TOL(Warning)" or "0" is set, this parameter becomes invalid, and "BrakeWearDiagnostics (Caution)" is not generated. Specify a value that satisfies "#12596 BWD_TOL(Warning)" > "#12597 BWD_TOL(Caution)".			
---Setting range---			
0 to 99999.999 (mm or deg)			
	#14301	valVDC	Variable full-closed torsion compensation ON
Select whether to enable or disable the variable full-closed torsion compensation. 0: Disable 1: Enable			
	#14302	VDCtex_sc	Variable full-closed torsion compensation: time constant magnification
Specify the magnification of time constant for variable full-closed torsion compensation (VDCtex1 to 8). When not using, set to "0".			
---Setting range---			
0 to 9999 (%)			
	#14303	VDCpex_sc	Variable full-closed torsion compensation: compensation (+) magnification
Specify the magnification of variable full-closed torsion compensation value (+) (VDCpex1 to 8). When not using, set to "0".			
---Setting range---			
0 to 32767 (%)			
	#14304	VDCnex_sc	Variable full-closed torsion compensation: compensation (-) magnification
Specify the magnification of variable full-closed torsion compensation value (-) (VDCnex1 to 8). When not using, set to "0".			
---Setting range---			
0 to 32767 (%)			

15 Machine Parameters

15.4 Axis Specifications Parameters

#14305	VDCtex_sft	Variable full-closed torsion compensation: compensation time constant shift
Specify the shift amount for variable full-closed torsion compensation time constant (VDCtex1 to 8). When not using, set to "0". ---Setting range--- -9999 to 9999(ms)		
#14306	VDCpex_sft	Variable full-closed torsion compensation: compensation value (+) shift
Specify the shift amount for variable full-closed torsion compensation value (+) (VDCpex1 to 8). When not using, set to "0". ---Setting range--- -32768 to 32767 (0.01 μm)		
#14307	VDCnex_sft	Variable full-closed torsion compensation: compensation value (-) shift
Specify the shift amount for variable full-closed torsion compensation value (-) (VDCnex1 to 8). When not using, set to "0". ---Setting range--- -32768 to 32767 (0.01 μm)		
#14311+5(n-1)	VDCan	Variable full-closed torsion compensation acceleration n
Specify the acceleration at which variable full-closed torsion compensation is applied. (n=1 to 8) Set the acceleration at reversal of machine travel direction. When not using, set to "0". ---Setting range--- 0 to 2147483647 ($\mu\text{m}/\text{s}^2$)		
#14312+5(n-1)	VDCtexn	Variable full-closed torsion compensation: compensation time constant n
Specify the time constant for variable full-closed torsion compensation. (n=1 to 8) This sets the timing of applying the variable full-closed torsion compensation. When 0 is set, the compensation is applied at the timing when the speed reaches the acceleration set in Variable full-closed torsion compensation acceleration n. ---Setting range--- 0 to 9999(ms)		
#14313+5(n-1)	VDCpexn	Variable full-closed torsion compensation: compensation value n (+)
Specify the compensation value of variable full-closed torsion compensation in the positive (+) direction. (n=1 to 8) Set the length of torsion (+) at reversal of machine travel direction. When not using, set to "0". ---Setting range--- 0 to 32767 (0.01 μm)		
#14314+5(n-1)	VDCnexn	Variable full-closed torsion compensation: compensation value n (-)
Specify the compensation value of variable full-closed torsion compensation in the negative (-) direction. (n=1 to 8) Set the length of torsion (-) at reversal of machine travel direction. When not using, set to "0". ---Setting range--- 0 to 32767 (0.01 μm)		

15 Machine Parameters

15.4 Axis Specifications Parameters


#14360	valBL2	Backlash compensation II valid
		<p>Select whether to enable the backlash compensation II function.</p> <p>0: Disable</p> <p>1: Enabled</p>
#14361	BL2_a1	Backlash compensation II acceleration rate 1
		<p>Specify the acceleration rate at which the backlash compensation II function should be applied.</p> <p>Set the acceleration rate at reversal of machine's travel direction.</p> <p>When not using, set to "0".</p> <p>---Setting range---</p> <p>0 to 2147483647 ($\mu\text{m/s}^2$)</p>
#14362	BL2_c1	Backlash compensation II compensation amount 1
		<p>Specify the compensation amount to be used for backlash compensation II.</p> <p>---Setting range---</p> <p>-9999999 to 9999999 (Machine error compensation unit)</p>
#14363	BL2_a2	Backlash compensation II acceleration rate 2
		<p>Specify the acceleration rate at which the backlash compensation II function should be applied.</p> <p>Set the acceleration rate at reversal of machine's travel direction.</p> <p>When not using, set to "0".</p> <p>---Setting range---</p> <p>0 to 2147483647 ($\mu\text{m/s}^2$)</p>
#14364	BL2_c2	Backlash compensation II compensation amount 2
		<p>Specify the compensation amount to be used for backlash compensation II.</p> <p>---Setting range---</p> <p>-9999999 to 9999999 (Machine error compensation unit)</p>
#14365	BL2_a3	Backlash compensation II acceleration rate 3
		<p>Specify the acceleration rate at which the backlash compensation II function should be applied.</p> <p>Set the acceleration rate at reversal of machine's travel direction.</p> <p>When not using, set to "0".</p> <p>---Setting range---</p> <p>0 to 2147483647 ($\mu\text{m/s}^2$)</p>
#14366	BL2_c3	Backlash compensation II compensation amount 3
		<p>Specify the compensation amount to be used for backlash compensation II.</p> <p>---Setting range---</p> <p>-9999999 to 9999999 (Machine error compensation unit)</p>
#14367	BL2_a4	Backlash compensation II acceleration rate 4
		<p>Specify the acceleration rate at which the backlash compensation II function should be applied.</p> <p>Set the acceleration rate at reversal of machine's travel direction.</p> <p>When not using, set to "0".</p> <p>---Setting range---</p> <p>0 to 2147483647 ($\mu\text{m/s}^2$)</p>
#14368	BL2_c4	Backlash compensation II compensation amount 4
		<p>Specify the compensation amount to be used for backlash compensation II.</p> <p>---Setting range---</p> <p>-9999999 to 9999999 (Machine error compensation unit)</p>

15 Machine Parameters

15.5 Zero Point Return Parameters

15.5 Zero Point Return Parameters

#2025	G28rap	G28 rapid traverse rate
	Set a rapid traverse rate for the dog type reference position return command. This is not used for the distance-coded reference position detection. ---Setting range--- 1 to 1000000 (mm/min)	
#2026	G28crp	G28 approach speed
	Set up the speed of approach to the reference point in the reference point return command. This speed is attained after the system stops with deceleration by dog detection. In the distance-coded reference position detection, the set value will be applied from the start of reference position establishment. (Note) The G28 approach speed unit is (10°/min) only when using the Z-phase type encoder (#1226 aux10/bit3=1) for the spindle/C-axis reference position return type. The same unit is used for both the micrometric and sub-micrometric specifications. ---Setting range--- 1 to 60000 (mm/min)	
#2027	G28sft	Reference position shift distance
	Set the distance from the electrical zero-point detection position to the reference position. This is not used for the distance-coded reference position detection. (Note 1) When "#1240 set12/bit2" is ON, a magnification (C: 10-fold, D: 100-fold and E: 1000-fold) corresponding to the input setting unit ("#1003 iunit") will be applied to the setting value. (Note 2) The sign of setting value is: the direction of "#2030 dir (-)" (Reference position direction (-)) is plus, and the opposite direction is minus. (Note 3) When set value is set to minus, the axis moves to electrical zero-point detection position at first and then moves in opposite direction. ---Setting range--- -99.999 to +99.999 (mm)	
#2028	grmask	Grid mask amount
	Set the distance where the grid point will be ignored when near-point dog OFF signals are close to that grid point during reference position return.	

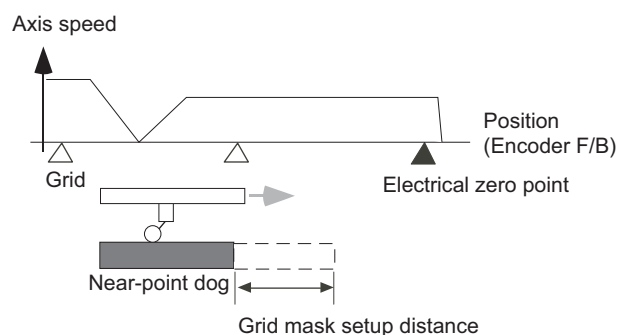

The grid mask is valid for one grid.

This is not used for the distance-coded reference position detection.

---Setting range---

0.000 to 99.999 (mm)

15 Machine Parameters

15.5 Zero Point Return Parameters


#2029	grspc	Grid interval
		<p>Set the distance between grids.</p> <p>Generally, set up the value equal to the ball screw pitch. However, if the encoder grid interval is not equal to the screw pitch when measured with a linear scale, set up the encoder grid interval.</p> <p>To make the grid space smaller, set a divisor of the grid space.</p> <p>This is not used for the distance-coded reference position detection.</p> <p>(Note) Set the grid interval "#2029 grspc" according to the reference encoder for grid interval "#2041 grspcref".</p> <p>(1) Semi-closed loop control</p> <p>If "#2041 grspcref" is set to "0" (grid interval by the motor-side), set "#2029 grspc" to the same value as the ball screw pitch.</p> <p>If "#2041 grspcref" is set to "1" (grid interval by the machine-side), set "#2029 grspc" to the moving amount calculation value per a motor rotation ("$\text{\#2201 SV001 PC1} / \text{\#2202 SV002 PC2} \times \text{\#2218 SV018 PIT}$").</p> <p>(2) Full-closed loop control</p> <p>If "#2041 grspcref" is set to "1" (grid interval by the machine-side), set "#2029 grspc" to the same value as the Z phase pitch.</p> <p>If "#2041 grspcref" is set to "0" (grid interval by the motor-side), set "#2029 grspc" to the moving amount calculation value per Z phase pitch ("$\text{\#2202 SV002 PC2} / \text{\#2201 SV001 PC1} \times \text{the Z phase pitch of the machine-side}$").</p> <p>(*) If "#2029 grspc" is set to "0", the ball screw pitch "#2218 SV018 PIT" is used instead of the grid interval.</p>

---Setting range---

0.000 to 999.999 (mm)

(PR)	#2030	dir (-)	Reference position direction (-)
			<p>Select which side of the near-point dog the reference position is established.</p> <p>For a rotary axis, select a direction that heads to the zero point from the intermediate point during automatic zero point return.</p> <p>0: Positive direction</p> <p>1: Negative direction</p>

Directions in which reference position is established as viewed from the near-point dog

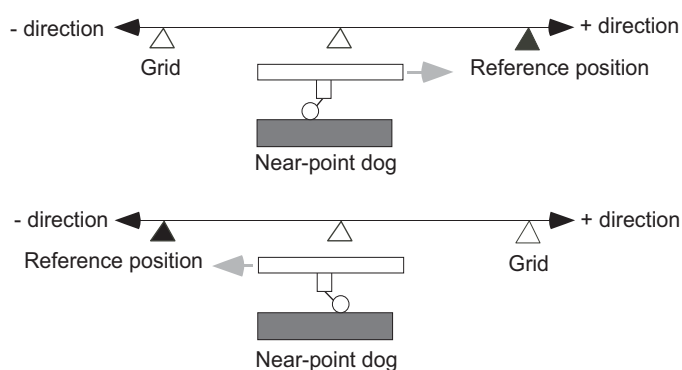


#2031	noref	Axis without reference position
		<p>Select whether the reference position is provided for the axis.</p> <p>0: Reference position is provided. (Normal controlled axis)</p> <p>1: No reference position is provided.</p> <p>When "1" is set, reference position return is not required before automatic operation starts.</p>

15 Machine Parameters

15.5 Zero Point Return Parameters

	#2032	nochk	Whether reference position return is completed not checked
			<p>Select whether to check the reference position return completion.</p> <p>0: Check the reference position return completion.</p> <p>1: Not check the reference position return completion.</p> <p>When "1" is set, the absolute and incremental commands can be executed even if dog type (or Z phase pulse system) reference position return is not completed.</p> <p>Note that this setting is available for a rotary axis only.</p>
(PR)	#2033	zp_no	Z phase pulse system reference position return spindle encoder No.
			Not used. Set to "0".
(PR)	#2034	rfpofs	Distance-coded reference position detection offset
			<p>Set the offset value from the position for the initial reference position setting to the machine's actual zero point in reference position return in the distance-coded reference position detection.</p> <p>Input the value of the machine value counter that is displayed immediately after the reference position is established.</p> <p>When the power is turned ON and this parameter is set to "0", the manual reference position return is regarded as initial reference position setting.</p> <p>If this parameter is set to "0", automatic operation won't be available.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p>
	#2035	srchmax	Distance-coded reference position detection scan distance
			<p>Set the maximum distance for scanning the reference marks when the reference position is not established in the distance-coded reference position detection.</p> <p>For the scan distance, set the distance that fully covers the number of reference marks as you wish to detect.</p> <p>(Example) When adding about 10% of additional coverage:</p> <p>Scan distance = Base reference mark interval [mm] * 2 * 1.1</p> <p>---Setting range---</p> <p>0.000 to 99999.999 (mm)</p>

#2036	slv_adjust	Reference position adjustment value
<p>Set the distance from the first grid point after leaving the near point dog on the slave axis to the position where the reference position is actually established in dog-type reference position return in synchronous control. (Reference position shift amount is not included.)</p> <p>The adjustment value will be automatically set in the slave axis's parameter according to the reference position adjustment complete signal from PLC.</p> <p>Fine adjustment is also available from the parameter screen.</p> <p>In the distance-coded reference position detection, the reference position adjustment value will be invalid.</p>		

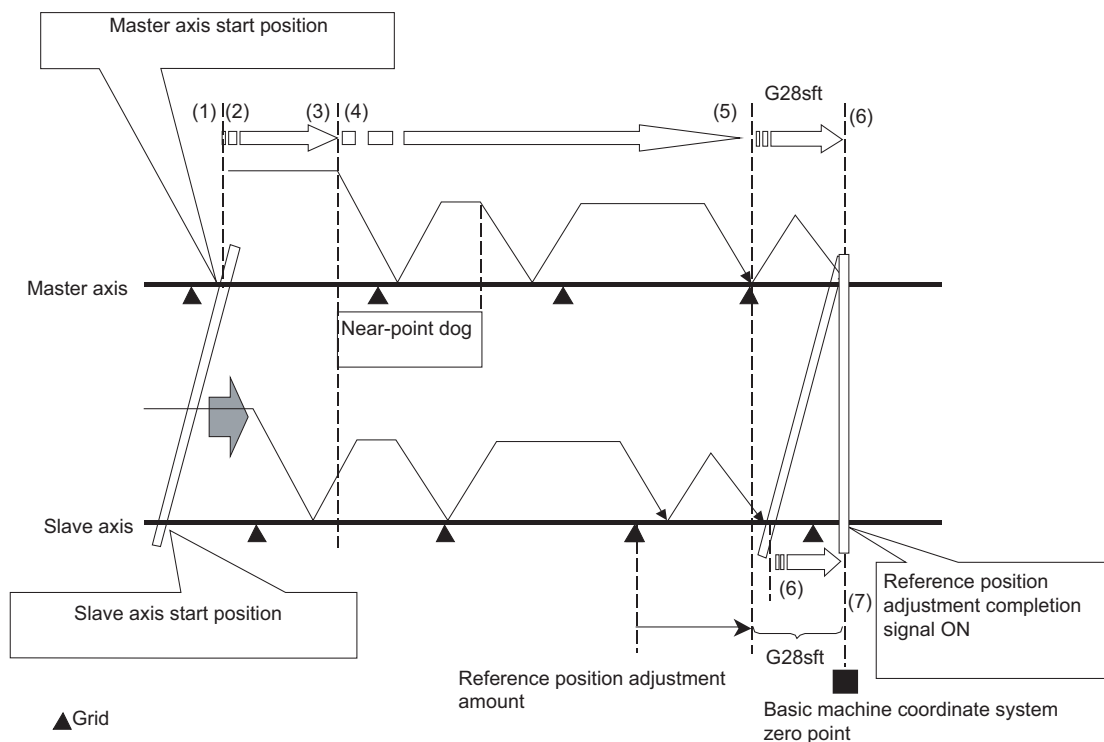

(Note 1) This parameter is enabled when the synchronization at zero point initialization ("#1493 ref_syn" = "1" of the master axis) is applied.

(Note 2) This parameter can be set when one of the following settings is applied.

- Relative position detection ("#2049 type" = "0")
- Dog-type absolute position detection ("#2049 type" = "3")
- Simple absolute position ("#2049 type" = "9")

(Note 3) Set "0" when using the speed/current command synchronization control.

(Note 4) A setting unit of this parameter is [mm]. It is not influenced by the content of the following parameters setting.

- "#1003 iunit"
- "#1004 ctrl_unit"
- "#1005 plcunit"
- "#1040 M_inch"
- "#1041 I_inch"
- "#1240 set12/bit2" (Zero point shift amount magnification)

(Note 5) The number of the significant digits after decimal point follows "#1004 ctrl_unit".

(Note 6) A change of this parameter requires reference position return. When the automatic operation starts without reference position return, an alarm will occur.

---Setting range---


0 to 99999.999999 (mm)

15 Machine Parameters

15.5 Zero Point Return Parameters

#2037	G53ofs	Reference position #1
-------	--------	-----------------------

Set the position of the first reference position from the zero point of the basic machine coordinate.

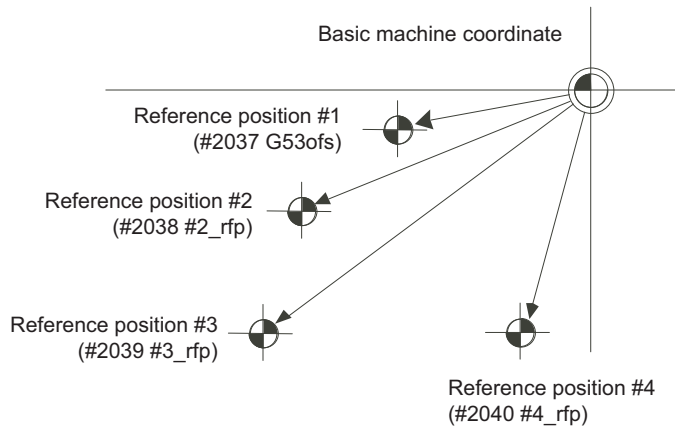


---Setting range---

-99999.999 to 99999.999 (mm)

#2038	#2_rfp	Reference position #2
-------	--------	-----------------------

Set the position of the second reference position from the zero point of the basic machine coordinate.

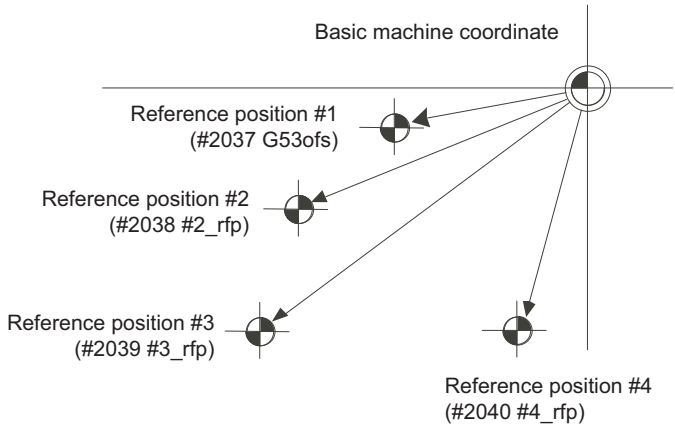


---Setting range---

-99999.999 to 99999.999 (mm)

#2039	#3_rfp	Reference position #3
-------	--------	-----------------------

Set the position of the third reference position from the zero point of the basic machine coordinate.

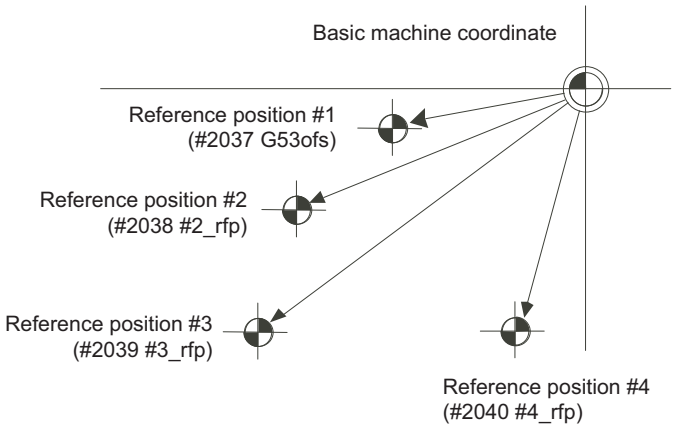

---Setting range---


-99999.999 to 99999.999 (mm)

15 Machine Parameters

15.5 Zero Point Return Parameters

#2040	#4_rfp	Reference position #4
-------	--------	-----------------------

Set the position of the fourth reference position from the zero point of the basic machine coordinate.

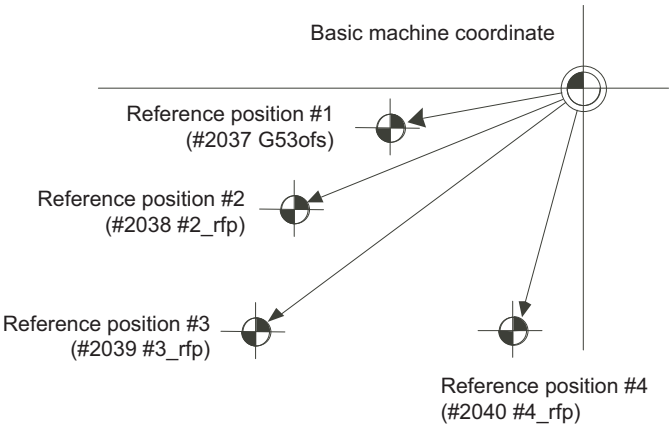

---Setting range---

-99999.999 to 99999.999 (mm)

#2041	grspceref	Reference encoder for grid interval
-------	-----------	-------------------------------------

Select the reference encoder (motor-side or machine-side) based on which the grid interval "#2029 grspc" is set.

0: Motor-side

1: Machine-side

(Note) When an MPI scale made by Mitsubishi Heavy Industries Machine Tool Co., Ltd. is used, set the zero point return parameters so that Z phase of the MPI scale becomes the grid point (electric basic position), and then perform zero point initialization setting.

15 Machine Parameters

15.6 Absolute Position Detection Parameters

15.6 Absolute Position Detection Parameters

(PR)	#2049	type	Absolute position detection method
			<p>Select the absolute position zero point alignment method.</p> <p>0: Not absolute position detection</p> <p>1: Stopper method (push against mechanical stopper)</p> <p>2: Marked point alignment method I (The grid point is the reference position.)</p> <p>3: Dog-type (align with dog and near point detection switch)</p> <p>4: Marked point alignment method II (The position with which the mark was aligned is the reference position.)</p> <p>9: Simple absolute position (Not absolute position detection, but the position when the power is turned off is registered.)</p>
	#2050	absdir	Basic point of Z direction
			<p>Select the direction of the grid point immediately before the machine basic position (basic point of encoder) in the marked point alignment.</p> <p>0: Positive direction</p> <p>1: Negative direction</p>
	#2051	check	Check
			<p>Set the tolerable range of travel distance (deviation distance) while the power is turned OFF.</p> <p>If the distance between the position when the power is turned OFF and when the power is turned ON again is larger than the set value, the information is notified to the PLC. (signal name: Absolute position warning)</p> <p>Set "0" to omit the check.</p> <p>---Setting range---</p> <p>0 to 99999.999 (mm)</p>
	#2054	clpush	Current limit (%)
			<p>Set the current limit value during the stopper operation in the dogless-type absolute position detection.</p> <p>The setting value is the ratio of the current limit value to the rated current value.</p> <p>---Setting range---</p> <p>0 to 100 (%)</p>
	#2055	pushf	Push speed
			<p>Set the feedrate for the automatic initial setting during stopper method.</p> <p>---Setting range---</p> <p>1 to 999 (mm/min)</p>
	#2056	aproch	Approach
			<p>Set the approach distance of the stopper when deciding the absolute position basic point with the stopper method.</p> <p>After using stopper once, the tool returns with this distance, and then use stopper again.</p> <p>---Setting range---</p> <p>0 to 999.999 (mm)</p>
	#2057	nrefp	Near zero point +
			<p>Set the positive direction width where the near reference position signal is output.</p> <p>When set to "0", the value is the same as #2218 SV018(PIT).</p> <p>(Note) When "#1240 set12/bit2" is ON, a magnification (C: 10-fold, D: 100-fold, E: 1000-fold) corresponding to the input setting increment ("#1003 iunit") will be applied to the setting value.</p> <p>---Setting range---</p> <p>0 to 999.999 (mm)</p> <p>(Input setting increment applied)</p>

15 Machine Parameters

15.6 Absolute Position Detection Parameters

#2058	nrefn	Near zero point -
		<p>Set the negative direction width where the near reference position signal is output.</p> <p>When set to "0", the value is the same as #2218 SV018(PIT).</p> <p>(Note) When "#1240 set12/bit2" is ON, a magnification (C: 10-fold, D: 100-fold, E: 1000-fold) corresponding to the input setting increment ("#1003 iunit") will be applied to the setting value.</p> <p>---Setting range---</p> <p>0 to 999.999 (mm)</p> <p>(Input setting increment applied)</p>
#2059	zerbas	Select zero point parameter and basic point
		<p>Select which is to be the zero point coordinate position during absolute position initial setting.</p> <p>0: Position where the axis was stopped.</p> <p>1: Grid point just before stopper.</p>

15 Machine Parameters


15.7 Servo Parameters

15.7 Servo Parameters

(PR)	#2201	SV001 PC1	Motor side gear ratio
			<p>Set the gear ratio in the motor side when there is the gear between the servo motor's shaft and machine (ball screw, etc.).</p> <p>For the rotary axis, set the total deceleration (acceleration) ratio.</p> <p>Even if the gear ratio is within the setting range, the electronic gears may overflow and an initial parameter error (servo alarm 37) may occur.</p> <p>For linear servo system Set to "1".</p> <p>---Setting range---</p> <p>1 to 32767</p>
(PR)	#2202	SV002 PC2	Machine side gear ratio
			<p>Set the gear ratio in the machine side when there is the gear between the servo motor's shaft and machine (ball screw, etc.).</p> <p>For the rotary axis, set the total deceleration (acceleration) ratio.</p> <p>Even if the gear ratio is within the setting range, the electronic gears may overflow and an initial parameter error (servo alarm 37) may occur.</p> <p>For linear servo system Set to "1".</p> <p>---Setting range---</p> <p>1 to 32767</p>
	#2203	SV003 PGN1	Position loop gain 1
			<p>Set the position loop gain. The standard setting is "33".</p> <p>The higher the setting value is, the more accurately the command can be followed, and the shorter the settling time in positioning gets, however, note that a bigger shock will be applied to the machine during acceleration/deceleration.</p> <p>When using the SHG control, also set SV004 (PGN2) and SV057 (SHGC).</p> <p>When using the OMR-FF control, set the servo rigidity against quadrant projection or cutting load, etc. For the tracking ability to the command, set by SV106(PGM).</p> <p>---Setting range---</p> <p>1 to 200 (rad/s)</p>
	#2204	SV004 PGN2	Position loop gain 2
			<p>When performing the SHG control, set the value of "SV003 x 8/3" to "SV004".</p> <p>When not using the SHG control, set to "0".</p> <p>When using the OMR-FF control, set to "0".</p> <p>Related parameters: SV003, SV057</p> <p>---Setting range---</p> <p>0 to 999 (rad/s)</p>
	#2205	SV005 VGN1	Speed loop gain 1
			<p>Set the speed loop gain.</p> <p>The higher the setting value is, the more accurate the control will be, however, vibration tends to occur.</p> <p>If vibration occurs, adjust by lowering by 20 to 30%.</p> <p>The value should be determined to the 70 to 80% of the value at which the vibration stops.</p> <p>The value differs depending on servo motors.</p> <p>Aim at the standard value determined by the servo motor type and load inertia ratio to adjust.</p> <p>---Setting range---</p> <p>1 to 30000</p>

15 Machine Parameters

15.7 Servo Parameters
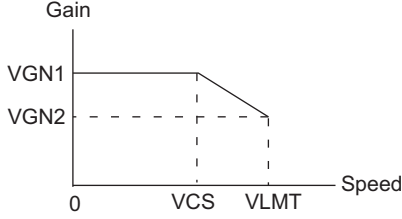
#2206	SV006 VGN2	Speed loop gain 2
	<p>Set the speed loop gain at the motor limitation speed VLMT with "VCS(SV029: Speed at the change of speed loop gain)".</p> <p>Use this to suppress noise at high speed rotation during rapid traverse, etc. Then, the speed loop gain decreases at faster speed than the setting value of VCS. When not using, set to "0".</p>	
		
	<p>---Setting range---</p> <p>-1000 to 30000</p>	
#2207	SV007 VIL	Speed loop delay compensation
	<p>Set this when the limit cycle occurs in the full-closed loop, or overshooting occurs in positioning. The speed loop delay compensation method can be selected with SV027/bit1,0.</p> <p>Normally, use "Changeover type 2". Changeover type 2 controls the occurrence of overshooting by lowering the speed loop lead compensation after the position droop gets 0.</p> <p>When setting this parameter, make sure to set the torque offset (SV032).</p>	
	<p>---Setting range---</p> <p>0 to 32767</p>	
#2208	SV008 VIA	Speed loop lead compensation
	<p>Set the gain of the speed loop integral control.</p> <p>Standard setting: 1364</p> <p>Standard setting in the SHG control: 1900</p> <p>Adjust the value by increasing/decreasing this by about 100 at a time.</p> <p>Raise this value to improve contour tracking accuracy in high-speed cutting.</p> <p>Lower this value when the position droop does not stabilize (when the vibration of 10 to 20Hz occurs).</p>	
	<p>---Setting range---</p> <p>1 to 9999</p>	
#2209	SV009 IQA	Current loop q axis lead compensation
	<p>Set the fixed value of each motor.</p> <p>Set the standard value for each motor described in the standard parameter list.</p>	
	<p>---Setting range---</p> <p>1 to 20480</p>	
#2210	SV010 IDA	Current loop d axis lead compensation
	<p>Set the fixed value of each motor.</p> <p>Set the standard value for each motor described in the standard parameter list.</p>	
	<p>---Setting range---</p> <p>1 to 20480</p>	
#2211	SV011 IQG	Current loop q axis gain
	<p>Set the fixed value of each motor.</p> <p>Set the standard value for each motor described in the standard parameter list.</p>	
	<p>---Setting range---</p> <p>1 to 8192</p>	
#2212	SV012 IDG	Current loop d axis gain
	<p>Set the fixed value of each motor.</p> <p>Set the standard value for each motor described in the standard parameter list.</p>	
	<p>---Setting range---</p> <p>1 to 8192</p>	

15 Machine Parameters

15.7 Servo Parameters

#2213	SV013 ILMT	Current limit value
	<p>Set the current (torque) limit value in a normal operation. This is a limit value in forward run and reverse run (for linear motors: forward and reverse direction). When the standard setting value is "800", the maximum torque is determined by the specification of the motor. Set this parameter as a proportion (%) to the stall current.</p> <p>---Setting range---</p> <p>0 - 999 (Stall current %)</p>	
#2214	SV014 ILMTsp	Current limit value in special control
	<p>Set the current (torque) limit value in a special operation (absolute position initial setting, stopper control and etc.). This is a limit value in forward and reverse directions. Set to "800" when not using. Set this parameter as a proportion (%) to the stall current.</p> <p>---Setting range---</p> <p>0 - 999 (Stall current %) However, when SV084/bitB=1, the setting range is from 0 to 32767 (Stall current 0.01%).</p>	
#2215	SV015 FFC	Acceleration rate feed forward gain
	<p>When a relative error in synchronous control is too large, set this parameter to the axis that is delaying. The standard setting is "0". The standard setting in the SHG control is "100". To adjust a relative error in acceleration/deceleration, increase the value by 50 at a time.</p> <p>---Setting range---</p> <p>0 to 999 (%)</p>	
#2216	SV016 LMC1	Lost motion compensation 1
	<p>Set this parameter when the protrusion (that occurs due to the non-sensitive band by friction, torsion, backlash, etc.) at quadrant change is too large. This sets the compensation torque at quadrant change (when an axis feed direction is reversed) by the proportion (%) to the stall torque. Whether to enable the lost motion compensation and the method can be set with other parameters.</p> <p>Type 2: When SV027/bit9, 8=10 (Compatible with obsolete type) Set the type 2 method compensation torque. The standard setting is double the friction torque. Related parameters: SV027/bit9,8, SV033/bitF, SV039, SV040, SV041, SV082/bit2</p> <p>Type 3: When SV082/bit1=1 Set the compensation torque equivalent of dynamic friction amount of the type 3 method compensation amount. The standard setting is double the dynamic friction torque. Related parameters: SV041, SV082/bit2,1, SV085, SV086</p> <p>To vary compensation amount according to the direction. When SV041 (LMC2) is "0", compensate with the value of SV016 (LMC1) in both +/-directions. If you wish to change the compensation amount depending on the command direction, set this and SV041 (LMC2). (SV016: + direction, SV041: - direction. However, the directions may be opposite depending on other settings.) When "-1" is set, the compensation will not be performed in the direction of the command.</p> <p>---Setting range---</p> <p>-1 to 200 (Stall current %) Note that when SV082/bit2 is "1", the setting range is between -1 and 20000 (Stall current 0.01%).</p>	

(PR)

#2217

SV017 SPEC1

Servo specification 1

Select the servo specifications.

A function is allocated to each bit.

Set this in hexadecimal format.

Bit-

F

E

D

C

B

A

9

8

7

6

5

4

3

2

1

0

0

0

0

0

mdir

dfbx

seqh

vfb

sdir

abs

mp

drvup

spm

bit F-C : spm Motor series selection

0: 200V HK motor (Standard)

1: 200V HG motor (Standard)

2: 400V HK-H motor (Standard)

3: 400V HG-H, HQ-H motor (Standard)

6: 200V LM-F linear motor

7: 200V direct-drive motor

8: 400V LM-F linear motor

9: 400V direct-drive motor

bit B :

Not used. Set to "0".

bit A : drvup Combined drive unit:

0: Normal setting (Combined drive unit: normal)

1: Combined drive unit: one upgrade

(Note) It is not available for MDS-EJ/EJH Series.

bit 9 :

Not used. Set to "0".

bit 8 : mp MPI scale pole number setting

0: 360 poles 1: 720 poles

bit 7 : abs Position control

These parameters are set automatically by the NC system.

0: Incremental 1: Absolute position control

bit 6-5 :

Not used. Set to "0".

bit 4 : sdir Sub side encoder feedback

Set the machine side encoder's installation polarity.

0: Forward polarity 1: Reverse polarity

bit 3 : vfb Speed feedback filter

0: Stop 1: Start (4500Hz)

bit 2 : seqh Ready on sequence

0: Normal 1: High-speed

bit 1 : dfbx Dual feedback control

Control the position FB signal in full closed control by the combination of a motor side encoder and machine side encoder.

0: Stop 1: Start

Related parameters: SV051, SV052

bit 0 : mdir Machine side encoder feedback (for Linear/direct-drive motor)

Set the encoder installation polarity in the linear servo and direct-drive motor control.

0: Forward polarity 1: Reverse polarity

15 Machine Parameters

15.7 Servo Parameters


(PR)	#2218	SV018 PIT	Ball screw pitch/Magnetic pole pitch
			<p>For servo motor: Set the ball screw pitch. For the rotary axis, set to "360".</p> <p>For direct-drive motor Set to "360".</p> <p>For linear motor Set the ball screw pitch. (For LM-F series, set to "48")</p> <p>---Setting range---</p> <p>For general motor: 1 to 32767 (mm/rev) - For linear motor 1 to 32767 (mm)</p>
(PR)	#2219	SV019 RNG1	Sub side encoder resolution
			<p>For semi-closed loop control Set the same value as SV020.</p> <p>For full-closed loop control Set the number of pulses per ball screw pitch.</p> <p>For direct-drive motor Set the same value as SV020.</p> <p>For 1000 pulse unit resolution encoder, set the number of pulses in SV019 in increments of 1000 pulse (kp). The value must be input in increments of 10K pulses (the 1st digit of the setting value is "0"). In this case, make sure to set "0" to SV117. For high-accuracy binary resolution encoder, set the number of pulses to four bite data of SV117 (high-order) and SV019 (low-order) in pulse (p) unit. SV117 = number of pulses / 65536 (when =0, set "-1" to SV117) SV019 = the remainder of number of "pulses / 65536"</p> <p>---Setting range---</p> <p>When SV117 = 0, the setting range is from 0 to 32767 (kp) When SV117≠0, the setting range is from 0 to 65535 (p)</p>
(PR)	#2220	SV020 RNG2	Main side encoder resolution
			<p>Normally, set to "0".</p> <p>For linear motor Set the number of pulses of the encoder per magnetic pole pitch with SV118.</p> <p>For direct-drive motor Set the number of pulses per revolution of the motor side encoder.</p> <p>For 1000 pulse unit resolution encoder, set the number of pulses to SV020 in increments of 1000 pulse(kp). The value must be input in increments of 10K pulses (the 1st digit of the setting value is "0"). In this case, make sure to set SV118 to "0". For high-accuracy binary resolution encoder, set the number of pulses to four bite data of SV118 (high-order) and SV020 (low-order) in pulse(p) unit. SV118 = number of pulses / 65536 (when =0, set "-1" to SV118) SV020 = the remainder of "number of pulses / 65536"</p> <p>---Setting range---</p> <p>When SV118 = 0, the setting range is from 0 to 32767 (kp) When SV118≠0, the setting range is from 0 to 65535 (p)</p>
#2221	SV021 OLT	Overload detection time constant	
		<p>Normally, set to "60". (For Mitsubishi Electric adjustment.)</p> <p>Related parameters: SV022</p> <p>---Setting range---</p> <p>1 to 999 (s)</p>	
#2222	SV022 OLL	Overload detection level	
		<p>Set the "Overload 1" (Alarm 50) current detection level as percentage to the stall current. Normally set this parameter to "150". (For Mitsubishi Electric adjustment.)</p> <p>Related parameters: SV021</p> <p>---Setting range---</p> <p>110 to 500 (Stall current %)</p>	

15 Machine Parameters

15.7 Servo Parameters

#2223	SV023 OD1	Excessive error detection width during servo ON
		<p>Set the excessive error detection width in servo ON. When set to "0", the excessive error alarm detection will be ignored, so do not set to "0". <Standard setting value> $OD1=OD2 = (\text{Rapid traverse rate [mm/min]}) / (60 \times \text{PGN1}) / 2 \text{ [mm]}$</p> <p>Related parameters: SV026</p> <p>---Setting range---</p> <p>0 to 32767 (mm) However, when SV084/bitC=1, the setting range is from 0 to 32767 (μm).</p>
#2224	SV024 INP	In-position detection width
		<p>Set the in-position detection width. Set the positioning accuracy required for the machine. The lower the setting is, the higher the positioning accuracy will be. However the cycle time (settling time) becomes longer. The standard setting value is "50".</p> <p>---Setting range---</p> <p>1 to 32767 (μm)</p>
(PR) #2225	SV025 MTYP	Motor/Encoder type

Set the position encoder type, speed encoder type and motor type.
 The setting value is a four-digit hex (HEX).

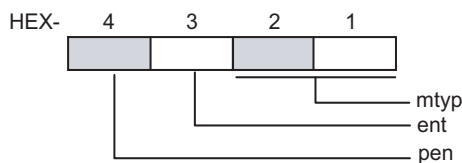**bit F-C: pen(HEX-4) Position encoder**

Semi-closed loop control by general motor
 pen=2

Full-closed loop control by general motor

- Ball screw end encoder (OSA405ET2AS, OSA676ET2AS)
 pen=6
- For serial signal output rotary scale (including MDS-EX-HR)
 pen=6
- For rectangular wave signal output linear scale
 pen=8
- For serial signal output linear scale (including MDS-EX-HR and MPI scale)
 pen=A
- For speed command synchronization control
 Primary axis pen=A
 Secondary axis pen=D
- For common encoder current command synchronous control
 Primary axis pen=2 (Rotary motor)
 pen=A (Linear motor)
 Secondary axis pen=D

For a linear motor
 pen=A

For a direct-drive motor
 pen=2

bit B-8: ent(HEX-3) Speed encoder

For a general motor: ent=2

For common encoder current command synchronous control

Primary axis pen=2 (Rotary motor)
 pen=A (Linear motor)

Secondary axis pen=D

For a linear motor: ent=A

For a direct-drive motor: ent=2

15 Machine Parameters

15.7 Servo Parameters

bit 7-0: mtyp(HEX-2,1) Motor type

Set the motor type. Set this with SV017/bitF-C.

For SV017/bitF-C = 0 (200V HK motor series)

HK76	: 51h	HK154 (E-V3-80)	: 91h	HK303	: 68h
HK105	: 52h	HK154 (E-V3-40)	: 98h	HK354	: 58h
HK55	: 53h	HK223	: 66h	HK453	: 59h
HK104	: 54h	HK224	: 56h	HK603	: 69h
HK123	: 64h	HK224 (E-V1/V2-160)	: 81h	HK702	: 6Ah
HK142	: 65h	HK204	: 57h	HK703	: 5Ah
HK154	: 55h	HK302	: 67h		

For SV017/bitF-C = 1 (200V HG motor series)

HG46	: BAh	HG154 (E-V3-40)	: 4Fh	HG603	: 69h
HG56	: BBh	HG224	: 46h	HG702	: 6Ah
HG96	: BCh	HG204	: 47h	HG703	: 4Ah
HG75	: 41h	HG354	: 48h	HG903	: 4Bh
HG105	: 42h	HG123	: 64h	HG1103	: 4Ch
HG54	: 43h	HG223	: 66h	HG142	: 65h
HG104	: 44h	HG303	: 68h	HG302	: 67h
HG154	: 45h	HG453	: 49h		

For SV017/bitF-C = 2 (400V HK-H motor series)

HK-H76	: 51h	HK-H223	: 66h	HK-H453	: 59h
HK-H105	: 52h	HK-H224	: 56h	HK-H603	: 69h
HK-H55	: 53h	HK-H224 (EH-V1/V2-80)	: 81h	HK-H702	: 6Ah
HK-H104	: 54h	HK-H204	: 57h	HK-H703	: 5Ah
HK-H123	: 64h	HK-H302	: 67h		
HK-H154	: 55h	HK-H303	: 68h		
HK-H154 (EH-V3-40)	: 91h	HK-H354	: 58h		

For SV017/bitF-C = 3 (400V HG-H, HQ-H motor series)

HG-H75	: 41h	HG-H224	: 46h	HG-H903	: 4Bh
HG-H105	: 42h	HG-H204	: 47h	HG-H1502	: 4Dh
HG-H54	: 43h	HG-H354	: 48h	HQ-H903	: 58h
HG-H104	: 44h	HG-H453	: 49h	HQ-H1103	: 59h
HG-H154	: 45h	HG-H703	: 4Ah		

For linear motor and direct-drive motor, follow the settings stated in respective materials.

#2226	SV026 OD2	Excessive error detection width during servo OFF
-------	-----------	--

Set the excessive error detection width during servo OFF.

When set to "0", the excessive error alarm detection will be ignored, so do not set to "0".

<Standard setting value>

OD1=OD2= (Rapid traverse rate [mm/min]) / (60×PGN1) / 2 [mm]

Related parameters: SV023

---Setting range---

0 to 32767 (mm)

However, when SV084/bitC=1, the setting range is from 0 to 32767 (μm).

15 Machine Parameters


15.7 Servo Parameters

#2227

SV027 SSF1

Servo function 1

Select the servo functions.
A function is assigned to each bit.
Set this in hexadecimal format.

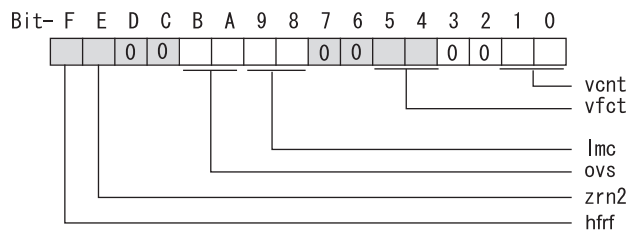**bit F : hrrf Higher harmonic suppression filter**

0: Stop
1: Start

bit E : zrn2

Set to "1". (Fixed)

bit D :

Not used. Set to "0".

bit C :

Not used. Set to "0".

bit B-A : ovs Overshooting compensation

Set this if overshooting occurs during positioning.

bitB,A=

00: Compensation stop

01: Setting prohibited

10: Setting prohibited

11: Type 3

Set the compensation amount in SV031(OVS1) and SV042(OVS2).

Related parameters: SV031, SV042, SV034/bitF-C

bit 9-8 : lmc Lost motion compensation type

Set this parameter when the protrusion at quadrant change is too large.

Type 2 has an obsolete type compatible control.

bit9,8=

00: Compensation stop

01: Setting prohibited

10: Type 2

11: Setting prohibited

Set the compensation amount in SV016(LMC1) and SV041(LMC2).

(Note) When "SV082/bit1=1", the lost motion compensation type 3 will be selected regardless of this setting.

bit 7 :

Not used. Set to "0".

bit 6 :

Not used. Set to "0".

bit 5-4 : vfct Jitter compensation pulse number

Suppress vibration by machine backlash when axis stops.

bit5,4=

00: Disable

01: 1 pulse

10: 2 pulse

11: 3 pulses

bit 3 :

Not used. Set to "0".

bit 2 :

Not used. Set to "0".

15 Machine Parameters

15.7 Servo Parameters

bit 1-0 : vcnt Speed loop delay compensation changeover type selection

Normally, use "Changeover type 2".

bit1,0=

00: Disable

01: Changeover type 1

10: Changeover type 2

11: Setting prohibited

Related parameters: SV007

(PR)	#2228	SV028 MSFT	Magnetic pole shift amount (for linear/direct-drive motor)
			<p>Set this parameter to adjust the motor magnetic pole position and encoder's installation phase when using linear motors or direct-drive motors.</p> <p>During the DC excitation of the initial setup (SV034/bit4=1), set the same value displayed in "AFLT gain" on the NC monitor screen.</p> <p>Related parameters: SV034/bit4, SV061, SV062, SV063</p> <p>For general motor: Not used. Set to "0".</p> <p>---Setting range---</p> <p>-18000 to 18000 (electrical angle 0.01°)</p>
	#2229	SV029 VCS	Speed at the change of speed loop gain
			<p>Noise at high speed rotation including rapid traverse can be reduced by lowering the speed loop gain at high speeds.</p> <p>Set the speed at which the speed loop gain changes. Use this with SV006 (VGN2).</p> <p>When not using, set to "0".</p> <p>---Setting range---</p> <p>0 to 9999 (r/min)</p>
	#2230	SV030 IVC	Voltage non-sensitive band compensation
			<p>When 100% is set, the voltage reduction amount equivalent to the logical non-energization in the PWM control will be compensated.</p> <p>When "0" is set, 100% compensation will be performed.</p> <p>Adjust in increments of 10% from the default value of 100%.</p> <p>If increased too much, vibration or vibration noise may be generated.</p> <p>---Setting range---</p> <p>0 to 255 (%)</p>
	#2231	SV031 OVS1	Overshooting compensation 1
			<p>This compensates the motor torque when overshooting occurs during positioning. This is valid only when the overshooting compensation (SV027/bitB,A) is selected.</p> <p>Type 3 SV027/bitB,A=11</p> <p>Set the compensation amount based on the motor stall current. Observing positioning droop waveform, increase in increments of 1% and find the value where overshooting does not occur.</p> <p>To vary compensation amount depending on the direction.</p> <p>When SV042 (OVS2) is "0", change the SV031 (OVS1) value in both of the +/- directions to compensate.</p> <p>To vary the compensation amount depending on the command direction, set this and SV042 (OVS2). (SV031: + direction, SV042: - direction. However, the directions may be opposite depending on other settings.)</p> <p>When "-1" is set, the compensation will not be performed in the direction of the command.</p> <p>Related parameters: SV027/bitB,A, SV034/bitF-C, SV042, SV082/bit2</p> <p>---Setting range---</p> <p>-1 to 100 (Stall current %)</p> <p>Note that the range will be "-1 - 10000" (Stall current 0.01%) when SV082/bit2 is "1".</p>

15 Machine Parameters

15.7 Servo Parameters

#2232	SV032 TOF	Torque offset
	<p>Set the unbalance torque on vertical axis and inclined axis.</p> <p>When the vertical axis pull up function is enabled, the pull up compensation direction is determined by this parameter's sign. When set to "0", and the pull up function is enabled (SV033/bitE=1), the alarm "S02 2233 Initial parameter error" occurs.</p> <p>This can be used for speed loop delay compensation and collision detection function.</p> <p>To use load inertia estimation function (drive monitor display), set this parameter, friction torque (SV045) and load inertia display enabling flag(SV035/bitF).</p> <p>Related parameters: SV007, SV033/bitE, SV059</p> <p>---Setting range---</p> <p>-100 to 100 (Stall current %)</p>	

15 Machine Parameters

15.7 Servo Parameters

#2233

SV033 SSF2

Servo function 2

Select the servo functions.
A function is assigned to each bit.
Set this in hexadecimal format.

Bit-

FEDCBA9876543210

F	E	D	C	B	A	9	8	7	6	5	4	3	2	1	0
			0	0	0	0	0								0

nfd1

fhz3

nfd2

rps

zup

lmc2a

bit F : lmc2a Lost motion compensation 2 timing

0: Normal 1: Change

bit E : zup Vertical axis pull up function

0: Stop 1: Enable

Related parameters: SV032, SV095

bit D : rps Safely limited speed setting increment

Change the setting units of the specified speed signal output speed (SV073).

0: mm/min 1: 100mm/min

Related parameters: SV073

bit C-8 :

Not used. Set to "0".

bit 7-5 : nfd2 Depth of Notch filter 2

Set the depth of Notch filter 2 (SV046).

bit7,6,5=

000: -∞

001: -18.1[dB]

010: -12.0[dB]

011: -8.5[dB]

100: -6.0[dB]

101: -4.1[dB]

110: -2.5[dB]

111: -1.2[dB]

bit 4 : fhz3 Notch filter 3

0: Stop 1: Start (1125Hz)

bit 3-1 : nfd1 Depth of Notch filter 1

Set the depth of Notch filter 1 (SV038).

bit3,2,1=

000: -∞

001: -18.1[dB]

010: -12.0[dB]

011: -8.5[dB]

100: -6.0[dB]

101: -4.1[dB]

110: -2.5[dB]

111: -1.2[dB]

bit 0 :

Not used. Set to "0".

15 Machine Parameters


15.7 Servo Parameters

#2234

SV034 SSF3

Servo function 3

Select the servo functions.
A function is assigned to each bit.
Set this in hexadecimal format.

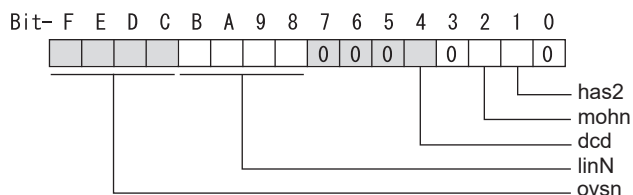**bit F-C: ovsn Overshooting compensation type 3 Non-sensitive band**

Set the non-sensitive band of the model position droop overshooting amount in increments of 2 μ m.
In the feed forward control, set the non-sensitive band of the model position droop and ignore the overshooting of the model.

0 : 0 μ m, 1: 2 μ m, 2: 4 μ m, ---, E : 28 μ m, F: 30 μ m

bit B-8 : linN The number of parallel connections when using linear motors (for linear)

Set to "2" to perform 1 amplifier 2 motor control by linear servo.

bit 7-5 :

Not used. Set to "0".

bit 4 : dcd (linear/direct-drive motor)

0: Normal setting 1: DC excitation mode

Related parameters: SV061, SV062, SV063

bit 3 :

Not used. Set to "0".

bit 2 : mohn Thermistor temperature detection (linear/direct-drive motor)

0: Normal setting 1: Disable

bit 1 : has HAS control

This stabilizes the speed overshooting by torque saturation phenomenon.

0: Normal setting 1: Enable

Related parameters: SV084/bitF

bit 0 :

Not used. Set to "0".

15 Machine Parameters

15.7 Servo Parameters

#2235	SV035 SSF4	Servo function 4																	
Select the servo functions. A function is assigned to each bit. Set this in hexadecimal format.																			
<div>Bit- F E D C B A 9 8 7 6 5 4 3 2 1 0</div> <div><table><tr><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td>0</td><td>0</td><td></td><td></td><td>0</td><td>0</td><td>0</td></tr></table></div> <div><div></div><div>clot</div><div>stod</div><div>ckab</div><div>cltq</div><div>clstp</div><div>cl2n</div><div>clG1</div><div>clt</div></div>													0	0			0	0	0
										0	0			0	0	0			

bit F: clt Inertia ratio display

0: Setting for normal use

1: Display the total inertia ratio estimated at acceleration/deceleration at the inertia ratio on the servo monitor screen

To display it on the screen, set an imbalance torque and friction torque to both SV032 and SV045 and repeat acceleration/deceleration operations for several times.

bit E-C: clG1 G1 Collision detection level

Set the collision detection level in the collision detection method 1 during cutting feed (G1) in multiples of that of rapid traverse (G0). When set to "0", detection of collision detection method 1 during cutting feed will be ignored.

G1 Collision detection level = G0 collision detection level (SV060) × clG1

bit B: cl2n Collision detection method 2

0: Enable 1: Disable

bit A: clstp Collision detection method 1 disabled during stop

0: Collision detection method 1 enabled during stop

1: Collision detection method 1 disabled during stop

bit 9-8: cltq Retract torque in collision detection

Set the retract torque in collision detection using the ratio of motor's maximum torque.

bit9,8=

00: 100%

01: 90%

10: 80% (Standard)

11: 70%

bit 7: ckab No signal detection 2

Set this to use rectangular wave output linear scale.

This enables the detection of No signal 2 (alarm 21).

0: Disable 1: Enable

bit 6: stod Alarm 4D-2 detection disabled during deceleration and stop

0: Normal 1: Alarm 4D-2 detection disabled during deceleration and stop

bit 5-4:

Not used. Set to "0".

bit 3: clot Collision detection estimated disturbance torque offset

0: Disable 1: Enable

bit 2-0:

Not used. Set to "0".


15 Machine Parameters

15.7 Servo Parameters

(PR)	#2236	SV036 PTYP	Power supply type/ Regenerative resistor type
------	-------	------------	---

MDS-E/EH Series: Power supply type

When connecting a power supply unit, set a code for each power supply unit.

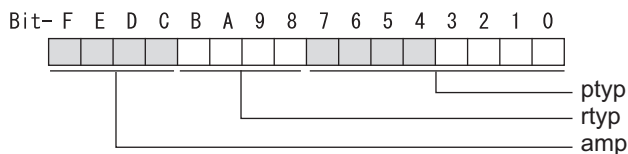**bit F-C : amp**

Set the power backup function to be used.

No function used : 0

Deceleration and stop function at power failure : 8

Retraction function at power failure : C

bit B-8 : rtp

Not used. Set to "0".

bit 7-0 : ptyp External emergency stop setting

When the emergency stop input signal of the power supply unit is "disabled"

Power supply unit is not connected	: 00
MDS-E-CV-37 / MDS-EH-CV-37	: 04
MDS-E-CV-75 / MDS-EH-CV-75	: 08
MDS-E-CV-110 / MDS-EH-CV-110	: 11
MDS-E-CV-185 / MDS-EH-CV-185	: 19
MDS-E-CV-300 / MDS-EH-CV-300	: 30
MDS-E-CV-370 / MDS-EH-CV-370	: 37
MDS-E-CV-450 / MDS-EH-CV-450	: 45
MDS-E-CV-550 / MDS-EH-CV-550	: 55
MDS-EH-CV-750	: 75

When the emergency stop input signal of the power supply unit is "enabled"

(Note) Set the power supply rotary switch to "4".

Power supply unit is not connected	: 00
MDS-E-CV-37 / MDS-EH-CV-37	: 44
MDS-E-CV-75 / MDS-EH-CV-75	: 48
MDS-E-CV-110 / MDS-EH-CV-110	: 51
MDS-E-CV-185 / MDS-EH-CV-185	: 59
MDS-E-CV-300 / MDS-EH-CV-300	: 70
MDS-E-CV-370 / MDS-EH-CV-370	: 77
MDS-E-CV-450 / MDS-EH-CV-450	: 85
MDS-E-CV-550 / MDS-EH-CV-550	: 95
MDS-EH-CV-750	: B5

MDS-EM/EMH Series

Not used. Set to "0000".


External emergency stop power supply type is set by spindle parameter (SP032).

15 Machine Parameters

15.7 Servo Parameters

MDS-EJ/EJH Series: Regenerative resistor type

Set the regenerative resistor type.

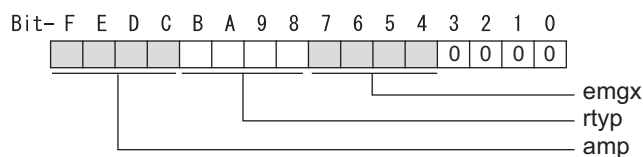**bit F-8 : amp(bit F-C) / rtyp(bit B-8)**

Resistor built-in drive unit : 10
 Setting prohibited : 11
 MR-RB032 : 12
 MR-RB12 or GZG200W39OHMK : 13
 MR-RB32 or GZG200W120OHMK 3 units connected in parallel : 14
 MR-RB30 or GZG200W39OHMK 3 units connected in parallel : 15
 MR-RB50 or GZG300W39OHMK 3 units connected in parallel : 16
 MR-RB31 or GZG200W20OHMK 3 units connected in parallel : 17
 MR-RB51 or GZG300W20OHMK 3 units connected in parallel : 18
 Setting prohibited : 19-1F

Setting prohibited : 20-23
 FCUA-RB22 : 24
 FCUA-RB37 : 25
 FCUA-RB55 : 26
 FCUA-RB75/2 : 27
 Setting prohibited : 28
 R-UNIT2 : 29
 Setting prohibited : 2A-2C
 FCUA-RB75/2 2 units connected in parallel : 2D
 FCUA-RB55 2 units connected in parallel : 2E
 Setting prohibited : 2F

MR-RB1H-4 : 33
 MR-RB3M-4 : 34
 MR-RB3G-4 : 35
 MR-RB5G-4 : 36

bit 7-4 : emgx External emergency stop function

Set the external emergency stop function.

0: Disable 4: Enable

bit 3-0 :

Not used. Set to "0".

#2237	SV037 JL	Load inertia scale
	Set the motor axis conversion total load inertia including motor itself in proportion to the motor inertia. $SV037(JL) = (J_m + J_l) / J_m \times 100$ Jm: Motor inertia Jl: Motor axis conversion load inertia	
	For linear motor, set the gross mass of the moving sections in kg unit.	
	<<Drive monitor load inertia ratio display>> Set SV035/bitF=1 and imbalance torque and friction torque to both SV032 and SV045, and then repeat acceleration/deceleration for several times.	
	---Setting range---	
	For general motor: 0 to 5000 (%) For linear motor 0 to 5000 (kg)	

#2238	SV038 FHz1	Notch filter frequency 1
	Set the vibration frequency to suppress when machine vibration occurs. (Normally, do not set 80 or less.) Set to "0" when not using.	
	Related parameters: SV033/bit3-1, SV115	
	---Setting range---	
	0 to 5000 (Hz)	

15 Machine Parameters

15.7 Servo Parameters

#2239	SV039 LMCD	Lost motion compensation timing
	Set this when the timing of lost motion compensation type 2 does not match. Adjust increments of 10 at a time.	
	---Setting range---	
	0 to 2000 (ms)	
#2240	SV040 LMCT	Lost motion compensation non-sensitive band
	Set the non-sensitive band of the lost motion compensation in the feed forward control. When "0" is set, 2 μ m is the actual value to be set. Adjust increments of 1 μ m.	
	---Setting range---	
	0 to 255 (μ m)	
#2241	SV041 LMC2	Lost motion compensation 2
	Set this with SV016 (LMC1) only when you wish to vary the lost motion compensation amount depending on the command directions. Normally, set to "0".	
	---Setting range---	
	-1 to 200 (Stall current %) Note that when SV082/bit2 is "1", the setting range is between -1 and 20000 (Stall current 0.01%).	
#2242	SV042 OVS2	Overshooting compensation 2
	Set this with SV031 (OVS1) only when you wish to vary the overshooting compensation amount depending on the command directions. Normally, set to "0".	
	---Setting range---	
	-1 to 100 (Stall current %) Note that when SV082/bit2 is "1", the setting range is between -1 and 10000 (Stall current 0.01%).	
#2243	SV043 OBS1	Disturbance observer filter frequency
	Set the disturbance observer filter band. Normally, set to "100". Setting values of 49 or less is equal to "0" setting. To use the disturbance observer, also set SV037 (JL) and SV044 (OBS2). When disturbance observer related parameters are changed, lost motion compensation needs to be readjusted. Set to "0" when not using.	
	---Setting range---	
	0 to 1000 (rad/s)	
#2244	SV044 OBS2	Disturbance observer gain
	Set the disturbance observer gain. The standard setting is "100 to 300". To use the disturbance observer, also set SV037 (JL) and SV043 (OBS1). When disturbance observer related parameters are changed, lost motion compensation needs to be readjusted. Set to "0" when not using.	
	---Setting range---	
	0 to 500 (%)	
#2245	SV045 TRUB	Friction torque
	Set the frictional torque when using the collision detection function. To use load inertia estimation function (drive monitor display), set this parameter, imbalance torque (SV032) and load inertia display enabling flag (SV035/bitF).	
	---Setting range---	
	0 to 255 (Stall current %)	
#2246	SV046 FH2	Notch filter frequency 2
	Set the vibration frequency to suppress when machine vibration occurs. (Normally, do not set 80 or less.) Set to "0" when not using.	
	Related parameters: SV033/bit7-5, SV115	
	---Setting range---	
	0 to 5000 (Hz)	

15 Machine Parameters

15.7 Servo Parameters

#2247	SV047 EC	Inductive voltage compensation gain
Set the inductive voltage compensation gain. Standard setting value is "100". If the current FB peak exceeds the current command peak, lower the gain. ---Setting range--- 0 to 200 (%)		
#2248	SV048 EMGrt	Vertical axis drop prevention time
Input the time required to prevent the vertical axis from dropping by delaying READY OFF until the brake works at an emergency stop. Increase in increments of 100ms at a time, find and set the value where the axis does not drop. When using a motor with a break of HG(-H) Series, HQ-H Series, and HK(-H) Series set to "200ms" as a standard. When the pull up function is enabled (SV033/bitE=1), the pull up is established during the drop prevention time. (Note) When not using the spindle drive unit, use the servo axis that controls vertical axis drop prevention control to control the power supply (connect with CN4). Related parameters: SV033/bitE, SV055, SV056 ---Setting range--- 0 to 20000 (ms) When set to "0", and the pull up function is enabled (SV033/bitE=1), the alarm "S02 2233 Initial parameter error" occurs.		
#2249	SV049 PGN1sp	Position loop gain 1 in spindle synchronous control
Set the position loop gain during spindle synchronization control (synchronous tapping and synchronization control with spindle C-axis). Set the same value as that of the position loop gain for spindle synchronous tapping control. When performing the SHG control, set this parameter with SV050 (PGN2sp) and SV058 (SHGCsp). When changing the value, change the value of "#2017 tap_g Axis servo gain". ---Setting range--- 1 to 200 (rad/s)		
#2250	SV050 PGN2sp	Position loop gain 2 in spindle synchronous control
When using SHG control during spindle synchronous control (synchronous tapping and synchronization control with spindle C-axis), set this parameter with SV049 (PGN1sp) and SV058 (SHGCsp). Make sure to set the value 8/3 times that of SV049. When not using the SHG control, set to "0". ---Setting range--- 0 to 999 (rad/s)		
#2251	SV051 DFBT	Dual feedback control time constant
Set the control time constant in dual feed back. When "0" is set, it operates at 1ms. The higher the time constant is, the closer it gets to the semi-closed control, so the limit of the position loop gain will be raised. For linear servo/direct-drive motor system Not used. Set to "0". Related parameters: SV017/bit1, SV052 ---Setting range--- 0 to 9999 (ms)		
#2252	SV052 DFBN	Dual feedback control non-sensitive band
Set the non-sensitive band in the dual feedback control. Normally, set to "0". For linear servo/direct-drive motor system Not used. Set to "0". Related parameters: SV017/bit1, SV052 ---Setting range--- 0 to 9999 (μm)		

15 Machine Parameters

15.7 Servo Parameters

#2253	SV053 OD3	Excessive error detection width in special control
	Set the excessive error detection width when servo ON in a special control (initial absolute position setting, stopper control and etc.). When "0" is set, excessive error detection will not be performed when servo ON during a special control. ---Setting range--- 0 to 32767 (mm) However, when SV084/bitC=1, the setting range is from 0 to 32767 (μm).	
#2254	SV054 ORE	Overrun detection width in closed loop control
	Set the overrun detection width in the full-closed loop control. When the gap between the motor side encoder and the linear scale (machine side encoder) exceeds the value set by this parameter, it will be judged as overrun and "Alarm 43" will be detected. When "-1" is set, if the differential velocity between the motor side encoder and the machine side encoder exceeds the 30% of the maximum motor speed, it will be judged as overrun and "Alarm 43" will be detected. When "0" is set, overrun will be detected with a 2mm width. For linear servo/direct-drive motor system Not used. Set to "0". ---Setting range--- -1 to 32767 (mm) However, when SV084/bitD=1, the setting range is from -1 to 32767 (μm).	
#2255	SV055 EMGx	Max. gate off delay time after emergency stop
	Set the time required between an emergency stop and forced READY OFF. Set the maximum value "+ 100ms" of the SV056 setting value of the servo drive unit electrified by the same power supply unit. When executing the vertical axis drop prevention, the gate off will be delayed for the length of time set at SV048 even when SV055's is smaller than that of SV048. Related parameters: SV048, SV056 ---Setting range--- 0 to 20000 (ms)	
#2256	SV056 EMGt	Deceleration time constant at emergency stop
	Set the time constant used for the deceleration control at emergency stop. Set the time required to stop from rapid traverse rate (rapid). The standard setting value is $EMGt \leq G0tL \times 0.9$. However, note that the standard setting value differs from the above-mentioned value when the setting value of "#2003:smgst Acceleration and deceleration modes bit 3-0:Rapid traverse acceleration/deceleration type" is 8 or F. Refer to Instruction Manual of the drive unit (section "5.5.1 Deceleration Control") for details. Related parameters: SV048, SV055 ---Setting range--- 0 to 20000 (ms)	
#2257	SV057 SHGC	SHG control gain
	When performing the SHG control, set to SV003(PGN1)×6. When not using the SHG control, set to "0". When using the OMR-FF control, set to "0". Related parameters: SV003, SV004 ---Setting range--- 0 to 1200 (rad/s)	
#2258	SV058 SHGCsp	SHG control gain in spindle synchronous control
	When using SHG control during spindle synchronization control (synchronous tapping and synchronous control with spindle C-axis), set this parameter with SV049 (PGN1sp) and SV050 (PGN2sp). Make sure to set the value 6 times that of SV049. When not using the SHG control, set to "0". ---Setting range--- 0 to 1200 (rad/s)	

15 Machine Parameters

15.7 Servo Parameters

#2259	SV059 TCNV	Collision detection torque estimated gain
	<p>Set the torque estimated gain when using the collision detection function. The standard setting value is the same as the load inertia ratio (SV037 setting value) including motor inertia. Set to "0" when not using the collision detection function.</p> <p>Related parameters: SV032, SV035/bitF-8, SV037, SV045, SV060</p> <p><<Drive monitor load inertia ratio display>> Set SV035/bitF=1 and imbalance torque and friction torque to both SV032 and SV045, and then repeat acceleration/deceleration for several times.</p> <p>---Setting range---</p> <p>For general motor: 0 to 5000 (%) For linear motor: 0 to 5000 (kg)</p>	
#2260	SV060 TLMT	Collision detection level
	<p>When using the collision detection function, set the collision detection level at the G0 feeding. When "0" is set, none of the collision detection function will work.</p> <p>Related parameters: SV032, SV035/bitF-8, SV037, SV045, SV059</p> <p>---Setting range---</p> <p>0 to 999 (Stall current %)</p>	
#2261	SV061 DA1NO	D/A output ch1 data No. / Initial DC excitation level
	<p>Input the data number you wish to output to the D/A output channel 1. When using the 2-axis drive unit, set "-1" to the axis that the data will not be output.</p> <p>When the DC excitation is running (SV034/bit4=1): Use this when the DC excitation is running (SV034/bit4=1) to adjust the initial magnetic pole position (when measuring the magnetic pole shift amount) for linear motor and direct-drive motor. Set the initial excitation level in DC excitation control. Set 10% as standard. Related parameters: SV062, SV063</p> <p>---Setting range---</p> <p>-32768 to 32767 When the DC excitation is running (SV034/bit4=1): 0 to 100 (Stall current %)</p>	
#2262	SV062 DA2NO	D/A output ch2 data No. / Final DC excitation level
	<p>Input the data number you wish to output to the D/A output channel 2. When using the 2-axis drive unit, set "-1" to the axis that the data will not be output.</p> <p>When the DC excitation is running (SV034/bit4=1): Use this when the DC excitation is running (SV034/bit4=1) to adjust the initial magnetic pole position (when measuring the magnetic pole shift amount) for linear motor and direct-drive motor. Set the final excitation level in DC excitation control. Set 10% as standard. When the magnetic pole shift amount measurement value is unsteady, adjust the value in increments of 5%. Related parameters: SV061, SV063</p> <p>---Setting range---</p> <p>-32768 to 32767 When the DC excitation is running (SV034/bit4=1): 0 to 100 (Stall current %)</p>	

15 Machine Parameters

15.7 Servo Parameters

#2263	SV063 DA1MPY	D/A output ch1 output scale / Initial DC excitation time
		<p>Set output scale of the D/A output channel 1 in increment of 1/100. When "0" is set, the magnification is the same as when "100" is set.</p> <p>When the DC excitation is running (SV034/bit4=1): Use this when the DC excitation is running (SV034/bit4=1) to adjust the initial magnetic pole position (when measuring the magnetic pole shift amount) for linear motor and direct-drive motor. Set the initial excitation time in DC excitation control. Set 1000ms as standard. When the magnetic pole shift amount measurement value is unsteady, adjust the value in increments of 500ms. Related parameters: SV061, SV062</p> <p>---Setting range---</p> <p>-32768 to 32767 (1/100-fold) When the DC excitation is running (SV034/bit4=1): 0 to 10000 (ms)</p>
#2264	SV064 DA2MPY	D/A output ch2 output scale
		<p>Set output scale of the D/A output channel 2 in increment of 1/100. When "0" is set, the magnification is the same as when "100" is set.</p> <p>---Setting range---</p> <p>-32768 to 32767 (1/100-fold)</p>
#2265	SV065 TLC	Machine end compensation gain
		<p>The shape of the machine end is compensated by compensating the spring effect from the machine end to the motor end. Set the machine end compensation gain. Measure the error amount by roundness measurement and estimate the setting value by the following formula.</p> <p>Compensation amount (μm) = Command speed F(mm/min)² * SV065 / (Radius R(mm) * SV003 * 16,200,000)</p> <p>Set to "0" when not using.</p> <p>---Setting range---</p> <p>-30000 to 30000 (Acceleration ratio 0.1%)</p>
#2266-2272	SV066 - SV072	
		This parameter is set automatically by the NC system.
(PR) #2273	SV073 FEEDout	Specified speed output speed
		<p>Set the specified speed. Also set SV082/bit9,8 to output digital signal.</p> <p>---Setting range---</p> <p>0 to 32767 (mm/min) However, when SV033/bitD=1, the setting range is from 0 to 32767 (100mm/min). (Only for MDS-E/EH and MDS-EM/EMH)</p>
#2274-2280	SV074 - SV080	
		This parameter is set automatically by the NC system.

15 Machine Parameters

15.7 Servo Parameters

(PR)

#2281

SV081 SPEC2

Servo specification 2

Select the servo functions.

A function is assigned to each bit.

Set this in hexadecimal format.

Bit-

F

E

D

C

B

A

9

8

7

6

5

4

3

2

1

0

0

0

0

0

0

0

0

0

0

0

0

0

absc

szchk

cbc

npg

bit F-A:

Not used. Set to "0".

bit 9: npg Earth fault detection

0: Disable 1: Enable (standard)

Set "0" and it is constantly "Enable" for MDS-EJ/EJH Series.

bit 8: cbc motor brake axis selection control

0: Standard 1: Motor brake axis selection control enabled

(Only for MDS-EJ-V2)

bit 7: szchk Distance-coded reference scale reference mark

0: Check at 4 points (standard) 1: Check at 3 points

bit 6-4:

Not used. Set to "0".

bit 3: absc Distance-coded reference scale

0: Disable 1: Enable

bit 2-0:

Not used. Set to "0".

15 Machine Parameters

15.7 Servo Parameters

#2282	SV082 SSF5	Servo function 5
	<div>Select the servo functions. A function is assigned to each bit. Set this in hexadecimal format.</div> <div><div>Bit- F E D C B A 9 8 7 6 5 4 3 2 1 0</div><div><div>0000</div><div></div><div></div><div></div><div></div><div></div><div>00000</div><div></div><div></div><div></div><div></div><div></div><div></div><div></div><div></div><div>0</div></div><div><div></div><div></div><div></div><div></div><div></div><div></div><div></div><div></div><div></div><div></div><div></div><div></div><div></div><div></div><div></div><div></div></div><div><div>lmc3</div><div>ccu</div><div>dos2</div><div>dos3</div></div></div>	
	<div>bit F-C: Not used. Set to "0".</div> <div>bit B-A: dos3 Digital signal output 3 selection bitB,A= 00: Disable 01: Setting prohibited 10: Contactor control signal output (For MDS-EJ/EJH) 11: Setting prohibited</div> <div>bit 9-8: dos2 Digital signal output 2 selection bit9,8= 00: Disable 01: Specified speed output 10: Setting prohibited 11: Setting prohibited</div> <div>bit 7-3: Not used. Set to "0".</div> <div>bit 2: ccu Lost motion overshoot compensation compensation amount setting increment 0: Stall current % 1: Stall current 0.01%</div> <div>bit 1: lmc3 Lost motion compensation type 3 Set this when protrusion at a quadrant change is too big. 0: Stop 1: Start</div> <div> Related parameters: SV016, SV041, SV085, SV086</div> <div>bit 0: Not used. Set to "0".</div>	

15 Machine Parameters

15.7 Servo Parameters

#2283	SV083 SSF6	Servo function 6																	
<p>Select the servo functions. A function is assigned to each bit. Set this in hexadecimal format.</p> <div style="margin-top: 20px;"><div style="display: flex; justify-content: space-between; margin-bottom: 5px;">Bit-FEDCBA9876543210</div><table border="1" style="width: 100%; text-align: center; border-collapse: collapse;"><tr><td style="width: 5%;">0</td><td style="width: 5%;">0</td><td style="width: 5%;">0</td><td style="width: 5%;">0</td><td style="width: 5%;">0</td><td style="width: 5%;">0</td><td style="width: 5%;">0</td><td style="width: 5%;">0</td><td style="width: 5%;">0</td><td style="width: 5%; background-color: #cccccc;"></td><td style="width: 5%; background-color: #cccccc;"></td><td style="width: 5%; background-color: #cccccc;"></td><td style="width: 5%;">0</td><td style="width: 5%;"></td><td style="width: 5%;"></td><td style="width: 5%;"></td><td style="width: 5%;">0</td></tr></table><div style="margin-top: 10px; text-align: right;"><div style="display: flex; justify-content: space-between; width: 80%; margin: 0 auto;"><div style="width: 40%; border-top: 1px solid black; border-left: 1px solid black; border-right: 1px solid black; height: 15px;"></div><div style="width: 10%;"></div><div style="width: 40%; border-top: 1px solid black; border-left: 1px solid black; border-right: 1px solid black; height: 15px;"></div></div><div style="display: flex; justify-content: space-between; width: 80%; margin: 0 auto; margin-top: 5px;">nfd4</div><div style="display: flex; justify-content: space-between; width: 80%; margin: 0 auto; margin-top: 5px;">nfd5</div></div></div>			0	0	0	0	0	0	0	0	0				0				0
0	0	0	0	0	0	0	0	0				0				0			

bit F-8 :

Not used. Set to "0".

bit 7-5 : nfd5 Depth of Notch filter 5

Set the depth of Notch filter 5 (SV088).

bit7,6,5=

000: -∞

001: -18.1[dB]

010: -12.0[dB]

011: -8.5[dB]

100: -6.0[dB]

101: -4.1[dB]

110: -2.5[dB]

111: -1.2[dB]

bit 4 :

Not used. Set to "0".

bit 3-1 : nfd4 Depth of Notch filter 4

Set the depth of Notch filter 4 (SV087).

bit3,2,1=

000: -∞

001: -18.1[dB]

010: -12.0[dB]

011: -8.5[dB]

100: -6.0[dB]

101: -4.1[dB]

110: -2.5[dB]

111: -1.2[dB]

bit 0 :

Not used. Set to "0".

15 Machine Parameters

15.7 Servo Parameters

#2284	SV084 SSF7	Servo function 7
<p>Select the servo functions. A function is assigned to each bit. Set this in hexadecimal format.</p> <p>Bit- F E D C B A 9 8 7 6 5 4 3 2 1 0</p> <p>irms ilm2u odu oru h2c</p>		
<p>bit F : h2c HAS control cancel amount</p> <p>0: 1/4 (standard) 1: 1/2</p> <p>Related parameters: SV034/bit1</p>		
<p>bit E :</p> <p>Not used. Set to "0".</p>		
<p>bit D : oru Overrun detection width unit</p> <p>0: mm (normal setting) 1: μm</p>		
<p>bit C : odu Excessive error detection width unit</p> <p>0: mm (normal setting) 1: μm</p>		
<p>bit B : ilm2u Current limit value (SV014) in special control setting unit</p> <p>0: Stall current % (normal setting) 1: Stall current 0.01%</p>		
<p>bit A-1 :</p> <p>Not used. Set to "0".</p>		
<p>bit 0 : irms Motor current display</p> <p>0: Motor q axis current display (normal) 1: Motor effective current display</p>		
#2285	SV085 LMCK	Lost motion compensation 3 spring constant
<p>Set the machine system's spring constant when selecting lost motion compensation type 3. When not using, set to "0".</p> <p>Related parameters: SV016, SV041, SV082/bit2,1, SV086</p> <p>---Setting range---</p> <p>0 to 32767 (0.01%/μm)</p>		
#2286	SV086 LMCC	Lost motion compensation 3 viscous coefficient
<p>Set the machine system's viscous coefficient when selecting lost motion compensation type 3. When not using, set to "0".</p> <p>Related parameters: SV016, SV041, SV082/bit2,1, SV086</p> <p>---Setting range---</p> <p>0 to 32767 (0.01%•s/mm)</p>		
#2287	SV087 FHZ4	Notch filter frequency 4
<p>Set the vibration frequency to suppress when machine vibration occurs. (Normally, do not set 80 or less.) Set to "0" when not using.</p> <p>Related parameters: SV083/bit3-1, SV115</p> <p>---Setting range---</p> <p>0 to 5000 (Hz)</p>		

15 Machine Parameters

15.7 Servo Parameters

#2288	SV088 FHz5	Notch filter frequency 5
	Set the vibration frequency to suppress when machine vibration occurs. (Normally, do not set 80 or less.) Set to "0" when not using. Related parameters: SV083/bit7-5, SV115 ---Setting range--- 0 to 5000 (Hz)	
#2289	SV089	Not used. Set to "0".
#2290	SV090	Not used. Set to "0".
#2291	SV091 LMC4G	Lost motion compensation 4 gain
	Use this with LMC compensation type 3. As the delay in path tracking is monitored and compensated, the delay in path tracking will be minimized even if machine friction amount changes by aging. Use the lost motion compensation amount (SV016) * 5 (10% of the dynamic friction torque) as the target. The higher the setting value is, the more accurate the quadrant change be; however, the more likely vibrations occur. ---Setting range--- 0 to 20000 (Stall current 0.01%)	
#2292	SV092	Not used. Set to "0".
#2293	SV093	Not used. Set to "0".
#2294	SV094 MPV	Magnetic pole position error detection speed
	The magnetic pole position detection function monitors the command speed and motor speed at the position command stop and detects the magnetic pole position error alarm (3E) if any. Set the error detection level for the command speed and motor speed at the position command stop. Be aware when setting the parameter as the setting units for general motors and linear motors are different. <<For general motor>> When the command speed error detection level is set to "0", the magnetic pole position error (3E) is detected at 10r/min. Set "10" as standard. This detects the magnetic pole position error (3E) when the motor rotation speed is 100r/min and more. <<For linear motor>> When the command motor speed level is set to "0", the magnetic pole position error (3E) is detected at 1mm/s. Set "10" as standard. This detects the magnetic pole position error (3E) when the motor speed is 10mm/s and more. ---Setting range--- 0 to 31999 <<For general motor>> Ten-thousands digit, Thousands digit ----- Command speed error detection level (10r/min) Hundreds digit, Tens digit, Ones digit ----- Motor speed error detection level (10r/min) <<For linear motor>> Ten-thousands digit, Thousands digit ----- Command speed error detection speed level (1mm/s) Hundreds digit, Tens digit, Ones digit ----- Motor speed error detection level (1mm/s)	

15 Machine Parameters

15.7 Servo Parameters

#2295	SV095 ZUPD	Vertical axis pull up distance
<p>Set this parameter to adjust the pull up distance when the vertical axis pull up function is enabled. When the pull up function is enabled and this parameter is set to "0", for a rotary motor, 8/1000 of a rotation at the motor end is internally set as the pull up distance, and for a linear motor, 80[μm] is set.</p> <p>Related parameters: SV032 : The pull up direction is determined. When "0" is set, the alarm occurs. SV033/bitE : Start-up of the pull up function SV048 : Set the drop prevention time. When "0" is set, the alarm occurs.</p> <p>---Setting range--- 0 to 2000 (μm)</p>		
#2296-2305	SV096 - SV105	
Not used. Set to "0".		
#2306	SV106 PGM	OMR-FF scale model gain
<p>Set the scale model gain (position response) in OMR-FF control. Set the same value as SV003(PGN1). Increase the setting value to perform a high-speed machining such as a fine arc or to improve the path error. Lower the value when vibration occurs during acceleration/deceleration. Set to "0" when not using OMR-FF control.</p> <p>---Setting range--- 0 to 300 (rad/s)</p>		
#2307-2311	SV107 - SV111	
Not used. Set to "0".		
#2312	SV112 IFF	OMR-FF current feed forward gain
<p>Set the current feed forward rate in OMR-FF control. The standard setting is "10000". Setting value of "0" is equal to "10000(100%)" setting. Set to "0" when not using OMR-FF control.</p> <p>---Setting range--- 0 to 32767 (0.01%)</p>		
#2313	SV113 SSF8	Servo function 8
<p>Select the servo functions. A function is assigned to each bit. Set this in hexadecimal format.</p> <div style="display: flex; align-items: center;"> <div style="margin-right: 10px;"> Bit- F E D C B A 9 8 7 6 5 4 3 2 1 0 </div> <div style="border: 1px solid black; padding: 2px; display: flex; align-items: center;"> <div style="border-right: 1px solid black; padding: 0 5px;">0</div> <div style="border-right: 1px solid black; padding: 0 5px;">0</div> <div style="border-right: 1px solid black; padding: 0 5px;">0</div> <div style="border-right: 1px solid black; padding: 0 5px;">0</div> <div style="border-right: 1px solid black; padding: 0 5px;">0</div> <div style="border-right: 1px solid black; padding: 0 5px;">0</div> <div style="border-right: 1px solid black; padding: 0 5px;">0</div> <div style="border-right: 1px solid black; padding: 0 5px;">0</div> <div style="border-right: 1px solid black; padding: 0 5px;"></div> <div style="border-right: 1px solid black; padding: 0 5px;"></div> <div style="border-right: 1px solid black; padding: 0 5px;">0</div> <div style="border-right: 1px solid black; padding: 0 5px;">0</div> <div style="border-right: 1px solid black; padding: 0 5px;">0</div> <div style="border-right: 1px solid black; padding: 0 5px;">0</div> <div style="border-right: 1px solid black; padding: 0 5px;">0</div> <div style="padding: 0 5px;">0</div> </div> <div style="margin-left: 10px; margin-top: 10px;"> <div style="border-top: 1px solid black; width: 100%;"></div> <div style="border-top: 1px solid black; width: 100%;"></div> <div style="border-top: 1px solid black; width: 100%;"></div> </div> <div style="margin-left: 100px; margin-top: 10px;"> omrffon nmerc sto </div> </div>		
<p>bit F-9 :</p> <p>Not used. Set to "0".</p> <p>bit 8 : sto Dedicated wiring STO function</p> <p>Set this parameter to use dedicated wiring STO function. 0: Dedicated wiring STO function unused 1: Dedicated wiring STO function used (Only for MDS-E/EH and MDS-EJ/EJH)</p> <p>bit 7 : nmerc Machine error compensation amount</p> <p>(Note) Do not turn ON the NC power supply with the setting as disable (set to "1"). The initial parameter error alarm is detected. 0: Enable (Normal setting) 1: Disable</p> <p>bit 0 : omrffon OMR-FF control enabled</p> <p>0: Disable 1: Enable</p>		

15 Machine Parameters


15.7 Servo Parameters

#2314

SV114 SSF9

Servo function 9

Select the servo functions.
A function is assigned to each bit.
Set this in hexadecimal format.

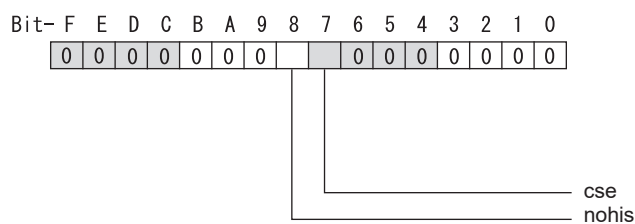**bit F-9 :**

Set to "8" when HG46, 56, 96 motors are driven by MDS-E-V3.
Set to "0" for other cases.

bit 8 : nohis History of communication error alarm between NC and DRV (34, 36, 38, 39)

0: Enable 1: Disable

bit 7 : cse Command speed monitoring function

0: Disable 1: Enable (Normal setting)

bit 6-0 :

Not used. Set to "0".

15 Machine Parameters


15.7 Servo Parameters

#2315

SV115 SSF10

Servo function 10

Select the servo functions.
A function is assigned to each bit.
Set this in hexadecimal format.

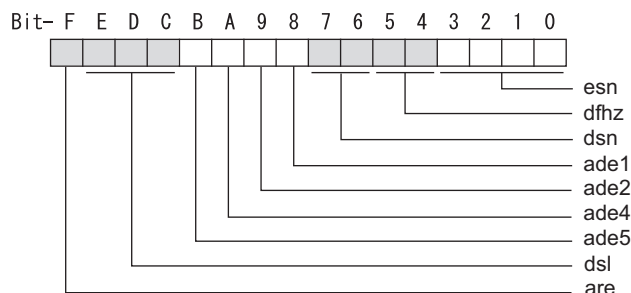**bit F : are Notch filter5 all frequencies adapted**

When enabled, Notch filter5 all frequencies adaptive range is not limited regardless of SV115/bit4,5 setting.
0: Disable 1: Enable

bit E-C: dsl Notch filter frequency display

Switch the "AFLT frequency" display on drive monitor screen to check every notch filter frequency.
When the selected notch filter is not used, "0" is displayed.

bitE,D,C=
000 : Estimated resonance frequency (Normal display)
001 : Notch filter 1 frequency
010 : Notch filter 2 frequency
011 : Notch filter 3 frequency (always displays 1125Hz)
100 : Notch filter 4 frequency
101 : Notch filter 5 frequency
Other settings: setting prohibited

bit B : ade5 Notch filter 5 / Adaptive follow-up function

0: Disable 1: Enable

bit A : ade4 Notch filter 4 / Adaptive follow-up function

0: Disable 1: Enable

bit 9 : ade2 Notch filter 2 / Adaptive follow-up function

0: Disable 1: Enable

bit 8 : ade1 Notch filter 1 / Adaptive follow-up function

0: Disable 1: Enable

bit 7-6 : dsn Estimated resonance frequency display holding time

Set the estimated resonance frequency display holding time to the "AFLT frequency" display on drive monitor screen.

bit7,6=
00: 4 [s]
01: 8 [s]
10: 12 [s]
11: 16 [s]

bit 5-4 : dfhz Notch filter frequency range

Set the adaptive range of the notch filter frequency. When the adaptive follow-up function is enabled and if the estimated resonance frequency exists in the set range, the notch filter will be adapted. Normally set this parameter to "00".

bit5,4=
00: -10 to 10 [%]
01: -20 to 20 [%]
10: -30 to 30 [%]
11: -40 to 40 [%]

15 Machine Parameters

15.7 Servo Parameters

bit 3-0 : esn Sensitivity of estimated resonance frequency

Set the sensitivity of the estimated resonance frequency. When the notch filter adaptive follow-up function is enabled, smaller setting value enables to detect smaller vibration component, however, adaptive movement will be repeated frequently. Normally set this parameter to "0".

0 : Normal setting (same sensitivity as A) 1 : Sensitivity high to F : Sensitivity low

#2316	SV116 SSF11	Servo function 11
bit1: fctcfw Full-closed torsion compensation function forward direction compensation enabled		
Compensate the torsion amount in the forward direction with the full-closed torsion compensation function. When compensating the torsion amount in the reverse direction only, set to "0".		
0: Stop 1: Start		
(PR) #2317	SV117 RNG1ex	Expansion sub side encoder resolution
For high-accuracy binary resolution encoder, set the number of pulses to four bite data of SV117 (high-order) and SV019 (low-order) by pulse (p). When SV117=0, the setting unit of SV019 is (kp). Refer to SV019 for details.		
Related parameters: SV019, SV020, SV118		
---Setting range---		
-1 to 32767		
(PR) #2318	SV118 RNG2ex	Expansion main side encoder resolution
When using high-accuracy binary resolution encoder, set the number of pulses to four bite data of SV118 (high-order) and SV020 (low-order) by pulse (p). When SV118=0, the setting unit of SV020 is (kp). Refer to SV020 for details.		
Related parameters: SV019, SV020, SV117		
---Setting range---		
-1 to 32767		
#2319-2328	SV119 - SV128	
Not used. Set to "0".		
#2329	SV129 Kwf	Synchronous control feed forward filter frequency
Set the acceleration rate feed forward filter frequency in high-speed synchronous tapping control. The standard setting is "600".		
Related parameters: SV244		
---Setting range---		
0 to 32767 (rad/s)		
(PR) #2330	SV130 RPITS	Base reference mark interval
Set the base reference mark intervals of distance-coded reference scale. When the distance-coded reference scale is not used, set to "0". The interval of basic reference mark (SV130) and auxiliary interval (SV131) must be in the specified relationship. Other settings cause the initial parameter error (alarm 37). Following is the specified relationship.		
The quotient of (SV130×1000) / SV131 must be 4 or more and leaves no remainder.		
Related parameters: SV081/bit7,3, SV131, SV134 to SV137		
---Setting range---		
0 to 32767 (mm)		

15 Machine Parameters

15.7 Servo Parameters

(PR)	#2331	SV131 DPITS	Auxiliary reference mark interval
			<p>Set the auxiliary interval of reference mark in the distance-coded reference scale. When the distance-coded reference scale is not used, set to "0".</p> <p>The interval of basic reference mark (SV130) and auxiliary interval (SV131) must be in the specified relationship. Other settings cause the initial parameter error (alarm 37).</p> <p>Following is the specified relationship.</p> <p>The quotient of (SV130×1000) / SV131 must be 4 or more and leaves no remainder.</p> <p>Related parameters: SV081/bit7,3, SV130, SV134 to SV137</p> <p>---Setting range---</p> <p>0 to 32767 (μm)</p>
	#2332	SV132	
			Not used. Set to "0".
	#2333	SV133	
			Not used. Set to "0".
	#2334	SV134 RRn0	Distance-coded reference check / revolution counter
			<p>Set this parameter to operate distance-coded reference check when using distance-coded reference scale. During the distance-coded reference check initial setup (SV137:RAER=-1), set the following items on the NC drive monitor screen after the distance-coded reference check initial setup warning A3 turns OFF.</p> <p>SV134=Rn, SV135=Pn, SV136=MPOS</p> <p>When reference point is set, the warning A3 turns OFF.</p> <p>To enable the distance-coded reference check function, SV081/bit3=1setting and a battery option are needed.</p> <p>Related parameters: SV081/bit3,7, SV130, SV131, SV134 to SV137</p> <p>---Setting range---</p> <p>-32768 to 32767</p>
	#2335	SV135 RPn0H	Distance-coded reference check /position within one rotation High
			<p>Set this parameter to operate distance-coded reference check when using distance-coded reference scale. During the distance-coded reference check initial setup (SV137:RAER=-1), set the following items on the NC drive monitor screen after the distance-coded reference check initial setup warning A3 turns OFF.</p> <p>SV134=Rn, SV135=Pn, SV136=MPOS</p> <p>When reference point is set, the warning A3 turns OFF.</p> <p>To enable the distance-coded reference check function, SV081/bit3=1setting and a battery option are needed.</p> <p>Related parameters: SV081/bit3,7, SV130, SV131, SV134 to SV137</p> <p>---Setting range---</p> <p>-32768 to 32767</p>
	#2336	SV136 RPn0L	Distance-coded reference check / position within one rotation Low
			<p>Set this parameter to operate distance-coded reference check when using distance-coded reference scale. During the distance-coded reference check initial setup (SV137:RAER=-1), set the following items on the NC drive monitor screen after the distance-coded reference check initial setup warning A3 turns OFF.</p> <p>SV134=Rn, SV135=Pn, SV136=MPOS</p> <p>When reference point is set, the warning A3 turns OFF.</p> <p>To enable the distance-coded reference check function, SV081/bit3=1setting and a battery option are needed.</p> <p>Related parameters: SV081/bit3,7, SV130, SV131, SV134 to SV137</p> <p>---Setting range---</p> <p>-32768 to 32767</p>

15 Machine Parameters

15.7 Servo Parameters

#2337	SV137 RAER	Distance-coded reference check allowable width
		<p>For the distance-coded reference check function when using distance-coded reference scale, set the allowable gap from the reference point position data calculated by the main side encoder. When the gap exceeds the allowable range, reference point created by distance-code is judged as wrong and detects alarm 42. The standard setting value is "basic reference mark interval (SV130) / 4".</p> <p>SV137=0 setting carries out the same operation as the standard setting value.</p> <p>SV137=-1 setting enables the distance-coded reference initial set up mode and displays setting values of SV134 to SV136 on NC drive monitor.</p> <p>To enable the distance-coded reference check function, SV081/bit3=1 setting and a battery option are needed.</p> <p>When SV137=32767, the distance-coded reference check function is disabled.</p>

Related parameters: SV081/bit3,7, SV130, SV131, SV134 to SV136

---Setting range---

-1 to 32767 (mm)

#2338-2397	SV138 - SV197	
		Not used. Set to "0".


#2398	SV198 NSE	No signal 2 special detection width
		<p>Set the special detection width for the no signal 2 (alarm 21).</p> <p>This detects no signal 2 (alarm 21) when machine side feedback is not invoked even if the motor side encoder feedback exceeds this setting in the rectangular wave signal output linear scale.</p> <p>When "0" is set, the detection will be performed with a 15μm width.</p>

---Setting range---

0 to 32767 (μm)

#2399	SV199 RTGM	Real-time tuning: maximum adaptive gain multiplier
		<p>In case that machine resonance is induced when mounting a workpiece, the speed loop gain is switched automatically in response to inertia by setting the speed loop gain and workpiece inertia multiplier in advance.</p> <p>The speed loop gain SV199(RTGM) changes in response to the estimated inertia ratio SV200(RTJX) based on the speed loop gain SV005(VGN1) and the inertia multiplier SV037(JL) which were adjusted when no workpiece was mounted.</p> <p>When SV199 is set to "0", the adaptation of the speed loop gain will be disabled.</p>

Speed control gain multiplier [%]

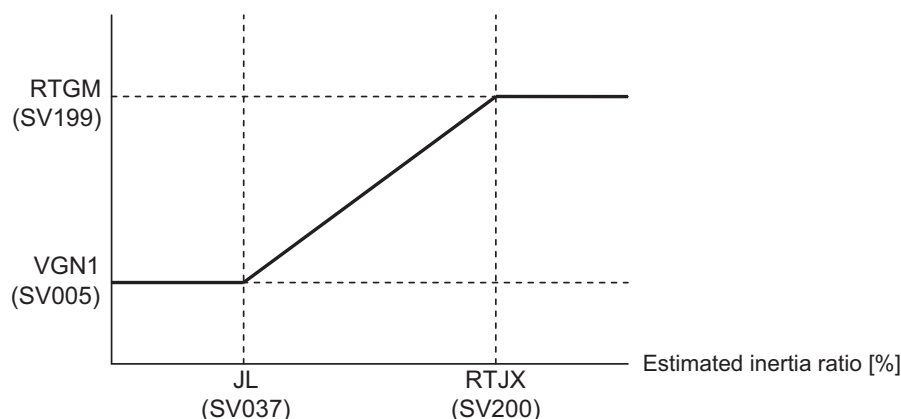


Related parameters: SV005, SV037, SV200

---Setting range---

0 to 5000 (%)

15 Machine Parameters

15.7 Servo Parameters
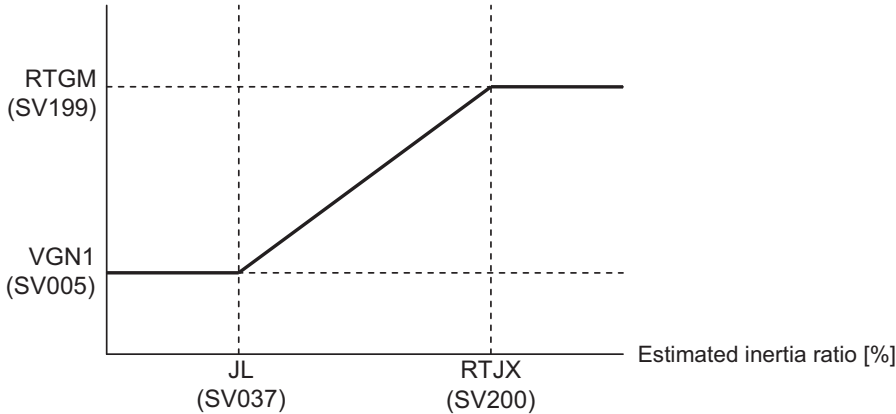
#2400	SV200 RTJX	Real-time tuning: maximum adaptive inertia ratio
<p>In case that machine resonance is induced when mounting a workpiece, the speed loop gain is switched automatically in response to inertia by setting the speed loop gain and workpiece inertia multiplier in advance.</p> <p>The speed loop gain SV199(RTGM) changes in response to the estimated inertia ratio SV200(RTJX) based on the speed loop gain SV005(VGN1) and the inertia multiplier SV037(JL) which were adjusted when no workpiece was mounted.</p> <p>When SV199 is set to "0", the adaptation of the speed loop gain will be disabled.</p> <p>Speed control gain multiplier [%]</p>  <p>Related parameters: SV005, SV037, SV199</p> <p>---Setting range---</p> <p>0 to 32767 (%)</p>		
#2401-2405	SV201 - SV205	
Not used. Set to "0".		
#2406	SV206 FCTC	Full-closed torsion compensation control torsion amount
<p>Set the compensation amount of full-closed torsion compensation function.</p> <p>Set the torsion amount between the motor-end position and the machine-end position right after the stop as a standard setting value.</p> <p>When not using, set to "0".</p> <p>---Setting range---</p> <p>0 to 32767 (0.01μm)</p>		
#2407-2409	SV207 - SV209	
Not used. Set to "0".		
#2410	SV210 GAPC	Height control (Analog input conversion factor)
<p>Set the conversion factor to convert analog voltage into position data.</p> <p>Specify the distance per volt in increments of 0.1 mm.</p> <p>The sign (+/-) of the analog input conversion factor is used to specify the compensation direction.</p> <p>Positive value: compensation in + direction</p> <p>Negative value: compensation in - direction</p> <p>---Setting range---</p> <p>-32768 to 32767 (0.1mm/V)</p>		
#2411	SV211	
Not used. Set to "0".		
#2412	SV212 GAPL	Height control (Compensation limit value)
<p>Set the upper limit value for the compensation amount that is automatically applied by profiling control to the value after approach has completed.</p> <p>This limitation prevents excessive compensation after completion of approach.</p> <p>---Setting range---</p> <p>0 to 32767 (0.1mm)</p>		

15 Machine Parameters

15.7 Servo Parameters

#2413	SV213 HITMAG	Height control (Derivative gain scale factor)
	Set the following accuracy with height change during profiling control. Set "100" as the initial value.	
	---Setting range---	
	0 to 999 (%)	
#2414	SV214 HITT	Height control (Derivative filter time constant)
	Set the time constant for filter cut-off for derivative gain. When "0" is set, the value "100" applies.	
	---Setting range---	
	0 to 20000 (ms)	
#2415	SV215 HITGN	Height control (Integral gain)
	Set the following accuracy with height change. Set "10" as the initial value.	
	---Setting range---	
	0 to 300 (rad/s)	
#2416	SV216 SLL	Height control (Speed limit value)
	Set the upper speed limit during approach/retraction. Set the product of "SV018*100" as the initial value.	
	---Setting range---	
	0 to 32767 (mm/min)	
#2417	SV217	
	Not used. Set to "0".	
#2418	SV218 HITA	Height control (Approach completion width)
	Set the in-position width applied to the positioning up to the setpoint height in the approach motion upon activation of height control. When "0" is set, the value "10" applies. Approach completion width must be smaller than the setpoint height.	
	---Setting range---	
	0 to 10000 (0.1mm)	
#2419-2436	SV219 - SV236	
	Not used. Set to "0".	
(PR) #2437	SV237 TCF	Torque command filter
	Set the filter for the torque command. The standard value is "3000" when using HG46, HG56, or HG96.	
	---Setting range---	
	0 to 5000 (rad/s)	
#2438	SV238 SSCFEED	Safely limited speed
	Set the machine's safely limited speed for the SLS (Safely Limited Speed) function. Set this parameter within the following setting ranges. For linear axis: 2000mm/min or less For rotary axis: 18000°/min (50r/min) or less When not using, set to "0".	
	---Setting range---	
	0 to 18000 (mm/min) or (°/min) However, when SV033/bitD = 1, the setting range is from -32768 to 32767 (100mm/min) or (100°/min).	

15 Machine Parameters

15.7 Servo Parameters

#2439	SV239 SSCRPM	Safely limited motor speed
	<p>Set the motor's safely limited speed for the SLS (Safely Limited Speed) function.</p> <p>Set a value to hold the following relationship.</p> <p>Be aware when setting the parameter as the setting units for general motors and linear motors are different.</p> <p><<For general motor>></p> $SV239 = (SV238/SV018) \times (SV002/SV001)$ <p>Only when the product is 0, set to "1".</p> <p><<For linear motor>></p> $SV239 = SV238/60$ <p>Only when the product is 0, set to "1".</p> <p>When not using, set to "0".</p> <p>---Setting range---</p> <p>For general motor: 0 to 32767 (r/min)</p> <p>For linear motor: 0 to 32767 (mm/s)</p> <p>(Note) The value of the safely limited speed and safely limited motor speed must satisfy the above relation. If this relation is not satisfied, the parameter error (37 or E4) will occur. (Error parameter No. is 239.)</p> <p>Checking this relation is executed when the drive unit is turned ON and parameter is changed and speed observation mode (states when a speed observation command is turned ON) is entered.</p> $\frac{SV238 : SSCFEED}{SV018 : PIT} \times \frac{SV002 : PC2}{SV001 : PC1} = SV239 : SSCRPM$ <p>Note that "1 (r/min)" is applied when the calculation result is "0 (r/min)"</p>	
#2440-2443	SV240 - SV243	
	Not used. Set to "0".	
(PR) #2444	SV244 DUNIT	Communication interpolation unit for communication among drive units
	<p>Set the communication interpolation unit among drive units in high-speed synchronous tapping control. When set to "0", it will be regarded as 20 (0.05μm) is set.</p> <p>Related parameters: SV129</p> <p>---Setting range---</p> <p>0 to 2000 (1/μm)</p>	
#2445-2456	SV245 - SV256	
	Not used. Set to "0".	

15.8 Spindle Specification Parameters

#3001	slimt1	Limit rotation speed (Gear: 00)
Set the spindle rotation speed for maximum motor speed when gear 00 is selected. Set the spindle rotation speed for the S analog output=10V during analog spindle control. ---Setting range--- 0 to 999999 (r/min)		
#3002	slimt2	Limit rotation speed (Gear: 01)
Set the spindle rotation speed for maximum motor speed when gear 01 is selected. Set the spindle rotation speed for the S analog output=10V during analog spindle control. ---Setting range--- 0 to 999999 (r/min)		
#3003	slimt3	Limit rotation speed (Gear: 10)
Set the spindle rotation speed for maximum motor speed when gear 10 is selected. Set the spindle rotation speed for the S analog output=10V during analog spindle control. ---Setting range--- 0 to 999999 (r/min)		
#3004	slimt4	Limit rotation speed (Gear: 11)
Set the spindle rotation speed for maximum motor speed when gear 11 is selected. Set the spindle rotation speed for the S analog output=10V during analog spindle control. ---Setting range--- 0 to 999999 (r/min)		
#3005	smax 1	Maximum rotation speed (Gear: 00)
Set the maximum spindle rotation speed which is actually commanded when gear 00 is selected. Set this as smax1(#3005)<= slimt1(#3001). By comparing the S command value and the values of gear 1 - 4, a spindle gear shift command will be output automatically. ---Setting range--- 0 to 999999 (r/min)		
#3006	smax 2	Maximum rotation speed (Gear: 01)
Set the maximum spindle rotation speed which is actually commanded when gear 01 is selected. Set this as smax2(#3006)<= slimt2 (#3002). By comparing the S command value and the values of gear 1 - 4, a spindle gear shift command will be output automatically. ---Setting range--- 0 to 999999 (r/min)		
#3007	smax 3	Maximum rotation speed (Gear: 10)
Set the maximum spindle rotation speed which is actually commanded when gear 10 is selected. Set this as smax3(#3007)<= slimt3 (#3003). By comparing the S command value and the values of gear 1 - 4, a spindle gear shift command will be output automatically. ---Setting range--- 0 to 999999 (r/min)		
#3008	smax 4	Maximum rotation speed (Gear: 11)
Set the maximum spindle rotation speed which is actually commanded when gear 11 is selected. Set this as smax4(#3008)<= slimt4 (#3004). By comparing the S command value and the values of gear 1 - 4, a spindle gear shift command will be output automatically. ---Setting range--- 0 to 999999 (r/min)		

15 Machine Parameters

15.8 Spindle Specification Parameters

#3009	ssift 1	Shift rotation speed (Gear: 00)
		<p>Set the spindle speed for gear shifting with gear 00.</p> <p>(Note) Setting too large value may cause a gear nick when changing gears.</p> <p>---Setting range---</p> <p>0 to 32767 (r/min)</p>
#3010	ssift 2	Shift rotation speed (Gear: 01)
		<p>Set the spindle speed for gear shifting with gear 01.</p> <p>(Note) Setting too large value may cause a gear nick when changing gears.</p> <p>---Setting range---</p> <p>0 to 32767 (r/min)</p>
#3011	ssift 3	Shift rotation speed (Gear: 10)
		<p>Set the spindle speed for gear shifting with gear 10.</p> <p>(Note) Setting too large value may cause a gear nick when changing gears.</p> <p>---Setting range---</p> <p>0 to 32767 (r/min)</p>
#3012	ssift 4	Shift rotation speed (Gear: 11)
		<p>Set the spindle speed for gear shifting with gear 11.</p> <p>(Note) Setting too large value may cause a gear nick when changing gears.</p> <p>---Setting range---</p> <p>0 to 32767 (r/min)</p>
#3013	stap 1	Synchronous tapping 1st step rotation speed (Gear: 00)
		<p>Set the speed which switches from 1st step to 2nd step in synchronous tapping multi-step acceleration/deceleration control when gear 00 is selected.</p> <p>The inclination of linear acceleration/deceleration control for 1st step is determined by the ratio of "stap1" (#3013) to "stapt1" (#3017).</p> <p>When the inclination is not set after 2nd step or it is higher than that of 1st step, the acceleration/deceleration control is executed with the same inclination as the 1st step for the rotation speed of "stap1" or higher.</p> <p>---Setting range---</p> <p>0 to 99999 (r/min)</p>
#3014	stap 2	Synchronous tapping 1st step rotation speed (Gear: 01)
		<p>Set the speed which switches from 1st step to 2nd step in synchronous tapping multi-step acceleration/deceleration control when gear 01 is selected.</p> <p>The inclination of linear acceleration/deceleration control for 1st step is determined by the ratio of "stap2" (#3014) to "stapt2" (#3018).</p> <p>When the inclination is not set after 2nd step or it is higher than that of 1st step, the acceleration/deceleration control is executed with the same inclination as the 1st step for the rotation speed of "stap2" or higher.</p> <p>---Setting range---</p> <p>0 to 99999 (r/min)</p>
#3015	stap 3	Synchronous tapping 1st step rotation speed (Gear: 10)
		<p>Set the speed which switches from 1st step to 2nd step in synchronous tapping multi-step acceleration/deceleration control when gear 10 is selected.</p> <p>The inclination of linear acceleration/deceleration control for 1st step is determined by the ratio of "stap3" (#3015) to "stapt3" (#3019).</p> <p>When the inclination is not set after 2nd step or it is higher than that of 1st step, the acceleration/deceleration control is executed with the same inclination as the 1st step for the rotation speed of "stap3" or higher.</p> <p>---Setting range---</p> <p>0 to 99999 (r/min)</p>


15 Machine Parameters

15.8 Spindle Specification Parameters

#3016	stap 4	Synchronous tapping 1st step rotation speed (Gear: 11)
Set the speed which switches from 1st step to 2nd step in synchronous tapping multi-step acceleration/deceleration control when gear 11 is selected. The inclination of linear acceleration/deceleration control for 1st step is determined by the ratio of "stap4" (#3016) to "stapt4" (#3020). When the inclination is not set after 2nd step or it is higher than that of 1st step, the acceleration/deceleration control is executed with the same inclination as the 1st step for the rotation speed of "stap4" or higher. ---Setting range--- 0 to 99999 (r/min)		
#3017	stapt 1	Synchronous tapping 1st step acceleration/deceleration time constant (Gear: 00)
Set the time constant for synchronous tapping 1st step linear acceleration/deceleration control when gear 00 is selected. (linear acceleration/deceleration pattern) ---Setting range--- 1 to 5000 (ms)		
#3018	stapt 2	Synchronous tapping 1st step acceleration/deceleration time constant (Gear: 01)
Set the time constant for synchronous tapping 1st step linear acceleration/deceleration control when gear 01 is selected. (linear acceleration/deceleration pattern) ---Setting range--- 1 to 5000 (ms)		
#3019	stapt 3	Synchronous tapping 1st step acceleration/deceleration time constant (Gear: 10)
Set the time constant for synchronous tapping 1st step linear acceleration/deceleration control when gear 10 is selected. (linear acceleration/deceleration pattern) ---Setting range--- 1 to 5000 (ms)		
#3020	stapt 4	Synchronous tapping 1st step acceleration/deceleration time constant (Gear: 11)
Set the time constant for synchronous tapping 1st step linear acceleration/deceleration control when gear 11 is selected. (linear acceleration/deceleration pattern) ---Setting range--- 1 to 5000 (ms)		

<Relation of spindle limit rotation speed and spindle maximum rotation speed>

The spindle rotation speed which can be attained at the spindle motor's maximum rotation speed is set for the limit rotation speed (slimt). This value is obtained by multiplying the gear ratio on the spindle motor maximum rotation speed (SP026). Set the maximum rotation speed (smax) when the rotation speed is to be limited according to the machine specifications, such as the spindle gear specifications. Up to four value can be set for gear changeover.

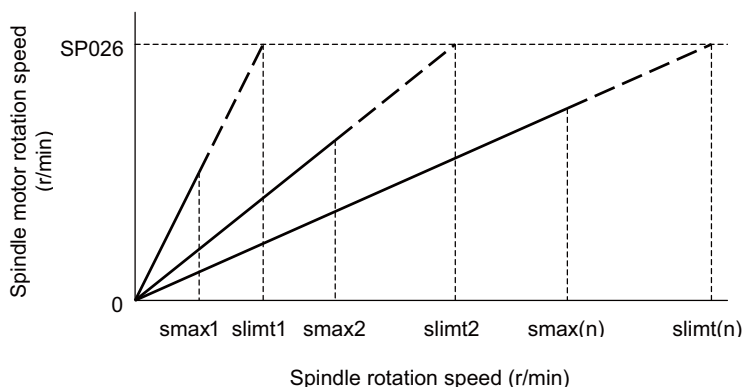


<Synchronous tapping multi-step acceleration/deceleration control parameter>

The acceleration/deceleration control can be set up to three steps in synchronous tapping control to carry out an optimal acceleration/deceleration control in accordance with the spindle motor characteristics whose output torque steps down when exceeding the base rotation speed.

Set the inclination for 2nd step or subsequent steps when the maximum rotation speed exceeds the base rotation speed during synchronous tapping control.

When the inclination is not set after 2nd step or it is higher than that of 1st step, the acceleration/deceleration control is executed with the same inclination as the 1st step for all the rotation speed.

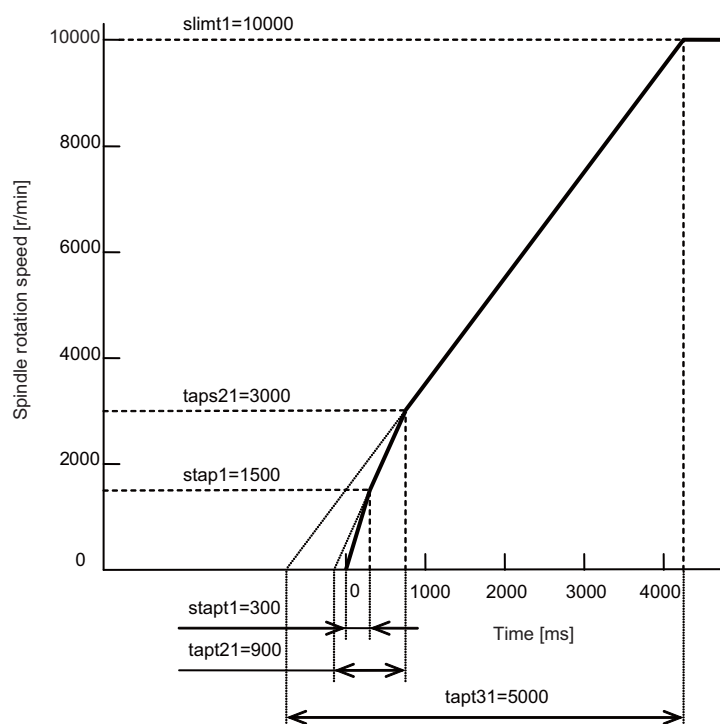


<Spindle synchronization multi-step acceleration/deceleration control parameter>

The acceleration/deceleration control can be set up to eight steps in spindle synchronization control to carry out an optimal acceleration/deceleration control in accordance with the spindle motor characteristics whose output torque steps down when exceeding the base rotation speed and further attenuate in output stepdown zone.

For 2nd step or subsequent steps, the specification allows to set the time constant magnification and changeover rotation speed based on the acceleration/deceleration setting of the 1st step.

Set the value of limit rotation speed or higher as the changeover rotation speed for the step not to be shifted when not carrying out a step shift.

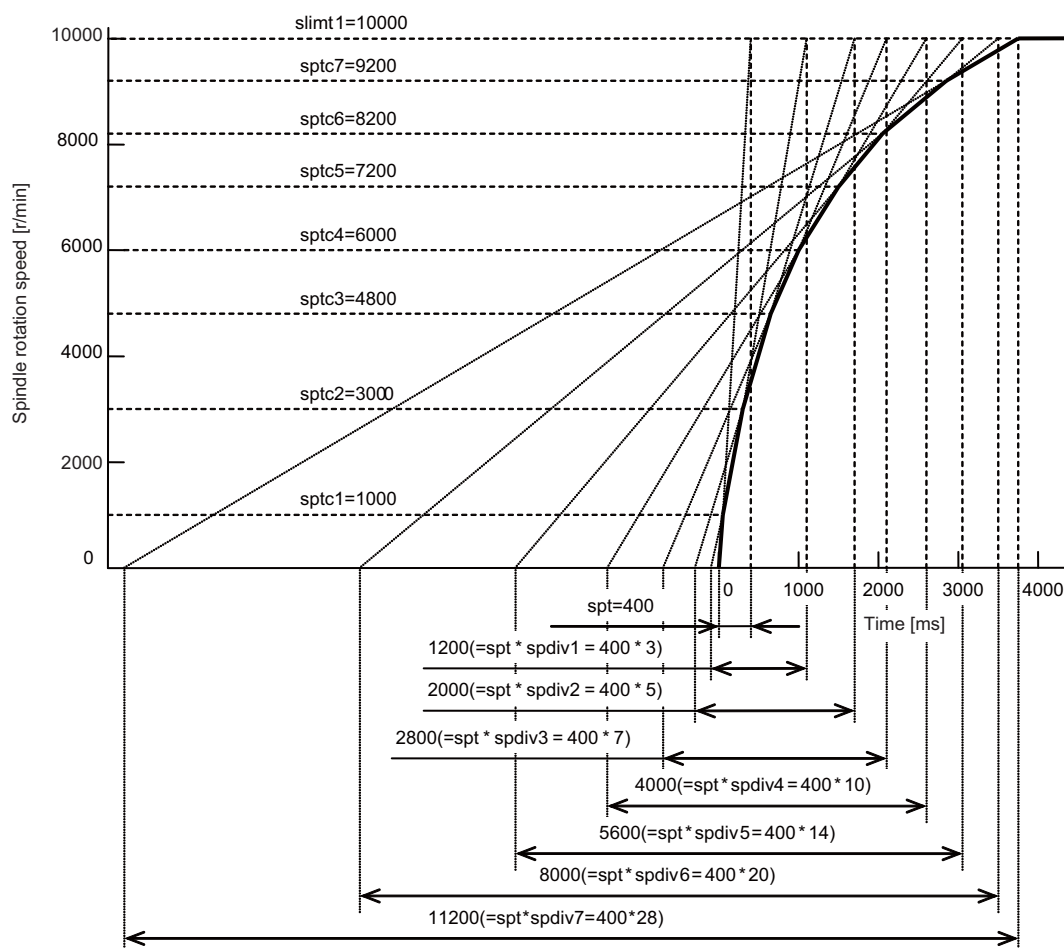


15 Machine Parameters

15.8 Spindle Specification Parameters

#3021		
Not used. Set to "0".		
#3022	sgear	Encoder gear ratio
Set the deceleration rate of the encoder to the spindle when inputting ABZ pulse output encoder feedback to NC during analog spindle control.		
0: 1/1		
1: 1/2		
2: 1/4		
3: 1/8		
---Setting range---		
0 to 3		
#3023	smini	Minimum rotation speed
Set the minimum spindle speed.		
If an S command below this setting is issued, the spindle will rotate at the minimum speed set by this parameter.		
---Setting range---		
0 to 32767 (r/min)		
(PR) #3024	sout	Spindle connection interface
Select the connection interface with the spindle drive unit.		
0: No unit to connect		
1: Digital optical (Mitsubishi spindle drive unit)		
2-5: S-analog (Analog I/F spindle drive unit)		
10: Pulse train (Analog I/F spindle drive unit)		
(PR) #3025	enc-on	Spindle encoder
Set the connection specifications of a spindle's encoder.		
0: Without encoder feedback when using analog spindle and connecting to NC		
1: With encoder feedback when using analog spindle and connecting to NC		
2: Mitsubishi spindle drive unit		
#3026	cs_ori	Selection of winding in orientation mode
Select the coil control in orientation mode for the spindle motor which performs coil changeover.		
0: Perform coil changeover based on the command from NC. (depending on the setting of parameter #1239/bit0)		
1: Use the coil L		
#3027	cs_syn	Selection of winding in spindle synchronization control mode
Select the coil control in spindle synchronization control mode for the spindle motor which performs coil changeover.		
0: Perform coil changeover based on the command from NC. (depending on the setting of parameter #1239/bit0)		
1: Use the coil H		
#3028	sprcmm	Tap cycle M command selection
Set the M codes for the spindle forward run/reverse run commands during tapping cycle.		
High-order 3 digits: Set the M code for spindle forward run command.		
Low-order 3 digits: Set the M code for spindle reverse run command.		
When "0" is set, it is handled assuming that "3004" is set (the M code for spindle forward run command is "3" and the M code for spindle reverse run command is "4").		
---Setting range---		
0 to 999999		

15 Machine Parameters

15.8 Spindle Specification Parameters
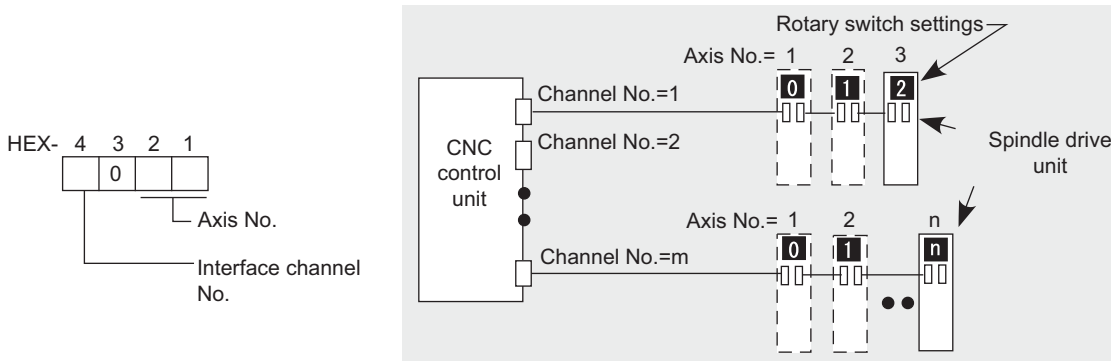
#3029	tapsel	Asynchronous tap gear selection
<p>Select the speed which is compared with S command at gear selection when using asynchronous tapping control with the spindle which performs gear changeover.</p> <p>0: Synchronous tapping 1st step rotation speed (stap)--- Multi-step acceleration/deceleration is not used.</p> <p>1: Maximum speed (smax)--- Multi-step acceleration/deceleration is used.</p> <p>This parameter is enabled only when "#1272 ext08/bit1 is 1".</p>		
#3030	Not used. Set to "0".	
(PR) #3031	smcp_no	Drive unit I/F channel No. (spindle)
<p>Set the interface channel No. of CNC control unit to which the spindle is connected and the axis No. within each channel.</p> <p>Set this parameter in 4-digit hexadecimal format.</p>		
 <p>HEX-4: Drive unit interface channel No.</p> <p>HEX-3: Not used. Set to "0".</p> <p>HEX-2, 1: Axis No.</p> <p>For an analog spindle, set to "0000".</p> <p>---Setting range---</p> <p>0000, 1001 to 1010, 2001 to 2010</p>		
#3032	Not used. Set to "0".	
(PR) #3035	spunit	Output unit
<p>Select the data unit for communication with the spindle drive unit.</p> <p>This selection is applied to the data communicated between the NC and spindle drive unit as well as the spindle movement data. Although the standard setting is B (0.001deg), set the same value as "#1004 ctrl_unit" when using Spindle/C axis control.</p> <p>B: 0.001deg (1μm)</p> <p>C: 0.0001deg (0.1μm)</p> <p>D: 0.00001deg (10nm)</p> <p>E: 0.000001deg (1nm)</p>		
#3037	taps21	Synchronous tapping 2nd step rotation speed (Gear: 00)
<p>Set the speed which switches from 2nd step to 3rd step in synchronous tapping multi-step acceleration/deceleration control when gear 00 is selected.</p> <p>The inclination of linear acceleration/deceleration control for 2nd step is determined by the ratio of "taps21" (#3037) to "tapt21" (#3041).</p> <p>When the inclination is not set for 3rd step or it is higher than that of 2nd step, the acceleration/deceleration control is executed with the same inclination as the 2nd step for the rotation speed of "taps21" or higher.</p> <p>---Setting range---</p> <p>0 to 99999 (r/min)</p>		

15 Machine Parameters

15.8 Spindle Specification Parameters

#3038	taps22	Synchronous tapping 2nd step rotation speed (Gear: 01)
Set the speed which switches from 2nd step to 3rd step in synchronous tapping multi-step acceleration/deceleration control when gear 01 is selected. The inclination of linear acceleration/deceleration control for 2nd step is determined by the ratio of "taps22" (#3038) to "tapt22" (#3042). When the inclination is not set for 3rd step or it is higher than that of 2nd step, the acceleration/deceleration control is executed with the same inclination as the 2nd step for the rotation speed of "taps22" or higher. ---Setting range--- 0 to 99999 (r/min)		
#3039	taps23	Synchronous tapping 2nd step rotation speed (Gear: 10)
Set the speed which switches from 2nd step to 3rd step in synchronous tapping multi-step acceleration/deceleration control when gear 10 is selected. The inclination of linear acceleration/deceleration control for 2nd step is determined by the ratio of "taps23" (#3039) to "tapt23" (#3043). When the inclination is not set for 3rd step or it is higher than that of 2nd step, the acceleration/deceleration control is executed with the same inclination as the 2nd step for the rotation speed of "taps23" or higher. ---Setting range--- 0 to 99999 (r/min)		
#3040	taps24	Synchronous tapping 2nd step rotation speed (Gear: 11)
Set the speed which switches from 2nd step to 3rd step in synchronous tapping multi-step acceleration/deceleration control when gear 11 is selected. The inclination of linear acceleration/deceleration control for 2nd step is determined by the ratio of "taps24" (#3040) to "tapt24" (#3044). When the inclination is not set for 3rd step or it is higher than that of 2nd step, the acceleration/deceleration control is executed with the same inclination as the 2nd step for the rotation speed of "taps24" or higher. ---Setting range--- 0 to 99999 (r/min)		
#3041	tapt21	Synchronous tapping 2nd step acceleration/deceleration time constant (Gear: 00)
Set the time constant for synchronous tapping 2nd step linear acceleration/deceleration control when gear 00 is selected. ---Setting range--- 1 to 5000 (ms)		
#3042	tapt22	Synchronous tapping 2nd step acceleration/deceleration time constant (Gear: 01)
Set the time constant for synchronous tapping 2nd step linear acceleration/deceleration control when gear 01 is selected. ---Setting range--- 1 to 5000 (ms)		
#3043	tapt23	Synchronous tapping 2nd step acceleration/deceleration time constant (Gear: 10)
Set the time constant for synchronous tapping 2nd step linear acceleration/deceleration control when gear 10 is selected. ---Setting range--- 1 to 5000 (ms)		
#3044	tapt24	Synchronous tapping 2nd step acceleration/deceleration time constant (Gear: 11)
Set the time constant for synchronous tapping 2nd step linear acceleration/deceleration control when gear 11 is selected. ---Setting range--- 1 to 5000 (ms)		

15 Machine Parameters

15.8 Spindle Specification Parameters

#3045	tapt31	Synchronous tapping 3rd step acceleration/deceleration time constant (Gear: 00)
<p>Set the time constant for synchronous tapping 3rd step linear acceleration/deceleration control when gear 00 is selected.</p> <p>The inclination of linear acceleration/deceleration control for 3rd step is determined by the ratio of slimt1(#3001) to tapt31(#3045).</p> <p>---Setting range---</p> <p>1 to 5000 (ms)</p>		
#3046	tapt32	Synchronous tapping 3rd step acceleration/deceleration time constant (Gear: 01)
<p>Set the time constant for synchronous tapping 3rd step linear acceleration/deceleration control when gear 01 is selected.</p> <p>The inclination of linear acceleration/deceleration control for 3rd step is determined by the ratio of slimt2(#3002) to tapt32 (#3046).</p> <p>---Setting range---</p> <p>1 to 5000 (ms)</p>		
#3047	tapt33	Synchronous tapping 3rd step acceleration/deceleration time constant (Gear: 10)
<p>Set the time constant for synchronous tapping 3rd step linear acceleration/deceleration control when gear 10 is selected.</p> <p>The inclination of linear acceleration/deceleration control for 3rd step is determined by the ratio of slimt3(#3003) to tapt33(#3047).</p> <p>---Setting range---</p> <p>1 to 5000 (ms)</p>		
#3048	tapt34	Synchronous tapping 3rd step acceleration/deceleration time constant (Gear: 11)
<p>Set the time constant for synchronous tapping 3rd step linear acceleration/deceleration control when gear 11 is selected.</p> <p>The inclination of linear acceleration/deceleration control for 3rd step is determined by the ratio of slimt4(#3004) to tapt34(#3048).</p> <p>---Setting range---</p> <p>1 to 5000(ms)</p>		
#3049	spt	Spindle synchronization acceleration/deceleration time constant
<p>Set the acceleration/deceleration time constant under spindle synchronization control.</p> <p>The inclination of acceleration/deceleration control is determined by the ratio to limit rotation speed (slimt). Set the same value for the reference axis and synchronized axis.</p> <p>The time constant for 2nd step or subsequent steps is the magnification setting on the basis of this setting value.</p> <p>---Setting range---</p> <p>0 to 9999 (ms)</p>		
#3050	sprlv	Spindle synchronization rotation speed attainment level
<p>Set the level of speed difference between the reference and synchronized spindles during spindle synchronization control. Setting of the synchronized spindle side is enabled. When the difference becomes below the setting level, the spindle speed synchronization complete signal will turn ON.</p> <p>---Setting range---</p> <p>0 to 4095 (pulse) (1 pulse = 0.088°)</p>		
#3051	spplv	Spindle phase synchronization attainment level
<p>Set the level of phase difference between the reference and synchronized spindles during spindle synchronization. Setting of the synchronized spindle side is enabled. When the difference becomes below the setting level, the spindle phase synchronization complete signal will go ON.</p> <p>---Setting range---</p> <p>0 to 4095 (pulse) (1 pulse = 0.088°)</p>		

15 Machine Parameters

15.8 Spindle Specification Parameters

#3052	splr	Spindle synchronization relative polarity
		<p>Set the polarity to match the rotation direction between the spindles which perform synchronization control under spindle synchronization control.</p> <p>0: Positive polarity (Spindle CW rotation at motor CW rotation)</p> <p>1: Negative polarity (Spindle CCW rotation at motor CW rotation)</p> <p>---Setting range---</p> <p>0000/0001 (HEX)</p>
#3053	sppst	Spindle encoder Z -phase position
		<p>Set the deviation amount from the spindle's basic point to the spindle encoder's Z phase.</p> <p>Obtain the deviation amount, considering a clockwise direction as positive when viewed from the spindle's front side.</p> <p>---Setting range---</p> <p>0 to 359999 (1/1000°)</p>
#3054	sptc1	Spindle synchronization multi-step acceleration/deceleration changeover speed 1
		<p>Set the speed which switches from 1st step to 2nd step in spindle synchronization multi-step acceleration/deceleration control.</p> <p>Set the same value for the reference axis and synchronized axis.</p> <p>Set the value of limit rotation speed (slimt) or higher not to carry out a step shift.</p> <p>---Setting range---</p> <p>0 to 99999 (r/min)</p>
#3055	sptc2	Spindle synchronization multi-step acceleration/deceleration changeover speed 2
		<p>Set the speed which switches from 2nd step to 3rd step in spindle synchronization multi-step acceleration/deceleration control.</p> <p>Set the same value for the reference axis and synchronized axis.</p> <p>Set the value of limit rotation speed (slimt) or higher not to carry out a step shift.</p> <p>---Setting range---</p> <p>0 to 99999 (r/min)</p>
#3056	sptc3	Spindle synchronization multi-step acceleration/deceleration changeover speed 3
		<p>Set the speed which switches from 3rd step to 4th step in spindle synchronization multi-step acceleration/deceleration control.</p> <p>Set the same value for the reference axis and synchronized axis.</p> <p>Set the value of limit rotation speed (slimt) or higher not to carry out a step shift.</p> <p>---Setting range---</p> <p>0 to 99999 (r/min)</p>
#3057	sptc4	Spindle synchronization multi-step acceleration/deceleration changeover speed 4
		<p>Set the speed which switches from 4th step to 5th step in spindle synchronization multi-step acceleration/deceleration control.</p> <p>Set the same value for the reference axis and synchronized axis.</p> <p>Set the value of limit rotation speed (slimt) or higher not to carry out a step shift.</p> <p>---Setting range---</p> <p>0 to 99999 (r/min)</p>
#3058	sptc5	Spindle synchronization multi-step acceleration/deceleration changeover speed 5
		<p>Set the speed which switches from 5th step to 6th step in spindle synchronization multi-step acceleration/deceleration control.</p> <p>Set the same value for the reference axis and synchronized axis.</p> <p>Set the value of limit rotation speed (slimt) or higher not to carry out a step shift.</p> <p>---Setting range---</p> <p>0 to 99999 (r/min)</p>

15 Machine Parameters

15.8 Spindle Specification Parameters

#3059	sptc6	Spindle synchronization multi-step acceleration/deceleration changeover speed 6
Set the speed which switches from 6th step to 7th step in spindle synchronization multi-step acceleration/deceleration control. Set the same value for the reference axis and synchronized axis. Set the value of limit rotation speed (slimt) or higher not to carry out a step shift. ---Setting range--- 0 to 99999 (r/min)		
#3060	sptc7	Spindle synchronization multi-step acceleration/deceleration changeover speed 7
Set the speed which switches from 7th step to 8th step in spindle synchronization multi-step acceleration/deceleration control. Set the same value for the reference axis and synchronized axis. Set the value of limit rotation speed (slimt) or higher not to carry out a step shift. ---Setting range--- 0 to 99999 (r/min)		
#3061	sptdiv1	Time constant magnification for changeover speed 1
Set the acceleration/deceleration time constant to be used at the speed of changeover speed 1 (sptc1) and higher in spindle synchronization multi-step acceleration/deceleration control. Set this as a magnification in relation to the spindle synchronization acceleration/deceleration time constant (spt). ---Setting range--- 0 to 127		
#3062	sptdiv2	Time constant magnification for changeover speed 2
Set the acceleration/deceleration time constant to be used at the speed of changeover speed 2 (sptc2) and higher in spindle synchronization multi-step acceleration/deceleration control. Set this as a magnification in relation to the spindle synchronization acceleration/deceleration time constant (spt). ---Setting range--- 0 to 127		
#3063	sptdiv3	Time constant magnification for changeover speed 3
Set the acceleration/deceleration time constant to be used at the speed of changeover speed 3 (sptc3) and higher in spindle synchronization multi-step acceleration/deceleration control. Set this as a magnification in relation to the spindle synchronization acceleration/deceleration time constant (spt). ---Setting range--- 0 to 127		
#3064	sptdiv4	Time constant magnification for changeover speed 4
Set the acceleration/deceleration time constant to be used at the speed of changeover speed 4 (sptc4) and higher in spindle synchronization multi-step acceleration/deceleration control. Set this as a magnification in relation to the spindle synchronization acceleration/deceleration time constant (spt). ---Setting range--- 0 to 127		
#3065	sptdiv5	Time constant magnification for changeover speed 5
Set the acceleration/deceleration time constant to be used at the speed of changeover speed 5 (sptc5) and higher in spindle synchronization multi-step acceleration/deceleration control. Set this as a magnification in relation to the spindle synchronization acceleration/deceleration time constant (spt). ---Setting range--- 0 to 127		
#3066	sptdiv6	Time constant magnification for changeover speed 6
Set the acceleration/deceleration time constant to be used at the speed of changeover speed 6 (sptc6) and higher in spindle synchronization multi-step acceleration/deceleration control. Set this as a magnification in relation to the spindle synchronization acceleration/deceleration time constant (spt). ---Setting range--- 0 to 127		

15 Machine Parameters

15.8 Spindle Specification Parameters

	#3067	spdiv7	Time constant magnification for changeover speed 7
			<p>Set the acceleration/deceleration time constant to be used at the speed of changeover speed 7 (sptc7) and higher in spindle synchronization multi-step acceleration/deceleration control. Set this as a magnification in relation to the spindle synchronization acceleration/deceleration time constant (spt).</p> <p>---Setting range---</p> <p>0 to 127</p>
	#3068	symtm1	Phase synchronization start confirmation time
			<p>Set the time to confirm that synchronization is attained before spindle phase synchronization control is started.</p> <p>When "0" is set, the time will be 2000ms. When "100" or less is set, the time will be 100ms.</p> <p>---Setting range---</p> <p>0 to 9999 (ms)</p>
	#3069	symtm2	Phase synchronization end confirmation time
			<p>Set a period of waiting time for spindle phase synchronization control's completion as a time in which the speed stays within the attainment range.</p> <p>When "0" is set, the time will be 500ms. When "100" or less is set, the time will be 100ms.</p> <p>---Setting range---</p> <p>0 to 9999(ms)</p>
	#3070	syprt	Phase synchronization alignment speed
			<p>Set the amount of speed fluctuation of synchronized spindle during spindle phase synchronization control. Set this as a proportion to commanded speed.</p> <p>When "0" is set, the amount will be 5%.</p> <p>---Setting range---</p> <p>0 to 100 (%)</p>
(PR)	#3071	SscDrSelSp	Speed monitor Door selection
			<p>Select which door group of the speed monitoring a spindle belongs to.</p> <p>0000: Belong to the door 1 group.</p> <p>0001: Belong to the door 1 group.</p> <p>0002: Belong to the door 2 group.</p> <p>0003: Belong to the door 1 and 2 groups.</p> <p>(Note) Speed monitoring function is validated when "SP229/bitF=1".</p> <p>---Setting range---</p> <p>0000 to 0003 (HEX)</p>
(PR)	#3072	Ssc Svof Filter Sp	Speed monitor Error detection time during servo OFF
			<p>Set the error detection time for when an error of command speed monitoring or feedback speed monitoring is detected during servo OFF.</p> <p>The alarm will occur if actual speed exceeds safe speed or safe rotation speed for a period of time longer than this setting.</p> <p>When "0" is set, the detection time will be 200 (ms).</p> <p>(Note) Speed monitoring function is validated when "SP229/bitF=1".</p> <p>---Setting range---</p> <p>0 to 9999(ms)</p>
	#3074	GBsp	Guide bushing spindle synchronization control
			<p>Set the reference spindle and G/B spindle.</p> <p>1: Reference spindle</p> <p>2: Guide bushing spindle</p> <p>0: Other</p>

15 Machine Parameters

15.8 Spindle Specification Parameters

(PR)	#3077	Sname	Spindle command name
		Specify a spindle name to be used for giving a spindle command. When spindle command name has been set for all the spindles, the spindle name type is used. If "0" is set to any spindle, the spindle No. type is selected. (Note) Do not set an identical name to two or more of all the spindles. ---Setting range--- 0 to 9	
#3101	sp_t 1	Acceleration/deceleration time constant with S command (Gear: 00)	
		Set the acceleration/deceleration time constant with S command (speed operation mode) when gear 00 is selected. Set the linear acceleration/deceleration time up to limit rotation speed (slimt1). Set the short time constant that the motor torque at acceleration is always saturated, however, when an abnormal noise or V-belt slip occurs, increase the time constant. ---Setting range--- 0 to 30000(ms)	
#3102	sp_t 2	Acceleration/deceleration time constant with S command (Gear: 01)	
		Set the acceleration/deceleration time constant with S command (speed operation mode) when gear 01 is selected. Set the linear acceleration/deceleration time up to limit rotation speed (slimt2). Set the short time constant that the motor torque at acceleration is always saturated, however, when an abnormal noise or V-belt slip occurs, increase the time constant. ---Setting range--- 0 to 30000 (ms)	
#3103	sp_t 3	Acceleration/deceleration time constant with S command (Gear: 10)	
		Set the acceleration/deceleration time constant with S command (speed operation mode) when gear 10 is selected. Set the linear acceleration/deceleration time up to limit rotation speed (slimt3). Set the short time constant that the motor torque at acceleration is always saturated, however, when an abnormal noise or V-belt slip occurs, increase the time constant. ---Setting range--- 0 to 30000 (ms)	
#3104	sp_t 4	Acceleration/deceleration time constant with S command (Gear: 11)	
		Set the acceleration/deceleration time constant with S command (speed operation mode) when gear 11 is selected. Set the linear acceleration/deceleration time up to limit rotation speed (slimt4). Set the short time constant that the motor torque at acceleration is always saturated, however, when an abnormal noise or V-belt slip occurs, increase the time constant. ---Setting range--- 0 to 30000 (ms)	
#3105	sut	Speed reach range	
		Set the speed deviation rate with respect to the commanded speed, at which the speed reach signal will be output. It will be 15% when set to "0". If the speed deviation is smaller than 45r/min, it will be set as 45r/min. ---Setting range--- 0 to 100 (%)	

15 Machine Parameters

15.8 Spindle Specification Parameters

#3106	zrn_typ	Zero point return specifications
<p>Select the zero point return specification.</p> <p>Functions are allocated to each bit.</p> <p>Set this in hexadecimal format.</p>		
Bit-	F E D C B A 9 8 7 6 5 4 3 2 1 0	

bitF: Spindle zero point detection with proximity switch

- 0: Normal
- 1: Enable spindle zero point detection using proximity switch

bitE: Interpolation mode selection 2 (Return to zero when stopping)

- 0: Interpolation mode (Follow the setting of "#1256 set28/bit1")
- 1: Non-interpolation mode (Use "#13001 SP001 PGV")

bitD: Interpolation mode selection 1 (Return to zero when rotating)

- 0: Non-interpolation mode
- 1: Interpolation mode

bitC: Z phase detection method

- 0: Follows Z phase detection direction (bit0).
- 1: Rotates in the commanded direction at Z phase detection speed to detect Z phase.

(*) To enable Z phase detection operation, set the parameter "#3106 zrn_typ/bit3" (Z phase detection operation ON) to "1".

bitB: Direction of zero point return initiated during spindle rotation

- 0: Follow the setting of zero point return direction
 - Follow the direction setting of orientation (bit2-1)
 - Follow the setting of synch tap zero return (bit6-5)
 - Follow the setting of spindle C axis zero return (bitA-9)
- 1: Follow the spindle rotation direction

bitA-9: Spindle/C axis zero point return direction

bitA,9=

- 00: Short-cut
- 01: Forward run
- 10: Reverse run

15 Machine Parameters

15.8 Spindle Specification Parameters

bit8: Spindle/C axis zero point return

- 0: Zero point return type
- 1: Deceleration stop type (standard setting)

(*) For Program command method, when "#1711 cfg11/bit3" is set to "0" (Zero point return type), Zero point return type is forcibly set.

bit7: Synchronous tapping command polarity

- 0: Forward direction
- 1: Reverse direction (The standard setting when spindle and motor are directly coupled)

bit6-5: Synchronous tapping zero point return direction

bit6,5=

- 00: Short-cut
- 01: Forward run
- 10: Reverse run

bit4: Synchronous tapping zero point return

- 0: Automatically return to zero point before synchronous tapping is started (tapping phase alignment)
- 1: Not return to zero point and immediately synchronous tapping is started

bit3: Z phase detection operation ON

- 0: When Z phase is not detected, detect Z phase during the rotation executed by a rotation command without performing the detection operation.
- 1: When Z phase is not detected, perform the detection operation according to the settings of bitC and bit0, and then rotate the motor according to a rotation command.

bit2-1: Orientation direction

bit2,1=

- 00: Short-cut
- 01: Forward run
- 10: Reverse run

bit0: Z phase detection direction

- 0: Forward direction
- 1: Reverse direction

#3107	ori_spd	Orientation command speed
	<p>Set the spindle speed during orientation command.</p> <p>When the spindle is not running or running to the different direction with the orientation, the orientation is carried out with this speed after a stop. When the spindle is running to the same direction with the orientation, this parameter does not have a meaning because it decelerates directly and the orientation is carried out.</p> <p>---Setting range---</p> <p>1 to 99999 (r/min)</p>	
#3108	ori_sft	Position shift amount for orientation
	<p>The orientation stop position can be moved by this parameter setting although normally the position is Z-phase position.</p> <p>During multi-point orientation control, the stop position is determined by the total value of this parameter and the position data for multi-point orientation of PLC input.</p> <p>---Setting range---</p> <p>-35999 to 35999 (0.01°)</p>	

15 Machine Parameters

15.8 Spindle Specification Parameters

#3109	zdetspd	Z phase detection speed
	<p>For the first S command after power is turned ON, the spindle rotates at the speed of setting value for this parameter until Z phase is detected twice.</p> <p>When "#3106/bitF = 1" (Spindle zero point proximity switch detection enabled), also proximity switch is detected.</p> <p>(Note) When spindle zero point proximity switch detection is enabled, the rotation direction of the orientation/zero point return (synchronous tapping, spindle/C axis) will follow Z phase detection direction. And the speed will follow Z phase detection speed.</p> <p>---Setting range---</p> <p>1 to 99999 (r/min)</p>	
#3110	tap_spd	Synchronous tapping zero point return speed
	<p>Set the zero point return speed during synchronous tapping control.</p> <p>---Setting range---</p> <p>1 to 99999 (r/min)</p>	
#3111	tap_sft	Synchronous tapping zero point return shift amount
	<p>Set the zero point return shift amount during synchronous tapping control. Zero point angle shifts from Z phase according to the setting angle.</p> <p>---Setting range---</p> <p>0 to 35999 (0.01°)</p>	
#3112	cax_spd	Spindle C axis zero point return speed
	<p>Set the zero point return speed during spindle C axis control.</p> <p>---Setting range---</p> <p>1 to 99999 (r/min)</p>	
#3113	cax_sft	Spindle C axis zero point return shift amount
	<p>Set the spindle C axis zero point return shift amount. Zero point angle shifts from Z phase according to the setting angle.</p> <p>---Setting range---</p> <p>0 to 359999 (0.001°)</p>	
#3114	cax_para_chg	Spindle/C axis parameter switch
	<p>Parameter switches when switching the encoder system between normal spindle control and C axis control, such as using spindle side encoder only for C axis control in spindle drive system. It is validated with replacing a certain servo parameter of the corresponding servo axis to a spindle parameter.</p> <p>0: Not switch</p> <p>1: Switch</p> <p>---Setting range---</p> <p>0/1 (Standard: 0)</p>	
#3115	sp2_t1	Time constant in orientation/interpolation mode automatic reference position return (Gear: 00)
	<p>Set the linear acceleration/deceleration time constant for zero point return control (#3106/bit4,8) which is automatically started at the time of switching orientation control, C axis control and synchronous tapping control when gear 00 is selected. The inclination is determined by the ratio to limit rotation speed (slimt1). Set the sufficiently large value compared to the acceleration/deceleration time constant with S command (sp_t1) so that the output torque is not saturated. When executing C axis zero point return manually, it depends on the axis specification parameter.</p> <p>---Setting range---</p> <p>0 to 30000 (ms)</p>	

15 Machine Parameters

15.8 Spindle Specification Parameters

#3116	sp2_t2	Time constant in orientation/interpolation mode automatic reference position return (Gear: 01)
<p>Set the linear acceleration/deceleration time constant for zero point return control (#3106/bit4,8) which is automatically started at the time of switching orientation control, C axis control and synchronous tapping control when gear 01 is selected. The inclination is determined by the ratio to limit rotation speed (slimt2). Set the sufficiently large value compared to the acceleration/deceleration time constant with S command (sp_t2) so that the output torque is not saturated. When executing C axis zero point return manually, it depends on the axis specification parameter.</p> <p>---Setting range---</p> <p>0 to 30000 (ms)</p>		
#3117	sp2_t3	Time constant in orientation/interpolation mode automatic reference position return (Gear: 10)
<p>Set the linear acceleration/deceleration time constant for zero point return control (#3106/bit4,8) which is automatically started at the time of switching orientation control, C axis control and synchronous tapping control when gear 10 is selected. The inclination is determined by the ratio to limit rotation speed (slimt3). Set the sufficiently large value compared to the acceleration/deceleration time constant with S command (sp_t3) so that the output torque is not saturated. When executing C axis zero point return manually, it depends on the axis specification parameter.</p> <p>---Setting range---</p> <p>0 to 30000 (ms)</p>		
#3118	sp2_t4	Time constant in orientation/interpolation mode automatic reference position return (Gear: 11)
<p>Set the linear acceleration/deceleration time constant for zero point return control (#3106/bit4,8) which is automatically started at the time of switching orientation control, C axis control and synchronous tapping control when gear 11 is selected. The inclination is determined by the ratio to limit rotation speed (slimt4). Set the sufficiently large value compared to the acceleration/deceleration time constant with S command (sp_t4) so that the output torque is not saturated. When executing C axis zero point return manually, it depends on the axis specification parameter.</p> <p>---Setting range---</p> <p>0 to 30000 (ms)</p>		
#3120	staptr	Time constant reduction rate in high-speed synchronous tapping
<p>When performing high-speed synchronous tapping control(#1281/bit5), set the reduction rate of the time constant compared to the time constant in normal synchronous tapping.</p> <p>(Setting "0" or "100" will be regarded as reduction rate zero, so the time constant won't be reduced.)</p> <p>E.g.) When set to "10", time constant in high-speed synchronous tapping will be 90% of that in normal synchronous tapping.</p> <p>---Setting range---</p> <p>0 to 100 (%)</p>		
#3121	tret	Turret indexing
<p>Select the validity of turret indexing.</p> <p>0: Disabled</p> <p>1: Enable</p>		
#3122	GRC	Turret side gear ratio
<p>Set the number of teeth on the turret side when the gear selection command (control input 4/bit6, 5) is set to 00. Set a value of GRC so that the ratio of GRC to the spindle side gear ratio (#13057 SP057) will be 1: N (an integer). If GRC is set to "0", it will be regarded as "1".</p> <p>---Setting range---</p> <p>0 to 32767</p>		
#3123	tret_spd	Turret indexing speed
<p>Set the turret end indexing speed when in turret indexing.</p> <p>When this parameter is set to 0, it follows the value set for Orientation command speed (#3107).</p> <p>---Setting range---</p> <p>0 to 32767(r/min)</p>		

15 Machine Parameters

15.8 Spindle Specification Parameters

#3124	tret_t	Turret indexing time constant
	Set the acceleration/deceleration time constant to reach Limit rotation speed (slimt1) at gear 00 when in turret indexing. Set this parameter to a larger value than time constant in orientation (#3115).	
	---Setting range---	
	0 to 30000 (ms)	
#3125	tret_inpos	Turret indexing in-position width
	Set the position error range in which the index positioning complete signal is output when in turret indexing. When this parameter is set to 0, the value of In-position width (#13024 SP024) will be used for this width.	
	---Setting range---	
	0 to 32767(1°/1000)	
#3126	tret_fin_off	Index positioning complete signal OFF time
	Set the time to forcibly turn OFF the index positioning complete signal since the indexing start signal turns ON. If this period of time has not passed yet, the index positioning complete signal will not turn ON even at the completion of index positioning.	
	---Setting range---	
	0 to 10000 (ms)	
#3127	SPECSP	Spindle specification
	bit0: Select the gear changeover method.	
	0: Gear change type 1 (When the spindle stop signal is ON and the selected gear differs from the recommended gear of NC side, the gear changeover is performed.)	
	1: Gear change type 2 (When the spindle stop signal is ON and the spindle gear shift signal is ON, the gear changeover is performed.)	
	bit1: Spindle cycle counter direction	
	Select whether to count up or down the cycle counter when the spindle turns forward.	
	0: Count up in forward run	
	1: Count down in forward run	
	bit3: Spindle rotation direction	
	Define the relationship between the motor's actual direction of rotation and the spindle rotation signals (Spindle forward run start/Spindle reverse run start).	
	0: Forward	
	1: Reverse	
	bit4: Change the timing of thread cutting start	
	0: Start thread cutting after receiving the Z-phase signal from the encoder.	
	1: Start thread cutting after receiving an external signal.	
	---Setting range---	
	0x0000 to 0xffff (hexadecimal)	
#3128	ori_spec	Orientation control specification
	bit0: Orientation in-position advance output	
	Reduce the orientation time by detecting an in-position faster.	
	The in-position detection width is changed from SP024(#13024) to ori_inp2.	
	0: Disable	
	1: Enable	
	bit1: High-speed proximity-switch orientation	
	Select whether to enable high-speed proximity-switch orientation.	
	This orientation can be used when Proximity-switch spindle zero point detection (#3106 zrn_typ/bitF) is enabled.	
	0: Disable high-speed	
	1: Enable high-speed	
	---Setting range---	
	0x0000 to 0xffff (hexadecimal)	

15 Machine Parameters

15.8 Spindle Specification Parameters

#3129	cax_spec	Spindle/C axis control specification
bit0: Spindle position control changeover method		
Select the method of changing the mode between C axis and spindle.		
0: PLC signal method		
1: Program command method		
bit1: Coordinate system setting when the deceleration stop type (no zero point return) is selected		
Select the C axis coordinate system setting method when the deceleration stop type (no zero point return) is selected.		
0: Establish the coordinates of the deceleration stop position by using the Z-phase position as the coordinate zero point.		
1: The deceleration stop position is used as the coordinate zero point.		
bit2: Mode selection at Power ON when the program command method is selected		
0: Spindle mode		
1: C axis mode		
This parameter is enabled when the program command method is selected (#3129 cax_spec/bit0 = 1).		
bit3: Mode selection at reset when the program command method is selected		
0: Spindle mode		
1: The mode at reset is retained.		
This parameter is enabled when the program command method is selected (#3129 cax_spec/bit0 = 1).		
bit4: Gain switchover for all the axes within the part system when C axis is selected		
0: The gains of servo axes except C axis are not switched when C axis is selected.		
1: The gains of servo axes except C axis are switched when C axis is selected.		
#2203 (PGN1) SV003 --> #2249 (PGN1sp) SV049		
#2204 (PGN2) SV004 --> #2250 (PGN2sp) SV050		
#2257 (SHGC) SV057 --> #2258 (SHGCsp) SV058		
bit5: Retention of coordinate system setting offset at switchover to C axis mode		
Select whether to retain the offset for the coordinate system setting(G92/G50) or local coordinate system setting (G52) when the control is switched to C axis mode.		
0: Not retain the offset for coordinate system setting		
1: Retain the offset for coordinate system setting		
---Setting range---		
0x0000 to 0xffff (hexadecimal)		

15 Machine Parameters

15.8 Spindle Specification Parameters

#3130	syn_spec	Spindle synchronization control specification
bit0: Tool spindle synchronization II (hobbing) automatic compensation selection		
0: No compensation.		
1: Compensate hobbing axis delay (advance) with workpiece axis.		
bit1: Phase alignment method selection		
0: Phase alignment method type 1 (step alignment method)		
1: Phase alignment method type 2 (multi-step acceleration/deceleration method)		
(*) Set this parameter for the synchronized spindle.		
bit2: Error compensation between reference and synchronized spindles		
0: Error compensation is performed.		
1: Error compensation is not performed.		
(*) Set this parameter for the synchronized spindle.		
bit3: Tool spindle synch II (hob): phase alignment when shift value is omitted;		
0: Not perform phase alignment		
1: Perform phase alignment		
bit6: Phase alignment position selection (hobbing)		
0: Feedback position		
1: Command position		
bit7: Multi-step acceleration/deceleration in hobbing mode		
0: Perform multi-step acceleration/deceleration based on the hobbing axis		
1: Perform multi-step acceleration/deceleration based on the workpiece axis		
---Setting range---		
0x0000 to 0xffff (hexadecimal)		
#3131	tap_spec	Synchronous tapping control specification
bitF: Analog spindle encoder polarity		
This parameter specifies the polarity of the encoder with respect to the spindle rotation.		
0: Forward		
1: Reverse		
---Setting range---		
0x0000 to 0xffff (hexadecimal)		
#3132	ori_inp2	2nd in-position width for orientation
Set the in-position width when in-position advance output control (#3128/bit0) is valid. Reduce the orientation time by setting a bigger value than the value of conventional SP024 and detecting an in-position faster.		
Conventional SP024 is used for 2nd in-position signal detection width.		
---Setting range---		
0 to 32767 (1deg/1000)		
#3133	spherr	Hobbing axis delay (advance) allowable angle
Set the allowable angle between the commanded position and actual position of hobbing axis when it is in tool spindle synchronization II (hobbing) mode (X18AE ON), and also when hobbing axis and workpiece axis are synchronizing (X18A9 ON).		
---Setting range---		
0 to 32767 (1deg/1000)		
#3134	sphtc	Primary delay time constant for hobbing axis automatic compensation
Set the primary delay time constant of hobbing axis automatic compensation primary delay filter control in tool spindle synchronization II (hobbing).		
When set to "0", primary delay filter control is invalid.		
---Setting range---		
0 to 32767 (ms)		

15 Machine Parameters

15.8 Spindle Specification Parameters

	#3135	sfdw_g	Feed forward gain for hobbing axis
	Set the feed forward gain for the hobbing axis in tool spindle synchronization II (hobbing) mode.		
	---Setting range---		
	0 to 200 (%)		
	#3136	ptaptr	Reduction rate of time constant for high-speed Punch Tap cycle
	Specify the rate of reduction for the time constant of Punch Tap cycle to be applied when Punch Tap cycle is executed with the high-speed synchronized tap being enabled (#1281 ext17/bit5 = 1).		
	When "0" or "100" is set, the reduction rate will be interpreted as "0" and the time constant will not be reduced.		
	(Example) When "10" is set, the time constant for normal Punch Tap cycle will be reduced to 90%.		
	---Setting range---		
	0 to 100 (%)		
	#3137	stap_ax_off	High-speed synchronous tapping disabled axis
	Not used. Set to "0".		
	#3138	motor_type	Spindle motor type
	Set the spindle motor type. The set type will be displayed on the drive monitor screen, and it will be also output to the system configuration data.		
	---Setting range---		
	Character string within 26 characters including A-Z, a-z, 0-9, "." (decimal point), "-" (hyphen), "/" (slash) (Setting is cleared when "0" is set)		
(PR)	#3139	sp_srvdrv	Spindle-mode servo control
	Select whether to enable spindle control using a servo drive unit and servo motor (spindle-mode servo control).		
	0: Disable spindle-mode servo control		
	1: Enable spindle-mode servo control		
(PR)	#3140	S_DINSp	Speed observation input door No.
	Set the door signal input in the drive unit.		
	Use this parameter only when the axis with a door signal belongs to several door groups.		
	The correspondence between the door signals and bits are as follows.		
	bit0: Door1 signal		
	bit1: Door2 signal		
	If the axis does not receive any door signal, set to "0".		
	An error (Y20 0027) will occur in the following cases.		
	- Several bits are enabled.		
	- Any bit other than those set in "#3071 S_DSISp" is enabled.		
	---Setting range---		
	0000 to 0002 (HEX)		
(PR)	#3141	spsscfeed1	Observation speed 1
	Set the observation speed, which is at the machine end, in the multi-step speed monitor.		
	(Note) When the setting value is larger than 18000, the last 2 digits will be ignored.		
	E.g.: 1234567 -> 1234500 (deg/min)		
	---Setting range---		
	0 to 6553500 (deg/min)		
(PR)	#3142	spsscfeed2	Observation speed 2
	Set the observation speed, which is at the machine end, in the multi-step speed monitor.		
	(Note) When the setting value is larger than 18000, the last 2 digits will be ignored.		
	E.g.: 1234567 -> 1234500 (deg/min)		
	---Setting range---		
	0 to 6553500 (deg/min)		

15 Machine Parameters

15.8 Spindle Specification Parameters

(PR)	#3143	spsscfeed3	Observation speed 3
			Set the observation speed, which is at the machine end, in the multi-step speed monitor.
			(Note) When the setting value is larger than 18000, the last 2 digits will be ignored. E.g.: 1234567 -> 1234500 (deg/min)
			---Setting range--- 0 to 6553500 (deg/min)
(PR)	#3144	spsscfeed4	Observation speed 4
			Set the observation speed, which is at the machine end, in the multi-step speed monitor.
			(Note) When the setting value is larger than 18000, the last 2 digits will be ignored. E.g.: 1234567 -> 1234500 (deg/min)
			---Setting range--- 0 to 6553500 (deg/min)
(PR)	#3145	S_SigInSP	Safety observation signal input
			This parameter specifies which observation speed change signal is input in the drive unit. The observation speed change signal corresponds to the following bits of the parameter. bit0: Observation speed change signal 1 is connected. bit1: Observation speed change signal 2 is connected. bit2: Observation speed change signal 3 is connected. If the axis receives no observation speed change signal, set to "0000". (Note) When a same setting value is set to more than one axis, or when more than one bit is set to turn ON for one axis, the alarm (Y20 0027) will occur.
			---Setting range--- 0000 to 0004 (HEX)
	#3146	RatedOutL(PwrCal)	Short-time rated output for power computation (L-coil)
			Specify the short-time rated output of the spindle motor (for L-coil). This value is used for calculating the power consumption of the spindle motor.
			---Setting range--- 0 to 99999999 (W)
	#3147	RatedOutH(PwrCal)	Short-time rated output for power computation (H-coil)
			Specify the short-time rated output of the spindle motor (for H-coil). This value is used for calculating the power consumption of the spindle motor. This parameter is used also when the coil switch function is OFF.
			---Setting range--- 0 to 99999999 (W)
	#3148	syncpctm	Temporary error cancel calculation delay time
			When a period of time set in this parameter has elapsed after turning-ON of the spindle chuck close (SPC-MPC) signal, you can temporarily cancel spindle sync error by turning ON the spindle sync error temporary cancel (SPDRPO) signal. If the specified time has not elapsed when the spindle sync error temporary cancel (SPDRPO) signal is turned ON, temporary cancel of spindle sync error is enabled first when the time of this parameter has elapsed. When "0" is set in this parameter, the delay time will be 284 (ms).
			---Setting range--- 0 to 30000 (ms)

15 Machine Parameters

15.8 Spindle Specification Parameters

(PR)	#3149	spsscfeed5	Observation speed 5
			Set the observation speed, which is at the machine end, in the multi-step speed monitor.
			(Note) When the setting value is larger than 18000, the last 2 digits will be ignored. E.g.: 1234567 -> 1234500 (deg/min)
			---Setting range---
			0 to 6553500 (deg/min)
(PR)	#3150	spsscfeed6	Observation speed 6
			Set the observation speed, which is at the machine end, in the multi-step speed monitor.
			(Note) When the setting value is larger than 18000, the last 2 digits will be ignored. E.g.: 1234567 -> 1234500 (deg/min)
			---Setting range---
			0 to 6553500 (deg/min)
(PR)	#3151	spsscfeed7	Observation speed 7
			Set the observation speed, which is at the machine end, in the multi-step speed monitor.
			(Note) When the setting value is larger than 18000, the last 2 digits will be ignored. E.g.: 1234567 -> 1234500 (deg/min)
			---Setting range---
			0 to 6553500 (deg/min)
(PR)	#3152	spsscfeed8	Observation speed 8
			Set the observation speed, which is at the machine end, in the multi-step speed monitor.
			(Note) When the setting value is larger than 18000, the last 2 digits will be ignored. E.g.: 1234567 -> 1234500 (deg/min)
			---Setting range---
			0 to 6553500 (deg/min)
#3153-3156		cms1-cms4	Spindle viscosity friction coefficient 1 to 4
			Set the spindle viscosity friction coefficient. These parameters are used to estimate the estimated disturbance torque of spindle.
			#13018 SP018/bit5 = 0 (Mechanical gear)
			#3153 cms1: Coefficient for the mechanical gear 1
			#3154 cms2: Coefficient for the mechanical gear 2
			#3155 cms3: Coefficient for the mechanical gear 3
			#3156 cms4: Coefficient for the mechanical gear 4
			#13018 SP018/bit5 = 1 (Coil changeover)
			#3153 cms1: Coefficient for the H coil
			#3154 cms2: Coefficient for the L coil
			#3155 cms3: Not used
			#3156 cms4: Not used
			---Setting range---
			0 to ±9999999 (0.00001%/rpm)

15 Machine Parameters

15.8 Spindle Specification Parameters

#3157-3160	fms1-fms4	Spindle coulomb friction coefficient 1 to 4
Set the spindle viscosity friction coefficient. These parameters are used to estimate the estimated disturbance torque of spindle.		
#13018 SP018/bit5 = 0 (Mechanical gear) <ul style="list-style-type: none"> #3157 fms1: Coefficient for the mechanical gear 1 #3158 fms2: Coefficient for the mechanical gear 2 #3159 fms3: Coefficient for the mechanical gear 3 #3160 fms4: Coefficient for the mechanical gear 4 		
#13018 SP018/bit5 = 1 (Coil changeover) <ul style="list-style-type: none"> #3157 fms1: Coefficient for the H coil #3158 fms2: Coefficient for the L coil #3159 fms3: Not used #3160 fms4: Not used 		
---Setting range--- 0 to ±9999999 (0.0001%/Nm)		
#3166	disttrq_t	Disturbance torque detection filter time constant
Set the responsiveness in detecting the disturbance torque.		
---Setting range--- 0 to 1000 (ms) (Default value: 0)		
#3167	spef	Spindle motor efficiency
Calculate the efficiency between the motor current value and the output torque, and compensate the disturbance torque detection at acceleration/deceleration. When set to "0", it controls as 100%.		
---Setting range--- 0 to 100 (%) (Default value: 0)		
#3168	StlTrqSPSV(PwrCal)	Stall torque of spindle-mode servo motor for power computation
Specify the stall torque of spindle-mode servo motor. This value is used for calculating the power consumption of the spindle-mode servo motor.		
---Setting range--- 0.000 to 1000.000 (Nm)		
#3169	rotspzsp	Spindle-mode rotary axis Motor zero speed (For spindle-mode rotary axis only)
Set the motor rotation speed to which the zero speed detection is executed. When the motor speed goes below the set speed, the zero speed detection turns ON. The standard setting value is "50". When the setting value is "0", it is on the standard setting value.		
---Setting range--- 0 to 1000 (r/min)		
#3170	rotspsdts	Spindle-mode rotary axis Speed detection setting value (For spindle-mode rotary axis only)
Set the motor speed to which the speed detection is executed. When the motor speed goes below the set speed, the speed detection turns ON. The standard setting value is 10% of the "#3001 slimt1" setting value. When the setting value is "0", it is on the standard setting value.		
---Setting range--- 0 to 32767(r/min)		

15 Machine Parameters

15.8 Spindle Specification Parameters

(PR)	#3192	LdMeter thresholdY	Loadmeter: Caution (Yellow) threshold
		<p>Specify the spindle load (%) at which the loadmeter displays a caution sign (yellow). If spindle load exceeds the specified value, the loadmeter displays a caution (yellow).</p> <p>If you wish to avoid showing the caution (yellow), set this parameter to be the same as "#3193 LdMeter thresholdR".</p> <p>When "0" is set, the value becomes 100% (default).</p> <p>---Setting range---</p> <p>0 to 300(%)</p>	
(PR)	#3193	LdMeter thresholdR	Loadmeter: Warning (Red) threshold
		<p>Specify the spindle load (%) at which the loadmeter displays a warning sign (red). If spindle load exceeds the specified value, the loadmeter displays a warning (red). If you wish to avoid showing the warning (red), set this parameter to be the same as "#3194 LdMeter load max".</p> <p>When "0" is set, the value becomes 150% (default).</p> <p>---Setting range---</p> <p>0 to 300(%)</p>	
(PR)	#3194	LdMeter load max	Loadmeter: Maximum spindle load
		<p>Specify the maximum spindle load (%) for loadmeter display.</p> <p>When "0" is set, the value becomes 200% (default).</p> <p>---Setting range---</p> <p>0 to 300(%)</p>	
(PR)	#3195	mgrsptyp	Spindle's machine group setting type
		<p>Specify which of the spindle's machine group No. parameters to use for the machine groupwise alarm stop function.</p> <p>0: "#3196 mgrspnum1" (Spindle's machine group No. 1) 1: "#3197 mgrspnum2" (Spindle's machine group No. 2)</p>	
(PR)	#3196	mgrspnum1	Spindle's machine group No. 1
		<p>Specify the machine group No. to which each spindle belongs. This parameter is enabled when the parameter "#3195 mgrsptyp" (Spindle's machine group setting type) is set to "0".</p> <p>---Setting range---</p> <p>0 to 32</p>	
(PR)	#3197	mgrspnum2	Spindle's machine group No. 2
		<p>Specify the machine group No. to which each spindle belongs, by setting the corresponding bit. This parameter is enabled when the parameter "#3195 mgrsptyp" (Spindle's machine group setting type) is set to "1".</p> <p>---Setting range---</p> <p>00 to FF</p> <p>Set this in hexadecimal format.</p>	
(PR)	#3199	spCode	Spindle selection code
		<p>In Multi-spindle control1, specify the code to select the spindle.</p> <p>The spindle whose code is same as the command value of address P will be selected.</p> <p>Spindle whose setting value is "0" cannot apply the spindle selection by address P.</p> <p>For different spindles, do not specify the same code.</p> <p>(Note) This parameter is valid when "#1300 ext36/bit4" is specified to "1". (Spindle selection by address P is valid)</p> <p>---Setting range---</p> <p>0 to 65535</p>	
	#13501	vfths11	Variable speed thread multi-step accel/decel change-over speed 1 (Gear00)
		<p>Set the spindle speed for changing the 1st step's acceleration/deceleration time constant at gear 00.</p> <p>---Setting range---</p> <p>0 to 99999 (r/min)</p>	

15 Machine Parameters

15.8 Spindle Specification Parameters

#13502	vfths12	Variable speed thread multi-step accel/decel change-over speed 1 (Gear01)
Set the spindle speed for changing the 1st step's acceleration/deceleration time constant at gear 01.		
---Setting range---		
0 to 99999 (r/min)		
#13503	vfths13	Variable speed thread multi-step accel/decel change-over speed 1 (Gear10)
Set the spindle speed for changing the 1st step's acceleration/deceleration time constant at gear 10.		
---Setting range---		
0 to 99999 (r/min)		
#13504	vfths14	Variable speed thread multi-step accel/decel change-over speed 1 (Gear11)
Set the spindle speed for changing the 1st step's acceleration/deceleration time constant at gear 11.		
---Setting range---		
0 to 99999 (r/min)		
#13505	vftht11	Variable speed thread multi-step accel/decel change time constant 1 (Gear00)
Set the time constant to reach the variable speed thread multi-step acceleration/deceleration changeover speed 1 at gear 00.		
---Setting range---		
0 to 30000 (10 ms)		
#13506	vftht12	Variable speed thread multi-step accel/decel change time constant 1 (Gear01)
Set the time constant to reach the variable speed thread multi-step acceleration/deceleration changeover speed 1 at gear 01.		
---Setting range---		
0 to 30000 (10 ms)		
#13507	vftht13	Variable speed thread multi-step accel/decel change time constant 1 (Gear10)
Set the time constant to reach the variable speed thread multi-step acceleration/deceleration changeover speed 1 at gear 10.		
---Setting range---		
0 to 30000 (10 ms)		
#13508	vftht14	Variable speed thread multi-step accel/decel change time constant 1 (Gear11)
Set the time constant to reach the variable speed thread multi-step acceleration/deceleration changeover speed 1 at gear 11.		
---Setting range---		
0 to 30000 (10 ms)		
#13509	vfths21	Variable speed thread multi-step accel/decel change-over speed 2 (Gear00)
Set the spindle speed for changing the 2nd step's acceleration/deceleration time constant at gear 00.		
---Setting range---		
0 to 99999 (r/min)		
#13510	vfths22	Variable speed thread multi-step accel/decel change-over speed 2 (Gear01)
Set the spindle speed for changing the 2nd step's acceleration/deceleration time constant at gear 01.		
---Setting range---		
0 to 99999 (r/min)		

15 Machine Parameters

15.8 Spindle Specification Parameters

#13511	vfths23	Variable speed thread multi-step accel/decel change-over speed 2 (Gear10)
Set the spindle speed for changing the 2nd step's acceleration/deceleration time constant at gear 10.		
---Setting range---		
0 to 99999 (r/min)		
#13512	vfths24	Variable speed thread multi-step accel/decel change-over speed 2 (Gear11)
Set the spindle speed for changing the 2nd step's acceleration/deceleration time constant at gear 11.		
---Setting range---		
0 to 99999 (r/min)		
#13513	vftht21	Variable speed thread multi-step accel/decel change time constant 2 (Gear00)
Set the time constant to reach the variable speed thread multi-step acceleration/deceleration changeover speed 2 at gear 00.		
---Setting range---		
0 to 30000 (10 ms)		
#13514	vftht22	Variable speed thread multi-step accel/decel change time constant 2 (Gear01)
Set the time constant to reach the variable speed thread multi-step acceleration/deceleration changeover speed 2 at gear 01.		
---Setting range---		
0 to 30000 (10 ms)		
#13515	vftht23	Variable speed thread multi-step accel/decel change time constant 2 (Gear10)
Set the time constant to reach the variable speed thread multi-step acceleration/deceleration changeover speed 2 at gear 10.		
---Setting range---		
0 to 30000 (10 ms)		
#13516	vftht24	Variable speed thread multi-step accel/decel change time constant 2 (Gear11)
Set the time constant to reach the variable speed thread multi-step acceleration/deceleration changeover speed 2 at gear 11.		
---Setting range---		
0 to 30000 (10 ms)		
#13517	vftht31	Variable speed thread multi-step accel/decel change time constant 3 (Gear00)
Set the time constant to reach the limit rotation speed at gear 00.		
---Setting range---		
0 to 30000 (10 ms)		
#13518	vftht32	Variable speed thread multi-step accel/decel change time constant 3 (Gear01)
Set the time constant to reach the limit rotation speed at gear 01.		
---Setting range---		
0 to 30000 (10 ms)		
#13519	vftht33	Variable speed thread multi-step accel/decel change time constant 3 (Gear10)
Set the time constant to reach the limit rotation speed at gear 10.		
---Setting range---		
0 to 30000 (10 ms)		

15 Machine Parameters

15.8 Spindle Specification Parameters

#13520	vftht34	Variable speed thread multi-step accel/decel change time constant 3 (Gear11)
Set the time constant to reach the limit rotation speed at gear 11.		
---Setting range---		
0 to 30000 (10 ms)		
#13521	spt2	Spindle synchronization acceleration/deceleration time constant (Gear: 01)
Spindle synchronization acceleration/deceleration time constant (Gear: 01) Specify the acceleration/deceleration time constant to be used when the rotation speed of spindle synchronization command is changed with the 2nd gear selected under the spindle-mode servo control or spindle synchronization control.		
---Setting range---		
0 to 9999(ms)		
#13522	sptc21	Spindle sync multistep acceleration/deceleration changeover speed 1 (Gear: 01)
Specify the spindle speed at which a changeover to the 1st step's acceleration/deceleration time constant is made when the 2nd step gear is selected.		
---Setting range---		
0 to 99999 (r/min)		
#13523	sptc22	Spindle sync multistep acceleration/deceleration changeover speed 2 (Gear: 01)
Specify the spindle speed at which a changeover to the 2nd step's acceleration/deceleration time constant is made when the 2nd step gear is selected.		
---Setting range---		
0 to 99999 (r/min)		
#13524	sptc23	Spindle sync multistep acceleration/deceleration changeover speed 3 (Gear: 01)
Specify the spindle speed at which a changeover to the 3rd step's acceleration/deceleration time constant is made when the 2nd step gear is selected.		
---Setting range---		
0 to 99999 (r/min)		
#13525	sptc24	Spindle sync multistep acceleration/deceleration changeover speed 4 (Gear: 01)
Specify the spindle speed at which a changeover to the 4th step's acceleration/deceleration time constant is made when the 2nd step gear is selected.		
---Setting range---		
0 to 99999 (r/min)		
#13526	sptc25	Spindle sync multistep acceleration/deceleration changeover speed 5 (Gear: 01)
Specify the spindle speed at which a changeover to the 5th step's acceleration/deceleration time constant is made when the 2nd step gear is selected.		
---Setting range---		
0 to 99999 (r/min)		
#13527	sptc26	Spindle sync multistep acceleration/deceleration changeover speed 6 (Gear: 01)
Specify the spindle speed at which a changeover to the 6th step's acceleration/deceleration time constant is made when the 2nd step gear is selected.		
---Setting range---		
0 to 99999 (r/min)		

15 Machine Parameters

15.8 Spindle Specification Parameters

#13528	sptc27	Spindle sync multistep acceleration/deceleration changeover speed 7 (Gear: 01)
Specify the spindle speed at which a changeover to the 7th step's acceleration/deceleration time constant is made when the 2nd step gear is selected.		
---Setting range---		
0 to 99999 (r/min)		
#13529	spdiv21	Time constant magnification for changeover speed 1 (Gear: 01)
Time constant magnification for changeover speed 1 (Gear: 01) Specify the acceleration/deceleration time constant to be used in a range of the spindle-mode servo control/spindle synchronization multi-step acceleration/deceleration changeover speed 1 (sptc21) to the spindle sync multi-step acceleration/deceleration changeover speed 2 (sptc22) when the 2nd step gear is selected. Set this as a magnification with respect to the spindle-mode servo control/spindle synchronization acceleration/deceleration time constant (spt2).		
---Setting range---		
0 to 127		
#13530	spdiv22	Time constant magnification for changeover speed 2 (Gear: 01)
Time constant magnification for changeover speed 2 (Gear: 01) Specify the acceleration/deceleration time constant to be used in a range of the spindle-mode servo control/spindle synchronization multi-step acceleration/deceleration changeover speed 2 (sptc22) to the spindle sync multi-step acceleration/deceleration changeover speed 3 (sptc23) when the 2nd step gear is selected. Set this as a magnification with respect to the spindle-mode servo control/spindle synchronization acceleration/deceleration time constant (spt2).		
---Setting range---		
0 to 127		
#13531	spdiv23	Time constant magnification for changeover speed 3 (Gear: 01)
Time constant magnification for changeover speed 3 (Gear: 01) Specify the acceleration/deceleration time constant to be used in a range of the spindle-mode servo control/spindle synchronization multi-step acceleration/deceleration changeover speed 3 (sptc23) to the spindle sync multi-step acceleration/deceleration changeover speed 4 (sptc24) when the 2nd step gear is selected. Set this as a magnification with respect to the spindle-mode servo control/spindle synchronization acceleration/deceleration time constant (spt2).		
---Setting range---		
0 to 127		
#13532	spdiv24	Time constant magnification for changeover speed 4 (Gear: 01)
Time constant magnification for changeover speed 4 (Gear: 01) Specify the acceleration/deceleration time constant to be used in a range of the spindle-mode servo control/spindle synchronization multi-step acceleration/deceleration changeover speed 4 (sptc24) to the spindle sync multi-step acceleration/deceleration changeover speed 5 (sptc25) when the 2nd step gear is selected. Set this as a magnification with respect to the spindle-mode servo control/spindle synchronization acceleration/deceleration time constant (spt2).		
---Setting range---		
0 to 127		
#13533	spdiv25	Time constant magnification for changeover speed 5 (Gear: 01)
Time constant magnification for changeover speed 5 (Gear: 01) Specify the acceleration/deceleration time constant to be used in a range of the spindle-mode servo control/spindle synchronization multi-step acceleration/deceleration changeover speed 5 (sptc25) to the spindle sync multi-step acceleration/deceleration changeover speed 6 (sptc26) when the 2nd step gear is selected. Set this as a magnification with respect to the spindle-mode servo control/spindle synchronization acceleration/deceleration time constant (spt2).		
---Setting range---		
0 to 127		

15 Machine Parameters

15.8 Spindle Specification Parameters

#13534	spdiv26	Time constant magnification for changeover speed 6 (Gear: 01)
		<p>Time constant magnification for changeover speed 6 (Gear: 01) Specify the acceleration/deceleration time constant to be used in a range of the spindle-mode servo control/spindle synchronization multi-step acceleration/deceleration changeover speed 6 (sptc26) to the spindle sync multi-step acceleration/deceleration changeover speed 7 (sptc27) when the 2nd step gear is selected. Set this as a magnification with respect to the spindle-mode servo control/spindle synchronization acceleration/deceleration time constant (spt2).</p> <p>---Setting range--- 0 to 127</p>
#13535	spdiv27	Time constant magnification for changeover speed 7 (Gear: 01)
		<p>Time constant magnification for changeover speed 7 (Gear: 01) Specify the acceleration/deceleration time constant to be used for the spindle-mode servo control/spindle synchronization multi-step acceleration/deceleration changeover speed 7 (sptc27) or a higher speed when the 2nd step gear is selected. Set this as a magnification with respect to the spindle-mode servo control/spindle synchronization acceleration/deceleration time constant (spt2).</p> <p>---Setting range--- 0 to 127</p>
#13536	spt3	Spindle synchronization acceleration/deceleration time constant(Gear: 10)
		<p>Spindle synchronization acceleration/deceleration time constant(Gear: 10) Specify the acceleration/deceleration time constant to be used when the commanded spindle synchronization rotation speed is changed with the 3rd gear selected during the spindle-mode servo control or spindle synchronization control.</p> <p>---Setting range--- 0 to 9999(ms)</p>
#13537	sptc31	Spindle sync multistep acceleration/deceleration changeover speed 1 (Gear: 10)
		<p>Specify the spindle speed at which a changeover to the 1st step's acceleration/deceleration time constant is made when the 3rd step gear is selected.</p> <p>---Setting range--- 0 to 99999 (r/min)</p>
#13538	sptc32	Spindle sync multistep acceleration/deceleration changeover speed 2 (Gear: 10)
		<p>Specify the spindle speed at which a changeover to the 2nd step's acceleration/deceleration time constant is made when the 3rd step gear is selected.</p> <p>---Setting range--- 0 to 99999 (r/min)</p>
#13539	sptc33	Spindle sync multistep acceleration/deceleration changeover speed 3 (Gear: 10)
		<p>Specify the spindle speed at which a changeover to the 3rd step's acceleration/deceleration time constant is made when the 3rd step gear is selected.</p> <p>---Setting range--- 0 to 99999 (r/min)</p>
#13540	sptc34	Spindle sync multistep acceleration/deceleration changeover speed 4 (Gear: 10)
		<p>Specify the spindle speed at which a changeover to the 4th step's acceleration/deceleration time constant is made when the 3rd step gear is selected.</p> <p>---Setting range--- 0 to 99999 (r/min)</p>

15 Machine Parameters

15.8 Spindle Specification Parameters

#13541	sptc35	Spindle sync multistep acceleration/deceleration changeover speed 5 (Gear: 10)
Specify the spindle speed at which a changeover to the 5th step's acceleration/deceleration time constant is made when the 3rd step gear is selected.		
---Setting range---		
0 to 99999 (r/min)		
#13542	sptc36	Spindle sync multistep acceleration/deceleration changeover speed 6 (Gear: 10)
Specify the spindle speed at which a changeover to the 6th step's acceleration/deceleration time constant is made when the 3rd step gear is selected.		
---Setting range---		
0 to 99999 (r/min)		
#13543	sptc37	Spindle sync multistep acceleration/deceleration changeover speed 7 (Gear: 10)
Specify the spindle speed at which a changeover to the 7th step's acceleration/deceleration time constant is made when the 3rd step gear is selected.		
---Setting range---		
0 to 99999 (r/min)		
#13544	spdiv31	Time constant magnification for changeover speed 1 (Gear: 10)
Time constant magnification for changeover speed 1 (Gear: 10) Specify the acceleration/deceleration time constant to be used in a range of the spindle-mode servo control/spindle synchronization multi-step acceleration/deceleration changeover speed 1 (sptc31) to the spindle sync multi-step acceleration/deceleration changeover speed 2 (sptc32) when the 3rd step gear is selected. Set this as a magnification with respect to the spindle-mode servo control/spindle synchronization acceleration/deceleration time constant (spt3).		
---Setting range---		
0 to 127		
#13545	spdiv32	Time constant magnification for changeover speed 2 (Gear: 10)
Time constant magnification for changeover speed 2 (Gear: 10) Specify the acceleration/deceleration time constant to be used in a range of the spindle-mode servo control/spindle synchronization multi-step acceleration/deceleration changeover speed 2 (sptc32) to the spindle sync multi-step acceleration/deceleration changeover speed 3 (sptc33) when the 3rd step gear is selected. Set this as a magnification with respect to the spindle-mode servo control/spindle synchronization acceleration/deceleration time constant (spt3).		
---Setting range---		
0 to 127		
#13546	spdiv33	Time constant magnification for changeover speed 3 (Gear: 10)
Time constant magnification for changeover speed 3 (Gear: 10) Specify the acceleration/deceleration time constant to be used in a range of the spindle-mode servo control/spindle synchronization multi-step acceleration/deceleration changeover speed 3 (sptc33) to the spindle sync multi-step acceleration/deceleration changeover speed 4 (sptc34) when the 3rd step gear is selected. Set this as a magnification with respect to the spindle-mode servo control/spindle synchronization acceleration/deceleration time constant (spt3).		
---Setting range---		
0 to 127		
#13547	spdiv34	Time constant magnification for changeover speed 4 (Gear: 10)
Time constant magnification for changeover speed 4 (Gear: 10) Specify the acceleration/deceleration time constant to be used in a range of the spindle-mode servo control/spindle synchronization multi-step acceleration/deceleration changeover speed 4 (sptc34) to the spindle sync multi-step acceleration/deceleration changeover speed 5 (sptc35) when the 3rd step gear is selected. Set this as a magnification with respect to the spindle-mode servo control/spindle synchronization acceleration/deceleration time constant (spt3).		
---Setting range---		
0 to 127		

15 Machine Parameters

15.8 Spindle Specification Parameters

#13548	spdiv35	Time constant magnification for changeover speed 5 (Gear: 10)
Time constant magnification for changeover speed 5 (Gear: 10) Specify the acceleration/deceleration time constant to be used in a range of the spindle-mode servo control/spindle synchronization multi-step acceleration/deceleration changeover speed 5 (sptc35) to the spindle sync multi-step acceleration/deceleration changeover speed 6 (sptc36) when the 3rd step gear is selected. Set this as a magnification with respect to the spindle-mode servo control/spindle synchronization acceleration/deceleration time constant (spt3). ---Setting range--- 0 to 127		
#13549	spdiv36	Time constant magnification for changeover speed 6 (Gear: 10)
Time constant magnification for changeover speed 6 (Gear: 10) Specify the acceleration/deceleration time constant to be used in a range of the spindle-mode servo control/spindle synchronization multi-step acceleration/deceleration changeover speed 6 (sptc36) to the spindle sync multi-step acceleration/deceleration changeover speed 7 (sptc37) when the 3rd step gear is selected. Set this as a magnification with respect to the spindle-mode servo control/spindle synchronization acceleration/deceleration time constant (spt3). ---Setting range--- 0 to 127		
#13550	spdiv37	Time constant magnification for changeover speed 7 (Gear: 10)
Time constant magnification for changeover speed 7 (Gear: 10) Specify the acceleration/deceleration time constant to be used for the spindle-mode servo control/spindle synchronization multi-step acceleration/deceleration changeover speed 7 (sptc37) or a higher speed when the 3rd step gear is selected. Set this as a magnification with respect to the spindle-mode servo control/spindle synchronization acceleration/deceleration time constant (spt3). ---Setting range--- 0 to 127		
#13551	spt4	Spindle synchronization acceleration/deceleration time constant (Gear: 11)
Spindle synchronization acceleration/deceleration time constant (Gear: 11) Specify the acceleration/deceleration time constant to be used when the commanded spindle synchronization rotation speed is changed with the 4th gear selected during the spindle-mode servo control or spindle synchronization control. ---Setting range--- 0 to 9999(ms)		
#13552	sptc41	Spindle sync multistep acceleration/deceleration changeover speed 1 (Gear: 11)
Specify the spindle speed at which a changeover to the 1st step's acceleration/deceleration time constant is made when the 4th step gear is selected. ---Setting range--- 0 to 99999 (r/min)		
#13553	sptc42	Spindle sync multistep acceleration/deceleration changeover speed 2 (Gear: 11)
Specify the spindle speed at which a changeover to the 2nd step's acceleration/deceleration time constant is made when the 4th step gear is selected. ---Setting range--- 0 to 99999 (r/min)		
#13554	sptc43	Spindle sync multistep acceleration/deceleration changeover speed 3 (Gear: 11)
Specify the spindle speed at which a changeover to the 3rd step's acceleration/deceleration time constant is made when the 4th step gear is selected. ---Setting range--- 0 to 99999 (r/min)		

15 Machine Parameters

15.8 Spindle Specification Parameters

#13555	sptc44	Spindle sync multistep acceleration/deceleration changeover speed 4 (Gear: 11)
Specify the spindle speed at which a changeover to the 4th step's acceleration/deceleration time constant is made when the 4th step gear is selected.		
---Setting range---		
0 to 99999 (r/min)		
#13556	sptc45	Spindle sync multistep acceleration/deceleration changeover speed 5 (Gear: 11)
Specify the spindle speed at which a changeover to the 5th step's acceleration/deceleration time constant is made when the 4th step gear is selected.		
---Setting range---		
0 to 99999 (r/min)		
#13557	sptc46	Spindle sync multistep acceleration/deceleration changeover speed 6 (Gear: 11)
Specify the spindle speed at which a changeover to the 6th step's acceleration/deceleration time constant is made when the 4th step gear is selected.		
---Setting range---		
0 to 99999 (r/min)		
#13558	sptc47	Spindle sync multistep acceleration/deceleration changeover speed 7 (Gear: 11)
Specify the spindle speed at which a changeover to the 7th step's acceleration/deceleration time constant is made when the 4th step gear is selected.		
---Setting range---		
0 to 99999 (r/min)		
#13559	spdiv41	Time constant magnification for changeover speed 1 (Gear: 11)
Time constant magnification for changeover speed 1 (Gear: 11)		
Specify the acceleration/deceleration time constant to be used in a range of the spindle-mode servo control/spindle synchronization multi-step acceleration/deceleration changeover speed 1 (sptc41) to the spindle sync multi-step acceleration/deceleration changeover speed 2 (sptc42) when the 4th step gear is selected. Set this as a magnification with respect to the spindle-mode servo control/spindle synchronization acceleration/deceleration time constant (spt4).		
---Setting range---		
0 to 127		
#13560	spdiv42	Time constant magnification for changeover speed 2 (Gear: 11)
Time constant magnification for changeover speed 2 (Gear: 11)		
Specify the acceleration/deceleration time constant to be used in a range of the spindle-mode servo control/spindle synchronization multi-step acceleration/deceleration changeover speed 2 (sptc42) to the spindle sync multi-step acceleration/deceleration changeover speed 3 (sptc43) when the 4th step gear is selected. Set this as a magnification with respect to the spindle-mode servo control/spindle synchronization acceleration/deceleration time constant (spt4).		
---Setting range---		
0 to 127		
#13561	spdiv43	Time constant magnification for changeover speed 3 (Gear: 11)
Time constant magnification for changeover speed 3 (Gear: 11)		
Specify the acceleration/deceleration time constant to be used in a range of the spindle-mode servo control/spindle synchronization multi-step acceleration/deceleration changeover speed 3 (sptc43) to the spindle sync multi-step acceleration/deceleration changeover speed 4 (sptc44) when the 4th step gear is selected. Set this as a magnification with respect to the spindle-mode servo control/spindle synchronization acceleration/deceleration time constant (spt4).		
---Setting range---		
0 to 127		

15 Machine Parameters

15.8 Spindle Specification Parameters

#13562	spdiv44	Time constant magnification for changeover speed 4 (Gear: 11)
		<p>Time constant magnification for changeover speed 4 (Gear: 11)</p> <p>Specify the acceleration/deceleration time constant to be used in a range of the spindle-mode servo control/spindle synchronization multi-step acceleration/deceleration changeover speed 4 (sptc44) to the spindle sync multi-step acceleration/deceleration changeover speed 5 (sptc45) when the 4th step gear is selected. Set this as a magnification with respect to the spindle-mode servo control/spindle synchronization acceleration/deceleration time constant (spt4).</p> <p>---Setting range---</p> <p>0 to 127</p>
#13563	spdiv45	Time constant magnification for changeover speed 5 (Gear: 11)
		<p>Time constant magnification for changeover speed 5 (Gear: 11)</p> <p>Specify the acceleration/deceleration time constant to be used in a range of the spindle-mode servo control/spindle synchronization multi-step acceleration/deceleration changeover speed 5 (sptc45) to the spindle sync multi-step acceleration/deceleration changeover speed 6 (sptc46) when the 4th step gear is selected. Set this as a magnification with respect to the spindle-mode servo control/spindle synchronization acceleration/deceleration time constant (spt4).</p> <p>---Setting range---</p> <p>0 to 127</p>
#13564	spdiv46	Time constant magnification for changeover speed 6 (Gear: 11)
		<p>Time constant magnification for changeover speed 6 (Gear: 11)</p> <p>Specify the acceleration/deceleration time constant to be used in a range of the spindle-mode servo control/spindle synchronization multi-step acceleration/deceleration changeover speed 6 (sptc46) to the spindle sync multi-step acceleration/deceleration changeover speed 7 (sptc47) when the 4th step gear is selected. Set this as a magnification with respect to the spindle-mode servo control/spindle synchronization acceleration/deceleration time constant (spt4).</p> <p>---Setting range---</p> <p>0 to 127</p>
#13565	spdiv47	Time constant magnification for changeover speed 7 (Gear: 11)
		<p>Time constant magnification for changeover speed 7 (Gear: 11)</p> <p>Specify the acceleration/deceleration time constant to be used for the spindle-mode servo control/spindle synchronization multi-step acceleration/deceleration changeover speed 7 (sptc47) or a higher speed when the 4th step gear is selected. Set this as a magnification with respect to the spindle-mode servo control/spindle synchronization acceleration/deceleration time constant (spt4).</p> <p>---Setting range---</p> <p>0 to 127</p>
#13678	OMRCC_valid_sp	OMR-CC valid
		<p>Select whether to enable OMR-CC when Spindle position control function is used together.</p> <p>0: Disable OMR-CC</p> <p>1: Enable OMR-CC</p>
(PR) #43001	sgear_tret	Turret gear change ON
		<p>Select whether to enable turret gear change control (gear change at the spindle gear ratios SGRA1 to SGRB4) for a spindle that is under semi-closed loop control.</p> <p>0: Disable</p> <p>1: Enable</p>
#43002	SGRA1	Spindle-side gear ratio 1
		<p>This ratio is enabled under turret gear change control.</p> <p>Specify the number of spindle-side gear teeth for gear selection command G11=0/G12=0.</p> <p>When 0 is set, the operation will be the same as when 1 is set.</p> <p>---Setting range---</p> <p>0 to 32767</p>

15 Machine Parameters

15.8 Spindle Specification Parameters

#43003	SGRA2	Spindle-side gear ratio 2
<p>This ratio is enabled under turret gear change control.</p> <p>Specify the number of spindle-side gear teeth for gear selection command G1=1/GI2=0.</p> <p>When 0 is set, the operation will be the same as when 1 is set.</p> <p>---Setting range---</p> <p>0 to 32767</p>		
#43004	SGRA3	Spindle-side gear ratio 3
<p>This ratio is enabled under turret gear change control.</p> <p>Specify the number of spindle-side gear teeth for gear selection command G1=0/GI2=1.</p> <p>When 0 is set, the operation will be the same as when 1 is set.</p> <p>---Setting range---</p> <p>0 to 32767</p>		
#43005	SGRA4	Spindle-side gear ratio 4
<p>This ratio is enabled under turret gear change control.</p> <p>Specify the number of spindle-side gear teeth for gear selection command G1=1/GI2=1.</p> <p>When 0 is set, the operation will be the same as when 1 is set.</p> <p>---Setting range---</p> <p>0 to 32767</p>		
#43006	SGRB1	Motor shaft-side gear ratio 1
<p>This ratio is enabled under turret gear change control.</p> <p>Specify the number of teeth of the motor shaft side gear 1 for gear selection command G1=0/GI2=0.</p> <p>When 0 is set, the operation will be the same as when 1 is set.</p> <p>---Setting range---</p> <p>0 to 32767</p>		
#43007	SGRB2	Motor shaft-side gear ratio 2
<p>This ratio is enabled under turret gear change control.</p> <p>Specify the number of teeth of the motor shaft side gear 1 for gear selection command G1=1/GI2=0.</p> <p>When 0 is set, the operation will be the same as when 1 is set.</p> <p>---Setting range---</p> <p>0 to 32767</p>		
#43008	SGRB3	Motor shaft-side gear ratio 3
<p>This ratio is enabled under turret gear change control.</p> <p>Specify the number of teeth of the motor shaft side gear 1 for gear selection command G1=0/GI2=1.</p> <p>When 0 is set, the operation will be the same as when 1 is set.</p> <p>---Setting range---</p> <p>0 to 32767</p>		
#43009	SGRB4	Motor shaft-side gear ratio 4
<p>This ratio is enabled under turret gear change control.</p> <p>Specify the number of teeth of the motor shaft side gear 1 for gear selection command G1=1/GI2=1.</p> <p>When 0 is set, the operation will be the same as when 1 is set.</p> <p>---Setting range---</p> <p>0 to 32767</p>		
#43046	smax_tap1	Synchro tapping spindle Max rotation speed (Gear: 00)
<p>Specify the maximum rotation speed in synchronous tapping multi-step acceleration/deceleration control when gear 00 is selected.</p> <p>Inclination of 3rd linear acceleration/deceleration control is determined by the ratio of smax_tap1(#43046) and tapt31(#3045).</p> <p>When "0" is set to smax_tap1, use smax1(#3005).</p> <p>When smax_tap1 is smax1 or more, use smax1.</p> <p>---Setting range---</p> <p>0 to 99999 (r/min)</p>		

15 Machine Parameters

15.8 Spindle Specification Parameters

#43047	smax_tap2	Synchro tapping spindle Max rotation speed (Gear: 01)
	Specify the maximum rotation speed in synchronous tapping multi-step acceleration/deceleration control when gear 01 is selected. Inclination of 3rd linear acceleration/deceleration control is determined by the ratio of smax_tap2(#43047) and tapt32(#3046). When "0" is set to smax_tap2, use smax2 (#3006). When smax_tap2 is smax2 or more, use smax2. ---Setting range--- 0 to 99999 (r/min)	
#43048	smax_tap3	Synchro tapping spindle Max rotation speed (Gear: 10)
	Specify the maximum rotation speed in synchronous tapping multi-step acceleration/deceleration control when gear 10 is selected. Inclination of 3rd linear acceleration/deceleration control is determined by the ratio of smax_tap3(#43048) and tapt33(#3047). When "0" is set to smax_tap3, use smax3 (#3007). When smax_tap3 is smax3 or more, use smax3. ---Setting range--- 0 to 99999 (r/min)	
#43049	smax_tap4	Synchro tapping spindle Max rotation speed (Gear: 11)
	Specify the maximum rotation speed in synchronous tapping multi-step acceleration/deceleration control when gear 11 is selected. Inclination of 3rd linear acceleration/deceleration control is determined by the ratio of smax_tap4(#43049) and tapt34(#3048). When 0 is set to smax_tap4, use smax4(#3008). When smax_tap4 is smax4 or more, use smax4. ---Setting range--- 0 to 99999 (r/min)	
#43070	loadrate_warn	Spindle motor equivalent load factor excess warning
	Specify the equivalent load factor of the spindle motor that causes the warning at the start of automatic operation. The warning appears when the equivalent load factor has exceeded the specified value. 0: Disable the warning 1 to 200: Warning display threshold [%]	
#43071	sp_spd_flg_dtc_p	Delay time for starting spindle speed fluctuation detection
	This parameter is used when address P is omitted from the spindle speed fluctuation detection command (G162). Specify a length of delay time from when G162 command is given to when the control detects a fluctuation. This delay time is also applied to a change in spindle speed command. A change in spindle speed command means a difference in the final command given to the spindle drive unit. ---Setting range--- 0 to 99.999 (s)	
#43072	sp_spd_flg_dtc_r	Allowable spindle speed fluctuation rate
	Specify the allowable spindle speed fluctuation rate to be applied to the spindle speed fluctuation detection command (G162) from which address R is omitted. When "0" is set, the allowable rate is 15%. If a speed deviation with respect to the command speed is smaller than 45 r/min, the speed deviation is treated as 45 r/min. ---Setting range--- 0 to 100 (%)	
#43073	sp_spd_flg_dtc_i	Allowable spindle speed fluctuation range
	Specify the allowable spindle speed fluctuation range to be applied to the spindle speed fluctuation detection command (G162) from which address I is omitted. When "0" is set, the allowable range is treated as 45 r/min. ---Setting range--- 0 to 999999 (r/min)	

15 Machine Parameters

15.8 Spindle Specification Parameters

	#43074	zdet_num	Maximum number of revolutions for Z phase detection
			Specify the maximum number of revolutions for the Z phase detection of proximity-switch orientation. If Z phase is not yet detected when the spindle has reached the specified number of revolutions, the operation error (M01 0301) occurs. When this parameter is "0", the maximum number of revolutions is treated as 2. ---Setting range--- 0 to 255 (revolutions)
(PR)	#43076	GRA1ex	Spindle-side extended gear ratio 1
			Specify the number of spindle-side gear teeth for "Gear selection command (Control input 4/bit6, 5) = 00". When 0 is set, extended gear ratio is disabled. When not using, set to "0". ---Setting range--- 0 to 2147483647
(PR)	#43077	GRA2ex	Spindle-side extended gear ratio 2
			Specify the number of spindle-side gear teeth for "Gear selection command (Control input 4/bit6, 5) = 01". When 0 is set, extended gear ratio is disabled. When not using, set to "0". ---Setting range--- 0 to 2147483647
(PR)	#43078	GRA3ex	Spindle-side extended gear ratio 3
			Specify the number of spindle-side gear teeth for "Gear selection command (Control input 4/bit6, 5) = 10". When 0 is set, extended gear ratio is disabled. When not using, set to "0". ---Setting range--- 0 to 2147483647
(PR)	#43079	GRA4ex	Spindle-side extended gear ratio 4
			Specify the number of spindle-side gear teeth for "Gear selection command (Control input 4/bit6, 5) = 11". When 0 is set, extended gear ratio is disabled. When not using, set to "0". ---Setting range--- 0 to 2147483647
(PR)	#43080	GRB1ex	Motor-side extended gear ratio 1
			Specify the number of motor-side gear teeth for "Gear selection command (Control input 4/bit6, 5) = 00". When 0 is set, extended gear ratio is disabled. When not using, set to "0". ---Setting range--- 0 to 2147483647
(PR)	#43081	GRB2ex	Motor-side extended gear ratio 2
			Specify the number of motor-side gear teeth for "Gear selection command (Control input 4/bit6, 5) = 01". When 0 is set, extended gear ratio is disabled. When not using, set to "0". ---Setting range--- 0 to 2147483647
(PR)	#43082	GRB3ex	Motor-side extended gear ratio 3
			Specify the number of motor-side gear teeth for "Gear selection command (Control input 4/bit6, 5) = 10". When 0 is set, extended gear ratio is disabled. When not using, set to "0". ---Setting range--- 0 to 2147483647

15 Machine Parameters

15.8 Spindle Specification Parameters

(PR)	#43083	GRB4ex	Motor-side extended gear ratio 4
			<p>Specify the number of motor-side gear teeth for "Gear selection command (Control input 4/bit6, 5) = 11".</p> <p>When 0 is set, extended gear ratio is disabled.</p> <p>When not using, set to "0".</p> <p>---Setting range---</p> <p>0 to 2147483647</p>
	#43084	protect_sp_st_tmp	Spindle protection start temperature
			<p>Specify the motor temperature at which spindle protection starts.</p> <p>When the spindle motor temperature reaches the set temperature or higher, the acceleration/deceleration time constant is switched from that of S command to that for spindle protection.</p> <p>Set a temperature that is the same as or higher than the spindle protection cancel temperature.</p> <p>When 0 is set, the spindle acceleration/deceleration time constant is not switched according to the temperature.</p> <p>---Setting range---</p> <p>0 to 200 (°C)</p>
	#43085	protect_sp_rls_tmp	Spindle protection cancel temperature
			<p>Specify the motor temperature at which spindle protection is cancelled.</p> <p>When the spindle motor temperature drops below the set temperature, the acceleration/deceleration time constant is switched from that for spindle protection to that of S command.</p> <p>Set a temperature that is the same as or lower than the spindle protection start temperature.</p> <p>When the set temperature is 0 or higher than the spindle protection start temperature, the cancel temperature is set 10 degrees lower than the start temperature.</p> <p>---Setting range---</p> <p>0 to 200 (°C)</p>
	#43086	protect_sp_t1	Acceleration/Deceleration time constant during spindle protection (Gear: 00)
			<p>Specify the acceleration/deceleration time constant for S command (speed operation mode) to be applied to the spindle motor (gear 00) that is being protected against increased temperature.</p> <p>Set the linear acceleration/deceleration time up to limit rotation speed (slimt1).</p> <p>When 0 or any value smaller than "#3101 sp_t1" is set, switchover of the time constant is disabled, and acceleration/deceleration is performed with the time constant "#3101 sp_t1".</p> <p>---Setting range---</p> <p>0 to 30000 (ms)</p>
	#43087	protect_sp_t2	Acceleration/Deceleration time constant during spindle protection (Gear: 01)
			<p>Specify the acceleration/deceleration time constant for S command (speed operation mode) to be applied to the spindle motor (gear 01) that is being protected against increased temperature.</p> <p>Set the linear acceleration/deceleration time up to limit rotation speed (slimt2).</p> <p>When 0 or any value smaller than "#3102 sp_t2" is set, switchover of the time constant is disabled, and acceleration/deceleration is performed with the time constant "#3102 sp_t2".</p> <p>---Setting range---</p> <p>0 to 30000 (ms)</p>
	#43088	protect_sp_t3	Acceleration/Deceleration time constant during spindle protection (Gear: 10)
			<p>Specify the acceleration/deceleration time constant for S command (speed operation mode) to be applied to the spindle motor (gear 10) that is being protected against increased temperature.</p> <p>Set the linear acceleration/deceleration time up to limit rotation speed (slimt3).</p> <p>When "0" or any value smaller than "#3103 sp_t3" is set, switchover of the time constant is disabled, and acceleration/deceleration is performed with the time constant "#3103 sp_t3".</p> <p>---Setting range---</p> <p>0 to 30000 (ms)</p>

15 Machine Parameters

15.8 Spindle Specification Parameters

#43089	protect_sp_t4	Acceleration/Deceleration time constant during spindle protection (Gear: 11)	
<p>Specify the acceleration/deceleration time constant for S command (speed operation mode) to be applied to the spindle motor (gear 11) that is being protected against increased temperature.</p> <p>Set the linear acceleration/deceleration time up to limit rotation speed (slimt4).</p> <p>When "0" or any value smaller than "#3104 sp_t4" is set, switchover of the time constant is disabled, and acceleration/deceleration is performed with the time constant "#3104 sp_t4".</p> <p>---Setting range---</p> <p>0 to 30000 (ms)</p>			
#43095	SP002cax(PGNcax)	Position loop gain for C axis mode	
<p>This parameter specifies the position loop gain that is applied when the spindle is controlled in C axis mode. If the parameter is set to "0", the value of the spindle parameter "#13002 SP002 (PGN)" will be used.</p> <p>---Setting range---</p> <p>0 to 200 (rad/s)</p>			
(PR)	#43097	sprotpls	Number of pulses per motor revolution
<p>When using the "Spindle control with pulse train output" function, subtract 1 from the number of pulses per revolution of the spindle motor, and enter the result in this parameter.</p> <p>(Example) When the number of pulses per revolution of the motor connected is 4096, enter "4095" in this parameter.</p> <p>---Setting range---</p> <p>0 to 32767</p>			
(PR)	#43098	plsspec	Form of pulse train output
<p>Specify the form of the pulse train to be output.</p> <p>bit8: Output logic</p> <p>Specify the logic of the pulse train to be output.</p> <p>0: Positive logic (Active high)</p> <p>1: Negative logic (Active low)</p> <p>bit7-4: Multiplying factor</p> <p>Specify the multiplying factor for the frequency of the pulse train.</p> <p>0: 1-fold</p> <p>1: 1/4-fold</p> <p>bit3-0: Output mode</p> <p>Specify the form of the pulse train for forward/reverse rotation.</p> <p>0: A/B phase mode</p> <p>1: PULSE/SIGN mode</p> <p>2: CW/CCW mode</p> <p>---Setting range---</p> <p>0000 to FFFF (HEX)</p>			
(PR)	#43099	plsmot	Maximum rotation speed of spindle motor controlled with pulse train output
<p>Specify the maximum rotation speed of the spindle motor that should be controlled with the pulse train output.</p> <p>---Setting range---</p> <p>0 to 999999 (r/min)</p>			

15 Machine Parameters

15.8 Spindle Specification Parameters

		#43100	plschk	Time to check spindle encoder output for control with pulse train output
		<p>Specify the time period to determine there is an error in feedback signal from the spindle encoder.</p> <p>If the feedback signal from the spindle encoder does not change significantly when the parameterized time period has elapsed after start of output to the spindle, the system determines there is an error in the spindle encoder, and an alarm stop takes place.</p> <p>If "0" is specified, the system behaves as if "200" was specified.</p> <p>This parameter is only valid when "#3025 enc-on" (Spindle encoder) is "1".</p> <p>---Setting range---</p> <p>0 to 1000 (ms)</p>		
		#43101	loadrate_ratio	Spindle motor equivalent load factor rating ratio
		<p>Adjust the value to be displayed and output as the equivalent load factor of the spindle motor using this parameter.</p> <p>(Example) When converting to continuous rating: Continuous rating / short-time rating * 100</p> <p>---Setting range---</p> <p>0 to 150 (%)</p> <p>Note that when set to "0", 100% applies.</p>		
		#43105	sp_temp_hide	Hide Spindle temperature
		<p>Hide (blank) the spindle unit temperature on the drive monitor screen.</p> <p>0: Show</p> <p>1: Hide</p> <p>(Note) Regardless of the setting of "#1251 set23/bit1" (Spindle temperature display), the temperature of the spindle for which "1" is set in this parameter is hidden (blank).</p>		
(PR)	#43107	S_disp_name	Sp disp name	
		<p>Specify the second character following the "S" in the spindle name to be displayed on the screen.</p> <p>(Example) "SA" is displayed as the spindle name when "A" is set.</p> <p>(Note) If even one spindle has a blank name, the spindle No. is displayed as the second character following the S in the name of all spindles.</p> <p>---Setting range---</p> <p>A to Z and 1 to 9</p> <p>(Setting is cleared when "0" is set.)</p>		

15 Machine Parameters

15.9 Spindle Parameters

15.9 Spindle Parameters

#13001	SP001 PGV	Position loop gain non-interpolation mode
	<p>Set the position loop gain for "Non-interpolation" control mode. When the setting value increases, the command tracking ability will enhance and the positioning settling time can be shorter. However, the impact on the machine during acceleration/deceleration will increase. Use the selection command, the control mode "bit 2, 1, 0 = 000" in control input 4. (Note) The control mode is commanded by NC.</p> <p>---Setting range---</p> <p>1 to 200 (rad/s)</p>	
#13002	SP002 PGN	Position loop gain interpolation mode
	<p>Set the position loop gain for "interpolation" control mode. When the setting value increases, the command tracking ability will enhance and the positioning settling time can be shorter. However, the impact on the machine during acceleration/deceleration will increase. Use the selection command, the control mode "bit 2, 1, 0 = 010 or 100" in control input 4. (Note) The control mode is commanded by NC. When carrying out the SHG control, set SP035/bitC to "1".</p> <p>---Setting range---</p> <p>1 to 200 (rad/s)</p>	
#13003	SP003 PGS	Position loop gain spindle synchronization
	<p>Set the position loop gain for "spindle synchronization" control mode. When the setting value increases, the command tracking ability will enhance and the positioning settling time can be shorter. However, the impact on the machine during acceleration/deceleration will increase. Use the selection command, the control mode "bit 2, 1, 0 = 001" in control input 4. (Note 1) The control mode is commanded by NC. When carrying out the SHG control, set SP036/bit4 to "1". (Note 2) Set the same value for the basic and synchronous spindles in spindle synchronization.</p> <p>---Setting range---</p> <p>1 to 200 (rad/s)</p>	
#13004	SP004	
	Not used. Set to "0".	
#13005	SP005 VGN1	Speed loop gain 1
	<p>Set the speed loop gain. Set this according to the load inertia size. The higher setting value will increase the accuracy of control, however, vibration tends to occur. If vibration occurs, adjust by lowering by 20 to 30%. The final value should be 70 to 80% of the value at which the vibration stops.</p> <p>---Setting range---</p> <p>1 to 9999</p>	
#13006	SP006 VIA1	Speed loop lead compensation 1
	<p>Set the speed loop integral control gain. The standard setting is "1900". Adjust the value by increasing/decreasing the value by about 100. Raise this value to improve the contour tracking accuracy in high-speed cutting. Lower this value when the position droop does not stabilize (when the vibration of 10 to 20Hz occurs).</p> <p>---Setting range---</p> <p>1 to 9999</p>	
#13007	SP007 VIL1	Speed loop delay compensation 1
	<p>Set this parameter when the limit cycle occurs in the full-closed loop or overshooting occurs in positioning. When setting this parameter, make sure to set the torque offset "SP050(TOF)". When not using, set to "0".</p> <p>---Setting range---</p> <p>0 to 32767</p>	

15 Machine Parameters

15.9 Spindle Parameters

#13008	SP008 VGN2	Speed loop gain 2
<p>Normally SP005(VGN1) is used. By setting "SP035/bit1, SP035/bit9 or SP036/bit1=1", gain 2 can be used according to the application. Gain 2 can also be used by setting "Speed gain set 2 changeover request (control input 5/ bitC) = 1". Refer to SP005(VGN1) for adjustment procedures.</p> <p>---Setting range---</p> <p>1 to 9999</p>		
#13009	SP009 VIA2	Speed loop lead compensation 2
<p>Normally SP006(VIA1) is used. By setting "SP035/bit1, SP035/bit9 or SP036/bit1=1", gain 2 can be used according to the application. Gain 2 can also be used by setting "Speed gain set 2 changeover request (control input 5/ bitC) = 1". Refer to SP006(VIA1) for adjustment procedures.</p> <p>---Setting range---</p> <p>1 to 9999</p>		
#13010	SP010 VIL2	Speed loop delay compensation 2
<p>Normally SP007(VIL1) is used. By setting "SP035/bit1, SP035/bit9 or SP036/bit1=1", gain 2 can be used according to the application. Gain 2 can also be used by setting "Speed gain set 2 changeover request (control input 5/ bitC) = 1". Refer to SP007(VIL1) for adjustment procedures.</p> <p>---Setting range---</p> <p>0 to 32767</p>		
#13011	SP011	
Not used. Set to "0".		
#13012	SP012	
Not used. Set to "0".		
#13013	SP013	
Not used. Set to "0".		
#13014	SP014 PY1	Minimum excitation rate 1
<p>Set the minimum value for the variable excitation rate. The standard setting is "50". Set to "0" when using an IPM spindle motor. If noise including gear noise is loud, select a small value. However, a larger setting value is more effective for impact response.</p> <p>(Note) When setting a value at "50 or more", check if there is no problem with gear noise, motor excitation noise, vibration during low-speed rotation or vibration when the servo is locked during orientation stop, etc. When setting a value at "less than 50", check if there is no problem with the impact load response or rigidity during servo lock.</p> <p>---Setting range---</p> <p>0 to 100 (%)</p>		
#13015	SP015 PY2	Minimum excitation rate 2
<p>Normally, SP014(PY1) is used. By setting "SP035/bit2, SP035/bitA or SP036/bit2=1", the excitation rate 2 can be used according to the application. The excitation rate 2 can also be used by setting "the minimum excitation rate 2 changeover request (control input 5/ bitB) = 1". Refer to SP014(PY1) for adjustment procedures. Set to "0" when using an IPM spindle motor.</p> <p>---Setting range---</p> <p>0 to 100 (%)</p>		

15 Machine Parameters

15.9 Spindle Parameters

#13016	SP016 DDT	Phase alignment deceleration rate	
	<p>Set the single-rotation position alignment deceleration rate for orientation stopping, phase alignment while rotating and switching from non-interpolation mode to spindle synchronization mode while rotating.</p> <p>When the load inertia is larger, the setting value should be smaller.</p> <p>When the setting value is larger, the orientation in-position and single-rotation position alignment complete faster, but the impact applied on the machine will increase.</p> <p>To change the deceleration rate only during rotation command (command F Δ T ≠ 0), set this parameter together with SP070 (KDDT).</p> <p>---Setting range---</p> <p>1 to 32767 (0.1(r/min)/ms)</p>		
(PR)	#13017	SP017 SPEC1	Spindle specification 1
	<p>Select the spindle specification.</p> <p>A function is allocated to each bit.</p> <p>Set this in hexadecimal format.</p> <div><div>Bit- F E D C B A 9 8 7 6 5 4 3 2 1 0</div><div><div><div></div><div></div><div></div><div></div><div>0</div><div>0</div><div>0</div><div>0</div><div>0</div><div>0</div><div>0</div><div></div><div></div><div></div><div></div><div></div><div></div></div><div><div></div><div></div><div></div><div></div><div></div><div></div><div></div><div></div><div></div><div></div><div></div><div></div><div></div><div></div><div></div><div></div></div><div><div>fdir2</div><div>dfbx</div><div>seqh</div><div>vfb</div><div>fdir</div><div>msr</div></div></div></div>		
	<p>bit F-C : msr Motor series selection</p> <p>0: 200V specification IM spindle motor</p> <p>1: 200V specification IPM spindle motor</p> <p>2: 400V specification IM spindle motor</p> <p>3: 400V specification IPM spindle motor</p> <p>4: 200V specification Tool spindle motor</p> <p>bit B-5 :</p> <p>Not used. Set to "0".</p> <p>bit 4 : fdir Position feedback</p> <p>Set the machine side encoder's installation polarity.</p> <p>0: Forward polarity 1: Reverse polarity</p> <p>bit 3 : vfb Speed feedback filter</p> <p>0: Disable 1: Enable (4500Hz)</p> <p>bit 2 : seqh READY ON sequence</p> <p>0: Normal 1: High-speed</p> <p>bit 1 : dfbx Dual feedback control</p> <p>Control the position FB signal in full closed control by the combination of a motor side encoder and machine side encoder.</p> <p>0: Stop 1: Start</p> <p>Related parameters: SP051, SP052</p> <p>bit 0 : fdir2 Speed feedback polarity</p> <p>Set the motor side encoder's installation polarity by a built-in motor.</p> <p>0: Forward polarity 1: Reverse polarity</p>		

15 Machine Parameters

15.9 Spindle Parameters

(PR)	#13018	SP018 SPEC2	Spindle specification 2																
		<p>Select the spindle specification. A function is allocated to each bit. Set this in hexadecimal format.</p> <p>Bit- F E D C B A 9 8 7 6 5 4 3 2 1 0</p> <table><tr><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td><td>0</td></tr></table> <p>oplp mkch spsu mpg</p>	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	
0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0				
		<p>bit F-A :</p> <p>Not used. Set to "0".</p> <p>bit 9 : mpg Earth fault detection</p> <p>0: Disable 1: Enable (standard)</p> <p>Set "0" and it is constantly "Enable" for MDS-EJ-SP Series.</p> <p>bit 8 : spsu Command speed limit value</p> <p>0: 33,750 r/min 1: 135,000 r/min</p> <p>bit 7-6 :</p> <p>Not used. Set to "0".</p> <p>bit 5 : mkch Coil switch function</p> <p>0: Disable 1: Enable</p> <p>bit 4-2 :</p> <p>Not used. Set to "0".</p> <p>bit 1 : oplp Open loop control</p> <p>This allows the operation in which no encoder feedback signals are used. It is used when adjusting the encoder, etc.</p> <p>0: Disable 1: Enable</p> <p>bit 0 :</p> <p>Not used. Set to "0".</p>																	

(PR)	#13019	SP019 RNG1	Sub side encoder resolution
		<p>[For semi-closed loop] Set the same value as SP020 (RNG2). (Refer to the explanation of SP020.)</p> <p>[For full-closed loop] Set the number of pulses per revolution of the machine side encoder.</p> <p>When using the encoder interface unit MDS-EX-HR, use this with SP097(RNG1ex).</p> <p>Encoder OSE-1024 (ABZ pulse): SP019=4096, SP097=-1</p> <p>TS5690(64 teeth): SP019 = 2000, SP097=0 TS5690(90 teeth): SP019 = 2880, SP097=0 TS5690(128 teeth): SP019 = 4000, SP097=0 TS5690(192 teeth): SP019 = 6000, SP097=0 TS5690(256 teeth): SP019 = 8000, SP097=0 TS5690(384 teeth): SP019 =12000, SP097=0</p> <p>ERM280(1200 teeth): SP019 = 4800, SP097=0 ERM280(2048 teeth): SP019 = 8000, SP097=0</p> <p>MPCI : SP019 = 7200, SP097=0 MBE205: SP019 = 2000, SP097=0 GEL2449M(524,288(p/rev)): SP019=0, SP097=8 MHS-04B Series(1,048,576(p/rev)): SP019=0, SP097=16</p> <p>---Setting range---</p> <p>When SP097=0, the setting range is from 0 to 32767 (kp) When SP097≠0, the setting range is from 0 to 65535 (p)</p>	

15 Machine Parameters

15.9 Spindle Parameters

(PR)	#13020	SP020 RNG2	Main side encoder resolution
			Set the number of pulses per revolution of the motor side encoder. Set the standard parameters for the motor with frame. ---Setting range--- When SP098=0, the setting range is from 0 to 32767 (kp) When SP098≠0, the setting range is from 0 to 65535 (p)
(PR)	#13021	SP021 OLT	Overload detection time constant
			Set the detection time constant of Overload 1 (Alarm 50). (For Mitsubishi Electric adjustment) Normally, set to "60". Set to "300" when using an IPM spindle motor. ---Setting range--- 1 to 15300 (s)
	#13022	SP022 OLL	Overload detection level
			Set the current detection level of "Overload 1" (Alarm 50) as a percentage against the motor short-time rated output current. (For Mitsubishi Electric adjustment) Normally, set to "120". Set to "100" when using an IPM spindle motor. ---Setting range--- 1 to 200 (Short-time rated %)
	#13023	SP023 OD1	Excessive error detection width (interpolation mode - spindle synchronization)
			Set the excessive error detection width for the interpolation mode and spindle synchronization. The standard setting is "120". When set to "0", the excessive error detection will be ignored, so do not set to "0". ---Setting range--- 1 to 32767 (°)
	#13024	SP024 INP	In-position width
			Set the in-position detection width. Set the positioning accuracy required to the machine. Lower setting value increases the positioning accuracy, but makes the cycle time (settling time) longer. The standard setting is "875". ---Setting range--- 0 to 32767 (1°/1000)
	#13025	SP025 INP2	2nd in-position width
			Use this when detecting an in-position different from normal in-position width such as advancing the in-position signal. The adjustment procedure is the same as SP024 (INP). The standard setting is "875". ---Setting range--- 0 to 32767 (1°/1000)
(PR)	#13026	SP026 TSP	Maximum motor speed
			Set the maximum motor speed. If the motor speed exceeds the set maximum speed, an overspeed alarm will occur. ---Setting range--- 1 to 32767 (r/min)
	#13027	SP027 ZSP	Motor zero speed
			Set the motor speed for detecting zero speed. If the motor speed drops below the set speed, the zero speed signal turns ON. The standard setting is "50". ---Setting range--- 1 to 1000 (r/min)

15 Machine Parameters

15.9 Spindle Parameters

	#13028	SP028 SDTS	Speed detection set value
			<p>Set the motor speed for detecting the speed. If the motor speed drops below the set speed, the speed detection signal turns ON. The standard setting is 10% of the maximum motor speed.</p> <p>---Setting range---</p> <p>10 to 32767 (r/min)</p>
	#13029	SP029 SDTR	Speed detection reset width
			<p>Set the hysteresis width in which the speed detection changes from ON to OFF. If the setting value is small, the speed detection will chatter easily. The standard setting is "30".</p> <p>---Setting range---</p> <p>10 to 1000 (r/min)</p>
	#13030	SP030 SDT2	2nd speed detection setting value
			<p>Set the specified speed of the specified speed output. When carrying out digital output of the specified speed output, set SP229/bitC to "1". It is not available for MDS-EJ-SP Series.</p> <p>---Setting range---</p> <p>0 to 32767 (r/min)</p>
(PR)	#13031	SP031 MTYP	Motor type
			<p>Set the control system of the spindle drive unit.</p> <p>2200: Semi closed loop control 4200: Full closed loop control by using spindle side ABZ pulse output encoder 6200: Full closed loop control by using spindle side serial output encoder</p>


15 Machine Parameters

15.9 Spindle Parameters

(PR)	#13032	SP032 PTYP	Power supply type/ Regenerative resistor type
------	--------	------------	---

MDS-E/EH Series: Power supply type

When connecting a power supply unit, set a code for each power supply unit.

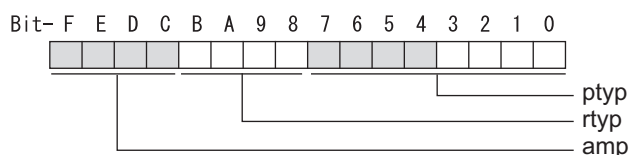**bit F-C : amp**

Set the power backup function to be used.

No function used : 0

Deceleration and stop function at power failure : 8

Retraction function at power failure: C

bit B-8 : rtyp

Not used. Set to "0".

bit 7-0 : ptyp External emergency stop setting

When the emergency stop input signal of the power supply unit is "disabled"

Power supply unit is not connected : 00

MDS-E-CV-37 / MDS-EH-CV-37 : 04

MDS-E-CV-75 / MDS-EH-CV-75 : 08

MDS-E-CV-110 / MDS-EH-CV-110 : 11

MDS-E-CV-185 / MDS-EH-CV-185 : 19

MDS-E-CV-300 / MDS-EH-CV-300 : 30

MDS-E-CV-370 / MDS-EH-CV-370 : 37

MDS-E-CV-450 / MDS-EH-CV-450 : 45

MDS-E-CV-550 / MDS-EH-CV-550 : 55

MDS-EH-CV-750 : 75

When the emergency stop input signal of the power supply unit is "enabled"

(Note) Set the power supply rotary switch to "4".

Power supply unit is not connected : 00

MDS-E-CV-37 / MDS-EH-CV-37 : 44

MDS-E-CV-75 / MDS-EH-CV-75 : 48

MDS-E-CV-110 / MDS-EH-CV-110 : 51

MDS-E-CV-185 / MDS-EH-CV-185 : 59

MDS-E-CV-300 / MDS-EH-CV-300 : 70

MDS-E-CV-370 / MDS-EH-CV-370 : 77


MDS-E-CV-450 / MDS-EH-CV-450 : 85

MDS-E-CV-550 / MDS-EH-CV-550 : 95

MDS-EH-CV-750 : B5

MDS-EM/EMH Series: Power supply type

Set as follows for the spindle drive section of the MDS-EM/EMH-SPV3.

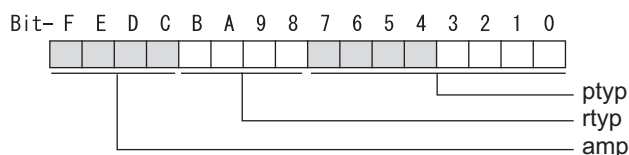**bit F-C : amp**

Not used. Set to "0".

bit B-8 : rtyp

Not used. Set to "0".

bit 7-0 : ptyp External emergency stop setting

Normal

MDS-EM: 20, MDS-EMH: 22, MDS-EM-SPV3-16040S: 16, MDS-EM-SPV3-320120: 37

External emergency stop function


MDS-EM: 60, MDS-EMH: 62, MDS-EM-SPV3-16040S: 56, MDS-EM-SPV3-320120: 77

15 Machine Parameters

15.9 Spindle Parameters

MDS-EJ-SP Series: Regenerative resistor type

Set the regenerative resistor type.

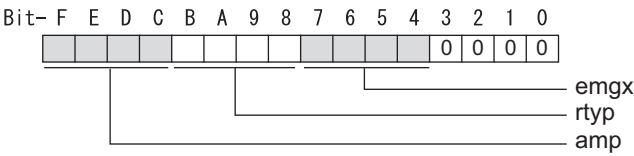

bit F-8 : amp(bit F-C) / rtyp(bit B-8)

Setting prohibited	: 10-12
MR-RB12 or GZG200W39OHMK	: 13
MR-RB32 or GZG200W120OHMK 3 units connected in parallel	: 14
MR-RB30 or GZG200W39OHMK 3 units connected in parallel	: 15
MR-RB50 or GZG300W39OHMK 3 units connected in parallel	: 16
Setting prohibited	: 17-1F
Setting prohibited	: 20-23
FCUA-RB22	: 24
FCUA-RB37	: 25
FCUA-RB55	: 26
FCUA-RB75/2 1 unit	: 27
R-UNIT1	: 28
R-UNIT2	: 29
R-UNIT3	: 2A
R-UNIT4	: 2B
R-UNIT5	: 2C
FCUA-RB75/2 2 units connected in parallel	: 2D
FCUA-RB55/2 2 units connected in parallel	: 2E
Setting prohibited	: 2F

bit 7-4 : emgx External emergency stop function

Set the external emergency stop function.

0: Disable 4: Enable

bit 3-0 :

Not used. Set to "0".

15 Machine Parameters


15.9 Spindle Parameters

#13033

SP033 SFNC1

Spindle function 1

Select the spindle specification.
A function is allocated to each bit.
Set this in hexadecimal format.

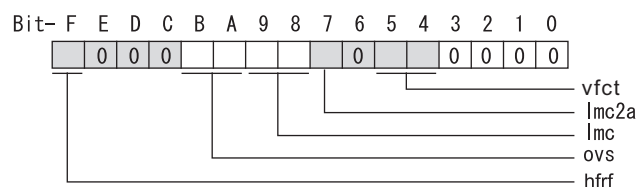**bit F : hfrf Higher harmonic suppression filter**

0: Stop
1: Start

bit E-C :

Not used. Set to "0".

bit B-A : ovs Overshoot compensation

Set this parameter when overshooting occurs during positioning.

bitB,A=

00: Compensation stop
01: Setting prohibited
10: Setting prohibited
11: Compensation type 3

Set the compensation amount in SP043(OVS1) and SP042(OVS2).

bit 9-8 : lmc Lost motion compensation type2

Set this parameter when the protrusion at quadrant change is too large.

bit9,8=

00: Compensation stop
01: Setting prohibited
10: Compensation type 2
11: Setting prohibited

Set the compensation amount in SP048(LMC1) and SP041(LMC2).

bit 7 : lmc2a Lost motion compensation 2 timing

0: Normal 1: Change

bit 6 :

Not used. Set to "0".

bit 5-4 : vfct Jitter compensation pulse number

Suppress vibration by machine backlash when axis stops.

bit5,4=

00: Disable
01: 1 pulse
10: 2 pulse
11: 3 pulses

bit 3-0 :

Not used. Set to "0".

15 Machine Parameters


15.9 Spindle Parameters

#13034

SP034 SFNC2

Spindle function 2

Select the spindle function.
A function is allocated to each bit.
Set this in hexadecimal format.

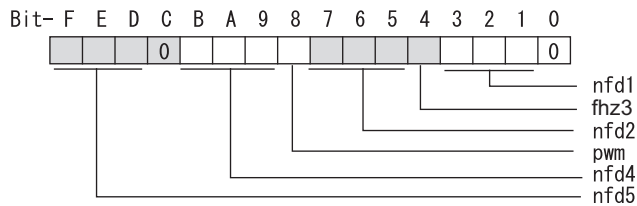**bit F-D : nfd5 Depth of Notch filter 5**

Set the depth of Notch filter 5 (SP088).

bit F,E,D=

000: $-\infty$

001: -18.1[dB]

010: -12.0[dB]

011: -8.5[dB]

100: -6.0[dB]

101: -4.1[dB]

110: -2.5[dB]

111: -1.2[dB]

bit C :

Not used. Set to "0".

bit B-9 : nfd4 Depth of Notch filter 4

Set the depth of Notch filter 4 (SP087).

bit B,A,9=

000: $-\infty$

001: -18.1[dB]

010: -12.0[dB]

011: -8.5[dB]

100: -6.0[dB]

101: -4.1[dB]

110: -2.5[dB]

111: -1.2[dB]

bit 8 : pwm Current control

0: Standard current control 1: High frequency current control

bit 7-5 : nfd2 Depth of Notch filter 2

Set the depth of Notch filter 2 (SP046).

bit 7,6,5=

000: $-\infty$

001: -18.1[dB]

010: -12.0[dB]

011: -8.5[dB]

100: -6.0[dB]

101: -4.1[dB]

110: -2.5[dB]

111: -1.2[dB]

bit 4 : fhz3 Notch filter 3

0: Stop 1: Start (1125Hz)

bit 3-1 : nfd1 Depth of Notch filter 1

Set the depth of Notch filter 1 (SP038).

bit 3,2,1=

000: $-\infty$

001: -18.1[dB]

010: -12.0[dB]

011: -8.5[dB]

100: -6.0[dB]

101: -4.1[dB]

110: -2.5[dB]

111: -1.2[dB]

15 Machine Parameters

15.9 Spindle Parameters

bit 0 :

Not used. Set to "0".

(PR)	#13035	SP035 SFNC3	Spindle function 3
		Select the spindle function. A function is allocated to each bit. Set this in hexadecimal format.	

bit F-D :

Not used. Set to "0".

bit C : shgn SHG control in interpolation mode

0: Stop 1: Start

When using the OMR-FF control, set to "0".

bit B :

Not used. Set to "0".

bit A : pyn Excitation rate selection in interpolation mode

0: Select Excitation rate 1 1: Select Excitation rate 2

bit 9 : vgn Speed loop gain set selection in interpolation mode

0: Select Set 1 1: Select Set 2

bit 8-7 :

Not used. Set to "0".

bit 6 : rtt_vgn Real-time tuning I in non-interpolation mode / speed gain adaptation stop

0: Stop 1: Start

bit 5-3 :

Not used. Set to "0".

bit 2 : pyin Excitation rate selection in non-interpolation mode

The excitation rate after the in-position can be selected.

0: Select Excitation rate 1 1: Select Excitation rate 2

bit 1 : vgn Speed loop gain set selection in non-interpolation mode

The speed loop gain set after the in-position can be selected.

0: Select Set 1 1: Select Set 2

bit 0 :

Not used. Set to "0".

15 Machine Parameters

15.9 Spindle Parameters

(PR)	#13036	SP036 SFNC4	Spindle function 4
		Select the spindle function. A function is allocated to each bit. Set this in hexadecimal format.	
		bit F-8 : Not used. Set to "0".	
		bit 7 : mksl Coil selection in spindle synchronization mode 0: Select the coil commanded during synchronization 1: Select high-speed coil	
		bit 6 : rtt_vgns Real-time tuning I in spindle synchronization mode / speed gain adaptation stop 0: Stop 1: Start	
		bit 5 : Not used. Set to "0".	
		bit 4 : shgs SHG control in spindle synchronization mode 0: Stop 1: Start When using the OMR-FF control, set to "0".	
		bit 3 : Not used. Set to "0".	
		bit 2 : pys Excitation rate selection in spindle synchronization mode 0: Select Excitation rate 1 1: Select Excitation rate 2	
		bit 1 : vgs Speed loop gain set selection in spindle synchronization mode 0: Select Set 1 (SP005,SP006,SP007) 1: Select Set 2 (SP008,SP009,SP010)	
		bit 0 : Not used. Set to "0".	
#13037	SP037 JL	Load inertia scale	
		Set the motor axis conversion total load inertia including motor itself in proportion to the motor inertia. $SV037(JL) = (J_m + J_l) / J_m \times 100$ Jm: Motor inertia Jl: Motor axis conversion load inertia ---Setting range--- 0 to 5000 (%)	
#13038	SP038 FHz1	Notch filter frequency 1	
		Set the vibration frequency to suppress when machine vibration occurs. (Enabled at 50 or more.) When not using, set to "0". Related parameters: SP034/bit3-1 ---Setting range--- 0 to 5000 (Hz)	
#13039	SP039 LMCD	Lost motion compensation timing	
		Set this parameter when the lost motion compensation type2 timing does not match. Adjust by increasing the value by 10 at a time. ---Setting range--- 0 to 2000 (ms)	

15 Machine Parameters

15.9 Spindle Parameters

#13040	SP040 LMCT	Lost motion compensation non-sensitive band
	Set the non-sensitive band of the lost motion compensation in the feed forward control. When "0" is set, 2°/1000 is set. Adjust by increasing the value by 1°/1000 at a time.	
	---Setting range---	
	-32768 to 32767 (1°/1000)	
#13041	SP041 LMC2	Lost motion compensation 2
	Set this parameter with SP048(LMC1) only to vary the lost motion compensation amount depending on the command directions. Normally, set to "0".	
	---Setting range---	
	-1 to 200 (Short-time rated %) Note that when SP227/bit2 is "1", the range will be -1 to 20000 (Short-time rated 0.01%).	
#13042	SP042 OVS2	Overshooting compensation 2
	Set this parameter with SP043(OVS1) only to vary the lost motion compensation amount depending on the command directions. Normally, set to "0".	
	---Setting range---	
	-1 to 100 (Short-time rated %) Note that when SP227/bit2 is "1", the range will be -1 to 10000 (Short-time rated 0.01%).	
#13043	SP043 OVS1	Overshooting compensation 1
	Set this parameter when overshooting occurs during positioning. This compensates the motor torque during positioning. This is valid only when the overshooting compensation SP033 (SFNC1/ovs) is selected.	
	[Type 3 "When SP033/ bitB,A=11"] Use this when performing overshoot compensation in the feed forward control during arc cutting mode. Set the compensation amount based on the motor short-time rated current. Increase the value in increments of 1% to find the value where overshooting ceases.	
	[To vary compensation amount depending on the direction] When SV042 (OVS2) is "0", change the SP043 (OVS1) value in both +/- directions to compensate. To change the compensation amount depending on the command direction, set this with SP042 (OVS2). (SP043: + direction, SP042: - direction, However, the directions may be opposite depending on other settings.) When "-1" is set, the compensation will not be performed in the command direction.	
	---Setting range---	
	-1 to 100 (Short-time rated %) Note that when SP227/bit2 is "1", the range will be -1 to 10000 (Short-time rated 0.01%).	
#13044	SP044 OBS2	Disturbance observer gain
	Set the disturbance observer gain. The standard setting is "100". To use the disturbance observer, also set SP037(JL), SP045(OBS1) and SP226/ bitE. When not using, set to "0".	
	---Setting range---	
	0 to 500 (%)	
#13045	SP045 OBS1	Disturbance observer filter frequency
	Set the disturbance observer filter band. Normally, set to "100". To use the disturbance observer, also set SP037(JL), SP044(OBS2) and SP226/ bitE. When not using, set to "0".	
	---Setting range---	
	0 to 1000 (rad/s)	

15 Machine Parameters

15.9 Spindle Parameters

#13046	SP046 FHz2	Notch filter frequency 2
	Set the vibration frequency to suppress when machine vibration occurs. (Enabled at 50 or more.) When not using, set to "0". Related parameters: SP034/bit7-5 ---Setting range--- 0 to 5000 (Hz)	
#13047	SP047 EC	Inductive voltage compensation gain
	Set the inductive voltage compensation gain. Normally, set to "100". Lower the gain when the current FB peak exceeds the current command peak. ---Setting range--- 0 to 200 (%)	
#13048	SP048 LMC1	Lost motion compensation 1
	Set this parameter when the protrusion (that occurs due to the non-sensitive band by friction, torsion, backlash, etc.) at quadrant change is too large. This sets the compensation torque at quadrant change (when an axis feed direction is reversed) by Short-time rated %. Whether to enable the lost motion compensation and the method can be set with other parameters. [Type 2 "When SP033/bit9,8=10"] Set the compensation amount based on the motor short-time rated current. The standard setting is double of the friction torque. The compensation amount will be 0 when "0" is set. Related parameters: SP033/bit9-8, SP039, SP040, SP041, SP227/bit2 [To vary compensation amount depending on the direction] When SP041 (LMC2) is "0", change SP048 (LMC1) value in both of +/- directions to compensate. To vary the compensation amount depending on the command direction, set this with SP041 (LMC2). (SP048: + direction, SP041: - direction, However, the directions may be opposite depending on other settings.) When "-1" is set, the compensation will not be performed in the command direction. ---Setting range--- -1 to 200 (Short-time rated %) Note that when SP227/bit2 is "1", the range will be -1 to 20000 (Short-time rated 0.01%).	
#13049	SP049 FFC	Acceleration rate feed forward gain
	When a relative error in the synchronous control is too large, set this parameter to the axis that is delaying. The standard setting is "0". The standard setting in the SHG control is "50". Adjust relative errors in acceleration/deceleration by increasing the value by 50. ---Setting range--- 0 to 999 (%)	
#13050	SP050 TOF	Torque offset
	Set the imbalance torque. ---Setting range--- -100 to 100 (Short-time rated %)	
#13051	SP051 DFBT	Dual feed back control time constant
	Set the control time constant in dual feed back. When the function is valid, the standard setting is "100". When "0" is set, the value is 1 ms. When the time constant is increased, the operation will get closer to the semi-closed control and the limit of the position loop gain will be raised. However, this cannot be used when the spindle slip occurs in machine configuration such as V-belt drive. Related parameters: SP017/bit1, SP052 ---Setting range--- 0 to 9999 (ms)	

15 Machine Parameters

15.9 Spindle Parameters

#13052		SP052 DFBN	Dual feedback control non-sensitive band
		Set the non-sensitive band in the dual feedback control. Normally set to "0".	
		Related parameters: SP017/bit1, SP051	
		---Setting range---	
		0 to 9999 (1/1000°)	
#13053		SP053 ODS	Excessive error detection width (non-interpolation mode)
		Set the excessive error detection width in non-interpolation mode. Standard setting value: ODS = Maximum motor speed [r/min] × 6/PGV/2	
		When set to "0", the excessive error detection will not be performed.	
		---Setting range---	
		0 to 32767 (°)	
#13054		SP054 ORE	Overrun detection width in closed loop control
		Set the overrun detection width in the full-closed loop control. When the gap between the motor side encoder and the machine side encoder exceeds the set value, it is judged as an overrun and "Alarm 43" is detected. When "-1" is set, if the differential velocity between the motor side encoder and the machine side encoder exceeds the 30% of the maximum motor speed, it will be judged as overrun and "Alarm 43" will be detected. When "0" is set, overrun will be detected with 2°. In the full-closed loop control, normally set this parameter to "360". During V-belt drive, set to "-1".	
		---Setting range---	
		-1 to 32767 (°)	
#13055		SP055 EMGx	Max. gate off delay time after emergency stop
		Set the time required to forcibly execute READY OFF after the emergency stop is input. Normally set to "5000". When 5000ms or more is set for deceleration time constant at emergency stop(SP056), set the same value as SP056. When using the power backup system (MDS-D/DH-PFU) and setting the value of this parameter to 5000ms or more, a communication error between NC and drive unit may occur when power restarts after a instantaneous power interrupt. It is not a problem so turn the NC power ON again to start up. When "0" is set, 7000ms is the actual value to be set.	
		Related parameters: SP056, SP230	
		---Setting range---	
		0 to 29900 (ms)	
#13056		SP056 EMGt	Deceleration time constant at emergency stop
		Set the time constant used for the deceleration control at emergency stop. Set the time required to stop from the maximum motor speed (TSP). When "0" is set, the deceleration control is executed with "7000ms".	
		Related parameters: SP055, SP230	
		---Setting range---	
		0 to 29900 (ms)	
(PR)	#13057	SP057 GRA1	Spindle side gear ratio 1
		Set the number of gear teeth on the spindle side when "the gear selection command (control input 4/bit6, 5)" is set to "00".	
		---Setting range---	
		1 to 32767	
(PR)	#13058	SP058 GRA2	Spindle side gear ratio 2
		Set the number of gear teeth on the spindle side when "the gear selection command (control input 4/bit6, 5)" is set to "01".	
		---Setting range---	
		1 to 32767	



15 Machine Parameters

15.9 Spindle Parameters

(PR)	#13059	SP059 GRA3	Spindle side gear ratio 3
	Set the number of gear teeth on the spindle side when "the gear selection command (control input 4/bit6, 5)" is set to "10".		
	---Setting range---		
	1 to 32767		
(PR)	#13060	SP060 GRA4	Spindle side gear ratio 4
	Set the number of gear teeth on the spindle side when "the gear selection command (control input 4/bit6, 5)" is set to "11".		
	---Setting range---		
	1 to 32767		
(PR)	#13061	SP061 GRB1	Motor side gear ratio 1
	Set the number of gear teeth on the motor side when "the gear selection command (control input 4/bit6, 5)" is set to "00".		
	---Setting range---		
	1 to 32767		
(PR)	#13062	SP062 GRB2	Motor side gear ratio 2
	Set the number of gear teeth on the motor side when "the gear selection command (control input 4/bit6, 5)" is set to "01".		
	---Setting range---		
	1 to 32767		
(PR)	#13063	SP063 GRB3	Motor side gear ratio 3
	Set the number of gear teeth on the motor side when "the gear selection command (control input 4/bit6, 5)" is set to "10".		
	---Setting range---		
	1 to 32767		
(PR)	#13064	SP064 GRB4	Motor side gear ratio 4
	Set the number of gear teeth on the motor side when "the gear selection command (control input 4/bit6, 5)" is set to "11".		
	---Setting range---		
	1 to 32767		
	#13065	SP065 TLM1	Torque limit 1
	Set the torque limit value when the torque limit (spindle control input 1/bitA, 9, 8) is set to "001" (TL3, TL2, TL1 = 001).		
	---Setting range---		
	0 to 999 (Short-time rated %)		
	#13066	SP066 TLM2	Torque limit 2
	Set the torque limit value when the torque limit (spindle control input 1/bitA, 9, 8) is set to "010" (TL3, TL2, TL1 = 010).		
	---Setting range---		
	0 to 999 (Short-time rated %)		
	#13067	SP067 TLM3	Torque limit 3
	Set the torque limit value when the torque limit (spindle control input 1/bitA, 9, 8) is set to "011" (TL3, TL2, TL1 = 011).		
	---Setting range---		
	0 to 999 (Short-time rated %)		
	#13068	SP068 TLM4	Torque limit 4
	Set the torque limit value when the torque limit (spindle control input 1/bitA, 9, 8) is set to "100" (TL3, TL2, TL1 = 100).		
	---Setting range---		
	0 to 999 (Short-time rated %)		

15 Machine Parameters

15.9 Spindle Parameters
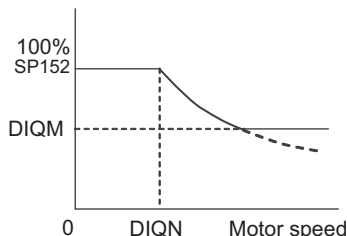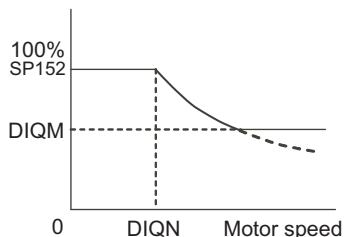
#13069	SP069 PCMP	Phase alignment completion width
<p>Set the single-rotation position alignment completion width for phase alignment and changing from non-interpolation to spindle synchronization mode during rotation.</p> <p>Set the rotation error that is required to the machine.</p> <p>When the setting value decreases, the rotation error will decrease, but the cycle time (settling time) will get longer. The standard setting is "875".</p> <p>---Setting range---</p> <p>0 to 32767 (1°/1000)</p>		
#13070	SP070 KDDT	Phase alignment deceleration rate scale
<p>Set the scale for SP016 (DDT) to change the deceleration rate only during rotation command (command F Δ T ≠ 0).</p> <p>When the setting value increases, the single-rotation position alignment will be completed faster, but the impact to the machine will also increase. When not using, set to "0".</p> <p>---Setting range---</p> <p>0 to 255 (1/16-fold)</p>		
#13071	SP071 DIQM	Variable current limit during deceleration, lower limit value
<p>Set this parameter to adjust the deceleration time by changing the current limit value during deceleration depending on the motor speed.</p> <p>As shown below, set the lower limit rate of the current limit in SP071 (DIQM), and use with SP072 (DIQN). When DIQM is set to 100%, the standard current limit value in deceleration (SP152) is applied.</p>  <p>---Setting range---</p> <p>0 to 999 (%)</p>		
#13072	SP072 DIQN	Variable current limit during deceleration, break point speed
<p>Set this parameter to adjust the deceleration time by changing the current limit value during deceleration depending on the motor speed.</p> <p>As shown below, set the lower limit rate of the current limit in SP071 (DIQM), and use with SP072 (DIQN). When DIQM is set to 100%, the standard current limit value in deceleration (SP152) is applied.</p>  <p>---Setting range---</p> <p>1 to 32767 (r/min)</p>		

15 Machine Parameters

15.9 Spindle Parameters

#13073	SP073 VGVN	Variable speed gain target value
--------	------------	----------------------------------


If noise is bothersome during high speed rotation, it may be reduced by lowering the speed loop gain at high speed.

Set this value to ensure the adequate response by suppressing noise and vibration at low speeds and increasing the speed loop gain at high speeds for a high-speed spindle of machining center, etc.


As shown below, set the speed loop gain rate for the overspeed detection speed in SP073 (VGVN), and use with SP074 (VGVS).

When not using, set to "0".

This function can be used when either Speed loop gain set 1 or Speed loop gain set 2 is selected.

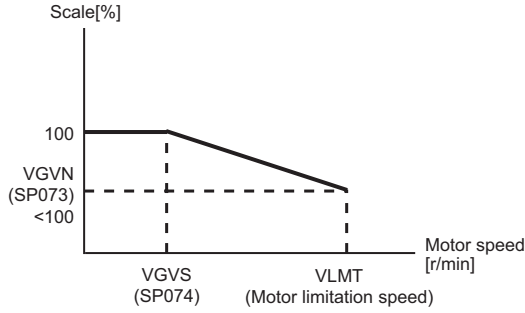

When lowering the speed loop gain at high speed

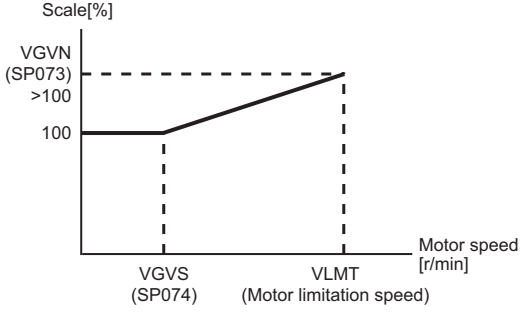

When increasing the speed loop gain at high speed

---Setting range---

0 to 999 (%)

#13074	SP074 VGVS	Variable speed gain change start speed
--------	------------	--


If noise is bothersome during high speed rotation, it may be reduced by lowering the speed loop gain at high speed.

Set this value to ensure the adequate response by suppressing noise and vibration at low speeds and increasing the speed loop gain at high speeds for a high-speed spindle of machining center, etc.


As shown below, set the speed loop gain rate for the overspeed detection speed in SP073 (VGVN), and use with SP074 (VGVS).

When not using, set to "0".

This function can be used when either Speed loop gain set 1 or Speed loop gain set 2 is selected.

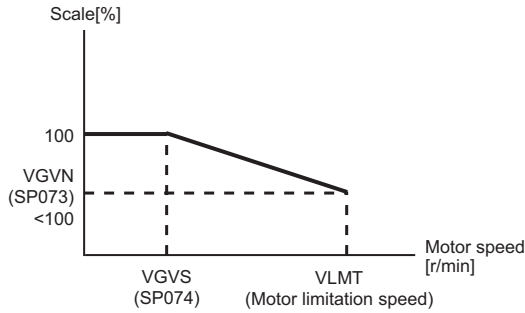

When lowering the speed loop gain at high speed

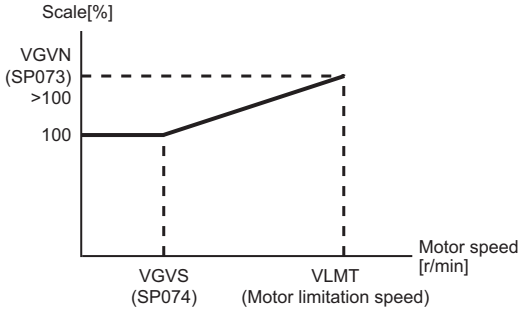

When increasing the speed loop gain at high speed

---Setting range---

0 to 32767 (r/min)

#13075	SP075 DWSH	Slip compensation scale during regeneration high-speed coil
--------	------------	---

Set the slip frequency scale during deceleration.

Normally, set to "0". (For Mitsubishi Electric adjustment)

---Setting range---

0 to 255 (1/16-fold)

15 Machine Parameters

15.9 Spindle Parameters

#13076	SP076 DWSL	Slip compensation scale during regeneration low-speed coil
Set the slip frequency scale at deceleration when using the low-speed coil. Normally, set to "0". (For Mitsubishi Electric adjustment)		
---Setting range---		
0 to 255 (1/16-fold)		
#13077	SP077 IQA	Q axis current lead compensation
Set the current loop gain. To use the coil switch function, set the current loop gain for when the high-speed coil is selected. The setting value is determined by the motor's electrical characteristics so that the value is fixed to each motor used. Set the value given in the spindle parameter list. (For Mitsubishi Electric adjustment)		
---Setting range---		
1 to 20480		
#13078	SP078 IDA	D axis current lead compensation
Set the current loop gain. To use the coil switch function, set the current loop gain for when the high-speed coil is selected. The setting value is determined by the motor's electrical characteristics so that the value is fixed to each motor used. Set the value given in the spindle parameter list. (For Mitsubishi Electric adjustment)		
---Setting range---		
1 to 20480		
#13079	SP079 IQG	Q axis current gain
Set the current loop gain. To use the coil switch function, set the current loop gain for when the high-speed coil is selected. The setting value is determined by the motor's electrical characteristics so that the value is fixed to each motor used. Set the value given in the spindle parameter list. (For Mitsubishi Electric adjustment)		
---Setting range---		
1 to 8192		
#13080	SP080 IDG	D axis current gain
Set the current loop gain. To use the coil switch function, set the current loop gain for when the high-speed coil is selected. The setting value is determined by the motor's electrical characteristics so that the value is fixed to each motor used. Set the value given in the spindle parameter list. (For Mitsubishi Electric adjustment)		
---Setting range---		
1 to 8192		
#13081	SP081 IQAL	Q axis current lead compensation low-speed coil
When using coil switch function, set the current loop gain for when the low-speed coil is selected. The setting value is determined by the motor's electrical characteristics so that the value is fixed to each motor used. Set the value given in the spindle parameter list. (For Mitsubishi Electric adjustment)		
---Setting range---		
1 to 20480		
#13082	SP082 IDAL	D axis current lead compensation low-speed coil
When using coil switch function, set the current loop gain for when the low-speed coil is selected. The setting value is determined by the motor's electrical characteristics so that the value is fixed to each motor used. Set the value given in the spindle parameter list. (For Mitsubishi Electric adjustment)		
---Setting range---		
1 to 20480		

15 Machine Parameters

15.9 Spindle Parameters

#13083	SP083 IQGL	Q axis current gain low-speed coil
<p>When using coil switch function, set the current loop gain for when the low-speed coil is selected. The setting value is determined by the motor's electrical characteristics so that the value is fixed to each motor used.</p> <p>Set the value given in the spindle parameter list. (For Mitsubishi Electric adjustment)</p> <p>---Setting range---</p> <p>1 to 8192</p>		
#13084	SP084 IDGL	D axis current gain low-speed coil
<p>When using coil switch function, set the current loop gain for when the low-speed coil is selected. The setting value is determined by the motor's electrical characteristics so that the value is fixed to each motor used.</p> <p>Set the value given in the spindle parameter list. (For Mitsubishi Electric adjustment)</p> <p>---Setting range---</p> <p>1 to 8192</p>		
#13085	SP085	
Not used. Set to "0".		
#13086	SP086	
Not used. Set to "0".		
#13087	SP087 FH _z 4	Notch filter frequency 4
<p>Set the vibration frequency to suppress when machine vibration occurs. (Enabled at 50 or more.) When not using, set to "0".</p> <p>Related parameters: SP034/bitB-9</p> <p>---Setting range---</p> <p>0 to 5000 (Hz)</p>		
#13088	SP088 FH _z 5	Notch filter frequency 5
<p>Set the vibration frequency to suppress when machine vibration occurs. (Enabled at 50 or more.) When not using, set to "0".</p> <p>Related parameters: SP034/bitF-D</p> <p>---Setting range---</p> <p>0 to 5000 (Hz)</p>		
#13089	SP089 TMKQ	Spindle output stabilizing gain Q axis
<p>Set the magnification of the torque current stabilizing gain. (For Mitsubishi Electric adjustment) When set to "0", the torque current stabilization is disabled. When not using, set to "0".</p> <p>---Setting range---</p> <p>0 to 32767</p>		
#13090	SP090 TMKD	Spindle output stabilizing gain D axis
<p>Set the magnification of the excitation current stabilizing gain. (For Mitsubishi Electric adjustment) When set to "0", the excitation current stabilization is disabled. When not using, set to "0".</p> <p>---Setting range---</p> <p>0 to 32767</p>		
#13091	SP091	
Not used. Set to "0".		
#13092	SP092	
Not used. Set to "0".		
#13093	SP093	
Not used. Set to "0".		

15 Machine Parameters

15.9 Spindle Parameters

#13094	SP094 MPV	Magnetic pole error detection speed
	<p>In the magnetic pole position detection function, the command motor speed and motor speed during the position command stop are monitored.</p> <p>Set the command motor speed level and motor speed level during the position command stop in "r/min" unit. When the command motor speed level is set to "0", the magnetic pole position error is detected at 10r/min. Set to "10" as a standard setting when the magnetic pole position error detection function is enabled. This detects the magnetic pole position error when the motor speed is "100r/min".</p> <p>Ten-thousands digit, Thousands digit ----- Command motor speed level (10r/min) Hundreds digit, Tens digit, Ones digit ----- Motor speed level (10r/min)</p> <p>---Setting range---</p> <p>0 to 31999</p>	
#13095	SP095 VIAX	Lead compensation scale during high-response acceleration/deceleration
	<p>Set the magnification against delay/lead compensation (SP006) of the high-response acceleration/deceleration (valid when SP226/ bitD is set to "1"). Normally, set to "0". Set this parameter to suppress overshooting when the speed is reached.</p> <p>---Setting range---</p> <p>0 to 10000 (0.01%)</p>	
#13096	SP096 SDW	Speed slowdown allowable width
	<p>When the spindle slows down due to multiple cutting, set the processable speed as percentage against the NC command speed.</p> <p>If the speed reduces below the tolerable range, the alarm 23 (Excessive speed error) will occur.</p> <p>(E.g.) When set to 90 [%]</p> <p>If S1000 is commanded, the speed reduced by 900r/min (=1000r/min × 90%) is the allowable lower limit. Thus if the spindle speed reduces to 100r/min or below, the alarm will occur.</p> <p>When "0" is set, the magnification is the same as when "85" is set. When set to "-1", the allowable width will be disabled.</p> <p>---Setting range---</p> <p>-1,0 to 100 (%)</p>	
#13097	SP097 RNG1ex	Extension sub side encoder resolution
	<p>When setting the machine side encoder resolution in pulse (p) unit, set the number of pulses to four bite data of SP097 (high-order) and SP019 (low-order) in pulse (p) unit.</p> <p>When SP097=0, the setting unit of SP019 is (kp). Refer to SP019 for details.</p> <p>Related parameters: SP019, SP020, SP098</p> <p>---Setting range---</p> <p>-1 to 32767</p>	
#13098	SP098 RNG2ex	Extension main side encoder resolution
	<p>When setting the motor side encoder resolution in pulse (p) unit, set the number of pulses to four bite data of SP098 (high-order) and SP020 (low-order) in pulse (p) unit.</p> <p>When SP098=0, the setting unit of SP020 is (kp). Refer to SP020 for details.</p> <p>Related parameters: SP019, SP020, SP097</p> <p>---Setting range---</p> <p>-1 to 32767</p>	
#13099-13105	SP099-SP105	
	Not used. Set to "0".	

15 Machine Parameters

15.9 Spindle Parameters

#13106	SP106 PGM	OMR-FF scale model gain
		<p>Set the scale model gain (position response) in OMR-FF control. Set the same value as SV002(PGN). Increase the setting value to perform a high-speed machining such as a fine arc or to improve the path error. Lower the value when vibration occurs during acceleration/deceleration. Set to "0" when not using OMR-FF control.</p> <p>---Setting range---</p> <p>0 to 300 (rad/s)</p>
#13107-13111	SP107-SP111	
		Not used. Set to "0".
#13112	SP112 IFF	OMR-FF current feed forward gain
		<p>Set the current feed forward rate in OMR-FF control. The standard setting is "10000". Setting value of 0 is equal to "10000(100%)" setting. Set to "0" when not using OMR-FF control.</p> <p>---Setting range---</p> <p>0 to 32767 (0.01%)</p>
#13113	SP113 OPLP	Current command value for open loop
		<p>Set the current command value for when the open loop control is enabled. When "0" is set, the state will be the same as when "50" is set. When not using, set to "0". The open loop control is enabled when "SP018/bit1" is set to "1".</p> <p>---Setting range---</p> <p>0 to 999 (Short-time rated %)</p>
#13114	SP114 MKT	Coil changeover gate cutoff timer
		<p>Set the time required to cut off the gate when turning OFF/ON the coil switch contactor. The value should be longer than the coil switch contactor's OFF/ON time. The standard setting is "150".</p> <p>---Setting range---</p> <p>0 to 3500 (ms)</p>
#13115	SP115 MKT2	Coil changeover current limit timer
		<p>Set the time required to limit the current immediately after the coil switch contactor ON/OFF is completed and the gate is turned ON. The standard setting is "250".</p> <p>---Setting range---</p> <p>0 to 3500 (ms)</p>
#13116	SP116 MKIL	Coil changeover current limit value
		<p>Set the time required to limit the current immediately after the coil switch contactor ON/OFF is completed and the gate is turned ON. The standard setting is "120".</p> <p>---Setting range---</p> <p>0 to 999 (Short-time rated %)</p>
#13117	SP117 SETM	Excessive speed deviation timer
		<p>Set the time to detect the speed excessive error alarm. Set the time required to the machine. The standard setting is "12".</p> <p>---Setting range---</p> <p>0 to 60 (s)</p>

15 Machine Parameters

15.9 Spindle Parameters

(PR)	#13118	SP118 MSFT	Magnetic pole shift amount
			<p>Set the magnetic pole shift amount of IPM spindle motor. During DC excitation of the initial setup: Set the same value displayed in the "AFLT gain" on the NC monitor screen in SP225/bit4=1. When not using, set to "0".</p> <p>---Setting range---</p> <p>-18000 to 18000 (electrical angle 0.01°)</p>
	#13119	SP119	Not used. Set to "0".
	#13120	SP120	Not used. Set to "0".
	#13121	SP121 MP Kpp	Magnetic pole detection position loop gain
			<p>Set the position loop gain in the magnetic polar detection loop. This is used in the initial magnetic polar detection when the IPM spindle motor is turned ON. Set to "0" when using an IM spindle motor.</p> <p>---Setting range---</p> <p>0 to 32767</p>
	#13122	SP122 MP Kvp	Magnetic pole detection speed loop gain
			<p>Set the speed loop gain in the magnetic polar detection loop. This is used in the initial magnetic polar detection when the IPM spindle motor is turned ON. Set to "0" when using an IM spindle motor.</p> <p>---Setting range---</p> <p>0 to 32767</p>
	#13123	SP123 MP Kvi	Magnetic pole detection speed loop lead compensation
			<p>Set the speed loop lead compensation in the magnetic polar detection loop. This is used in the initial magnetic polar detection when the IPM spindle motor is turned ON. Set to "0" when using an IM spindle motor.</p> <p>---Setting range---</p> <p>0 to 32767</p>
	#13124	SP124 ILMTsp	Magnetic pole detection current limit value
			<p>Set the current limit value for the magnetic polar detection loop. This is used in the initial magnetic polar detection when the IPM spindle motor is turned ON. Set to "0" when using an IM spindle motor.</p> <p>---Setting range---</p> <p>0 to 999 (Short-time rated %)</p>
	#13125	SP125 DA1NO	D/A output ch1 data No. / Initial DC excitation level
			<p>Input the desired data number to D/A output channel. When using the 2-axis drive unit, set "-1" to the axis that the data will not be output.</p> <p>When the DC excitation is running: Use in the DC excitation function. DC excitation: Set the initial excitation level when SP225/bit4=1. When "0" is set, the state will be the same as when "20" is set.</p> <p>---Setting range---</p> <p>-32768 to 32767</p>
	#13126	SP126 DA2NO	D/A output ch2 data No. / Final DC excitation level
			<p>Input the desired data number to D/A output channel. When using the 2-axis drive unit, set "-1" to the axis that the data will not be output.</p> <p>When the DC excitation is running: Use in the DC excitation function. DC excitation: Set the final excitation level when SP225/bit4=1. When "0" is set, the state will be the same as when "50" is set.</p> <p>---Setting range---</p> <p>-32768 to 32767</p>

15 Machine Parameters

15.9 Spindle Parameters

#13127	SP127 DA1MPY	D/A output ch1 output scale / Initial DC excitation time
		<p>Set the output scale in increments of 1/100. When "0" is set, the scale is the same as when "100" is set.</p> <p>When the DC excitation is running: Use in the DC excitation function. DC excitation: Set the initial excitation time when SP225/bit4=1. When "0" is set, the state will be the same as when "10000" is set.</p> <p>---Setting range---</p> <p>-32768 to 32767 (1/100-fold)</p>
#13128	SP128 DA2MPY	D/A output ch2 output scale
		<p>Set the output scale in increments of 1/100. When "0" is set, the scale is the same as when "100" is set.</p> <p>---Setting range---</p> <p>-32768 to 32767 (1/100-fold)</p>
(PR) #13129-13141	SP129-SP141	
		<p>Set the unique constants for the spindle motor. (High-speed coil) The setting value is determined by the motor's mechanical and electrical characteristics and specifications, so normally set the value given in the spindle parameter list.</p>
(PR) #13142	SP142	
		<p>Set the unique constants for the spindle motor. (High-speed coil) The setting value is determined by the motor's mechanical and electrical characteristics and specifications, so normally set the value given in the spindle parameter list. For IPM spindle motor This parameter is used in initial magnetic pole detection of IPM spindle motor. (1) Pulse application time: Set it in [μs] unit. (0 < application time < 350) (2) Pulse application coil: To select a low-speed coil, add 1000 to the pulse application time. (3) Polarity of estimated magnetic pole: When it is set to the reverse polarity, add "-" to the total of (1) and (2). E.g.: When performing 333μs pulse-applied magnetic pole estimation in a low-speed coil and selecting the reverse polarity for the estimated polarity SP142 = -(333+1000) = -1333</p>
(PR) #13143-13160	SP143-SP160	
		<p>Set the unique constants for the spindle motor. (High-speed coil) The setting value is determined by the motor's mechanical and electrical characteristics and specifications, so normally set the value given in the spindle parameter list.</p>
(PR) #13161-13192	SP161-SP192	
		<p>Set the unique constants for the spindle motor. (Low-speed coil) The setting value is determined by the motor's mechanical and electrical characteristics and specifications, so normally set the value given in the spindle parameter list.</p>
#13193	SP193 LMR	Change magnification for load meter standard output (High-speed coil)
		<p>Set the standard output to be displayed as 100% in load meter using the short-time rated output ratio. To display the continuous rated output as 100%, set as follows. Continuous rated output/Short-time rated output \times 100 When "0" is set, the standard output to be displayed as 100% in load meter will be the short-time rated output. (Note) When several output characteristics such as 15-minute rating and 30-minute rating are plotted on the characteristics figure, set the change magnification for the characteristic with the highest rated output.</p> <p>---Setting range---</p> <p>0 to 100 (%)</p>

15 Machine Parameters


15.9 Spindle Parameters

#13194

SP194 LMN

Base speed for load meter standard output (High-speed coil)

Set the base speed of the standard output to be displayed as 100% in load meter.
To display the continuous rated output as 100%, set the base speed of the continuous rated output as follows.

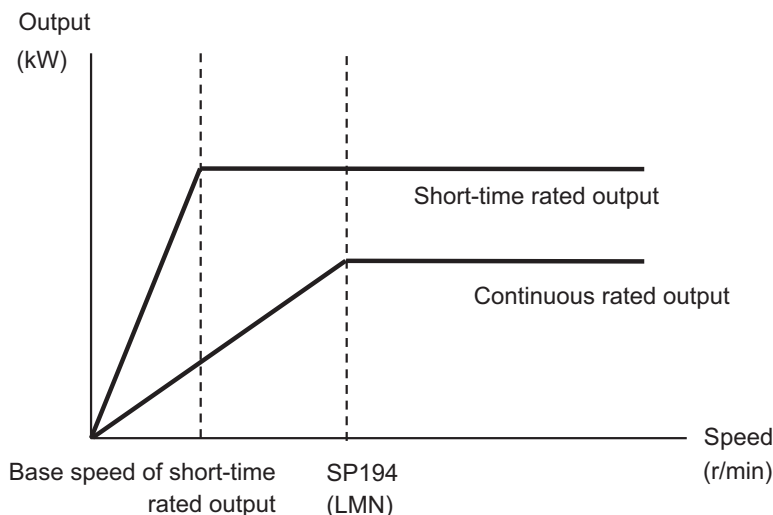

When "0" is set, the base speed of the short-time rated output will be applied.

(Note) When the speed is less than the base speed, the standard output to be displayed as 100% in load meter changes with the motor speed.

---Setting range---

0 to 32767 (r/min)

#13195

SP195 LMRL

Change magnification for load meter standard output (Low-speed coil)

Set the standard output to be displayed as 100% in load meter using the short-time rated output ratio.

To display the continuous rated output as 100%, set as follows.

Continuous rated output/Short-time rated output × 100

When "0" is set, the standard output to be displayed as 100% in load meter will be the short-time rated output.


(Note) When several output characteristics such as 15-minute rating and 30-minute rating are plotted on the characteristics figure, set the change magnification for the characteristic with the highest rated output.

---Setting range---

0 to 100 (%)

15 Machine Parameters

15.9 Spindle Parameters
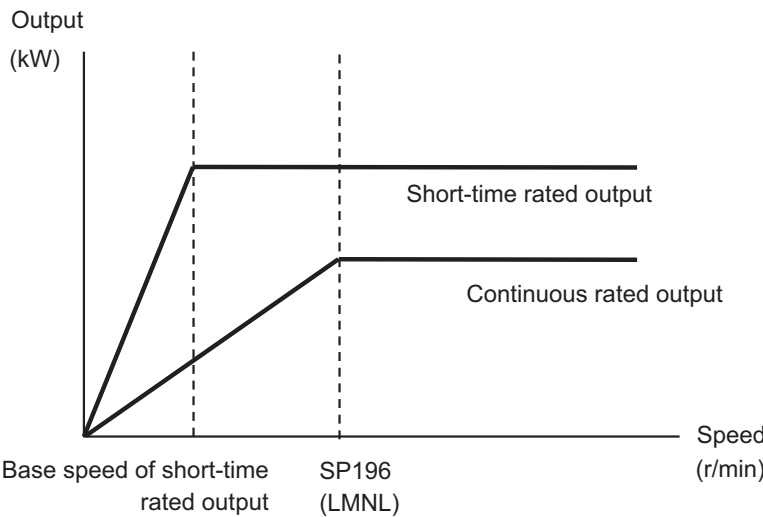
#13196	SP196 LMNL	Base speed for load meter standard output (Low-speed coil)
<p>Set the base speed of the standard output to be displayed as 100% in load meter. To display the continuous rated output as 100%, set the base speed of the continuous rated output as follows.</p>  <p>When "0" is set, the base speed of the short-time rated output will be applied. (Note) When the speed is less than the base speed, the standard output to be displayed as 100% in load meter changes with the motor speed.</p> <p>---Setting range---</p> <p>0 to 32767 (r/min)</p>		
#13197-13198	SP197-SP198	
<p>Not used. Set to "0".</p>		

15 Machine Parameters


15.9 Spindle Parameters

#13199	SP199 RTGM	Real-time tuning: maximum adaptive gain multiplier
--------	------------	--

In case that machine resonance is induced when mounting a workpiece, the speed loop gain is switched automatically in response to inertia by setting the speed loop gain and workpiece inertia multiplier in advance.

The speed loop gain SP199(RTGM) changes in response to the estimated inertia ratio SP200(RTJX) based on the speed loop gain SP005(VGN1) and the inertia multiplier SP037(JL) which were adjusted when no workpiece was mounted.

When SP199 is set to "0", the adaptation of the speed loop gain will be disabled.

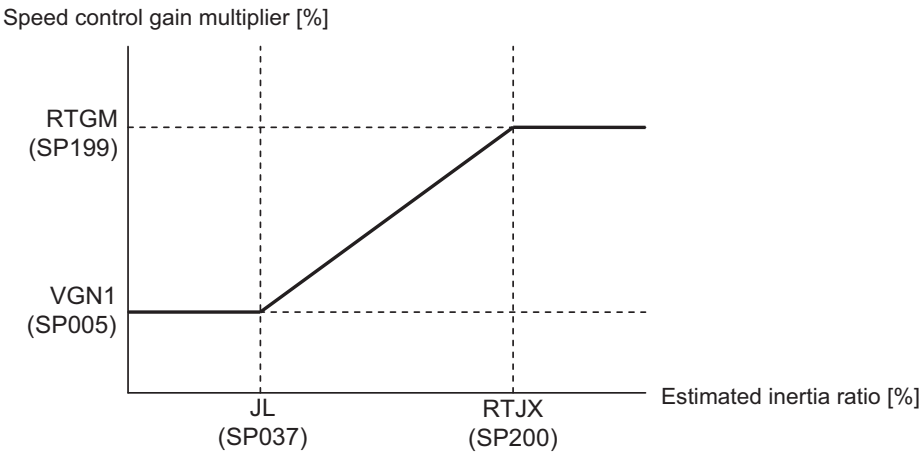

Related parameters: SP005, SP037, SP200

---Setting range---


0 to 5000 (%)

#13200	SP200 RTJX	Real-time tuning: maximum adaptive inertia ratio
--------	------------	--

In case that machine resonance is induced when mounting a workpiece, the speed loop gain is switched automatically in response to inertia by setting the speed loop gain and workpiece inertia multiplier in advance.

The speed loop gain SP199(RTGM) changes in response to the estimated inertia ratio SP200(RTJX) based on the speed loop gain SP005(VGN1) and the inertia multiplier SP037(JL) which were adjusted when no workpiece was mounted.

When SP199 is set to "0", the adaptation of the speed loop gain will be disabled.

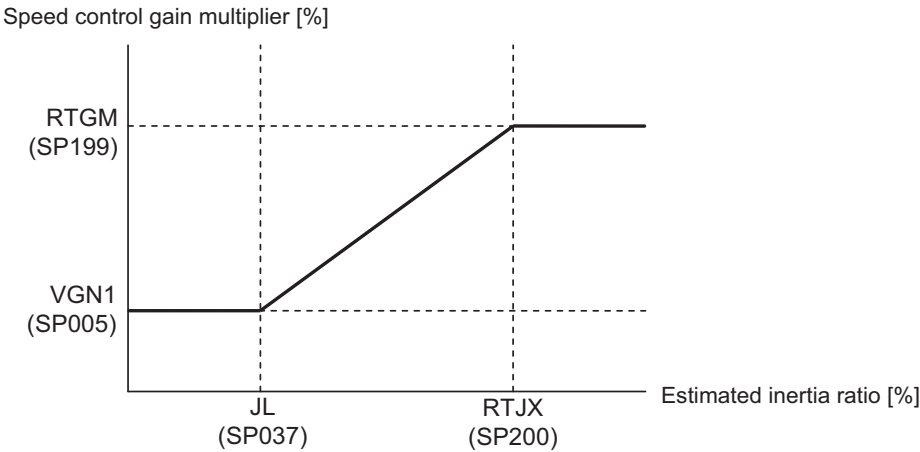

Related parameters: SP005, SP037, SP199

---Setting range---

0 to 32767 (%)

15 Machine Parameters

15.9 Spindle Parameters

#13201- SP201-SP224
13224


Not used. Set to "0".

#13225

SP225 SFNC5

Spindle function 5

Select the spindle functions.
Functions are allocated to each bit.
Set this in hexadecimal format.

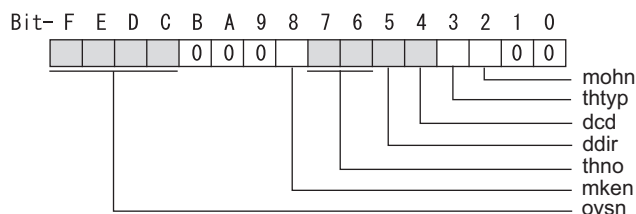**bit F-C: ovsn Overshooting compensation type 3 non-sensitive band**

Set the non-sensitive band of the overshooting compensation type 3 in increments of $2^\circ/1000$.
In the feed forward control, set the non-sensitive band for the model position droop and ignore the model overshooting. Set to "2°/1000" as a standard.

bit B-9:

Not used. Set to "0".

bit 8: mken Coil switch allowance in deceleration control

This enables a coil changeover while decelerating after an emergency stop for a spindle motor with coil changeover specification. A coil changeover may enable an excessive load inertia to stop within the maximum delay time.

0: Normal (Disable)

1: Enable

bit 7-6: thno

Select the thermistor characteristics.
When SP225/bit3=0 (N type) is selected
bit7,6=
00: For Mitsubishi Electric spindle motor
01: For Mitsubishi Electric spindle motor
10: PT3-51F
11: Setting prohibited
When SP225/bit3=1 (P type) is selected
bit7,6=
00: KTY84-130 (Manufactured by Philips)
01: Setting prohibited
10: Pt1000 (Platinum resistance temperature detector)
11: Setting prohibited

bit 5: ddir Proximity switch signal enable edge

0: Falling edge 1: Rising edge

bit 4: dcd DC excitation mode

0: Normal 1: Start

bit 3: thtyp

Select the thermistor type.
0: Type N thermistor (Mitsubishi Electric standard)
1: Type P thermistor or platinum resistance temperature detector

bit 2: mohn Thermistor temperature detection

0: Normal 1: Disable (Except for TS5690/5691)

bit 1-0:

Not used. Set to "0".

15 Machine Parameters

15.9 Spindle Parameters

#13226	SP226 SFNC6	Spindle function 6
Select the spindle functions. Functions are allocated to each bit. Set this in hexadecimal format.		
Bit- F E D C B A 9 8 7 6 5 4 3 2 1 0 <div> <div>0</div> <div></div> <div></div> <div></div> <div>0</div> <div>0</div> <div>0</div> <div></div> <div>0</div> <div></div> <div></div> <div>0</div> <div></div> <div>0</div> <div>0</div> <div>0</div> </div> <div> dd2 pon stod r2c tqof vup obs </div>		

bit F :

Not used. Set to "0".

bit E : obs Disturbance observer

0: Normal 1: Enable

bit D : vup High response acceleration / deceleration

This suppresses a temporal delay which occurs when the target speed is attained from acceleration and when the spindle stops from deceleration.

0: Normal acceleration/deceleration 1: High response acceleration/deceleration Enable

bit C : tqof Spindle output stabilization during acceleration

0: Normal 1: Disable

bit B-9 :

Not used. Set to "0".

bit 8 : r2c Temperature compensation adjustment indicator

0: Normal 1: Display

bit 7 :

Not used. Set to "0".

bit 6 : stod 4D-2 detection disabled during deceleration and stop

0: Normal 1: Alarm 4D-2 detection disabled during deceleration and stop

bit 5 : pon IPM spindle pulse application magnetic pole estimation

0: Normal 1: Enable

bit 4 :

Not used. Set to "0".

bit 3 : dd2 High-speed synchronous tapping 2

0: Normal 1: Enable

bit 2-0 :

Not used. Set to "0".

#13228	SP228 SFNC8	Spindle function 8
--------	-------------	--------------------

15 Machine Parameters

15.9 Spindle Parameters

#13229	SP229 SFNC9	Spindle function 9
	Select the spindle functions. Functions are allocated to each bit. Set this in hexadecimal format.	
	<div> <div> Bit- F E D C B A 9 8 7 6 5 4 3 2 1 0 <div> <div>0</div><div>0</div><div></div><div></div><div>0</div><div>0</div><div>0</div><div></div><div>0</div><div>0</div><div>0</div><div>0</div><div>0</div><div>0</div><div>0</div><div></div> </div> </div> <div> <div>omrffon</div> <div>sto</div> <div>sdt2</div> <div>rps</div> </div> </div>	
	bit F-E : Not used. Set to "0".	
	bit D : rps Safely limited speed setting unit 0: Normal 1: 100°/min	
	bit C : sdt2 Specified speed output digital signal 2 output 0: Normal 1: Enable	
	bit B-9 : Not used. Set to "0".	
	bit 8 : sto Dedicated wiring STO function Set this parameter to use dedicated wiring STO function. 0: Dedicated wiring STO function unused 1: Dedicated wiring STO function used (Only for MDS-E/EH and MDS-EJ/EJH)	
	bit 7-1 : Not used. Set to "0".	
	bit 0 : omrffon OMR-FF control enabled 0: Disable 1: Enable	
#13230	SP230 SFNC10	Spindle function 10
	Select the spindle functions. Functions are allocated to each bit. Set this in hexadecimal format.	
	<div> <div> Bit- F E D C B A 9 8 7 6 5 4 3 2 1 0 <div> <div>0</div><div>0</div><div>0</div><div>0</div><div></div><div>0</div><div>0</div><div></div><div></div><div>0</div><div>0</div><div>0</div><div>0</div><div>0</div><div>0</div><div>0</div> </div> </div> <div> <div>cse</div> <div>nohis</div> <div>pfdsr</div> </div> </div>	
	bit F-C : Not used. Set to "0".	
	bit B : pfdsr Set the spindle stop operation at a power failure when the deceleration and stop function at power failure is enabled. Normal (Coast to a stop at power failure) : 0 Deceleration and stop at power failure : 1	
	bit A-9 : Not used. Set to "0".	
	bit 8 : nohis History of communication error alarm between NC and DRV(34,36,38,39) 0: Enable 1: Disable	
	bit 7 : cse Spindle C axis command speed monitoring function 0: Normal setting (function disabled) 1: Function enabled	
	bit 6-0 : Not used. Set to "0". Related parameters: SP055, SP056	

15 Machine Parameters

15.9 Spindle Parameters

#13231	SP231	
bit 3-0 : Sensitivity of estimated resonance frequency		
Set the sensitivity of the estimated resonance frequency. Smaller setting value enables to detect smaller vibration component 0: Normal setting 1: Sensitivity high to F: Sensitivity low.		
#13232	SP232	
Not used. Set to "0000".		
#13233	SP233 IVC	Voltage non-sensitive band compensation
When 100% is set, the voltage equivalent to the logical non-energized time will be compensated. When "0" is set, 100% compensation will be performed. Adjust in increments of 10% from the default value 100%. If the value is too large, vibration or vibration noise may be generated.		
---Setting range---		
0 to 255 (%)		
#13234	SP234	
Not used. Set to "0".		
(PR) #13235	SP235 R2H	Temperature compensation gain
Set the magnification in converting the thermistor temperature to the control compensation amount. When "0" is set, the temperature compensation function is disabled. When not using, or when using an IPM spindle motor, set to "0".		
---Setting range---		
0 to 400 (%)		
(PR) #13236	SP236 WIH	Temperature compensation time constant
Set the delay time constant from the thermistor temperature to the control compensation amount. When "0" is set, the delay time constant is disabled. When not using, or when using an IPM spindle motor, set to "0".		
---Setting range---		
0 to 150 (min)		
(PR) #13237	SP237 TCF	Torque command filter
Set the filter for the torque command. The standard value is "500".		
---Setting range---		
0 to 5000 (rad/s)		
#13238	SP238 SSCFEED	Safely limited speed
Set the safely limited speed at the spindle end for the SLS (Safely Limited Speed) function. When not using, set to "0".		
---Setting range---		
0 to 18000 (°/min)		
However, when SP229/bitD is set to "1", the setting range is from -32768 to 32767 (100°/min).		

15 Machine Parameters

15.9 Spindle Parameters

#13239	SP239 SSCRPM	Safely limited motor speed
		<p>Set the motor's safely limited speed for the SLS (Safely Limited Speed) function.</p> <p>When not using, set to "0".</p> <p>---Setting range---</p> <p>0 to 32767 (r/min)</p> <p>(Note) The value of the safely limited speed and safely limited motor speed must satisfy the following relation. If this relation is not satisfied, the parameter error (37 or E4) will occur. (Error parameter No. is 239.) Checking this relation is executed when the drive unit is turned ON and parameter is changed and speed observation mode (states when a speed observation command is turned ON) is entered.</p> $\frac{\text{SP238 :SSCFEED}}{360} \times \frac{\text{SP057 :GRA1}}{\text{SP061 :GRB1}} = \text{SP239 :SSCRPM}$ <p>Note that "1 (r/min)" is applied when the calculation result is "0 (r/min)"</p>
(PR) #13240	SP240	Not used. Set to "0".
(PR) #13241-13256	SP241-SP256	This is automatically set by the NC system.

15.10 Spindle-type Servo Parameters

#52001	SVSPEC	Spindle-mode servo: Specification
[Exclusive for spindle-mode servo motor]		
bit0: Selection of position loop gain when C axis is selected		
0: Use the position loop gain (#52203 SV003, #52204 SV004, #52257 SV057)		
1: Use the spindle sync control position loop gain (#52249 SV049, #52250 SV050, #52258 SV058)		
bit1: Selection of sync tap cycle position loop gain		
0: Use the position loop gain (#52203 SV003, #52204 SV004, #52257 SV057)		
1: Use the spindle sync control position loop gain (#52249 SV049, #52250 SV050, #52258 SV058)		
---Setting range---		
00 to FFFF (HEX)		
#52002	svzsp	Spindle-mode servo: Motor zero speed
[Exclusive for spindle-mode servo motor]		
Specify the motor rotation speed at which zero speed detection is carried out. When the actual motor speed drops to the specified speed or below, the zero speed detection signal turns ON. The standard setting value is "50". When the setting value is "0", it is on the standard setting value.		
---Setting range---		
0 to 1000 (r/min)		
#52003	svsdts	Spindle-mode servo: Speed detection set value
[Exclusive for spindle-mode servo motor]		
Specify the motor speed at which speed detection is carried out. When the actual motor speed drops to the specified speed or below, the speed detection signal turns ON. The standard setting value is 10% of the "#3001 slmt1" setting value. When the setting value is "0", it is on the standard setting value.		
---Setting range---		
0 to 32767(r/min)		
#52004	svtlm1	Spindle-mode servo: Torque limit 1
[Exclusive for spindle-mode servo motor]		
Specify the torque limit value to be applied when Torque limit (Control input 1/bitA,9,8)=001.		
---Setting range---		
0 to 999 (Short-time rated %)		
#52005	svtlm2	Spindle-mode servo: Torque limit 2
[Exclusive for spindle-mode servo motor]		
Specify the torque limit value to be applied when Torque limit (Control input 1/bitA,9,8)=010.		
---Setting range---		
0 to 999 (Short-time rated %)		
#52006	svtlm3	Spindle-mode servo: Torque limit 3
[Exclusive for spindle-mode servo motor]		
Specify the torque limit value to be applied when Torque limit (Control input 1/bitA,9,8)=011.		
---Setting range---		
0 to 999 (Short-time rated %)		
#52201-52456	SV001-SV256	Spindle-type Servo Parameters
The description and setting range for these parameters are the same as Servo parameters "#2201 SV001" to "#2456 SV256". Refer to "15.7 Servo Parameters" for details.		
(Note) Set the same value to "#52203 SV003(PGN)" for the reference and synchronized spindles in spindle synchronization.		

15.11 Rotary Axis Configuration Parameters

(PR)	#7900	RCDAX_I	Orthogonal coordinate horizontal axis name
			Set the name of the horizontal axis in the orthogonal coordinate system. Set "0" when horizontal axis is not used. ---Setting range--- A,B,C,U,V,W,X,Y,Z Two digits between A to Z and 1 to 9 0: Mechanical axis specifications
(PR)	#7901	RCDAX_J	Orthogonal coordinate vertical axis name
			Set the name of the vertical axis in the orthogonal coordinate system. Set "0" when vertical axis is not used. ---Setting range--- A,B,C,U,V,W,X,Y,Z Two digits between A to Z and 1 to 9 0: Mechanical axis specifications
(PR)	#7902	RCDAX_K	Orthogonal coordinate height axis name
			Set the name of the height axis in the orthogonal coordinate system. Set "0" when height axis is not used. ---Setting range--- A,B,C,U,V,W,X,Y,Z Two digits between A to Z and 1 to 9 0: Mechanical axis specifications
	#7903	G92_CRD	Origin zero set coordinate selection
			Select the coordinate to preset when issuing an origin zero command (G92X_Y_Z;). 0: Tool center coordinate 1: Holder center coordinate
	#7904	NO_TIP	Tool handle feed function selection
			Select whether to enable the tool handle feed. 0: Enable (tool handle feed) 1: Disable (standard)
	#7905	NO_ABS	Selection of tool axis travel amount display at manual ABS switch ON/OFF
			Select how to update the display of tool axis travel amount. 0: Update at ABS switch OFF 1: Update at every ON and OFF of ABS switch
	#7906	PASSTYP	Singular point passage type
			Select the movement after passing through a singular point. 0: Type 1 The direction depends on the sign of the rotation angle of A axis or B axis at the start of tool center point control/tool cutting point control. 1: Type 2 The direction where the amount of rotation of C axis on the singular point is smaller.
	#7907	CHK_ANG	Near singular judgment angle
			Set the angle for judging a position near the singular point. When "0.000" is set, it will operate as 1.000 (°). ---Setting range--- 0.000 to 5.000 (°)
	#7908	SLCT_PRG_COORD	Programming coordinate system selection
			Select the coordinate system for the programming coordinate. 0: Table coordinate system (coordinate system that rotates together with workpiece) 1: Workpiece coordinate system

15 Machine Parameters

15.11 Rotary Axis Configuration Parameters

#7909	IJK_VEC_MR	Posture vector mirror image selection
	Select whether to enable the mirror image on the posture vector (IJK) when Type 2 is selected in "#7906 PASSTYP". 0: Disable 1: Enable	
#7910	SLCT_INT_MODE	Interpolation method selection
	Select the interpolation method. When combining spline interpolation 2 and tool center point control, only the joint interpolation method is valid. 0: Joint interpolation method 1: Single axis rotation interpolation method	
#7911	SLCT_STANDARD_POS	Reference position of rotary axis
	Select the reference point of the rotary axis. 0: The origin of the workpiece coordinate system 1: The position at the time of tool center point control/tool cutting point control start command	
#7912	NO_MANUAL	Selection of 3-dimensional manual feed
	Select whether to enable the 3-dimensional manual feed 0: Enable (3-dimensional manual feed) 1: Disable (standard manual feed)	
#7913	MCHN_SPEED_CTRL	Machine speed fluctuation suppression
	Select whether to suppress the machine speed fluctuation due to rotary axis movement. 0: Not suppress 1: Suppress (Note) This parameter is disabled when SSS control is enabled.	
#7914	ROT_PREFILT	Rotary axis prefilter time constant
	Set the time constant for rotary axis prefilter. By setting this time constant, the orientation change of the tool (rotary axis motion) during tool center point control/tool cutting point control becomes smoother. This parameter can also be set from [Setup] screen ([User] - [Hi-prec param]). When "0" is specified, the rotary axis prefiltering function is disabled. ---Setting range--- 0 to 200 (ms)	
#7915	SLCT_SLOPE_CRD_MOD	Rotary axis basic position in inclined surface machining
	Set the basic position of rotary axis to establish the feature coordinate system when inclined surface machining is commanded. * The position will not change when inclined surface machining is running. It will change when the next inclined surface machining is commanded. 0: At zero degree 1: At the start position	
#7916	ROT_ERR_MODE	Rotation center error compensation method
	Select the compensation method of rotation center error. 0: Compensation with orthogonal axis only. 1: Compensation with orthogonal and rotary axes.	
(PR) #7917	SLCT_G53_6_ROTAX	G53.6 rotary axes rotation order
	Specify in which order to rotate the rotary axes when the address Q is unspecified in G53.6 and when the number of simultaneous contour control axes is limited to 4. 0: In the order of primary and secondary rotary axes 1: In the order of secondary and primary rotary axes	

15 Machine Parameters

15.11 Rotary Axis Configuration Parameters

#7918	SLCT_ROTAX_ANS	Selection of solution for defining primary rotary axis angle
		<p>Select the solution that defines the calculated angle of the primary rotary axis when address P is omitted from G53.1 or G53.6 command.</p> <p>0: Default solution of each machine type</p> <p>1: Solution that makes the primary rotary axis value positive</p> <p>2: Solution that makes the primary rotary axis value negative</p>
(PR) #7920	SLCT_T1	Rotary axis selection
		<p>Select in which axis direction to rotate the base-side rotary axis of the rotary head. When the base-side rotary axis is tilting, use the tens place to select the axis around which the rotary axis is tilted.</p> <p>0: Invalid</p> <p>1: I axis</p> <p>2: J axis</p> <p>3: K axis</p> <p>1x: Tilted around I axis</p> <p>2x: Tilted around J axis</p> <p>3x: Tilted around K axis</p> <p>(Note) A value from 0 to 99 can be set from the screen. However when an invalid value is set, the operation error (M01 0127) occurs at the power ON.</p> <p>---Setting range---</p> <p>0 to 3</p> <p>12, 13, 21, 23, 31, 32</p>
(PR) #7921	TIANGT1	Tilt angle
		<p>Set the tilt angle if the base-side rotary axis of the rotary head is tilted. Set the angle with the CCW direction of the tilted plane being defined as the positive direction.</p> <p>---Setting range---</p> <p>-89.999 to 89.999 (°)</p>
(PR) #7922	ROTAXT1	Rotary axis name
		<p>Set the name of the tool rotating type base-side rotary axis.</p> <p>---Setting range---</p> <p>A,B,C,U,V,W,X,Y,Z</p> <p>Two digits between A to Z and 1 to 9</p> <p>0: Mechanical axis specifications</p>
#7923	DIR_T1	Rotation direction
		<p>Set the rotation direction of the tool rotating type base-side rotary axis.</p> <p>The rotation direction specifications vary according to the setting of "#1450 5axis_Spec/bit3" (Select specifications of rotation direction parameter).</p> <p>- When "#1450 5axis_Spec/bit3" = "0"</p> <p>The specifications vary for each function.</p> <p>- When "#1450 5axis_Spec/bit3" = "1"</p> <p>The specifications are common to the functions.</p> <p>0: When the tool motion viewed from the workpiece is in right-hand screw direction, it is taken as the positive direction.</p> <p>1: When the tool motion viewed from the workpiece is in left-hand screw direction, it is taken as the positive direction.</p>
#7924	COFST1H	Horizontal axis rotation center offset
		<p>Set the distance in the horizontal axis direction between the rotation centers of the tool-side rotary axis and the base-side rotary axis.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p>

15 Machine Parameters

15.11 Rotary Axis Configuration Parameters

#7925	COFST1V	Vertical axis rotation center offset
		Set the distance in the vertical axis direction between the rotation centers of the tool-side rotary axis and the base-side rotary axis. ---Setting range--- -99999.999 to 99999.999 (mm)
#7926	COFST1T	Height axis rotation center offset
		Set the distance in the height axis direction between the rotation centers of the tool-side rotary axis and the base-side rotary axis. ---Setting range--- -99999.999 to 99999.999 (mm)
#7927	CERRT1H	Horizontal axis rotation center position deviation
		Set the position deviation in the horizontal axis direction of the tool rotating type base-side rotary axis rotation center. When tool rotating type base rotary axis is I axis rotation, set the position deviation of J axis rotation. When tool rotating type base rotary axis is J axis rotation, set the position deviation of K axis rotation. When tool rotating type base rotary axis is K axis rotation, set the position deviation of I axis rotation. * Radius value is need to be set. ---Setting range--- -99999.999 to 99999.999 (mm) (Follow as "#1006 mcmpunit" (Machine error compensation unit))
#7928	CERRT1V	Vertical axis rotation center position deviation
		Set the position deviation in the vertical axis direction of the tool rotating type base-side rotary axis rotation center. When tool rotating type base rotary axis is I axis rotation, set the position deviation of K axis rotation. When tool rotating type base rotary axis is J axis rotation, set the position deviation of I axis rotation. When tool rotating type base rotary axis is K axis rotation, set the position deviation of J axis rotation. * Radius value is need to be set. ---Setting range--- -99999.999 to 99999.999 (mm) (Follow as "#1006 mcmpunit" (Machine error compensation unit))
(PR) #7930	LCT_T2	Rotary axis selection
		Select in which axis direction to rotate the tool-side rotary axis of the rotary head. When the tool-side rotary axis is tilting, use the tens place to select the axis around which the rotary axis is tilted. 0: Invalid 1: I axis 2: J axis 3: K axis 1x: Tilted around I axis 2x: Tilted around J axis 3x: Tilted around K axis (Note) A value from 0 to 99 can be set from the screen. However when an invalid value is set, the operation error (M01 0127) occurs at the power ON. ---Setting range--- 0 to 3 12, 13, 21, 23, 31, 32
(PR) #7931	TIANGT2	Tilt angle
		Set the tilt angle if the tool-side rotary axis of the rotary head is tilted. Set the angle with the CCW direction of the tilted plane being defined as the positive direction. ---Setting range--- -89.999 to 89.999 (°)

15 Machine Parameters

15.11 Rotary Axis Configuration Parameters

(PR)	#7932	ROTXT2	Rotary axis name
		Set the name of the tool rotating type tool-side rotary axis.	
		---Setting range---	
		A,B,C,U,V,W,X,Y,Z	
		Two digits between A to Z and 1 to 9	
		0: Mechanical axis specifications	
	#7933	DIR_T2	Rotation direction
		Set the rotation direction of the tool rotating type tool-side rotary axis.	
		The rotation direction specifications vary according to the setting of "#1450 5axis_Spec/bit3" (Select specifications of rotation direction parameter).	
		- When "#1450 5axis_Spec/bit3" = "0"	
		The specifications vary for each function.	
		- When "#1450 5axis_Spec/bit3" = "1"	
		The specifications are common to the functions.	
		0: When the tool motion viewed from the workpiece is in right-hand screw direction, it is taken as the positive direction.	
		1: When the tool motion viewed from the workpiece is in left-hand screw direction, it is taken as the positive direction.	
	#7934	COFST2H	Horizontal axis rotation center offset
		Set the distance in the horizontal axis direction between the spindle holder center and the rotation center of the tool-side rotary axis.	
		---Setting range---	
		-99999.999 to 99999.999 (mm)	
	#7935	COFST2V	Vertical axis rotation center offset
		Set the distance in the vertical axis direction between the spindle holder center and the rotation center of the tool-side rotary axis.	
		---Setting range---	
		-99999.999 to 99999.999 (mm)	
	#7936	COFST2T	Height axis rotation center offset
		Set the distance in the height axis direction between the spindle holder center and the rotation center of the tool-side rotary axis.	
		---Setting range---	
		-99999.999 to 99999.999 (mm)	
	#7937	CERRT2H	Horizontal axis rotation center position deviation
		Set the position deviation in the horizontal axis direction of the tool rotating type tool-side rotary axis rotation center. When tool rotating type tool rotary axis is I axis rotation, set the position deviation of J axis rotation. When tool rotating type tool rotary axis is J axis rotation, set the position deviation of K axis rotation. When tool rotating type tool rotary axis is K axis rotation, set the position deviation of I axis rotation.	
		* Radius value is need to be set.	
		---Setting range---	
		-99999.999 to 99999.999 (mm)	
		(Follow as "#1006 mcompunit" (Machine error compensation unit))	
	#7938	CERRT2V	Vertical axis rotation center position deviation
		Set the position deviation in the vertical axis direction of the tool rotating type tool-side rotary axis rotation center. When tool rotating type tool rotary axis is I axis rotation, set the position deviation of K axis rotation. When tool rotating type tool rotary axis is J axis rotation, set the position deviation of I axis rotation. When tool rotating type tool rotary axis is K axis rotation, set the position deviation of J axis rotation.	
		* Radius value is need to be set.	
		---Setting range---	
		-99999.999 to 99999.999 (mm)	
		(Follow as "#1006 mcompunit" (Machine error compensation unit))	

15 Machine Parameters

15.11 Rotary Axis Configuration Parameters

(PR)	#7940	SLCT_W1	Rotary axis selection
			<p>Select in which axis direction to rotate the base-side rotary axis of the rotary table. When the base-side rotary axis is tilting, use the tens place to select the axis around which the rotary axis is tilted.</p> <p>0: Invalid</p> <p>1: I axis</p> <p>2: J axis</p> <p>3: K axis</p> <p>1x: Tilted around I axis</p> <p>2x: Tilted around J axis</p> <p>3x: Tilted around K axis</p> <p>(Note) A value from 0 to 99 can be set from the screen. However when an invalid value is set, the operation error (M01 0127) occurs at the power ON.</p> <p>---Setting range---</p> <p>0 to 3</p> <p>12, 13, 21, 23, 31, 32</p>
(PR)	#7941	TIANGW1	Tilt angle
			<p>Set the tilt angle if the base-side rotary axis of the rotary table is tilted. Set the angle with the CCW direction of the tilted plane being defined as the negative direction.</p> <p>---Setting range---</p> <p>-89.999 to 89.999 (°)</p>
(PR)	#7942	ROTAXW1	Rotary axis name
			<p>Set the name of the table rotating type base-side rotary axis.</p> <p>---Setting range---</p> <p>A,B,C,U,V,W,X,Y,Z</p> <p>Two digits between A to Z and 1 to 9</p> <p>0: Mechanical axis specifications</p>
	#7943	DIR_W1	Rotation direction
			<p>Set the rotation direction for the table rotating type base-side rotary axis.</p> <p>The rotation direction specifications vary according to the setting of "#1450 5axis_Spec/bit3" (Select specifications of rotation direction parameter).</p> <p>- When "#1450 5axis_Spec/bit3" = "0"</p> <p>The specifications vary for each function.</p> <p>- When "#1450 5axis_Spec/bit3" = "1"</p> <p>The specifications are common to the functions.</p> <p>0: When the tool motion viewed from the workpiece is in right-hand screw direction, it is taken as the positive direction.</p> <p>1: When the tool motion viewed from the workpiece is in left-hand screw direction, it is taken as the positive direction.</p>
	#7944	COFSW1H	Horizontal axis rotation center offset
			<p>When all axes are at the machine zero point, set the distance in the horizontal axis direction from the machine zero point to the rotation center of the base-side rotary axis.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p>
	#7945	COFSW1V	Vertical axis rotation center offset
			<p>When all axes are at the machine zero point, set the distance in the vertical axis direction from the machine zero point to the rotation center of the base-side rotary axis.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p>
	#7946	COFSW1T	Height axis rotation center offset
			<p>When all axes are at the machine zero point, set the distance in the height axis direction from the machine zero point to the rotation center of the base-side rotary axis.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p>

15 Machine Parameters

15.11 Rotary Axis Configuration Parameters

#7947	CERRW1H	Horizontal axis rotation center position deviation
	<p>Set the position deviation in the horizontal axis direction of the table rotating type base-side rotary axis rotation center. When table rotating type base rotary axis is I axis rotation, set the position deviation of J axis rotation. When table rotating type base rotary axis is J axis rotation, set the position deviation of K axis rotation. When table rotating type base rotary axis is K axis rotation, set the position deviation of I axis rotation.</p> <p>* Radius value is need to be set.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p> <p>(Follow as "#1006 mcmpunit" (Machine error compensation unit))</p>	
#7948	CERRW1V	Vertical axis rotation center position deviation
	<p>Set the position deviation in the vertical axis direction of the table rotating type base-side rotary axis rotation center. When table rotating type base rotary axis is I axis rotation, set the position deviation of K axis rotation. When table rotating type base rotary axis is J axis rotation, set the position deviation of I axis rotation. When table rotating type base rotary axis is K axis rotation, set the position deviation of J axis rotation.</p> <p>* Radius value is need to be set.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p> <p>(Follow as "#1006 mcmpunit" (Machine error compensation unit))</p>	
(PR) #7950	SLCT_W2	Rotary axis selection
	<p>Select in which axis direction to rotate the workpiece-side rotary axis of the rotary table. When the workpiece-side rotary axis is tilting, use the tens place to select the axis around which the rotary axis is tilted.</p> <p>0: Invalid</p> <p>1: I axis</p> <p>2: J axis</p> <p>3: K axis</p> <p>1x: Tilted around I axis</p> <p>2x: Tilted around J axis</p> <p>3x: Tilted around K axis</p> <p>(Note) A value from 0 to 99 can be set from the screen. However when an invalid value is set, the operation error (M01 0127) occurs at the power ON.</p> <p>---Setting range---</p> <p>0 to 3</p> <p>12, 13, 21, 23, 31, 32</p>	
(PR) #7951	TIANGW2	Tilt angle
	<p>Set the tilt angle if the workpiece-side rotary axis of the rotary table is tilted. Set the angle with the CCW direction of the tilted plane being defined as the negative direction.</p> <p>---Setting range---</p> <p>-89.999 to 89.999 (°)</p>	
(PR) #7952	ROTAXW2	Rotary axis name
	<p>Set the name of the table rotating type workpiece-side rotary axis.</p> <p>---Setting range---</p> <p>A,B,C,U,V,W,X,Y,Z</p> <p>Two digits between A to Z and 1 to 9</p> <p>0: Mechanical axis specifications</p>	

15 Machine Parameters

15.11 Rotary Axis Configuration Parameters

#7953	DIR_W2	Rotation direction
		<p>Set the rotation direction for the table rotating type workpiece-side rotary axis.</p> <p>The rotation direction specifications vary according to the setting of "#1450 5axis_Spec/bit3" (Select specifications of rotation direction parameter).</p> <ul style="list-style-type: none"> - When "#1450 5axis_Spec/bit3" = "0" <p>The specifications vary for each function.</p> <ul style="list-style-type: none"> - When "#1450 5axis_Spec/bit3" = "1" <p>The specifications are common to the functions.</p> <p>0: When the tool motion viewed from the workpiece is in right-hand screw direction, it is taken as the positive direction.</p> <p>1: When the tool motion viewed from the workpiece is in left-hand screw direction, it is taken as the positive direction.</p>
#7954	COFSW2H	Horizontal axis rotation center offset
		<p>When all axes are at the machine zero point, set the distance in the horizontal axis direction between rotation centers of the base-side rotary axis and the workpiece-side rotary axis.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p>
#7955	COFSW2V	Vertical axis rotation center offset
		<p>When all axes are at the machine zero point, set the distance in the vertical axis direction between rotation centers of the base-side rotary axis and the workpiece-side rotary axis.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p>
#7956	COFSW2T	Height axis rotation center offset
		<p>When all axes are at the machine zero point, set the distance in the height axis direction between rotation centers of the base-side rotary axis and the workpiece-side rotary axis.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p>
#7957	CERRW2H	Horizontal axis rotation center position deviation
		<p>Set the position deviation in the horizontal axis direction of the table rotating type workpiece-side rotary axis rotation center. When table rotating type workpiece side rotary axis is I axis rotation, set the position deviation of J axis rotation. When table rotating type workpiece side rotary axis is J axis rotation, set the position deviation of K axis rotation. When table rotating type workpiece side rotary axis is K axis rotation, set the position deviation of I axis rotation.</p> <p>* Radius value is need to be set.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p> <p>(Follow as "#1006 mcmpunit" (Machine error compensation unit))</p>
#7958	CERRW2V	Vertical axis rotation center position deviation
		<p>Set the position deviation in the vertical axis direction of the table rotating type workpiece-side rotary axis rotation center. When table rotating type workpiece side rotary axis is I axis rotation, set the position deviation of K axis rotation. When table rotating type workpiece side rotary axis is J axis rotation, set the position deviation of I axis rotation. When table rotating type workpiece side rotary axis is K axis rotation, set the position deviation of J axis rotation.</p> <p>* Radius value is need to be set.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (mm)</p> <p>(Follow as "#1006 mcmpunit" (Machine error compensation unit))</p>
#7960	Rot1 Ang Geo Dev1	Angular deviation 1 of center line of 1st rotary axis
		<p>When 1st rotary axis is I axis rotation, set the angular deviation of J axis rotation. When 1st rotary axis is J axis rotation, set the angular deviation of K axis rotation. When 1st rotary axis is K axis rotation, set the angular deviation of I axis rotation.</p> <p>---Setting range---</p> <p>-1.000000 to 1.000000 (deg)</p>

15 Machine Parameters

15.11 Rotary Axis Configuration Parameters

#7961	Rot1 Ang Geo Dev2	Angular deviation 2 of center line of 1st rotary axis
	When 1st rotary axis is I axis rotation, set the angular deviation of K axis rotation. When 1st rotary axis is J axis rotation, set the angular deviation of I axis rotation. When 1st rotary axis is K axis rotation, set the angular deviation of J axis rotation.	
	---Setting range---	
	-1.000000 to 1.000000 (deg)	
#7962	Rot2 Ang Geo Dev1	Angular deviation 1 of center line of 2nd rotary axis
	When 2nd rotary axis is I axis rotation, set the angular deviation of J axis rotation. When 2nd rotary axis is J axis rotation, set the angular deviation of K axis rotation. When 2nd rotary axis is K axis rotation, set the angular deviation of I axis rotation.	
	---Setting range---	
	-1.000000 to 1.000000 (deg)	
#7963	Rot2 Ang Geo Dev2	Angular deviation 2 of center line of 2nd rotary axis
	When 2nd rotary axis is I axis rotation, set the angular deviation of K axis rotation. When 2nd rotary axis is J axis rotation, set the angular deviation of I axis rotation. When 2nd rotary axis is K axis rotation, set the angular deviation of J axis rotation.	
	---Setting range---	
	-1.000000 to 1.000000 (deg)	
#7967	SPINDLE_END_OFS_H	Spindle end offset for horizontal axis
	When all axes are at the machine zero point, set the distance in the horizontal axis direction from the machine zero point to the spindle end.	
	This parameter can be used only when Tool head hot swapping function is enabled.	
	---Setting range---	
	-99999.999 to 99999.999 (mm)	
#7968	SPINDLE_END_OFS_V	Spindle end offset for vertical axis
	When all axes are at the machine zero point, set the distance in the vertical axis direction from the machine zero point to the spindle end.	
	This parameter can be used only when Tool head hot swapping function is enabled.	
	---Setting range---	
	-99999.999 to 99999.999 (mm)	
#7969	SPINDLE_END_OFS_T	Spindle end offset for height axis
	When all axes are at the machine zero point, set the distance in the height axis direction from the machine zero point to the spindle end.	
	This parameter can be used only when Tool head hot swapping function is enabled.	
	---Setting range---	
	-99999.999 to 99999.999 (mm)	

15.12 PLC Timer

#16000- 16703	T0 - T703	PLC timer <10ms/100ms>
<p>Set the time for the timer used in the PLC program (ladder). The 10ms timer and 100ms timer are identified by the command used. This setting value is valid when #6449/bit0 = 0.</p> <p>The timer T setting method (variable/fixed) and No. of points can be set with #6454/bit3-bit0.</p> <ul style="list-style-type: none"> •When #6454/bit3-0 = 0000, variable T: None, Fixed T: #16000-#16703 •When #6454/bit3-0 = 0001, variable T: #16000-#16099, Fixed T: #16100-#16703 •When #6454/bit3-0 = 0010, variable T: #16000-#16199, Fixed T: #16200-#16703 •When #6454/bit3-0 = 0011, variable T: #16000-#16299, Fixed T: #16300-#16703 : •When #6454/bit3-0=0111, variable T: #16000-#16703 Fixed T: None <p>The time unit of the time set by this parameter can be changed with the setting of "#8142 PLC timer unit".</p> <ul style="list-style-type: none"> •When #8142 = 0, the time unit of the timer (10 ms or 100 ms) is determined by the PLC program instruction. •When #8142 = 1, the time unit of the timer is 1 ms. <p>---Setting range---</p> <p>When #8142 = 0: 0 to 32767 (x 10 ms or x 100 ms)</p> <p>When #8142 = 1, and 10 ms timer is used: 0 to 327670 (ms)</p> <p>When #8142 = 1, and 100 ms timer is used: 0 to 3276700 (ms)</p>		

15.13 PLC Integrated Timer

#17000- 17063	ST0 - ST63	PLC integrated timer <100ms INC.>
<p>Set the time for the integrated timer used in the PLC program (ladder). This setting value is valid when #6449/bit0 = 0.</p> <p>The timer ST setting method (variable/fixed) and No. of points can be set with #6453/bit7-bit5.</p> <ul style="list-style-type: none"> •When #6453/bit7-5 = 000, variable ST: None, Fixed ST: #17000-#17063 •When #6453/bit7-5 = 001, variable ST: #17000-#17019, Fixed ST: #17020-#17063 •When #6453/bit7-5 = 010, variable ST: #17000-#17039, Fixed ST: #17040-#17063 •When #6453/bit7-5 = 011, variable ST: #17000-#17063, Fixed ST: None <p>The time unit of the time set by this parameter can be changed with the setting of "#8143 PLC int.timer unit".</p> <ul style="list-style-type: none"> •When #8143 = 0, the time unit of the timer is determined by the PLC program instruction. •When #8143 = 1, the time unit of the timer is 1 ms. •When #8143 = 2, the time unit of the timer is 10 ms. <p>---Setting range---</p> <p>When #8143 = 0: 0 to 32767 (x 100 ms)</p> <p>When #8143 = 1, and integrated timer is used: 0 to 3276700 (ms)</p> <p>When #8143 = 2, and integrated timer is used: 0 to 327670 (x 10 ms)</p>		

15.14 PLC Counter

#17200- 17455	C000 - C255	Counter
<p>Set the counter used in the PLC program (ladder). This setting value is valid when #6449/bit0 = 0.</p> <p>The counter C setting method (variable/fixed) and No. of points can be set with #6454/bit7-bit4.</p> <ul style="list-style-type: none"> •When #6454/bit7-4 = 0000, variable C: None, Fixed C: #17200-#17455 •When #6454/bit7-4 = 0001, variable C: #17200-#17239, Fixed C: #17240-#17455 •When #6454/bit7-4 = 0010, variable C: #17200-#17279, Fixed C: #17280-#17455 •When #6454/bit7-4 = 0011, variable C: #17200-#17319, Fixed C: #17320-#17455 <p style="text-align: center;">:</p> <ul style="list-style-type: none"> •When #6454/bit7-4 = 0111, variable C: #17200-#17455, Fixed C: None <p>---Setting range---</p> <p>0 to 32767</p>		

15.15 PLC Constants

#18001- 18150	R7500,7501 - R7798,7799	PLC constant (Base area)
Set the value to be set in the data type R register (R7500 to R7799) used in the PLC program (ladder).		
---Setting range---		
-2147483648 to 2147483647		
#18151- 18900	R8300,8301 - R9798,9799	PLC constant (Extension area)
Set the value to be set in the data type R register (R8300 to R9799) used in the PLC program (ladder).		
#18151 to #18900 is used as the PLC constant extended area.		
The area is valid for the number of PLC constant extension points ("#1326 PLC Const Ext. Num" setting value), starting with #18151.		
---Setting range---		
-2147483648 to 2147483647		
#59301- 59600	R27500,27501 - R28098,28099	PLC constant (Extension area2)
Set the value to be set in the data type R register (R27500 to R28099) used in the PLC program (ladder).		
---Setting range---		
-2147483648 to 2147483647		

15.16 PLC Bit Selection

(Note) #6449 to #6496 are PLC operation parameters used by the machine tool builder and Mitsubishi Electric. Refer to "PLC Development Manual" and "PLC Programming Manual" for details.

#6401-6448	R7800-Low - R7823-High	Bit selection
This is the bit type parameter used in the PLC program (ladder).		
#6449	R7824-Low	Bit selection
bit7: Control unit thermal alarm valid bit6: Setting and display unit thermal management valid (This function may not be available for some NC models.) bit5: Set to "0". bit4: Battery alarm/warning detection disabled (Note) When the parameter is set to "1", the "Battery alarm" signal and the "Battery warning" signal will not be turned ON, and the alarm messages will not be displayed. bit3: Counter C retention bit2: Integrated timer ST retention bit1: PLC counter program valid bit0: PLC timer program valid		
#6450	R7824-High	Bit selection
bit7: Set to "0". bit6: External alarm message display (This function may not be available for some NC models.) bit5: Alarm/operator change (This function may not be available for some NC models.) bit4: Full screen display of message (This function may not be available for some NC models.) bit3: Set to "0". bit2: Operator message valid bit1: Alarm message display interface 1: R method 0: F method bit0: Alarm message valid		
#6451	R7825-Low	Bit selection
bit7-3: Set to "0". bit2: Built-in edit function edit invalid (This function may not be available for some NC models.) bit1: Set to "0". bit0: Built-in edit function valid (This function may not be available for some NC models.)		
#6452	R7825-High	Bit selection
bit7: Set to "0". bit6: Branch destination label check valid bit5: Set to "0". bit4: Serial handy terminal communication valid bit3-0: Set to "0".		
#6453	R7826-Low	Bit selection
bit7-5: Integrated timer ST Variable/fixed Number of points setting bit4: Set to "0". bit3: Operation by the menu [Ladder Monitor] 0: Screen can transit to PLC on-board screen after MTB password is input. 1: Screen can transit to PLC on-board screen without MTB password input. bit2-0: Message language change code		
#6454	R7826-High	Bit selection
bit7-4: Counter C Variable/fixed Number of points setting bit3-0: Timer T Variable/fixed Number of points setting		

15 Machine Parameters

15.16 PLC Bit Selection

#6455	R7827-Low	Bit selection
	bit7: Enable ladder program writing during RUN	
	bit6: Enable ladder program writing during RUN (in high-speed processing)	
	bit5-4: Set to "0".	
	bit3: Display type switching for operator message	
	1: R method	
	0: F method	
	bit2-0: R device access variables decimal point valid region	
#6456	R7827-High	Bit selection
	bit7-5: Set to "0".	
	bit4: Motor insulation deterioration detection ON	
	bit3: Set to "0".	
	bit2: PLS/PLF instruction Holding PLC in STOP state valid	
	bit1-0: Set to "0".	
#6457-6458	R7828-Low - R7828-High	Bit selection
	High-speed input specification 1	
#6459-6460	R7829-Low - R7829-High	Bit selection
	High-speed input specification 2	
#6461-6462	R7830-Low - R7830-High	Bit selection
	High-speed output specification 1	
#6463-6464	R7831-Low - R7831-High	Bit selection
	High-speed output specification 2	
#6465-6466	R7832-Low - R7832-High	Bit selection
	High-speed input specification 3	
#6467-6468	R7833-Low - R7833-High	Bit selection
	High-speed input specification 4	
#6469-6470	R7834-Low - R7834-High	Bit selection
	Set to "0".	
#6471	R7835-Low	Bit selection
	bit7-6: Operation mode of the user safety sequence project	
	bit5-2: Set to "0".	
	bit1: Enable layout	
	bit0: Set to "0".	
#6472	R7835-High	Bit selection
	Operation mode of the machine sequence project	
#6473-6474	R7836-Low - R7836-High	Bit selection
	High-speed output specification 3	
#6475-6476	R7837-Low - R7837-High	Bit selection
	High-speed output specification 4	
#6477-6480	R7838-Low - R7839-High	Bit selection
	Set to "0".	
#6481-6496	R7840-Low - R7847-High	Bit selection
	This is reserved for debugging by Mitsubishi Electric. Set to "0".	
#6497-6596	R7848-Low - R7897-High	Bit selection
	This is the bit type parameter used in the PLC program (ladder).	

15 Machine Parameters

15.16 PLC Bit Selection

#59001-59100	R7898-Low - R7947-High	Bit selection expansion 2
--------------	------------------------	---------------------------

This is the bit type parameter used in the PLC program (ladder).

15 Machine Parameters

15.17 Machine Error Compensation Parameters

15.17 Machine Error Compensation Parameters

(PR)	#4000	Pinc	Machine error compensation increment method
			<p>Select the method to set the machine error compensation data.</p> <p>0: Absolute amount method</p> <p>1: Incremental amount method</p>
	#4001	cmpax	Base axis <n-th axis>
			<p>Set the name of the base axis for machine error compensation.</p> <p>(1) For the pitch error compensation, set the name (#1013 axname) of the axis to be compensated.</p> <p>(2) For the relative position compensation, set the name (#1013 axname) of the axis to be used as the reference.</p> <p>For a system configured with a single part system, set the axis name only.</p> <p>For a system configured with multiple part systems, set the part system number and the axis name.</p> <p>(Example) Z axis of the 2nd part system: 2Z</p> <p>This parameter can also be set with the axis name and the serial number.</p> <p>(Example) When \$1: with C axis, \$2: without C axis, and \$3: with C axis, the C axis of the 3rd part system (\$3) is set with "C2".</p> <p>To set a PLC axis as the base axis, set it with P and the serial number of the PLC axis.</p> <p>(Example) 3rd PLC axis: P3</p> <p>---Setting range---</p> <p>Axis name, e.g. X, Y, Z, U, V, W, A, B, C or H</p> <p>Part system number + Axis name, e.g. 1X, 1Y, 1Z, 2X, 2Y and 2Z</p> <p>Axis name + Serial number of the axis, e.g. X1, Y1, Z1, P1, P2 and P3</p>
	#4002	drcax	Compensation axis <n-th axis>
			<p>Set the name of the compensation axis for machine error compensation.</p> <p>(1) For the pitch error compensation, set the same axis name as in "#4001 cmpax".</p> <p>(2) For the relative position compensation, set the name (#1013 axname) of the axis to be actually compensated.</p> <p>For a system configured with a single part system, set the axis name only.</p> <p>For a system configured with multiple part systems, set the part system number and the axis name.</p> <p>(Example) Z axis of the 2nd part system: 2Z</p> <p>This parameter can also be set with the axis name and the serial number.</p> <p>(Example) When \$1: with C axis, \$2: without C axis, and \$3: with C axis, the C axis of the 3rd part system (\$3) is set with "C2".</p> <p>To set a PLC axis as the compensation axis, set it with P and the serial number of the PLC axis.</p> <p>(Example) 3rd PLC axis: P3</p> <p>---Setting range---</p> <p>Axis name, e.g. X, Y, Z, U, V, W, A, B, C or H</p> <p>Part system number + Axis name, e.g. 1X, 1Y, 1Z, 2X, 2Y and 2Z</p> <p>Axis name + Serial number of the axis, e.g. X1, Y1, Z1, P1, P2 and P3</p>
	#4003	rdvno	Division point number at reference position <n-th axis>
			<p>Set the compensation data No. corresponding to the reference position. As the reference position is actually the base position, there is no compensation No. Therefore set the number that is decremented by 1.</p> <p>(Note) When bidirectional pitch error compensation is enabled, set compensation data No. corresponding to reference point in shifting in plus direction.</p> <p>---Setting range---</p> <p>4101 to 5999</p>

15 Machine Parameters

15.17 Machine Error Compensation Parameters

#4004	mdvno	Division point number at the most negative side <n-th axis>
		<p>Set the compensation data No. at the farthest end on the negative side.</p> <p>(Note) When the axis moves in positive direction with bidirectional pitch error compensation enabled, set compensation data No. of which locates on the nearest point to negative side. The compensation point should be set with even number.</p> <p>---Setting range---</p> <p>4101 to 5999</p>
#4005	pdvno	Division point number at the most positive side <n-th axis>
		<p>Set the compensation data No. at the farthest end on the positive side.</p> <p>(Note) When the axis moves in negative direction with bidirectional pitch error compensation enabled, set compensation data No. of which locates on the nearest point to positive side. The compensation point should be set with even number.</p> <p>---Setting range---</p> <p>4101 to 5999</p>
#4006	sc	Compensation scale factor <n-th axis>
		<p>Set the scale factor for the compensation amount.</p> <p>---Setting range---</p> <p>0 to 99</p>
#4007	spcdv	Division interval <n-th axis>
		<p>Set the interval to divide the basic axis.</p> <p>Each compensation data will be the compensation amount for each of these intervals.</p> <p>---Setting range---</p> <p>0.001 to 9999.999 (mm)</p>
#4008	twopc	Bidirectional pitch error compensation <n-th axis>
		<p>Select whether to enable bidirectional pitch error compensation.</p> <p>0: Disable</p> <p>1: Enable</p>
#4009	refcmp	Reference position compensation amount <n-th axis>
		<p>When bidirectional pitch error compensation is enabled, set the compensation amount of the reference position when the axis moves to the position from the opposite direction of the zero point return.</p> <p>(Note) The actual compensation amount will be the value obtained by multiplying the setting value with the compensation scale.</p> <p>---Setting range---</p> <p>-32768 to 32767</p>
#4101-5999		
		<p>Set the compensation amount for each axis.</p> <p>(Note) The actual compensation amount will be the value obtained by multiplying the setting value with the compensation scale.</p> <p>---Setting range---</p> <p>-32768 to 32767</p>

15.18 Macro List

#7001	M[01] Code
<p>Set the M code used for calling out the macro with the M command.</p> <p>Select codes to be entered other than the codes basically required by the machine and M codes of M0, M1, M2, M30, M96 through M99, and M198.</p> <p>This is valid when "#1195 Mmac" is set to "1".</p> <p>---Setting range---</p> <p>0 to 9999</p>	
#7002	M[01] TYPE
<p>Specify the macro call type.</p> <p>0: Equivalent to M98 P****;</p> <p>1: Equivalent to G65 P****;</p> <p>2: Equivalent to G66 P****;</p> <p>3: Equivalent to G66.1 P****;</p> <p>4: Equivalent to G144 D0 A****; (Sub part system control II complete wait method) (for L system only)</p> <p>5: Equivalent to G144 D1 A****; (Sub part system control II parallel process method) (for L system only)</p> <p>Others: Equivalent to M98 P****;</p>	
#7003	M[01] Program No.
<p>Set the No. of the program or file name to be called out. The file name can contain up to 32 characters.</p> <p>---Setting range---</p> <p>Program name or file name (up to 32 characters)</p>	
#7011	M[02] Code
The setting method is same as "#7001".	
#7012	M[02] Type
The setting method is same as "#7002".	
#7013	M[02] Program No.
The setting method is same as "#7003".	
#7021	M[03] Code
The setting method is same as "#7001".	
#7022	M[03] Type
The setting method is same as "#7002".	
#7023	M[03] Program No.
The setting method is same as "#7003".	
#7031	M[04] Code
The setting method is same as "#7001".	
#7032	M[04] Type
The setting method is same as "#7002".	
#7033	M[04] Program No.
The setting method is same as "#7003".	
#7041	M[05] Code
The setting method is same as "#7001".	
#7042	M[05] Type
The setting method is same as "#7002".	
#7043	M[05] Program No.
The setting method is same as "#7003".	
#7051	M[06] Code
The setting method is same as "#7001".	

15 Machine Parameters

15.18 Macro List

#7052	M[06] Type
	The setting method is same as "#7002".
#7053	M[06] Program No.
	The setting method is same as "#7003".
#7061	M[07] Code
	The setting method is same as "#7001".
#7062	M[07] Type
	The setting method is same as "#7002".
#7063	M[07] Program No.
	The setting method is same as "#7003".
#7071	M[08] Code
	The setting method is same as "#7001".
#7072	M[08] Type
	The setting method is same as "#7002".
#7073	M[08] Program No.
	The setting method is same as "#7003".
#7081	M[09] Code
	The setting method is same as "#7001".
#7082	M[09] Type
	The setting method is same as "#7002".
#7083	M[09] Program No.
	The setting method is same as "#7003".
#7091	M[10] Code
	The setting method is same as "#7001".
#7092	M[10] Type
	The setting method is same as "#7002".
#7093	M[10] Program No.
	The setting method is same as "#7003".
#7102	M2mac Type
	Set the type for when calling out the macro with the 2nd miscellaneous command. The macro will be called out with the "#1170 M2name" address command when "#1198 M2mac" is set to "1". The setting method is same as "M call macro". ---Setting range--- 0 to 3
#7103	M2mac Program No.
	Set the program No. for when calling out the macro with the 2nd miscellaneous command. The macro will be called out with the "#1170 M2name" address command when "#1198 M2mac" is set to "1". The setting method is same as "M call macro". ---Setting range--- Program name or file name (up to 32 characters)
#7201	G[01] Code
	Set the G code to be used when calling the macro with a G command. Do not set a G code used in the system. G101 to G110 and G200 to G202 are user macro I codes. However, if a parameter is set for the G code call code, the G code call will have the priority, and these cannot be used as the user macro I. ---Setting range--- 1 to 999

15 Machine Parameters

15.18 Macro List

#7202	G[01] Type
	Specify the macro call type. 0: Equivalent to M98 P****; 1: Equivalent to G65 P****; 2: Equivalent to G66 P****; 3: Equivalent to G66.1 P****;
#7203	G[01] Program No.
	Set the No. of the program or file name to be called out. The file name can contain up to 32 characters. ---Setting range--- Program name or file name (up to 32 characters)
#7211	G[02] Code
	The setting method is same as "#7201".
#7212	G[02] Type
	The setting method is same as "#7202".
#7213	G[02] Program No.
	The setting method is same as "#7203".
#7221	G[03] Code
	The setting method is same as "#7201".
#7222	G[03] Type
	The setting method is same as "#7202".
#7223	G[03] Program No.
	The setting method is same as "#7203".
#7231	G[04] Code
	The setting method is same as "#7201".
#7232	G[04] Type
	The setting method is same as "#7202".
#7233	G[04] Program No.
	The setting method is same as "#7203".
#7241	G[05] Code
	The setting method is same as "#7201".
#7242	G[05] Type
	The setting method is same as "#7202".
#7243	G[05] Program No.
	The setting method is same as "#7203".
#7251	G[06] Code
	The setting method is same as "#7201".
#7252	G[06] Type
	The setting method is same as "#7202".
#7253	G[06] Program No.
	The setting method is same as "#7203".
#7261	G[07] Code
	The setting method is same as "#7201".
#7262	G[07] Type
	The setting method is same as "#7202".
#7263	G[07] Program No.
	The setting method is same as "#7203".

15 Machine Parameters

15.18 Macro List

#7271	G[08] Code
The setting method is same as "#7201".	
#7272	G[08] Type
The setting method is same as "#7202".	
#7273	G[08] Program No.
The setting method is same as "#7203".	
#7281	G[09] Code
The setting method is same as "#7201".	
#7282	G[09] Type
The setting method is same as "#7202".	
#7283	G[09] Program No.
The setting method is same as "#7203".	
#7291	G[10] Code
The setting method is same as "#7201".	
#7292	G[10] Type
The setting method is same as "#7202".	
#7293	G[10] Program No.
The setting method is same as "#7203".	
#7302	Smac Type
Set the type No. for when calling the macro with an S command.	
This is valid when "#1196 Smac" is set to "1".	
The setting method is same as "M call macro".	
---Setting range---	
0 to 3	
#7303	Smac Program No.
Set the program No. for when calling the macro with an S command.	
This is valid when "#1196 Smac" is set to "1".	
The setting method is same as "M call macro".	
---Setting range---	
Program name or file name (up to 32 characters)	
#7312	Tmac Type
Set the type for when calling the macro with a T command.	
This is valid when "#1197 Tmac" is set to "1".	
The setting method is same as "M call macro".	
---Setting range---	
0 to 3	
#7313	Tmac Program No.
Set the program No. for when calling the macro with a T command.	
This is valid when "#1197 Tmac" is set to "1".	
The setting method is same as "M call macro".	
---Setting range---	
Program name or file name (up to 32 characters)	

15 Machine Parameters

15.18 Macro List

#7314	Man Tmac prg No.
	Specify the macro program number to be called with the T code input through a manual numerical value command.
	When a nonzero value is set in the parameter, macro call is executed irrespective of the setting of "#1197 Tmac".
	---Setting range---
	Program name or file name (up to 32 characters)
	(Setting is cleared when "0" is set)
#7322	G200 type
	Specify the macro call type.
	0: Equivalent to M98 P****;
	1: Equivalent to G65 P****;
	2: Equivalent to G66 P****;
	3: Equivalent to G66.1 P****;
#7323	G200 program No.
	Specify the figures in the hundreds and higher places of the macro program No. to be called.
	---Setting range---
	90 to 99, or 1000100 to 1999999
	(Note) To set the program No. to "1000100 to 1999999", set the macro call out type to 0 (M98) or 1 (G65).
#7332	G300 type
	The setting method is same as "#7322".
#7333	G300 program No.
	The setting method is same as "#7323".
#7342	G400 type
	The setting method is same as "#7322".
#7343	G400 program No.
	The setting method is same as "#7323".
#7352	G500 type
	The setting method is same as "#7322".
#7353	G500 program No.
	The setting method is same as "#7323".
#7362	G600 type
	The setting method is same as "#7322".
#7363	G600 program No.
	The setting method is same as "#7323".
#7372	G700 type
	The setting method is same as "#7322".
#7373	G700 program No.
	The setting method is same as "#7323".
#7382	G800 type
	The setting method is same as "#7322".
#7383	G800 program No.
	The setting method is same as "#7323".
#7392	G900 type
	The setting method is same as "#7322".

15 Machine Parameters

15.18 Macro List

#7393	G900 program No.
The setting method is same as "#7323".	
#7401	ASCII[01] Valid
The ASCII code macro parameters (#7402 to 7405) are validated.	
0: Disable	
1: Enable	
#7402	ASCII[01] Code
Set the ASCII code used to call macros with the ASCII code.	
L system: A,B,D,F,H,I,J,K,M,Q,R,S,T	
M system: A,B,F,H,I,K,M,Q,R,S,T	
#7403	ASCII[01] Type
Set the macro call type.	
0: M98	
1: G65	
2: G66	
3: G66.1	
#7404	ASCII[01] Program No.
Set the program No. called with macro call.	
---Setting range---	
Program name or file name (up to 32 characters)	
#7405	ASCII[01] Variable
When the call type is "0", set the variable No. set after the ASCII code.	
---Setting range---	
100 to 149	
#7411	ASCII[02] Valid
The ASCII code macro parameters (#7412 to 7415) are validated.	
0: Disable	
1: Enable	
#7412	ASCII[02] Code
Set the ASCII code used to call macros with the ASCII code.	
L system: A,B,D,F,H,I,J,K,M,Q,R,S,T	
M system: A,B,F,H,I,K,M,Q,R,S,T	
#7413	ASCII[02] Type
Set the macro call type.	
0: M98	
1: G65	
2: G66	
3: G66.1	
#7414	ASCII[02] Program No.
Set the program No. called with macro call.	
---Setting range---	
Program name or file name (up to 32 characters)	
#7415	ASCII[02] Variable
When the call type is "0", set the variable No. set after the ASCII code.	
---Setting range---	
100 to 149	

15 Machine Parameters

15.18 Macro List

#7421	Gmac initial Gcode
Specify the initial G code to be used when the macro call via G command is set all at once.	
---Setting range---	
0 to 9999	
#7422	Gmac batch type
Select the type of the macro call.	
0: equivalent to M98 P****;	
1: equivalent to G65 P****;	
2: equivalent to G66 P****;	
3: equivalent to G66.1 P****;	
Others: equivalent to M98 P****;	
#7423	Gmac initial prog.
Specify the initial program No. to be used when the macro call via G command is set all at once.	
This parameter cannot be specified with the file name.	
When the parameter is set to "0", the batch settings of the macro call via G command will be invalid.	
---Setting range---	
0 to 99999999	
#7424	Gmac qty of macros
Specify the number of sequential macro programs to be called when the macro call via G command is set all at once.	
When the parameter is set to "0", the batch settings of the macro call via G command will be invalid.	
---Setting range---	
0 to 255	
#7431	Gm.n initial Gcode
Specify the initial G code to be used when the macro call via G command with decimal point is set all at once.	
---Setting range---	
0.0 to 999.9	
#7432	Gm.n batch type
Select the type of the macro call.	
0: equivalent to M98 P****;	
1: equivalent to G65 P****;	
2: equivalent to G66 P****;	
3: equivalent to G66.1 P****;	
Others: equivalent to M98 P****;	
#7433	Gm.n initial prog.
Specify the initial program No. to be used when the macro call via G command with decimal point is set all at once.	
This parameter cannot be specified with the file name.	
When the parameter is set to "0", the batch settings of the macro call via G command with decimal point will be invalid.	
---Setting range---	
0 to 99999999	
#7434	Gm.n qty of macros
Specify the number of sequential macro programs to be called when the macro call via G command with decimal point is set all at once.	
When the parameter is set to "0", the batch settings of the macro call via G command with decimal point will be invalid.	
---Setting range---	
0 to 255	

15 Machine Parameters

15.18 Macro List

#7441	Mmac[1] init Mcode
Specify the initial M code to be used when the macro call via M command is set all at once. This is valid when "#1195 Mmac" is set to "1". ---Setting range--- 0 to 9999	
#7442	Mmac[1] batch type
Specify the macro call type. 0: Equivalent to M98 P****; 1: Equivalent to G65 P****; 2: Equivalent to G66 P****; 3: Equivalent to G66.1 P****; 4: Equivalent to G144 D0 A****; (Sub part system control II complete wait method) (for L system only) 5: Equivalent to G144 D1 A****; (Sub part system control II parallel process method) (for L system only) Others: Equivalent to M98 P****;	
#7443	Mmac[1] init prog.
Specify the initial program No. to be used when the macro call via M command is set all at once. This parameter cannot be specified with the file name. When the parameter is set to "0", the batch settings of the macro call via M command will be invalid. ---Setting range--- 0 to 99999999	
#7444	Mmac[1] qty macros
Specify the number of sequential macro programs to call when the macro call via M command is set all at once. When the parameter is set to "0", the batch settings of the macro call via M command will be invalid. ---Setting range--- 0 to 9999	
#7451	Mmac[2] init Mcode
The setting method is same as "#7441".	
#7452	Mmac[2] batch type
The setting method is same as "#7442".	
#7453	Mmac[2] init prog.
The setting method is same as "#7443".	
#7454	Mmac[2] qty macros
The setting method is same as "#7444".	
#7461	Mmac[3] init Mcode
The setting method is same as "#7441".	
#7462	Mmac[3] batch type
The setting method is same as "#7442".	
#7463	Mmac[3] init prog.
The setting method is same as "#7443".	
#7464	Mmac[3] qty macros
The setting method is same as "#7444".	
#56501	Gm.n[01] code
Specify the G code to be used for the macro call via G command with decimal point. Specify it with one decimal place. When the parameter is set to "0.0", the macro call via G command with decimal point will be invalid. ---Setting range--- 0.0 to 999.9	

15 Machine Parameters

15.18 Macro List

#56502	Gm.n[01] type
Select the type of the macro call. 0: equivalent to M98 P****; 1: equivalent to G65 P****; 2: equivalent to G66 P****; 3: equivalent to G66.1 P****; Others: equivalent to M98 P****;	
#56503	Gm.n[01] prog. No.
Specify the number of the program or the name of the file to be called up. The file name can be up to 32 characters long. ---Setting range--- Program name or file name (up to 32 characters long)	
#56511	Gm.n[02] code
The setting method is same as "#56501".	
#56512	Gm.n[02] type
The setting method is same as "#56502".	
#56513	Gm.n[02] prog. No.
The setting method is same as "#56503".	
#56521	Gm.n[03] code
The setting method is same as "#56501".	
#56522	Gm.n[03] type
The setting method is same as "#56502".	
#56523	Gm.n[03] prog. No.
The setting method is same as "#56503".	
#56531	Gm.n[04] code
The setting method is same as "#56501".	
#56532	Gm.n[04] type
The setting method is same as "#56502".	
#56533	Gm.n[04] prog. No.
The setting method is same as "#56503".	
#56541	Gm.n[05] code
The setting method is same as "#56501".	
#56542	Gm.n[05] type
The setting method is same as "#56502".	
#56543	Gm.n[05] prog. No.
The setting method is same as "#56503".	
#56551	Gm.n[06] code
The setting method is same as "#56501".	
#56552	Gm.n[06] type
The setting method is same as "#56502".	
#56553	Gm.n[06] prog. No.
The setting method is same as "#56503".	
#56561	Gm.n[07] code
The setting method is same as "#56501".	
#56562	Gm.n[07] type
The setting method is same as "#56502".	

15 Machine Parameters

15.18 Macro List

#56563	Gm.n[07] prog. No.
The setting method is same as "#56503".	
#56571	Gm.n[08] code
The setting method is same as "#56501".	
#56572	Gm.n[08] type
The setting method is same as "#56502".	
#56573	Gm.n[08] prog. No.
The setting method is same as "#56503".	
#56581	Gm.n[09] code
The setting method is same as "#56501".	
#56582	Gm.n[09] type
The setting method is same as "#56502".	
#56583	Gm.n[09] prog. No.
The setting method is same as "#56503".	
#56591	Gm.n[10] code
The setting method is same as "#56501".	
#56592	Gm.n[10] type
The setting method is same as "#56502".	
#56593	Gm.n[10] prog. No.
The setting method is same as "#56503".	

15 Machine Parameters

15.19 Position Switches

15.19 Position Switches

#7500	Pcheck	High-speed switching of position switch
Specify whether to perform position switch area checking at high speeds.		
0: Do not perform position switch area checking at high speed (do it the same as before).		
1: Perform position switch area checking at high speed.		
#7501+10(n-1)	PSWn axis	Axis name
"n" represents the position switch No. (n=1 to 24)		
Specify the name of the axis for which a position switch is provided.		
---Setting range---		
Axis address such as X, Y, Z, U, V, W, A, B, C or H		
#7502+10(n-1)	PSWn dog1	Imaginary dog position 1
"n" represents the position switch No. (n=1 to 24)		
When the machine enters the range between imaginary dog positions 1 and 2, a signal is output to the PLC.		
For the device No., refer to "PLC Interface Manual".		
---Setting range---		
-99999.999 to 99999.999 (mm)		
#7503+10(n-1)	PSWn dog2	Imaginary dog position 2
"n" represents the position switch No. (n=1 to 24)		
When the machine enters the range between imaginary dog positions 1 and 2, a signal is output to the PLC.		
For the device No., refer to "PLC Interface Manual".		
---Setting range---		
-99999.999 to 99999.999 (mm)		
#7504+10(n-1)	PSWn check	Selection of area check method
"n" represents the position switch No. (n=1 to 24)		
When position switch area checking at high speed is selected, specify the mode of area checking, i.e., whether to use the command type machine position or encoder feedback position, for each position switch.		
0: Use the command type machine position as the machine position for position switch area checking.		
1: Use the encoder feedback position as the machine position for position switch area checking.		
(Note) This parameter is valid only when "1" set in "#7500 Pcheck".		

15.20 RIO Device Allocation Parameters

(PR)	#53001	RIO dev assign	RIO device allocation method
		Select whether the fixed allocation method or arbitrary allocation method is used to assign devices to each remote I/O unit station. 0: Fixed allocation 1: Arbitrary allocation	
(PR)	#53011	RIO CH No. #1	Remote I/O channel No. for allocation
		Specify the channel No. of the 1st remote I/O unit station. * When 0 is set, all the RIO allocation parameters of the 1st station will be disabled. ---Setting range--- 0, 1 to 3	
(PR)	#53012	RIO Station No. #1	Remote I/O station No. for allocation
		Specify the station No. of the 1st remote I/O unit station. * Set this parameter to be the same as the rotary switch of the remote I/O unit to which PLC devices are assigned. ---Setting range--- 0 to 63	
(PR)	#53013	DI dev name #1	DI device name #1
		Specify the name of DI allocation devices for the 1st remote I/O unit station. * When 0 is set, this will be left blank. ---Setting range--- 0, X, R, ZR	
(PR)	#53014	DI dev No. #1	DI device number #1
		Specify the head device No. of DI allocation devices for the 1st remote I/O unit station. For device X: Hexadecimal For others: Decimal * This parameter changes to "0" if you change the device name "DI dev name #1". * Specify "DI dev name #1" ahead of this parameter. * The devices corresponding to the occupied station of the operation panel cannot be set. ---Setting range--- Decimal: 0 to 65535 Hexadecimal: 0 to FFFF	
(PR)	#53015	DO dev name #1	DO device name #1
		Specify the name of DO allocation devices for the 1st remote I/O unit station. * When 0 is set, this will be left blank. ---Setting range--- 0, Y, R, ZR	
(PR)	#53016	DO dev No. #1	DO device number #1
		Specify the head device No. of DO allocation devices for the 1st remote I/O unit station. For device Y: Hexadecimal For others: Decimal * This parameter changes to "0" if you change the device name "DO dev name #1". * Specify "DO dev name #1" ahead of this parameter. * The devices corresponding to the occupied station of the operation panel cannot be set. ---Setting range--- Decimal: 0 to 65535 Hexadecimal: 0 to FFFF	

15 Machine Parameters

15.20 RIO Device Allocation Parameters

(PR)	#53017	DI Hi-Spd #1	High-speed input designation #1
		Select at which speed to input 32 points of input data to the 1st remote I/O unit station: PLC high-speed or PLC medium-speed. 0: PLC medium-speed 1: PLC high-speed	
(PR)	#53018	DO Hi-Spd #1	High-speed output designation #1
		Select at which speed to output 32 points of output data from the 1st remote I/O unit station: PLC high-speed or PLC medium-speed. 0: PLC medium-speed 1: PLC high-speed	

15 Machine Parameters

15.20 RIO Device Allocation Parameters

Parameter list for RIO device 2nd and following stations

Parameter Nos and Names for the RIO device 2nd and following stations are shown below.

Refer to the description of RIO 1st station by replacing its station No. (or # No) for details of each parameter.

	RIO CH No.	RIO Sta. No.	DI dev name	DI dev No.	DO dev name	DO dev No.	DI Hi-Spd	DO Hi-Spd
#1 Station No.: 1	#53011 RIO CH No. #1	#53012 RIO Sta. No. #1	#53013 DI dev name #1	#53014 DI dev No. #1	#53015 DO dev name #1	#53016 DO dev No. #1	#53017 DI Hi-Spd #1	#53018 DO Hi-Spd #1
#2 Station No.: 2	#53021 RIO CH No. #2	#53022 RIO Sta. No. #2	#53023 DI dev name #2	#53024 DI dev No. #2	#53025 DO dev name #2	#53026 DO dev No. #2	#53027 DI Hi-Spd #2	#53028 DO Hi-Spd #2
#3 Station No.: 3	#53031 RIO CH No. #3	#53032 RIO Sta. No. #3	#53033 DI dev name #3	#53034 DI dev No. #3	#53035 DO dev name #3	#53036 DO dev No. #3	#53037 DI Hi-Spd #3	#53038 DO Hi-Spd #3
#4 Station No.: 4	#53041 RIO CH No. #4	#53042 RIO Sta. No. #4	#53043 DI dev name #4	#53044 DI dev No. #4	#53045 DO dev name #4	#53046 DO dev No. #4	#53047 DI Hi-Spd #4	#53048 DO Hi-Spd #4
#5 Station No.: 5	#53051 RIO CH No. #5	#53052 RIO Sta. No. #5	#53053 DI dev name #5	#53054 DI dev No. #5	#53055 DO dev name #5	#53056 DO dev No. #5	#53057 DI Hi-Spd #5	#53058 DO Hi-Spd #5
#6 Station No.: 6	#53061 RIO CH No. #6	#53062 RIO Sta. No. #6	#53063 DI dev name #6	#53064 DI dev No. #6	#53065 DO dev name #6	#53066 DO dev No. #6	#53067 DI Hi-Spd #6	#53068 DO Hi-Spd #6
#7 Station No.: 7	#53071 RIO CH No. #7	#53072 RIO Sta. No. #7	#53073 DI dev name #7	#53074 DI dev No. #7	#53075 DO dev name #7	#53076 DO dev No. #7	#53077 DI Hi-Spd #7	#53078 DO Hi-Spd #7
#8 Station No.: 8	#53081 RIO CH No. #8	#53082 RIO Sta. No. #8	#53083 DI dev name #8	#53084 DI dev No. #8	#53085 DO dev name #8	#53086 DO dev No. #8	#53087 DI Hi-Spd #8	#53088 DO Hi-Spd #8
#9 Station No.: 9	#53091 RIO CH No. #9	#53092 RIO Sta. No. #9	#53093 DI dev name #9	#53094 DI dev No. #9	#53095 DO dev name #9	#53096 DO dev No. #9	#53097 DI Hi-Spd #9	#53098 DO Hi-Spd #9
#10 Station No.: 10	#53101 RIO CH No. #10	#53102 RIO Sta. No. #10	#53103 DI dev name #10	#53104 DI dev No. #10	#53105 DO dev name #10	#53106 DO dev No. #10	#53107 DI Hi-Spd #10	#53108 DO Hi-Spd #10
#11 Station No.: 11	#53111 RIO CH No. #11	#53112 RIO Sta. No. #11	#53113 DI dev name #11	#53114 DI dev No. #11	#53115 DO dev name #11	#53116 DO dev No. #11	#53117 DI Hi-Spd #11	#53118 DO Hi-Spd #11
#12 Station No.: 12	#53121 RIO CH No. #12	#53122 RIO Sta. No. #12	#53123 DI dev name #12	#53124 DI dev No. #12	#53125 DO dev name #12	#53126 DO dev No. #12	#53127 DI Hi-Spd #12	#53128 DO Hi-Spd #12
#13 Station No.: 13	#53131 RIO CH No. #13	#53132 RIO Sta. No. #13	#53133 DI dev name #13	#53134 DI dev No. #13	#53135 DO dev name #13	#53136 DO dev No. #13	#53137 DI Hi-Spd #13	#53138 DO Hi-Spd #13
#14 Station No.: 14	#53141 RIO CH No. #14	#53142 RIO Sta. No. #14	#53143 DI dev name #14	#53144 DI dev No. #14	#53145 DO dev name #14	#53146 DO dev No. #14	#53147 DI Hi-Spd #14	#53148 DO Hi-Spd #14
#15 Station No.: 15	#53151 RIO CH No. #15	#53152 RIO Sta. No. #15	#53153 DI dev name #15	#53154 DI dev No. #15	#53155 DO dev name #15	#53156 DO dev No. #15	#53157 DI Hi-Spd #15	#53158 DO Hi-Spd #15
#16 Station No.: 16	#53161 RIO CH No. #16	#53162 RIO Sta. No. #16	#53163 DI dev name #16	#53164 DI dev No. #16	#53165 DO dev name #16	#53166 DO dev No. #16	#53167 DI Hi-Spd #16	#53168 DO Hi-Spd #16
#17 Station No.: 17	#53171 RIO CH No. #17	#53172 RIO Sta. No. #17	#53173 DI dev name #17	#53174 DI dev No. #17	#53175 DO dev name #17	#53176 DO dev No. #17	#53177 DI Hi-Spd #17	#53178 DO Hi-Spd #17

15 Machine Parameters

15.20 RIO Device Allocation Parameters

	RIO CH No.	RIO Sta. No.	DI dev name	DI dev No.	DO dev name	DO dev No.	DI Hi-Spd	DO Hi-Spd
#18 Station No.: 18	#53181 RIO CH No. #18	#53182 RIO Sta. No. #18	#53183 DI dev name #18	#53184 DI dev No. #18	#53185 DO dev name #18	#53186 DO dev No. #18	#53187 DI Hi-Spd #18	#53188 DO Hi-Spd #18
#19 Station No.: 19	#53191 RIO CH No. #19	#53192 RIO Sta. No. #19	#53193 DI dev name #19	#53194 DI dev No. #19	#53195 DO dev name #19	#53196 DO dev No. #19	#53197 DI Hi-Spd #19	#53198 DO Hi-Spd #19
#20 Station No.: 20	#53201 RIO CH No. #20	#53202 RIO Sta. No. #20	#53203 DI dev name #20	#53204 DI dev No. #20	#53205 DO dev name #20	#53206 DO dev No. #20	#53207 DI Hi-Spd #20	#53208 DO Hi-Spd #20
#21 Station No.: 21	#53211 RIO CH No. #21	#53212 RIO Sta. No. #21	#53213 DI dev name #21	#53214 DI dev No. #21	#53215 DO dev name #21	#53216 DO dev No. #21	#53217 DI Hi-Spd #21	#53218 DO Hi-Spd #21
#22 Station No.: 22	#53221 RIO CH No. #22	#53222 RIO Sta. No. #22	#53223 DI dev name #22	#53224 DI dev No. #22	#53225 DO dev name #22	#53226 DO dev No. #22	#53227 DI Hi-Spd #22	#53228 DO Hi-Spd #22
#23 Station No.: 23	#53231 RIO CH No. #23	#53232 RIO Sta. No. #23	#53233 DI dev name #23	#53234 DI dev No. #23	#53235 DO dev name #23	#53236 DO dev No. #23	#53237 DI Hi-Spd #23	#53238 DO Hi-Spd #23
#24 Station No.: 24	#53241 RIO CH No. #24	#53242 RIO Sta. No. #24	#53243 DI dev name #24	#53244 DI dev No. #24	#53245 DO dev name #24	#53246 DO dev No. #24	#53247 DI Hi-Spd #24	#53248 DO Hi-Spd #24
#25 Station No.: 25	#53251 RIO CH No. #25	#53252 RIO Sta. No. #25	#53253 DI dev name #25	#53254 DI dev No. #25	#53255 DO dev name #25	#53256 DO dev No. #25	#53257 DI Hi-Spd #25	#53258 DO Hi-Spd #25
#26 Station No.: 26	#53261 RIO CH No. #26	#53262 RIO Sta. No. #26	#53263 DI dev name #26	#53264 DI dev No. #26	#53265 DO dev name #26	#53266 DO dev No. #26	#53267 DI Hi-Spd #26	#53268 DO Hi-Spd #26
#27 Station No.: 27	#53271 RIO CH No. #27	#53272 RIO Sta. No. #27	#53273 DI dev name #27	#53274 DI dev No. #27	#53275 DO dev name #27	#53276 DO dev No. #27	#53277 DI Hi-Spd #27	#53278 DO Hi-Spd #27
#28 Station No.: 28	#53281 RIO CH No. #28	#53282 RIO Sta. No. #28	#53283 DI dev name #28	#53284 DI dev No. #28	#53285 DO dev name #28	#53286 DO dev No. #28	#53287 DI Hi-Spd #28	#53288 DO Hi-Spd #28
#29 Station No.: 29	#53291 RIO CH No. #29	#53292 RIO Sta. No. #29	#53293 DI dev name #29	#53294 DI dev No. #29	#53295 DO dev name #29	#53296 DO dev No. #29	#53297 DI Hi-Spd #29	#53298 DO Hi-Spd #29
#30 Station No.: 30	#53301 RIO CH No. #30	#53302 RIO Sta. No. #30	#53303 DI dev name #30	#53304 DI dev No. #30	#53305 DO dev name #30	#53306 DO dev No. #30	#53307 DI Hi-Spd #30	#53308 DO Hi-Spd #30
#31 Station No.: 31	#53311 RIO CH No. #31	#53312 RIO Sta. No. #31	#53313 DI dev name #31	#53314 DI dev No. #31	#53315 DO dev name #31	#53316 DO dev No. #31	#53317 DI Hi-Spd #31	#53318 DO Hi-Spd #31
#32 Station No.: 32	#53321 RIO CH No. #32	#53322 RIO Sta. No. #32	#53323 DI dev name #32	#53324 DI dev No. #32	#53325 DO dev name #32	#53326 DO dev No. #32	#53327 DI Hi-Spd #32	#53328 DO Hi-Spd #32
#33 Station No.: 33	#53331 RIO CH No. #33	#53332 RIO Sta. No. #33	#53333 DI dev name #33	#53334 DI dev No. #33	#53335 DO dev name #33	#53336 DO dev No. #33	#53337 DI Hi-Spd #33	#53338 DO Hi-Spd #33
#34 Station No.: 34	#53341 RIO CH No. #34	#53342 RIO Sta. No. #34	#53343 DI dev name #34	#53344 DI dev No. #34	#53345 DO dev name #34	#53346 DO dev No. #34	#53347 DI Hi-Spd #34	#53348 DO Hi-Spd #34
#35 Station No.: 35	#53351 RIO CH No. #35	#53352 RIO Sta. No. #35	#53353 DI dev name #35	#53354 DI dev No. #35	#53355 DO dev name #35	#53356 DO dev No. #35	#53357 DI Hi-Spd #35	#53358 DO Hi-Spd #35
#36 Station No.: 36	#53361 RIO CH No. #36	#53362 RIO Sta. No. #36	#53363 DI dev name #36	#53364 DI dev No. #36	#53365 DO dev name #36	#53366 DO dev No. #36	#53367 DI Hi-Spd #36	#53368 DO Hi-Spd #36

15 Machine Parameters

15.20 RIO Device Allocation Parameters

	RIO CH No.	RIO Sta. No.	DI dev name	DI dev No.	DO dev name	DO dev No.	DI Hi-Spd	DO Hi-Spd
#37 Station No.: 37	#53371 RIO CH No. #37	#53372 RIO Sta. No. #37	#53373 DI dev name #37	#53374 DI dev No. #37	#53375 DO dev name #37	#53376 DO dev No. #37	#53377 DI Hi-Spd #37	#53378 DO Hi-Spd #37
#38 Station No.: 38	#53381 RIO CH No. #38	#53382 RIO Sta. No. #38	#53383 DI dev name #38	#53384 DI dev No. #38	#53385 DO dev name #38	#53386 DO dev No. #38	#53387 DI Hi-Spd #38	#53388 DO Hi-Spd #38
#39 Station No.: 39	#53391 RIO CH No. #39	#53392 RIO Sta. No. #39	#53393 DI dev name #39	#53394 DI dev No. #39	#53395 DO dev name #39	#53396 DO dev No. #39	#53397 DI Hi-Spd #39	#53398 DO Hi-Spd #39
#40 Station No.: 40	#53401 RIO CH No. #40	#53402 RIO Sta. No. #40	#53403 DI dev name #40	#53404 DI dev No. #40	#53405 DO dev name #40	#53406 DO dev No. #40	#53407 DI Hi-Spd #40	#53408 DO Hi-Spd #40
#41 Station No.: 41	#53411 RIO CH No. #41	#53412 RIO Sta. No. #41	#53413 DI dev name #41	#53414 DI dev No. #41	#53415 DO dev name #41	#53416 DO dev No. #41	#53417 DI Hi-Spd #41	#53418 DO Hi-Spd #41
#42 Station No.: 42	#53421 RIO CH No. #42	#53422 RIO Sta. No. #42	#53423 DI dev name #42	#53424 DI dev No. #42	#53425 DO dev name #42	#53426 DO dev No. #42	#53427 DI Hi-Spd #42	#53428 DO Hi-Spd #42
#43 Station No.: 43	#53431 RIO CH No. #43	#53432 RIO Sta. No. #43	#53433 DI dev name #43	#53434 DI dev No. #43	#53435 DO dev name #43	#53436 DO dev No. #43	#53437 DI Hi-Spd #43	#53438 DO Hi-Spd #43
#44 Station No.: 44	#53441 RIO CH No. #44	#53442 RIO Sta. No. #44	#53443 DI dev name #44	#53444 DI dev No. #44	#53445 DO dev name #44	#53446 DO dev No. #44	#53447 DI Hi-Spd #44	#53448 DO Hi-Spd #44
#45 Station No.: 45	#53451 RIO CH No. #45	#53452 RIO Sta. No. #45	#53453 DI dev name #45	#53454 DI dev No. #45	#53455 DO dev name #45	#53456 DO dev No. #45	#53457 DI Hi-Spd #45	#53458 DO Hi-Spd #45
#46 Station No.: 46	#53461 RIO CH No. #46	#53462 RIO Sta. No. #46	#53463 DI dev name #46	#53464 DI dev No. #46	#53465 DO dev name #46	#53466 DO dev No. #46	#53467 DI Hi-Spd #46	#53468 DO Hi-Spd #46
#47 Station No.: 47	#53471 RIO CH No. #47	#53472 RIO Sta. No. #47	#53473 DI dev name #47	#53474 DI dev No. #47	#53475 DO dev name #47	#53476 DO dev No. #47	#53477 DI Hi-Spd #47	#53478 DO Hi-Spd #47
#48 Station No.: 48	#53481 RIO CH No. #48	#53482 RIO Sta. No. #48	#53483 DI dev name #48	#53484 DI dev No. #48	#53485 DO dev name #48	#53486 DO dev No. #48	#53487 DI Hi-Spd #48	#53488 DO Hi-Spd #48
#49 Station No.: 49	#53491 RIO CH No. #49	#53492 RIO Sta. No. #49	#53493 DI dev name #49	#53494 DI dev No. #49	#53495 DO dev name #49	#53496 DO dev No. #49	#53497 DI Hi-Spd #49	#53498 DO Hi-Spd #49
#50 Station No.: 50	#53501 RIO CH No. #50	#53502 RIO Sta. No. #50	#53503 DI dev name #50	#53504 DI dev No. #50	#53505 DO dev name #50	#53506 DO dev No. #50	#53507 DI Hi-Spd #50	#53508 DO Hi-Spd #50
#51 Station No.: 51	#53511 RIO CH No. #51	#53512 RIO Sta. No. #51	#53513 DI dev name #51	#53514 DI dev No. #51	#53515 DO dev name #51	#53516 DO dev No. #51	#53517 DI Hi-Spd #51	#53518 DO Hi-Spd #51
#52 Station No.: 52	#53521 RIO CH No. #52	#53522 RIO Sta. No. #52	#53523 DI dev name #52	#53524 DI dev No. #52	#53525 DO dev name #52	#53526 DO dev No. #52	#53527 DI Hi-Spd #52	#53528 DO Hi-Spd #52
#53 Station No.: 53	#53531 RIO CH No. #53	#53532 RIO Sta. No. #53	#53533 DI dev name #53	#53534 DI dev No. #53	#53535 DO dev name #53	#53536 DO dev No. #53	#53537 DI Hi-Spd #53	#53538 DO Hi-Spd #53
#54 Station No.: 54	#53541 RIO CH No. #54	#53542 RIO Sta. No. #54	#53543 DI dev name #54	#53544 DI dev No. #54	#53545 DO dev name #54	#53546 DO dev No. #54	#53547 DI Hi-Spd #54	#53548 DO Hi-Spd #54
#55 Station No.: 55	#53551 RIO CH No. #55	#53552 RIO Sta. No. #55	#53553 DI dev name #55	#53554 DI dev No. #55	#53555 DO dev name #55	#53556 DO dev No. #55	#53557 DI Hi-Spd #55	#53558 DO Hi-Spd #55

15 Machine Parameters

15.20 RIO Device Allocation Parameters

	RIO CH No.	RIO Sta. No.	DI dev name	DI dev No.	DO dev name	DO dev No.	DI Hi-Spd	DO Hi-Spd
#56 Station No.: 56	#53561 RIO CH No. #56	#53562 RIO Sta. No. #56	#53563 DI dev name #56	#53564 DI dev No. #56	#53565 DO dev name #56	#53566 DO dev No. #56	#53567 DI Hi-Spd #56	#53568 DO Hi-Spd #56
#57 Station No.: 57	#53571 RIO CH No. #57	#53572 RIO Sta. No. #57	#53573 DI dev name #57	#53574 DI dev No. #57	#53575 DO dev name #57	#53576 DO dev No. #57	#53577 DI Hi-Spd #57	#53578 DO Hi-Spd #57
#58 Station No.: 58	#53581 RIO CH No. #58	#53582 RIO Sta. No. #58	#53583 DI dev name #58	#53584 DI dev No. #58	#53585 DO dev name #58	#53586 DO dev No. #58	#53587 DI Hi-Spd #58	#53588 DO Hi-Spd #58
#59 Station No.: 59	#53591 RIO CH No. #59	#53592 RIO Sta. No. #59	#53593 DI dev name #59	#53594 DI dev No. #59	#53595 DO dev name #59	#53596 DO dev No. #59	#53597 DI Hi-Spd #59	#53598 DO Hi-Spd #59
#60 Station No.: 60	#53601 RIO CH No. #60	#53602 RIO Sta. No. #60	#53603 DI dev name #60	#53604 DI dev No. #60	#53605 DO dev name #60	#53606 DO dev No. #60	#53607 DI Hi-Spd #60	#53608 DO Hi-Spd #60
#61 Station No.: 61	#53611 RIO CH No. #61	#53612 RIO Sta. No. #61	#53613 DI dev name #61	#53614 DI dev No. #61	#53615 DO dev name #61	#53616 DO dev No. #61	#53617 DI Hi-Spd #61	#53618 DO Hi-Spd #61
#62 Station No.: 62	#53621 RIO CH No. #62	#53622 RIO Sta. No. #62	#53623 DI dev name #62	#53624 DI dev No. #62	#53625 DO dev name #62	#53626 DO dev No. #62	#53627 DI Hi-Spd #62	#53628 DO Hi-Spd #62
#63 Station No.: 63	#53631 RIO CH No. #63	#53632 RIO Sta. No. #63	#53633 DI dev name #63	#53634 DI dev No. #63	#53635 DO dev name #63	#53636 DO dev No. #63	#53637 DI Hi-Spd #63	#53638 DO Hi-Spd #63
#64 Station No.: 64	#53641 RIO CH No. #64	#53642 RIO Sta. No. #64	#53643 DI dev name #64	#53644 DI dev No. #64	#53645 DO dev name #64	#53646 DO dev No. #64	#53647 DI Hi-Spd #64	#53648 DO Hi-Spd #64
#65 Station No.: 65	#53651 RIO CH No. #65	#53652 RIO Sta. No. #65	#53653 DI dev name #65	#53654 DI dev No. #65	#53655 DO dev name #65	#53656 DO dev No. #65	#53657 DI Hi-Spd #65	#53658 DO Hi-Spd #65
#66 Station No.: 66	#53661 RIO CH No. #66	#53662 RIO Sta. No. #66	#53663 DI dev name #66	#53664 DI dev No. #66	#53665 DO dev name #66	#53666 DO dev No. #66	#53667 DI Hi-Spd #66	#53668 DO Hi-Spd #66
#67 Station No.: 67	#53671 RIO CH No. #67	#53672 RIO Sta. No. #67	#53673 DI dev name #67	#53674 DI dev No. #67	#53675 DO dev name #67	#53676 DO dev No. #67	#53677 DI Hi-Spd #67	#53678 DO Hi-Spd #67
#68 Station No.: 68	#53681 RIO CH No. #68	#53682 RIO Sta. No. #68	#53683 DI dev name #68	#53684 DI dev No. #68	#53685 DO dev name #68	#53686 DO dev No. #68	#53687 DI Hi-Spd #68	#53688 DO Hi-Spd #68
#69 Station No.: 69	#53691 RIO CH No. #69	#53692 RIO Sta. No. #69	#53693 DI dev name #69	#53694 DI dev No. #69	#53695 DO dev name #69	#53696 DO dev No. #69	#53697 DI Hi-Spd #69	#53698 DO Hi-Spd #69
#70 Station No.: 70	#53701 RIO CH No. #70	#53702 RIO Sta. No. #70	#53703 DI dev name #70	#53704 DI dev No. #70	#53705 DO dev name #70	#53706 DO dev No. #70	#53707 DI Hi-Spd #70	#53708 DO Hi-Spd #70
#71 Station No.: 71	#53711 RIO CH No. #71	#53712 RIO Sta. No. #71	#53713 DI dev name #71	#53714 DI dev No. #71	#53715 DO dev name #71	#53716 DO dev No. #71	#53717 DI Hi-Spd #71	#53718 DO Hi-Spd #71
#72 Station No.: 72	#53721 RIO CH No. #72	#53722 RIO Sta. No. #72	#53723 DI dev name #72	#53724 DI dev No. #72	#53725 DO dev name #72	#53726 DO dev No. #72	#53727 DI Hi-Spd #72	#53728 DO Hi-Spd #72
#73 Station No.: 73	#53731 RIO CH No. #73	#53732 RIO Sta. No. #73	#53733 DI dev name #73	#53734 DI dev No. #73	#53735 DO dev name #73	#53736 DO dev No. #73	#53737 DI Hi-Spd #73	#53738 DO Hi-Spd #73
#74 Station No.: 74	#53741 RIO CH No. #74	#53742 RIO Sta. No. #74	#53743 DI dev name #74	#53744 DI dev No. #74	#53745 DO dev name #74	#53746 DO dev No. #74	#53747 DI Hi-Spd #74	#53748 DO Hi-Spd #74

15 Machine Parameters

15.20 RIO Device Allocation Parameters

	RIO CH No.	RIO Sta. No.	DI dev name	DI dev No.	DO dev name	DO dev No.	DI Hi-Spd	DO Hi-Spd
#75 Station No.: 75	#53751 RIO CH No. #75	#53752 RIO Sta. No. #75	#53753 DI dev name #75	#53754 DI dev No. #75	#53755 DO dev name #75	#53756 DO dev No. #75	#53757 DI Hi-Spd #75	#53758 DO Hi-Spd #75
#76 Station No.: 76	#53761 RIO CH No. #76	#53762 RIO Sta. No. #76	#53763 DI dev name #76	#53764 DI dev No. #76	#53765 DO dev name #76	#53766 DO dev No. #76	#53767 DI Hi-Spd #76	#53768 DO Hi-Spd #76
#77 Station No.: 77	#53771 RIO CH No. #77	#53772 RIO Sta. No. #77	#53773 DI dev name #77	#53774 DI dev No. #77	#53775 DO dev name #77	#53776 DO dev No. #77	#53777 DI Hi-Spd #77	#53778 DO Hi-Spd #77
#78 Station No.: 78	#53781 RIO CH No. #78	#53782 RIO Sta. No. #78	#53783 DI dev name #78	#53784 DI dev No. #78	#53785 DO dev name #78	#53786 DO dev No. #78	#53787 DI Hi-Spd #78	#53788 DO Hi-Spd #78
#79 Station No.: 79	#53791 RIO CH No. #79	#53792 RIO Sta. No. #79	#53793 DI dev name #79	#53794 DI dev No. #79	#53795 DO dev name #79	#53796 DO dev No. #79	#53797 DI Hi-Spd #79	#53798 DO Hi-Spd #79
#80 Station No.: 80	#53801 RIO CH No. #80	#53802 RIO Sta. No. #80	#53803 DI dev name #80	#53804 DI dev No. #80	#53805 DO dev name #80	#53806 DO dev No. #80	#53807 DI Hi-Spd #80	#53808 DO Hi-Spd #80
#81 Station No.: 81	#53811 RIO CH No. #81	#53812 RIO Sta. No. #81	#53813 DI dev name #81	#53814 DI dev No. #81	#53815 DO dev name #81	#53816 DO dev No. #81	#53817 DI Hi-Spd #81	#53818 DO Hi-Spd #81
#82 Station No.: 82	#53821 RIO CH No. #82	#53822 RIO Sta. No. #82	#53823 DI dev name #82	#53824 DI dev No. #82	#53825 DO dev name #82	#53826 DO dev No. #82	#53827 DI Hi-Spd #82	#53828 DO Hi-Spd #82
#83 Station No.: 83	#53831 RIO CH No. #83	#53832 RIO Sta. No. #83	#53833 DI dev name #83	#53834 DI dev No. #83	#53835 DO dev name #83	#53836 DO dev No. #83	#53837 DI Hi-Spd #83	#53838 DO Hi-Spd #83
#84 Station No.: 84	#53841 RIO CH No. #84	#53842 RIO Sta. No. #84	#53843 DI dev name #84	#53844 DI dev No. #84	#53845 DO dev name #84	#53846 DO dev No. #84	#53847 DI Hi-Spd #84	#53848 DO Hi-Spd #84
#85 Station No.: 85	#53851 RIO CH No. #85	#53852 RIO Sta. No. #85	#53853 DI dev name #85	#53854 DI dev No. #85	#53855 DO dev name #85	#53856 DO dev No. #85	#53857 DI Hi-Spd #85	#53858 DO Hi-Spd #85
#86 Station No.: 86	#53861 RIO CH No. #86	#53862 RIO Sta. No. #86	#53863 DI dev name #86	#53864 DI dev No. #86	#53865 DO dev name #86	#53866 DO dev No. #86	#53867 DI Hi-Spd #86	#53868 DO Hi-Spd #86
#87 Station No.: 87	#53871 RIO CH No. #87	#53872 RIO Sta. No. #87	#53873 DI dev name #87	#53874 DI dev No. #87	#53875 DO dev name #87	#53876 DO dev No. #87	#53877 DI Hi-Spd #87	#53878 DO Hi-Spd #87
#88 Station No.: 88	#53881 RIO CH No. #88	#53882 RIO Sta. No. #88	#53883 DI dev name #88	#53884 DI dev No. #88	#53885 DO dev name #88	#53886 DO dev No. #88	#53887 DI Hi-Spd #88	#53888 DO Hi-Spd #88
#89 Station No.: 89	#53891 RIO CH No. #89	#53892 RIO Sta. No. #89	#53893 DI dev name #89	#53894 DI dev No. #89	#53895 DO dev name #89	#53896 DO dev No. #89	#53897 DI Hi-Spd #89	#53898 DO Hi-Spd #89
#90 Station No.: 90	#53901 RIO CH No. #90	#53902 RIO Sta. No. #90	#53903 DI dev name #90	#53904 DI dev No. #90	#53905 DO dev name #90	#53906 DO dev No. #90	#53907 DI Hi-Spd #90	#53908 DO Hi-Spd #90
#91 Station No.: 91	#53911 RIO CH No. #91	#53912 RIO Sta. No. #91	#53913 DI dev name #91	#53914 DI dev No. #91	#53915 DO dev name #91	#53916 DO dev No. #91	#53917 DI Hi-Spd #91	#53918 DO Hi-Spd #91
#92 Station No.: 92	#53921 RIO CH No. #92	#53922 RIO Sta. No. #92	#53923 DI dev name #92	#53924 DI dev No. #92	#53925 DO dev name #92	#53926 DO dev No. #92	#53927 DI Hi-Spd #92	#53928 DO Hi-Spd #92
#93 Station No.: 93	#53931 RIO CH No. #93	#53932 RIO Sta. No. #93	#53933 DI dev name #93	#53934 DI dev No. #93	#53935 DO dev name #93	#53936 DO dev No. #93	#53937 DI Hi-Spd #93	#53938 DO Hi-Spd #93

15 Machine Parameters

15.20 RIO Device Allocation Parameters

	RIO CH No.	RIO Sta. No.	DI dev name	DI dev No.	DO dev name	DO dev No.	DI Hi-Spd	DO Hi-Spd
#94 Station No.: 94	#53941 RIO CH No. #94	#53942 RIO Sta. No. #94	#53943 DI dev name #94	#53944 DI dev No. #94	#53945 DO dev name #94	#53946 DO dev No. #94	#53947 DI Hi-Spd #94	#53948 DO Hi-Spd #94
#95 Station No.: 95	#53951 RIO CH No. #95	#53952 RIO Sta. No. #95	#53953 DI dev name #95	#53954 DI dev No. #95	#53955 DO dev name #95	#53956 DO dev No. #95	#53957 DI Hi-Spd #95	#53958 DO Hi-Spd #95
#96 Station No.: 96	#53961 RIO CH No. #96	#53962 RIO Sta. No. #96	#53963 DI dev name #96	#53964 DI dev No. #96	#53965 DO dev name #96	#53966 DO dev No. #96	#53967 DI Hi-Spd #96	#53968 DO Hi-Spd #96
#97 Station No.: 97	#53971 RIO CH No. #97	#53972 RIO Sta. No. #97	#53973 DI dev name #97	#53974 DI dev No. #97	#53975 DO dev name #97	#53976 DO dev No. #97	#53977 DI Hi-Spd #97	#53978 DO Hi-Spd #97
#98 Station No.: 98	#53981 RIO CH No. #98	#53982 RIO Sta. No. #98	#53983 DI dev name #98	#53984 DI dev No. #98	#53985 DO dev name #98	#53986 DO dev No. #98	#53987 DI Hi-Spd #98	#53988 DO Hi-Spd #98
#99 Station No.: 99	#53991 RIO CH No. #99	#53992 RIO Sta. No. #99	#53993 DI dev name #99	#53994 DI dev No. #99	#53995 DO dev name #99	#53996 DO dev No. #99	#53997 DI Hi-Spd #99	#53998 DO Hi-Spd #99
#100 Station No.: 100	#54001 RIO CH No. #100	#54002 RIO Sta. No. #100	#54003 DI dev name #100	#54004 DI dev No. #100	#54005 DO dev name #100	#54006 DO dev No. #100	#54007 DI Hi-Spd #100	#54008 DO Hi-Spd #100
#101 Station No.: 101	#54011 RIO CH No. #101	#54012 RIO Sta. No. #101	#54013 DI dev name #101	#54014 DI dev No. #101	#54015 DO dev name #101	#54016 DO dev No. #101	#54017 DI Hi-Spd #101	#54018 DO Hi-Spd #101
#102 Station No.: 102	#54021 RIO CH No. #102	#54022 RIO Sta. No. #102	#54023 DI dev name #102	#54024 DI dev No. #102	#54025 DO dev name #102	#54026 DO dev No. #102	#54027 DI Hi-Spd #102	#54028 DO Hi-Spd #102
#103 Station No.: 103	#54031 RIO CH No. #103	#54032 RIO Sta. No. #103	#54033 DI dev name #103	#54034 DI dev No. #103	#54035 DO dev name #103	#54036 DO dev No. #103	#54037 DI Hi-Spd #103	#54038 DO Hi-Spd #103
#104 Station No.: 104	#54041 RIO CH No. #104	#54042 RIO Sta. No. #104	#54043 DI dev name #104	#54044 DI dev No. #104	#54045 DO dev name #104	#54046 DO dev No. #104	#54047 DI Hi-Spd #104	#54048 DO Hi-Spd #104
#105 Station No.:105	#54051 RIO CH No. #105	#54052 RIO Sta. No. #105	#54053 DI dev name #105	#54054 DI dev No. #105	#54055 DO dev name #105	#54056 DO dev No. #105	#54057 DI Hi-Spd #105	#54058 DO Hi-Spd #105
#106 Station No.:106	#54061 RIO CH No. #106	#54062 RIO Sta. No. #106	#54063 DI dev name #106	#54064 DI dev No. #106	#54065 DO dev name #106	#54066 DO dev No. #106	#54067 DI Hi-Spd #106	#54068 DO Hi-Spd #106
#107 Station No.:107	#54071 RIO CH No. #107	#54072 RIO Sta. No. #107	#54073 DI dev name #107	#54074 DI dev No. #107	#54075 DO dev name #107	#54076 DO dev No. #107	#54077 DI Hi-Spd #107	#54078 DO Hi-Spd #107
#108 Station No.:108	#54081 RIO CH No. #108	#54082 RIO Sta. No. #108	#54083 DI dev name #108	#54084 DI dev No. #108	#54085 DO dev name #108	#54086 DO dev No. #108	#54087 DI Hi-Spd #108	#54088 DO Hi-Spd #108
#109 Station No.: 109	#54091 RIO CH No. #109	#54092 RIO Sta. No. #109	#54093 DI dev name #109	#54094 DI dev No. #109	#54095 DO dev name #109	#54096 DO dev No. #109	#54097 DI Hi-Spd #109	#54098 DO Hi-Spd #109
#110 Station No.: 110	#54101 RIO CH No. #110	#54102 RIO Sta. No. #110	#54103 DI dev name #110	#54104 DI dev No. #110	#54105 DO dev name #110	#54106 DO dev No. #110	#54107 DI Hi-Spd #110	#54108 DO Hi-Spd #110
#111 Station No.: 111	#54111 RIO CH No. #111	#54112 RIO Sta. No. #111	#54113 DI dev name #111	#54114 DI dev No. #111	#54115 DO dev name #111	#54116 DO dev No. #111	#54117 DI Hi-Spd #111	#54118 DO Hi-Spd #111
#112 Station No.: 112	#54121 RIO CH No. #112	#54122 RIO Sta. No. #112	#54123 DI dev name #112	#54124 DI dev No. #112	#54125 DO dev name #112	#54126 DO dev No. #112	#54127 DI Hi-Spd #112	#54128 DO Hi-Spd #112

15 Machine Parameters

15.20 RIO Device Allocation Parameters

	RIO CH No.	RIO Sta. No.	DI dev name	DI dev No.	DO dev name	DO dev No.	DI Hi-Spd	DO Hi-Spd
#113 Station No.: 113	#54131 RIO CH No. #113	#54132 RIO Sta. No. #113	#54133 DI dev name #113	#54134 DI dev No. #113	#54135 DO dev name #113	#54136 DO dev No. #113	#54137 DI Hi-Spd #113	#54138 DO Hi-Spd #113
#114 Station No.: 114	#54141 RIO CH No. #114	#54142 RIO Sta. No. #114	#54143 DI dev name #114	#54144 DI dev No. #114	#54145 DO dev name #114	#54146 DO dev No. #114	#54147 DI Hi-Spd #114	#54148 DO Hi-Spd #114
#115 Station No.: 115	#54151 RIO CH No. #115	#54152 RIO Sta. No. #115	#54153 DI dev name #115	#54154 DI dev No. #115	#54155 DO dev name #115	#54156 DO dev No. #115	#54157 DI Hi-Spd #115	#54158 DO Hi-Spd #115
#116 Station No.: 116	#54161 RIO CH No. #116	#54162 RIO Sta. No. #116	#54163 DI dev name #116	#54164 DI dev No. #116	#54165 DO dev name #116	#54166 DO dev No. #116	#54167 DI Hi-Spd #116	#54168 DO Hi-Spd #116
#117 Station No.: 117	#54171 RIO CH No. #117	#54172 RIO Sta. No. #117	#54173 DI dev name #117	#54174 DI dev No. #117	#54175 DO dev name #117	#54176 DO dev No. #117	#54177 DI Hi-Spd #117	#54178 DO Hi-Spd #117
#118 Station No.: 118	#54181 RIO CH No. #118	#54182 RIO Sta. No. #118	#54183 DI dev name #118	#54184 DI dev No. #118	#54185 DO dev name #118	#54186 DO dev No. #118	#54187 DI Hi-Spd #118	#54188 DO Hi-Spd #118
#119 Station No.: 119	#54191 RIO CH No. #119	#54192 RIO Sta. No. #119	#54193 DI dev name #119	#54194 DI dev No. #119	#54195 DO dev name #119	#54196 DO dev No. #119	#54197 DI Hi-Spd #119	#54198 DO Hi-Spd #119
#120 Station No.: 120	#54201 RIO CH No. #120	#54202 RIO Sta. No. #120	#54203 DI dev name #120	#54204 DI dev No. #120	#54205 DO dev name #120	#54206 DO dev No. #120	#54207 DI Hi-Spd #120	#54208 DO Hi-Spd #120
#121 Station No.: 121	#54211 RIO CH No. #121	#54212 RIO Sta. No. #121	#54213 DI dev name #121	#54214 DI dev No. #121	#54215 DO dev name #121	#54216 DO dev No. #121	#54217 DI Hi-Spd #121	#54218 DO Hi-Spd #121
#122 Station No.: 122	#54221 RIO CH No. #122	#54222 RIO Sta. No. #122	#54223 DI dev name #122	#54224 DI dev No. #122	#54225 DO dev name #122	#54226 DO dev No. #122	#54227 DI Hi-Spd #122	#54228 DO Hi-Spd #122
#123 Station No.: 123	#54231 RIO CH No. #123	#54232 RIO Sta. No. #123	#54233 DI dev name #123	#54234 DI dev No. #123	#54235 DO dev name #123	#54236 DO dev No. #123	#54237 DI Hi-Spd #123	#54238 DO Hi-Spd #123
#124 Station No.: 124	#54241 RIO CH No. #124	#54242 RIO Sta. No. #124	#54243 DI dev name #124	#54244 DI dev No. #124	#54245 DO dev name #124	#54246 DO dev No. #124	#54247 DI Hi-Spd #124	#54248 DO Hi-Spd #124
#125 Station No.: 125	#54251 RIO CH No. #125	#54252 RIO Sta. No. #125	#54253 DI dev name #125	#54254 DI dev No. #125	#54255 DO dev name #125	#54256 DO dev No. #125	#54257 DI Hi-Spd #125	#54258 DO Hi-Spd #125
#126 Station No.: 126	#54261 RIO CH No. #126	#54262 RIO Sta. No. #126	#54263 DI dev name #126	#54264 DI dev No. #126	#54265 DO dev name #126	#54266 DO dev No. #126	#54267 DI Hi-Spd #126	#54268 DO Hi-Spd #126
#127 Station No.: 127	#54271 RIO CH No. #127	#54272 RIO Sta. No. #127	#54273 DI dev name #127	#54274 DI dev No. #127	#54275 DO dev name #127	#54276 DO dev No. #127	#54277 DI Hi-Spd #127	#54278 DO Hi-Spd #127
#128 Station No.: 128	#54281 RIO CH No. #128	#54282 RIO Sta. No. #128	#54283 DI dev name #128	#54284 DI dev No. #128	#54285 DO dev name #128	#54286 DO dev No. #128	#54287 DI Hi-Spd #128	#54288 DO Hi-Spd #128
#129 Station No.: 129	#54291 RIO CH No. #129	#54292 RIO Sta. No. #129	#54293 DI dev name #129	#54294 DI dev No. #129	#54295 DO dev name #129	#54296 DO dev No. #129	#54297 DI Hi-Spd #129	#54298 DO Hi-Spd #129
#130 Station No.: 130	#54301 RIO CH No. #130	#54302 RIO Sta. No. #130	#54303 DI dev name #130	#54304 DI dev No. #130	#54305 DO dev name #130	#54306 DO dev No. #130	#54307 DI Hi-Spd #130	#54308 DO Hi-Spd #130
#131 Station No.: 131	#54311 RIO CH No. #131	#54312 RIO Sta. No. #131	#54313 DI dev name #131	#54314 DI dev No. #131	#54315 DO dev name #131	#54316 DO dev No. #131	#54317 DI Hi-Spd #131	#54318 DO Hi-Spd #131

15 Machine Parameters

15.20 RIO Device Allocation Parameters

	RIO CH No.	RIO Sta. No.	DI dev name	DI dev No.	DO dev name	DO dev No.	DI Hi-Spd	DO Hi-Spd
#132 Station No.: 132	#54321 RIO CH No. #132	#54322 RIO Sta. No. #132	#54323 DI dev name #132	#54324 DI dev No. #132	#54325 DO dev name #132	#54326 DO dev No. #132	#54327 DI Hi-Spd #132	#54328 DO Hi-Spd #132
#133 Station No.: 133	#54331 RIO CH No. #133	#54332 RIO Sta. No. #133	#54333 DI dev name #133	#54334 DI dev No. #133	#54335 DO dev name #133	#54336 DO dev No. #133	#54337 DI Hi-Spd #133	#54338 DO Hi-Spd #133
#134 Station No.: 134	#54341 RIO CH No. #134	#54342 RIO Sta. No. #134	#54343 DI dev name #134	#54344 DI dev No. #134	#54345 DO dev name #134	#54346 DO dev No. #134	#54347 DI Hi-Spd #134	#54348 DO Hi-Spd #134
#135 Station No.: 135	#54351 RIO CH No. #135	#54352 RIO Sta. No. #135	#54353 DI dev name #135	#54354 DI dev No. #135	#54355 DO dev name #135	#54356 DO dev No. #135	#54357 DI Hi-Spd #135	#54358 DO Hi-Spd #135
#136 Station No.: 136	#54361 RIO CH No. #136	#54362 RIO Sta. No. #136	#54363 DI dev name #136	#54364 DI dev No. #136	#54365 DO dev name #136	#54366 DO dev No. #136	#54367 DI Hi-Spd #136	#54368 DO Hi-Spd #136
#137 Station No.: 137	#54371 RIO CH No. #137	#54372 RIO Sta. No. #137	#54373 DI dev name #137	#54374 DI dev No. #137	#54375 DO dev name #137	#54376 DO dev No. #137	#54377 DI Hi-Spd #137	#54378 DO Hi-Spd #137
#138 Station No.: 138	#54381 RIO CH No. #138	#54382 RIO Sta. No. #138	#54383 DI dev name #138	#54384 DI dev No. #138	#54385 DO dev name #138	#54386 DO dev No. #138	#54387 DI Hi-Spd #138	#54388 DO Hi-Spd #138
#139 Station No.: 139	#54391 RIO CH No. #139	#54392 RIO Sta. No. #139	#54393 DI dev name #139	#54394 DI dev No. #139	#54395 DO dev name #139	#54396 DO dev No. #139	#54397 DI Hi-Spd #139	#54398 DO Hi-Spd #139
#140 Station No.: 140	#54401 RIO CH No. #140	#54402 RIO Sta. No. #140	#54403 DI dev name #140	#54404 DI dev No. #140	#54405 DO dev name #140	#54406 DO dev No. #140	#54407 DI Hi-Spd #140	#54408 DO Hi-Spd #140
#141 Station No.: 141	#54411 RIO CH No. #141	#54412 RIO Sta. No. #141	#54413 DI dev name #141	#54414 DI dev No. #141	#54415 DO dev name #141	#54416 DO dev No. #141	#54417 DI Hi-Spd #141	#54418 DO Hi-Spd #141
#142 Station No.: 142	#54421 RIO CH No. #142	#54422 RIO Sta. No. #142	#54423 DI dev name #142	#54424 DI dev No. #142	#54425 DO dev name #142	#54426 DO dev No. #142	#54427 DI Hi-Spd #142	#54428 DO Hi-Spd #142
#143 Station No.: 143	#54431 RIO CH No. #143	#54432 RIO Sta. No. #143	#54433 DI dev name #143	#54434 DI dev No. #143	#54435 DO dev name #143	#54436 DO dev No. #143	#54437 DI Hi-Spd #143	#54438 DO Hi-Spd #143
#144 Station No.: 144	#54441 RIO CH No. #144	#54442 RIO Sta. No. #144	#54443 DI dev name #144	#54444 DI dev No. #144	#54445 DO dev name #144	#54446 DO dev No. #144	#54447 DI Hi-Spd #144	#54448 DO Hi-Spd #144
#145 Station No.: 145	#54451 RIO CH No. #145	#54452 RIO Sta. No. #145	#54453 DI dev name #145	#54454 DI dev No. #145	#54455 DO dev name #145	#54456 DO dev No. #145	#54457 DI Hi-Spd #145	#54458 DO Hi-Spd #145
#146 Station No.: 146	#54461 RIO CH No. #146	#54462 RIO Sta. No. #146	#54463 DI dev name #146	#54464 DI dev No. #146	#54465 DO dev name #146	#54466 DO dev No. #146	#54467 DI Hi-Spd #146	#54468 DO Hi-Spd #146
#147 Station No.: 147	#54471 RIO CH No. #147	#54472 RIO Sta. No. #147	#54473 DI dev name #147	#54474 DI dev No. #147	#54475 DO dev name #147	#54476 DO dev No. #147	#54477 DI Hi-Spd #147	#54478 DO Hi-Spd #147
#148 Station No.: 148	#54481 RIO CH No. #148	#54482 RIO Sta. No. #148	#54483 DI dev name #148	#54484 DI dev No. #148	#54485 DO dev name #148	#54486 DO dev No. #148	#54487 DI Hi-Spd #148	#54488 DO Hi-Spd #148
#149 Station No.: 149	#54491 RIO CH No. #149	#54492 RIO Sta. No. #149	#54493 DI dev name #149	#54494 DI dev No. #149	#54495 DO dev name #149	#54496 DO dev No. #149	#54497 DI Hi-Spd #149	#54498 DO Hi-Spd #149
#150 Station No.: 150	#54501 RIO CH No. #150	#54502 RIO Sta. No. #150	#54503 DI dev name #150	#54504 DI dev No. #150	#54505 DO dev name #150	#54506 DO dev No. #150	#54507 DI Hi-Spd #150	#54508 DO Hi-Spd #150

15 Machine Parameters

15.20 RIO Device Allocation Parameters

	RIO CH No.	RIO Sta. No.	DI dev name	DI dev No.	DO dev name	DO dev No.	DI Hi-Spd	DO Hi-Spd
#151 Station No.: 151	#54511 RIO CH No. #151	#54512 RIO Sta. No. #151	#54513 DI dev name #151	#54514 DI dev No. #151	#54515 DO dev name #151	#54516 DO dev No. #151	#54517 DI Hi-Spd #151	#54518 DO Hi-Spd #151
#152 Station No.: 152	#54521 RIO CH No. #152	#54522 RIO Sta. No. #152	#54523 DI dev name #152	#54524 DI dev No. #152	#54525 DO dev name #152	#54526 DO dev No. #152	#54527 DI Hi-Spd #152	#54528 DO Hi-Spd #152
#153 Station No.: 153	#54531 RIO CH No. #153	#54532 RIO Sta. No. #153	#54533 DI dev name #153	#54534 DI dev No. #153	#54535 DO dev name #153	#54536 DO dev No. #153	#54537 DI Hi-Spd #153	#54538 DO Hi-Spd #153
#154 Station No.: 154	#54541 RIO CH No. #154	#54542 RIO Sta. No. #154	#54543 DI dev name #154	#54544 DI dev No. #154	#54545 DO dev name #154	#54546 DO dev No. #154	#54547 DI Hi-Spd #154	#54548 DO Hi-Spd #154
#155 Station No.: 155	#54551 RIO CH No. #155	#54552 RIO Sta. No. #155	#54553 DI dev name #155	#54554 DI dev No. #155	#54555 DO dev name #155	#54556 DO dev No. #155	#54557 DI Hi-Spd #155	#54558 DO Hi-Spd #155
#156 Station No.: 156	#54561 RIO CH No. #156	#54562 RIO Sta. No. #156	#54563 DI dev name #156	#54564 DI dev No. #156	#54565 DO dev name #156	#54566 DO dev No. #156	#54567 DI Hi-Spd #156	#54568 DO Hi-Spd #156
#157 Station No.: 157	#54571 RIO CH No. #157	#54572 RIO Sta. No. #157	#54573 DI dev name #157	#54574 DI dev No. #157	#54575 DO dev name #157	#54576 DO dev No. #157	#54577 DI Hi-Spd #157	#54578 DO Hi-Spd #157
#158 Station No.: 158	#54581 RIO CH No. #158	#54582 RIO Sta. No. #158	#54583 DI dev name #158	#54584 DI dev No. #158	#54585 DO dev name #158	#54586 DO dev No. #158	#54587 DI Hi-Spd #158	#54588 DO Hi-Spd #158
#159 Station No.: 159	#54591 RIO CH No. #159	#54592 RIO Sta. No. #159	#54593 DI dev name #159	#54594 DI dev No. #159	#54595 DO dev name #159	#54596 DO dev No. #159	#54597 DI Hi-Spd #159	#54598 DO Hi-Spd #159
#160 Station No.: 160	#54601 RIO CH No. #160	#54602 RIO Sta. No. #160	#54603 DI dev name #160	#54604 DI dev No. #160	#54605 DO dev name #160	#54606 DO dev No. #160	#54607 DI Hi-Spd #160	#54608 DO Hi-Spd #160
#161 Station No.: 161	#54611 RIO CH No. #161	#54612 RIO Sta. No. #161	#54613 DI dev name #161	#54614 DI dev No. #161	#54615 DO dev name #161	#54616 DO dev No. #161	#54617 DI Hi-Spd #161	#54618 DO Hi-Spd #161
#162 Station No.: 162	#54621 RIO CH No. #162	#54622 RIO Sta. No. #162	#54623 DI dev name #162	#54624 DI dev No. #162	#54625 DO dev name #162	#54626 DO dev No. #162	#54627 DI Hi-Spd #162	#54628 DO Hi-Spd #162
#163 Station No.: 163	#54631 RIO CH No. #163	#54632 RIO Sta. No. #163	#54633 DI dev name #163	#54634 DI dev No. #163	#54635 DO dev name #163	#54636 DO dev No. #163	#54637 DI Hi-Spd #163	#54638 DO Hi-Spd #163
#164 Station No.: 164	#54641 RIO CH No. #164	#54642 RIO Sta. No. #164	#54643 DI dev name #164	#54644 DI dev No. #164	#54645 DO dev name #164	#54646 DO dev No. #164	#54647 DI Hi-Spd #164	#54648 DO Hi-Spd #164
#165 Station No.: 165	#54651 RIO CH No. #165	#54652 RIO Sta. No. #165	#54653 DI dev name #165	#54654 DI dev No. #165	#54655 DO dev name #165	#54656 DO dev No. #165	#54657 DI Hi-Spd #165	#54658 DO Hi-Spd #165
#166 Station No.: 166	#54661 RIO CH No. #166	#54662 RIO Sta. No. #166	#54663 DI dev name #166	#54664 DI dev No. #166	#54665 DO dev name #166	#54666 DO dev No. #166	#54667 DI Hi-Spd #166	#54668 DO Hi-Spd #166
#167 Station No.: 167	#54671 RIO CH No. #167	#54672 RIO Sta. No. #167	#54673 DI dev name #167	#54674 DI dev No. #167	#54675 DO dev name #167	#54676 DO dev No. #167	#54677 DI Hi-Spd #167	#54678 DO Hi-Spd #167
#168 Station No.: 168	#54681 RIO CH No. #168	#54682 RIO Sta. No. #168	#54683 DI dev name #168	#54684 DI dev No. #168	#54685 DO dev name #168	#54686 DO dev No. #168	#54687 DI Hi-Spd #168	#54688 DO Hi-Spd #168
#169 Station No.: 169	#54691 RIO CH No. #169	#54692 RIO Sta. No. #169	#54693 DI dev name #169	#54694 DI dev No. #169	#54695 DO dev name #169	#54696 DO dev No. #169	#54697 DI Hi-Spd #169	#54698 DO Hi-Spd #169

15 Machine Parameters

15.20 RIO Device Allocation Parameters

	RIO CH No.	RIO Sta. No.	DI dev name	DI dev No.	DO dev name	DO dev No.	DI Hi-Spd	DO Hi-Spd
#170 Station No.: 170	#54701 RIO CH No. #170	#54702 RIO Sta. No. #170	#54703 DI dev name #170	#54704 DI dev No. #170	#54705 DO dev name #170	#54706 DO dev No. #170	#54707 DI Hi-Spd #170	#54708 DO Hi-Spd #170
#171 Station No.: 171	#54711 RIO CH No. #171	#54712 RIO Sta. No. #171	#54713 DI dev name #171	#54714 DI dev No. #171	#54715 DO dev name #171	#54716 DO dev No. #171	#54717 DI Hi-Spd #171	#54718 DO Hi-Spd #171
#172 Station No.: 172	#54721 RIO CH No. #172	#54722 RIO Sta. No. #172	#54723 DI dev name #172	#54724 DI dev No. #172	#54725 DO dev name #172	#54726 DO dev No. #172	#54727 DI Hi-Spd #172	#54728 DO Hi-Spd #172
#173 Station No.: 173	#54731 RIO CH No. #173	#54732 RIO Sta. No. #173	#54733 DI dev name #173	#54734 DI dev No. #173	#54735 DO dev name #173	#54736 DO dev No. #173	#54737 DI Hi-Spd #173	#54738 DO Hi-Spd #173
#174 Station No.: 174	#54741 RIO CH No. #174	#54742 RIO Sta. No. #174	#54743 DI dev name #174	#54744 DI dev No. #174	#54745 DO dev name #174	#54746 DO dev No. #174	#54747 DI Hi-Spd #174	#54748 DO Hi-Spd #174
#175 Station No.: 175	#54751 RIO CH No. #175	#54752 RIO Sta. No. #175	#54753 DI dev name #175	#54754 DI dev No. #175	#54755 DO dev name #175	#54756 DO dev No. #175	#54757 DI Hi-Spd #175	#54758 DO Hi-Spd #175
#176 Station No.: 176	#54761 RIO CH No. #176	#54762 RIO Sta. No. #176	#54763 DI dev name #176	#54764 DI dev No. #176	#54765 DO dev name #176	#54766 DO dev No. #176	#54767 DI Hi-Spd #176	#54768 DO Hi-Spd #176
#177 Station No.: 177	#54771 RIO CH No. #177	#54772 RIO Sta. No. #177	#54773 DI dev name #177	#54774 DI dev No. #177	#54775 DO dev name #177	#54776 DO dev No. #177	#54777 DI Hi-Spd #177	#54778 DO Hi-Spd #177
#178 Station No.: 178	#54781 RIO CH No. #178	#54782 RIO Sta. No. #178	#54783 DI dev name #178	#54784 DI dev No. #178	#54785 DO dev name #178	#54786 DO dev No. #178	#54787 DI Hi-Spd #178	#54788 DO Hi-Spd #178
#179 Station No.: 179	#54791 RIO CH No. #179	#54792 RIO Sta. No. #179	#54793 DI dev name #179	#54794 DI dev No. #179	#54795 DO dev name #179	#54796 DO dev No. #179	#54797 DI Hi-Spd #179	#54798 DO Hi-Spd #179
#180 Station No.: 180	#54801 RIO CH No. #180	#54802 RIO Sta. No. #180	#54803 DI dev name #180	#54804 DI dev No. #180	#54805 DO dev name #180	#54806 DO dev No. #180	#54807 DI Hi-Spd #180	#54808 DO Hi-Spd #180
#181 Station No.: 181	#54811 RIO CH No. #181	#54812 RIO Sta. No. #181	#54813 DI dev name #181	#54814 DI dev No. #181	#54815 DO dev name #181	#54816 DO dev No. #181	#54817 DI Hi-Spd #181	#54818 DO Hi-Spd #181
#182 Station No.: 182	#54821 RIO CH No. #182	#54822 RIO Sta. No. #182	#54823 DI dev name #182	#54824 DI dev No. #182	#54825 DO dev name #182	#54826 DO dev No. #182	#54827 DI Hi-Spd #182	#54828 DO Hi-Spd #182
#183 Station No.: 183	#54831 RIO CH No. #183	#54832 RIO Sta. No. #183	#54833 DI dev name #183	#54834 DI dev No. #183	#54835 DO dev name #183	#54836 DO dev No. #183	#54837 DI Hi-Spd #183	#54838 DO Hi-Spd #183
#184 Station No.: 184	#54841 RIO CH No. #184	#54842 RIO Sta. No. #184	#54843 DI dev name #184	#54844 DI dev No. #184	#54845 DO dev name #184	#54846 DO dev No. #184	#54847 DI Hi-Spd #184	#54848 DO Hi-Spd #184
#185 Station No.: 185	#54851 RIO CH No. #185	#54852 RIO Sta. No. #185	#54853 DI dev name #185	#54854 DI dev No. #185	#54855 DO dev name #185	#54856 DO dev No. #185	#54857 DI Hi-Spd #185	#54858 DO Hi-Spd #185
#186 Station No.: 186	#54861 RIO CH No. #186	#54862 RIO Sta. No. #186	#54863 DI dev name #186	#54864 DI dev No. #186	#54865 DO dev name #186	#54866 DO dev No. #186	#54867 DI Hi-Spd #186	#54868 DO Hi-Spd #186

15 Machine Parameters

15.21 Open Parameters

15.21 Open Parameters

#29001- 29896	Open param 1
------------------	--------------

Set LONG data.
#29001 to #29896 are used as parameter range where C language modules can be used arbitrarily.

#29901- 29996	Open param 2
------------------	--------------

Set DOUBLE data.
#29901 to #29996 are used as parameter range where C language modules can be used arbitrarily.

15.22 Device Open Parameters

#40001- 40100	Device Open Parameters
--------------------------	-------------------------------

<Data typ>

Set the data format (BYTE, WORD, DWORD, WORD(BIT)) of the assignment area.

0: WORD

1: DWORD

2: BYTE

3: WORD(BIT)

<Data no>

Set the number of data in the assignment area. The number to be designated varies depending on the unit designated by the data format.

0 to 3000

(Depends on the device assignment and data format.)

<Disp typ>

Designate the status of data display format, display restrictions and input protection.

bit0: Cancellation of protection for input

Select whether to check the input protection for the data protection key 2 on the group details screen.

(Note) The name of data protection key differs between machine tool builders. Refer to manuals issued by each machine tool builder for details.

0: Check

1: Not check

bit1: Cancellation of restriction on display

Select whether to display the group details screen even when a machine tool builder password is not entered.

0: Not display

1: Display

bit4: BCD format

Display the data of the group details screen in BCD format.

0: Disabled

1: Enabled

bit5: BIT format

Display the data of the group details screen in BIT format.

0: Disabled

1: Enabled

bit6: HEX format (Hexadecimal format)

Display the data of the group details screen in HEX format.

0: Disabled

1: Enabled

bit7: Sign (Decimal format only)

Select whether to display the data of the group details screen in a decimal format with/without a sign.

0: With sign

1: Without sign

15.23 SRAM Open Parameters

#41001- 41100	SRAM Open Parameters
--------------------------	-----------------------------

<Data typ>

Set the data type (CHAR, SHORT, LONG, DOUBLE) of the assignment area.

- 1: CHAR
- 2: SHORT
- 3: LONG
- 4: DOUBLE

<Data no>

Set the number of data in the assignment area. The number to be designated varies depending on the unit and free area designated by the data format.

0 to 9999999 (Depends on the data format and free area)

<Disp typ>

Designate the status of data display format, display restrictions and input protection.

bit0: Cancellation of protection for input

Select whether to check the input protection for the data protection key 2 on the group details screen.

(Note) The name of data protection key differs between machine tool builders. Refer to manuals issued by each machine tool builder for details.

- 0: Check
- 1: Not check

bit1: Cancellation of restriction on display

Select whether to display the group details screen even when a machine tool builder password is not entered.

- 0: Not display
- 1: Display

bit4: BCD format

Display the data of the group details screen in BCD format.

- 0: Disable
- 1: Enable

bit5: BIT format

Display the data of the group details screen in BIT format.

- 0: Disable
- 1: Enable

bit6: HEX format (Hexadecimal format)

Display the data of the group details screen in HEX format.

- 0: Disable
- 1: Enable

bit7: Sign (Decimal format only)

Select whether to display the data of the group details screen in a decimal format with/without a sign.

- 0: With sign
- 1: Without sign

15 Machine Parameters

15.24 CC-Link Parameters

15.24 CC-Link Parameters

(PR)	#24001+40(n-1)	SLn station No.	CC-Link station No.
		Set the station No. of the CC-Link I/F unit. "n" represents the expansion slot No. (n=1 to 3) -1: Invalid 0: Master station 1 to 64: Device station ---Master station--- Set a value within the setting range. ---Local/standby master station--- Set a value within the setting range. ---Setting range--- -1 to 64	
(PR)	#24002+40(n-1)	SLn line-spd&Mode	CC-Link transmission rate and mode
		Select the transmission rate and operation mode of the CC-Link I/F unit. "n" represents the expansion slot No. (n=1 to 3) <Online mode> 0: 156Kbps 1: 625Kbps 2: 2.5Mbps 3: 5Mbps 4: 10Mbps <Circuit test mode> 5: 156Kbps 6: 625Kbps 7: 2.5Mbps 8: 5Mbps 9: 10Mbps <Hardware test mode> 10: 156Kbps 11: 625Kbps 12: 2.5Mbps 13: 5Mbps 14: 10Mbps (Note) Perform hardware test after removing the CC-Link cable. ---Master station--- Set a value within the setting range. ---Local/standby master station--- Set a value within the setting range. ---Setting range--- 0 to 14	

(PR)	#24003+40(n-1)	SLn set fault sta	Setting of data link faulty station
			<p>Select whether to clear or hold the data input from the data link faulty station.</p> <p>"n" represents the expansion slot No. (n=1 to 3)</p> <p>0: Clear</p> <p>1: Hold</p> <p>(Note) Refer to "CC-Link System Master/Local Module User's Manual (SH-080394E)" for the details of the functions.</p> <p>---Master station---</p> <p>Set to "0" or "1".</p> <p>---Local/standby master station---</p> <p>Set to "0" or "1".</p>
	#24004+40(n-1)	SLn PLC stop set	Setting at PLC STOP
			<p>Set whether to refresh or compulsorily clear the device stations at PLC STOP.</p> <p>"n" represents the expansion slot No. (n=1 to 3)</p> <p>0: Refresh</p> <p>1: Compulsorily clear</p> <p>(Note) Refer to "CC-Link System Master/Local Module User's Manual (SH-080394E)" for the details of the functions.</p> <p>---Master station---</p> <p>Set to "0" or "1".</p> <p>---Local/standby master station---</p> <p>Set to "0" or "1".</p>
(PR)	#24005+40(n-1)	SLn occ stations	Number of occupied stations
			<p>Set the number of occupied local and standby master stations.</p> <p>"n" represents the expansion slot No. (n=1 to 3)</p> <p>---Master station---</p> <p>Set to "0".</p> <p>---Local/standby master station---</p> <p>Set to either of "1" to "4".</p> <p>---Setting range---</p> <p>0 to 4</p>
(PR)	#24006+40(n-1)	SLn extended cyc	Extended cyclic setting
			<p>Set the magnification for the extended cyclic operation of the local station whose type corresponds to Ver.2.</p> <p>"n" represents the expansion slot No. (n=1 to 3)</p> <p>Set "1" for the local station whose type corresponds to Ver.1.</p> <p>This function is out of specifications when the protocol version is Ver.1. The setting for the local station is fixed to "1".</p> <p>---Master station---</p> <p>Set to "0".</p> <p>---Local/standby master station---</p> <p>Set to either of "1", "2", "4" or "8".</p> <p>---Setting range---</p> <p>0, 1, 2, 4, 8 (times)</p>

15 Machine Parameters

15.24 CC-Link Parameters

	#24007+40(n-1)	SLn conn modules	Number of connected modules
		Set the total number of remote stations, local stations, intelligent device stations, standby master station and reserved stations connected to the master station. "n" represents the expansion slot No. (n=1 to 3) ---Master station--- Set to either of "1" to "64". ---Local/standby master station--- Set to "0". ---Setting range--- 0 to 64 (modules)	
	#24008+40(n-1)	SLn num of retries	Number of retries
		Set the number of retries for when a communication error occurs. "n" represents the expansion slot No. (n=1 to 3) ---Master station--- Set to either of "1" to "7". ---Local/standby master station--- Set to "0". ---Setting range--- 0 to 7 (times)	
	#24009+40(n-1)	SLn auto ret mdl	Number of automatic return modules
		Set the total number of remote stations, local stations, intelligent device stations and standby master station that can be returned to system operation by a single link scan. "n" represents the expansion slot No. (n=1 to 3) (Note) Refer to "CC-Link System Master/Local Module User's Manual (SH-080394E)" for the details of the functions. ---Master station--- Set to either of "1" to "10". ---Local/standby master station--- Set to "0". ---Setting range--- 0 to 10 (modules)	
(PR)	#24010+40(n-1)	SLn STBY master st	Standby master station
		Set the station No. of the standby master station. "n" represents the expansion slot No. (n=1 to 3) Set "0" when no standby master station is provided. ---Master station--- Set a value within the setting range. ---Local/standby master station--- Set "0" (fixed) for the local station. Set "1" (fixed) for the standby station. ---Setting range--- 0 to 64	

#24011+40(n-1)	SLn ope at NC down	Operation at NC down
	Set the data link status for when the master station failure occurs. "n" represents the expansion slot No. (n=1 to 3) 0: Fixed to stop (Note) Refer to "CC-Link System Master/Local Module User's Manual (SH-080394E)" for the details of the functions. ---Master station--- Set to "0" (fixed). ---Local/standby master station--- Set to "0".	
#24012+40(n-1)	SLn scan mode	Scan mode
	Select whether to synchronize the link scan with one ladder scan. "n" represents the expansion slot No. (n=1 to 3) 0: Fixed to synchronize ---Master station--- Set to "0" (fixed). ---Local/standby master station--- Set to "0".	
#24013+40(n-1)	SLn delay time	Delay time
	Set the delay time. "n" represents the expansion slot No. (n=1 to 3) 0: (Fixed value) ---Master station--- Set to "0" (fixed). ---Local/standby master station--- Set to "0".	
#24014+40(n-1)	SLn RX dev name	Remote input (RX) refresh device name
	Set the refresh device name of the remote input (RX) to be automatically refreshed. (Example) X "n" represents the expansion slot No. (n=1 to 3) Set "0" when no setting is required. ---Master station--- Set a value within the setting range. ---Local/standby master station--- Set a value within the setting range. ---Setting range--- 0, X, M, L, B, D, W, R	

15 Machine Parameters

15.24 CC-Link Parameters

#24015+40(n-1)	SLn RX dev No.	Remote input (RX) refresh device No.
		<p>Set the refresh device No. of the remote input (RX) to be automatically refreshed.</p> <p>"n" represents the expansion slot No. (n=1 to 3)</p> <p>(Note 1) When setting parameters in ALL.PRM with using the parameter input/output function, input the device No. of decimal digit.</p> <p>(Example) When setting "X400" for the remote input (RX) refresh device No., input as follows; #24014+40(n-1): "X" #24015+40(n-1): "1024"</p> <p>(Note 2) When the refresh device name has been set, the refresh device No. will be "0". Confirm the refresh device No. after changing the refresh device name.</p> <p>If you specify bit devices, set them in increments of 16 points.</p> <p>The operation will not be guaranteed unless the address is set in increments of 16 points.</p> <p>(Example) 1000</p> <p>---Master station---</p> <p>Set a value within the setting range.</p> <p>---Local/standby master station---</p> <p>Set a value within the setting range.</p> <p>---Setting range---</p> <p>X: 0 to 5FF M: 0 to 10239 L: 0 to 511 B: 0 to 1FFF D: 0 to 2047 W: 0 to 1FFF R: 8300 to 9799, 9800 to 9899</p>
#24016+40(n-1)	SLn RY dev name	Remote output (RY) refresh device name
		<p>Set the refresh device name of the remote output (RY) to be automatically refreshed.</p> <p>(Example) Y</p> <p>"n" represents the expansion slot No. (n=1 to 3)</p> <p>Set "0" when no setting is required.</p> <p>---Master station---</p> <p>Set a value within the setting range.</p> <p>---Local/standby master station---</p> <p>Set a value within the setting range.</p> <p>---Setting range---</p> <p>0, Y, M, L, B, D, W, R</p>

15 Machine Parameters

15.24 CC-Link Parameters

#24017+40(n-1)	SLn RY dev No.	Remote output (RY) refresh device No.
		<p>Set the refresh device No. of the remote output (RY) to be automatically refreshed.</p> <p>"n" represents the expansion slot No. (n=1 to 3)</p> <p>(Note 1) When setting parameters in ALL.PRM with using the parameter input/output function, input the device No. of decimal digit.</p> <p>(Example) When setting "X400" for the remote input (RX) refresh device No., input as follows; #24014+40(n-1): "X" #24015+40(n-1): "1024"</p> <p>(Note 2) When the refresh device name has been set, the refresh device No. will be "0". Confirm the refresh device No. after changing the refresh device name.</p> <p>If you specify bit devices, set them in increments of 16 points.</p> <p>The operation will not be guaranteed unless the address is set in increments of 16 points.</p> <p>(Example) 1000</p> <p>---Master station---</p> <p>Set a value within the setting range.</p> <p>---Local/standby master station---</p> <p>Set a value within the setting range.</p> <p>---Setting range---</p> <p>Y: 0 to 5FF M: 0 to 10239 L: 0 to 511 B: 0 to 1FFF D: 0 to 2047 W: 0 to 1FFF R: 8300 to 9799, 9800 to 9899</p>
#24018+40(n-1)	SLn RWr dev name	Remote register (RWr) refresh device name
		<p>Set the refresh device name of the remote register (RWr) to be automatically refreshed.</p> <p>(Example) W</p> <p>"n" represents the expansion slot No. (n=1 to 3)</p> <p>Set "0" when no setting is required.</p> <p>---Master station---</p> <p>Set a value within the setting range.</p> <p>---Local/standby master station---</p> <p>Set a value within the setting range.</p> <p>---Setting range---</p> <p>0, M, L, B, D, W, R</p>

15 Machine Parameters

15.24 CC-Link Parameters

#24019+40(n-1)	SLn RWr dev No.	Remote register (RWr) refresh device No.
		<p>Set the refresh device No. of the remote register (RWr) to be automatically refreshed.</p> <p>"n" represents the expansion slot No. (n=1 to 3)</p> <p>(Note 1) When setting parameters in ALL.PRM with using the parameter input/output function, input the device No. of decimal digit.</p> <p>(Example) When setting "X400" for the remote input (RX) refresh device No., input as follows; #24014+40(n-1): "X" #24015+40(n-1): "1024"</p> <p>(Note 2) When the refresh device name has been set, the refresh device No. will be "0". Confirm the refresh device No. after changing the refresh device name.</p> <p>If you specify bit devices, set them in increments of 16 points.</p> <p>The operation will not be guaranteed unless the address is set in increments of 16 points.</p> <p>(Example) 1FF0</p> <p>---Master station---</p> <p>Set a value within the setting range.</p> <p>---Local/standby master station---</p> <p>Set a value within the setting range.</p> <p>---Setting range---</p> <p>M: 0 to 10239</p> <p>L: 0 to 511</p> <p>B: 0 to 1FFF</p> <p>D: 0 to 2047</p> <p>W: 0 to 1FFF</p> <p>R: 8300 to 9799, 9800 to 9899</p>
#24020+40(n-1)	SLn RWw dev name	Remote register (RWw) refresh device name
		<p>Set the refresh device name of the remote register (RWw) to be automatically refreshed.</p> <p>(Example) W</p> <p>"n" represents the expansion slot No. (n=1 to 3)</p> <p>Set "0" when no setting is required.</p> <p>---Master station---</p> <p>Set a value within the setting range.</p> <p>---Local/standby master station---</p> <p>Set a value within the setting range.</p> <p>---Setting range---</p> <p>0, M, L, B, D, W, R</p>

15 Machine Parameters

15.24 CC-Link Parameters

#24021+40(n-1)	SLn RWw dev No.	Remote register (RWw) refresh device No.
		<p>Set the refresh device No. of the remote register (RWw) to be automatically refreshed.</p> <p>"n" represents the expansion slot No. (n=1 to 3)</p> <p>(Note 1) When setting parameters in ALL.PRM with using the parameter input/output function, input the device No. of decimal digit.</p> <p>(Example) When setting "X400" for the remote input (RX) refresh device No., input as follows; #24014+40(n-1): "X" #24015+40(n-1): "1024"</p> <p>(Note 2) When the refresh device name has been set, the refresh device No. will be "0". Confirm the refresh device No. after changing the refresh device name.</p> <p>If you specify bit devices, set them in increments of 16 points.</p> <p>The operation will not be guaranteed unless the address is set in increments of 16 points.</p> <p>(Example) 1FF0</p> <p>---Master station---</p> <p>Set a value within the setting range.</p> <p>---Local/standby master station---</p> <p>Set a value within the setting range.</p> <p>---Setting range---</p> <p>M: 0 to 10239 L: 0 to 511 B: 0 to 1FFF D: 0 to 2047 W: 0 to 1FFF R: 8300 to 9799, 9800 to 9899</p>
#24022+40(n-1)	SLn SB dev name	Special relay (SB) refresh device name
		<p>Set the refresh device name of the special relay (SB) to be automatically refreshed.</p> <p>(Example) SB</p> <p>"n" represents the expansion slot No. (n=1 to 3)</p> <p>Set "0" when no setting is required.</p> <p>---Master station---</p> <p>Set a value within the setting range.</p> <p>---Local/standby master station---</p> <p>Set a value within the setting range.</p> <p>---Setting range---</p> <p>0, M, L, B, D, W, R, SB</p>

15 Machine Parameters

15.24 CC-Link Parameters

#24023+40(n-1)	SLn SB dev No.	Special relay (SB) refresh device No.
		<p>Set the refresh device No. of the special relay (SB) to be automatically refreshed.</p> <p>"n" represents the expansion slot No. (n=1 to 3)</p> <p>(Note 1) When setting parameters in ALL.PRM with using the parameter input/output function, input the device No. of decimal digit.</p> <p>(Example) When setting "X400" for the remote input (RX) refresh device No., input as follows; #24014+40(n-1): "X" #24015+40(n-1): "1024"</p> <p>(Note 2) When the refresh device name has been set, the refresh device No. will be "0". Confirm the refresh device No. after changing the refresh device name.</p> <p>If you specify bit devices, set them in increments of 16 points.</p> <p>The operation will not be guaranteed unless the address is set in increments of 16 points.</p> <p>(Example) 1F0</p> <p>---Master station---</p> <p>Set a value within the setting range.</p> <p>---Local/standby master station---</p> <p>Set a value within the setting range.</p> <p>---Setting range---</p> <p>M: 0 to 10239 L: 0 to 511 B: 0 to 1FFF D: 0 to 2047 W: 0 to 1FFF SB: 0 to 1FF R: 8300 to 9799, 9800 to 9899</p>
#24024+40(n-1)	SLn SW dev name	Special relay (SW) refresh device name
		<p>Set the refresh device name of the special relay (SW) to be automatically refreshed.</p> <p>"n" represents the expansion slot No. (n=1 to 3)</p> <p>(Example) SW</p> <p>Set "0" when no setting is required.</p> <p>---Master station---</p> <p>Set a value within the setting range.</p> <p>---Local/standby master station---</p> <p>Set a value within the setting range.</p> <p>---Setting range---</p> <p>0, M, L, B, D, W, R, SW</p>

15 Machine Parameters

15.24 CC-Link Parameters

#24025+40(n-1)	SLn SW dev No.	Special relay (SW) refresh device No.	
<p>Set the refresh device No. of the special relay (SW) to be automatically refreshed.</p> <p>"n" represents the expansion slot No. (n=1 to 3)</p> <p>(Note 1) When setting parameters in ALL.PRM with using the parameter input/output function, input the device No. of decimal digit. (Example) When setting "X400" for the remote input (RX) refresh device No., input as follows; #24014+40(n-1): "X" #24015+40(n-1): "1024"</p> <p>(Note 2) When the refresh device name has been set, the refresh device No. will be "0". Confirm the refresh device No. after changing the refresh device name.</p> <p>If you specify bit devices, set them in increments of 16 points.</p> <p>(Example) 1F0</p> <p>---Master station---</p> <p>Set a value within the setting range.</p> <p>---Local/standby master station---</p> <p>Set a value within the setting range.</p> <p>---Setting range---</p> <p>M: 0 to 10239 L: 0 to 511 B: 0 to 1FFF D: 0 to 2047 W: 0 to 1FFF SW: 0 to 1FF R: 8300 to 9799, 9800 to 9899</p>			
(PR)	#24026+40(n-1)	SLn Protocol Ver	Protocol version
<p>Select the CC-Link version mode that has been set to the slide switch SW1-2 on the CC-Link unit (HN566/ HN567).</p> <p>"n" represents the expansion slot No. (n=1 to 3)</p> <p>0: Ver.2 1: Ver.1</p> <p>Ver.2 mode has been set to SW1-2 as default.</p> <p>---Master station---</p> <p>Set to "0" or "1".</p> <p>---Local/standby master station---</p> <p>Set to "0" or "1".</p>			
#24121+15(m-1)	CNm station type	Station type	
<p>Set the type of the connected remote station, local station, intelligent device station and standby master station.</p> <p>0: No setting 1: Ver.1 remote I/O station 2: Ver.1 remote device station 3: Ver.1 intelligent device station 4: Ver.2 remote device station 5: Ver.2 intelligent device station</p> <p>"m" means the m-th connected station in ascending order of station No. (m=1 to 64)</p> <p>---Master station---</p> <p>Set to either of "0" to "5".</p> <p>---Local/standby master station---</p> <p>Set to "0".</p>			

15 Machine Parameters

15.24 CC-Link Parameters

#24122+15(m-1)	CNm extended cyc	Extended cyclic setting
		<p>Select the magnification for the extended cycling operation of the connected remote, local and intelligent stations.</p> <p>Set "1" when the protocol version is Ver.1.</p> <p>Set "0" when no setting is required.</p> <p>"m" means the m-th connected station in ascending order of station No. (m=1 to 64)</p> <p>---Master station---</p> <p>Set a value within the setting range.</p> <p>---Local/standby master station---</p> <p>Set to "0".</p> <p>---Setting range---</p> <p>0, 1, 2, 4, 8 (times)</p>
#24123+15(m-1)	CNm occ stations	Number of occupied stations
		<p>Set the number of the occupied stations by the connected remote, local and intelligent stations.</p> <p>Set 1 for 8 points I/O and 16 points I/O.</p> <p>Set "0" when no setting is required.</p> <p>"m" means the m-th connected station in ascending order of station No. (m=1 to 64)</p> <p>---Master station---</p> <p>Set a value within the setting range.</p> <p>---Local/standby master station---</p> <p>Set to "0".</p> <p>---Setting range---</p> <p>0 to 4 (stations occupied)</p>
#24124+15(m-1)	CNm station No.	Station No.
		<p>Set the station No. of the connected remote, local and intelligent stations.</p> <p>Set "0" when no setting is required.</p> <p>"m" means the m-th connected station in ascending order of station No. (m=1 to 64)</p> <p>---Master station---</p> <p>Set a value within the setting range.</p> <p>---Local/standby master station---</p> <p>Set to "0".</p> <p>---Setting range---</p> <p>0 to 64</p>

15 Machine Parameters

15.24 CC-Link Parameters

#24125+15(m-1)	CNm remote sta pt	Remote station points
		<p>Select the number of points of the connected remote station.</p> <p>"m" means the m-th connected station in ascending order of station No. (m=1 to 64)</p> <p>The details of setting values differ with each protocol version and station type.</p> <p>Protocol: Ver.2 (station type: Ver.1, remote I/O station)</p> <p>0: 0 point (reserved station)</p> <p>1: 8 points</p> <p>2: 8 points + 8 points reserved</p> <p>3: 16 points</p> <p>4: 32 points</p> <ul style="list-style-type: none"> •Setting "0" is valid only for the reserved station. When "0" is set for the other stations, the number of points will be 32. •Set the value so that the total number of points of remote I/O stations connected in series will be multiple of 16. <p>(Example 1) 2 units of 8 points I/O: Set "1" for each</p> <p>(Example 2) 3 units of 8 points I/O: Set "1" for the first and the second I/O, "2" for the third.</p> <p>Protocol: Ver.2 (station type: Ver.1 except remote I/O station)</p> <p>0: 0 point (reserved station)</p> <p>1 to 4: Automatically calculated</p> <ul style="list-style-type: none"> •Setting "0" is valid only for the reserved station. When "0" is set for the other stations, the number of points will be automatically calculated. •Unless 0 is set, the number of points will be automatically calculated with the number of occupied stations and the setting value of the extended cycling. <p>Protocol: Ver.1 (for all station types)</p> <p>0 to 4: Automatically calculated</p> <ul style="list-style-type: none"> •"0" cannot be set even for the reserved station. •Automatically calculated with the setting value of the number of occupied stations. <p>---Master station---</p> <p>Set a value corresponding to the protocol version and the station type.</p> <p>---Local/standby master station---</p> <p>Set to "0".</p>
#24126+15(m-1)	CNm set rsvd sta	Reserved station
		<p>Set the reserved/error invalid station.</p> <p>"m" means the m-th connected station in ascending order of station No. (m=1 to 64)</p> <p>0: No setting</p> <p>1: Reserved station</p> <p>2: Error invalid station</p> <p>(Note) Refer to "CC-Link System Master/Local Module User's Manual (SH-080394E)" for the details of the functions.</p> <p>---Master station---</p> <p>Set either of "0" to "2".</p> <p>---Local/standby master station---</p> <p>Set to "0".</p>

15 Machine Parameters

15.24 CC-Link Parameters

#24131+15(m-1)	CNm send size	Send buffer size
	<p>Set the allocation of the buffer memory size to the local station, standby master station and intelligent device station when in transient transmission.</p> <p>"m" means the m-th connected station in ascending order of station No. (m=1 to 64)</p> <p>Set "0" when no setting is required.</p> <p>(Note) The total size of the send/receive buffers must be 4096 (words) or less.</p> <p>---Master station---</p> <p>Set a value within the setting range.</p> <p>---Local/standby master station---</p> <p>Set to "0".</p> <p>---Setting range---</p> <p>0, 64 to 4096 (words)</p>	
#24132+15(m-1)	CNm receive size	Receive buffer size
	<p>Set the allocation of the buffer memory size to the local station, standby master station and intelligent device station when in transient transmission.</p> <p>"m" means the m-th connected station in ascending order of station No. (m=1 to 64)</p> <p>Set "0" when no setting is required.</p> <p>(Note) The total size of the send/receive buffers must be 4096 (words) or less.</p> <p>---Master station---</p> <p>Set a value within the setting range.</p> <p>---Local/standby master station---</p> <p>Set to "0".</p> <p>---Setting range---</p> <p>0, 64 to 4096 (words)</p>	
#24133+15(m-1)	CNm auto bfr size	Automatic update buffer size
	<p>Set the allocation of the buffer memory size to the local station, standby master station and intelligent device station when in transient transmission.</p> <p>"m" means the m-th connected station in ascending order of station No. (m=1 to 64)</p> <p>Set "0" when no setting is required.</p> <p>---Master station---</p> <p>Set a value within the setting range.</p> <p>---Local/standby master station---</p> <p>Set to "0".</p> <p>---Setting range---</p> <p>0, 128 to 4096 (words)</p>	

15.25 PLC Axis Indexing Parameters

(PR)	#12800	chgauxno	Auxiliary axis number
			Set the axis No. to be controlled as auxiliary axis using auxiliary axis interface. When "0" is set, the axis will not operate as auxiliary axis. ---Setting range--- 0 to 8: (M800VW/M800VS Series) 0 to 4: (M80V Series)
(PR)	#12801	aux_station	Number of indexing stations
			Set the number of stations. For linear axis, this value is expressed by: number of divisions = number of stations -1. Setting "0" or "1" sets the number of stations to 2. ---Setting range--- 0 to 360
(PR)	#12802	aux_Cont1	Control parameter 1
			The bits that are not explained here must be set to "0". bit3: 0: Automatic reach signal isn't interlocked with the start signal. 1: Automatic reach signal is interlocked with the start signal. bit4: 0: Automatic reach signal is turned ON again. 1: Automatic reach signal isn't turned ON again. bit5: 0: Station No. Output within fixed position. 1: Station No. Constantly output. bit9: 0: Rotation direction determined by operation control signal (DIR) 1: Rotation direction in the shortcut direction bitE: 0: Rotation direction in operation control signal (DIR) or in the shortcut direction 1: Rotation direction in the arbitrary position command sign direction bitF: 0: Stopper direction is in the positioning direction. 1: Stopper direction is in the sign direction of the stopper amount.
(PR)	#12803	aux_Cont2	Control parameter 2
			The bits that are not explained here must be set to "0". bit4: 0: Uniform assignment 1: Arbitrary coordinate assignment
(PR)	#12804	aux_tleng	Linear axis stroke length
			Set the movement stroke length for linear axes. (Note 1) Setting "0.000" causes an MCP alarm at the power ON. (Note 2) This parameter is meaningless at the non-uniform index or random position command. ---Setting range--- 0.000 to 99999.999 (mm)
	#12805	aux_ST.offset	Station offset
			Set the distance (offset) from the reference position to station 1. ---Setting range--- -99999.999 to 99999.999 (° or mm)

15 Machine Parameters

15.25 PLC Axis Indexing Parameters

#12810+10(n-1)	aux_Aspeedn	Operation parameter group n Automatic operation speed
<p>Set the feedrate during automatic operation when "operation parameter group n" is selected.</p> <p>"#12810 aux_Aspeed1" is regarded as the clamp value for the automatic operation speeds and manual operation speeds of all operation groups.</p> <p>A speed exceeding "aux_Aspeed1" cannot be commanded, even if it is set in a parameter.</p> <p>(Note) Setting "0" causes an operation error at the "Operation start" signal's ON.</p> <p>---Setting range---</p> <p>0 to 100000 (°/min or mm/min)</p>		
#12811+10(n-1)	aux_Mspeedn	Operation parameter group n Manual operation speed
<p>Set the feedrate during manual operation or JOG operation when "operation parameter group n" is selected.</p> <p>(Note) Setting "0" causes an operation error at the "Operation start" signal's ON.</p> <p>---Setting range---</p> <p>0 to 100000 (°/min or mm/min)</p>		
#12812+10(n-1)	aux_timen.1	Operation parameter group n Acceleration/deceleration time constant 1
<p>Set the linear acceleration/deceleration time for "Operation parameter group 1 automatic operation speed" (clamp speed) when "operation parameter group n" is selected.</p> <p>When "#12818+10(n-1) aux_smgstn" is "F", S-shape acceleration/deceleration is carried out.</p> <p>When operating at a speed less than the clamp speed, if "#1361 aux_acc" is set to "0", the axis will accelerate/decelerate with the time constant set in this parameter. If "#1361 aux_acc" is set to "1", the axis will accelerate/decelerate at the constant-gradient determined by this parameter and "aux_Aspeed1".</p> <p>Setting "0" cancels acceleration/deceleration: The axis will move with the time constant "0".</p> <p>---Setting range---</p> <p>0 to 4000 (ms)</p>		
#12813+10(n-1)	aux_timen.2	Operation parameter group n Acceleration/deceleration time constant 2
<p>Set the total time of the non-linear parts in the S-pattern acceleration/deceleration.</p> <p>In the handle feed operation mode, this setting value is regarded as time constant for the linear acceleration/deceleration.</p> <p>(Note) If this parameter is set to "0" while "#12818 aux_smgst1" is set to "F", an MCP alarm will occur.</p> <p>---Setting range---</p> <p>0 to 4000 (ms)</p>		
#12814+10(n-1)	aux_TLn	Operation parameter group n Torque limit value
<p>Set the motor output torque limit value when "operation parameter group n" is selected.</p> <p>When setting 500%, the torque is limited at the maximum torque of the motor specifications. Set 500%, when torque is not particularly needed to be limited.</p> <p>In the stopper positioning operation mode, this will be regarded as torque limit value when positioning to the stopper starting coordinates.</p> <p>---Setting range---</p> <p>0 to 500 (%)</p>		
#12815+10(n-1)	aux_ODn	Operation parameter group n Excessive error detection width
<p>Set the excessive error detection width when "operation parameter group n" is selected.</p> <p>The excessive error alarm (S03 0052) will be detected when the position droop becomes larger than this setting value.</p> <p>In the stopper positioning operation mode, this will be regarded as excessive error detection width when positioning to the stopper starting coordinates.</p> <p>---Setting range---</p> <p>0 to 32767(° or mm)</p>		

15 Machine Parameters

15.25 PLC Axis Indexing Parameters

	#12816+10(n-1)	aux_justn	Operation parameter group n Set position output width
			<p>Set the tolerable value at which "set position reached" (JST) or "automatic set position reached" (JSTA) signal is output when "operation parameter group n" is selected.</p> <p>"Set position reached" (JST) indicates that the machine position is at any station.</p> <p>During automatic operation, "automatic set position reached" (JSTA) is also output under the same condition.</p> <p>These signals will turn OFF when the machine position moves away from the station over this value.</p> <p>---Setting range---</p> <p>0.000 to 99999.999 (° or mm)</p>
	#12817+10(n-1)	aux_nearn	Operation parameter group n Near set position output width
			<p>Set the tolerable value at which "near set position" (NEAR) signal is output when "operation parameter group n" is selected.</p> <p>"Near set position" (NEAR) indicates that the machine position is near any station position. This value is generally set wider than the set position output width.</p> <p>During operations, this is related to the special commands when the station selection is set to "0".</p> <p>---Setting range---</p> <p>0.000 to 99999.999 (° or mm)</p>
(PR)	#12818+10(n-1)	aux_smgstn	Operation parameter group n Acceleration/Deceleration type
			<p>Select the acceleration/deceleration type when "operation parameter group n" is selected.</p> <p>0, 1: Linear acceleration/deceleration</p> <p>F: S-pattern acceleration/deceleration</p>
	#12850	aux_stpos2	Station 2 coordinate
			<p>Set the station 2 coordinate value when arbitrary coordinate assignment is selected.</p> <p>The station 1 coordinate value is fixed at "0.000" (machine coordinate zero point).</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
	#12851	aux_stpos3	Station 3 coordinate
			<p>Set the station 3 coordinate value when arbitrary coordinate assignment is selected.</p> <p>The station 1 coordinate value is fixed at "0.000" (machine coordinate zero point).</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
	#12852	aux_stpos4	Station 4 coordinate
			<p>Set the station 4 coordinate value when arbitrary coordinate assignment is selected.</p> <p>The station 1 coordinate value is fixed at "0.000" (machine coordinate zero point).</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
	#12853	aux_stpos5	Station 5 coordinate
			<p>Set the station 5 coordinate value when arbitrary coordinate assignment is selected.</p> <p>The station 1 coordinate value is fixed at "0.000" (machine coordinate zero point).</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
	#12854	aux_stpos6	Station 6 coordinate
			<p>Set the station 6 coordinate value when arbitrary coordinate assignment is selected.</p> <p>The station 1 coordinate value is fixed at "0.000" (machine coordinate zero point).</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>

15 Machine Parameters

15.25 PLC Axis Indexing Parameters

#12855	aux_stpos7	Station 7 coordinate
Set the station 7 coordinate value when arbitrary coordinate assignment is selected. The station 1 coordinate value is fixed at "0.000" (machine coordinate zero point). ---Setting range--- -99999.999 to 99999.999 (° or mm)		
#12856	aux_stpos8	Station 8 coordinate
Set the station 8 coordinate value when arbitrary coordinate assignment is selected. The station 1 coordinate value is fixed at "0.000" (machine coordinate zero point). ---Setting range--- -99999.999 to 99999.999 (° or mm)		
#12857	aux_stpos9	Station 9 coordinate
Set the station 9 coordinate value when arbitrary coordinate assignment is selected. The station 1 coordinate value is fixed at "0.000" (machine coordinate zero point). ---Setting range--- -99999.999 to 99999.999 (° or mm)		
#12858	aux_stpos10	Station 10 coordinate
Set the station 10 coordinate value when arbitrary coordinate assignment is selected. The station 1 coordinate value is fixed at "0.000" (machine coordinate zero point). ---Setting range--- -99999.999 to 99999.999 (° or mm)		
#12859	aux_stpos11	Station 11 coordinate
Set the station 11 coordinate value when arbitrary coordinate assignment is selected. The station 1 coordinate value is fixed at "0.000" (machine coordinate zero point). ---Setting range--- -99999.999 to 99999.999 (° or mm)		
#12860	aux_stpos12	Station 12 coordinate
Set the station 12 coordinate value when arbitrary coordinate assignment is selected. The station 1 coordinate value is fixed at "0.000" (machine coordinate zero point). ---Setting range--- -99999.999 to 99999.999 (° or mm)		
#12861	aux_stpos13	Station 13 coordinate
Set the station 13 coordinate value when arbitrary coordinate assignment is selected. The station 1 coordinate value is fixed at "0.000" (machine coordinate zero point). ---Setting range--- -99999.999 to 99999.999 (° or mm)		
#12862	aux_stpos14	Station 14 coordinate
Set the station 14 coordinate value when arbitrary coordinate assignment is selected. The station 1 coordinate value is fixed at "0.000" (machine coordinate zero point). ---Setting range--- -99999.999 to 99999.999 (° or mm)		
#12863	aux_stpos15	Station 15 coordinate
Set the station 15 coordinate value when arbitrary coordinate assignment is selected. The station 1 coordinate value is fixed at "0.000" (machine coordinate zero point). ---Setting range--- -99999.999 to 99999.999 (° or mm)		

15 Machine Parameters

15.25 PLC Axis Indexing Parameters

#12864	aux_stpos16	Station 16 coordinate
Set the station 16 coordinate value when arbitrary coordinate assignment is selected. The station 1 coordinate value is fixed at "0.000" (machine coordinate zero point). ---Setting range--- -99999.999 to 99999.999 (° or mm)		
#12865	aux_stpos17	Station 17 coordinate
Set the station 17 coordinate value when arbitrary coordinate assignment is selected. The station 1 coordinate value is fixed at "0.000" (machine coordinate zero point). ---Setting range--- -99999.999 to 99999.999 (° or mm)		
#12866	aux_stpos18	Station 18 coordinate
Set the station 18 coordinate value when arbitrary coordinate assignment is selected. The station 1 coordinate value is fixed at "0.000" (machine coordinate zero point). ---Setting range--- -99999.999 to 99999.999 (° or mm)		
#12867	aux_stpos19	Station 19 coordinate
Set the station 19 coordinate value when arbitrary coordinate assignment is selected. The station 1 coordinate value is fixed at "0.000" (machine coordinate zero point). ---Setting range--- -99999.999 to 99999.999 (° or mm)		
#12868	aux_stpos20	Station 20 coordinate
Set the station 20 coordinate value when arbitrary coordinate assignment is selected. The station 1 coordinate value is fixed at "0.000" (machine coordinate zero point). ---Setting range--- -99999.999 to 99999.999 (° or mm)		
#12870	aux_PSWcheck	PSW detection method
Select the criterion for the output of position switches 1 to 15. bit0 to E correspond to position switches 1 to 15. 0: Judged by the machine position of the command system. 1: Judged by the machine FB position (actual position). (Note) The bits that are not explained here must be set to "0".		
#12871	aux_PSW1dog1	PSW1 area setting 1
Set "PSW1 area setting" 1 and 2 to specify the area where the position switch 1 will turn ON when the machine is positioned. Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation. For rotary axes, the output turns ON in the area excluding 0.000 degree. ---Setting range--- -99999.999 to 99999.999 (° or mm)		
#12872	aux_PSW1dog2	PSW1 area setting 2
Set "PSW1 area setting" 1 and 2 to specify the area where the position switch 1 will turn ON when the machine is positioned. Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation. For rotary axes, the output turns ON in the area excluding 0.000 degree. ---Setting range--- -99999.999 to 99999.999 (° or mm)		

15 Machine Parameters

15.25 PLC Axis Indexing Parameters

#12873	aux_PSW2dog1	PSW2 area setting 1
		<p>Set "PSW2 area setting" 1 and 2 to specify the area where the position switch 2 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
#12874	aux_PSW2dog2	PSW2 area setting 2
		<p>Set "PSW2 area setting" 1 and 2 to specify the area where the position switch 2 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
#12875	aux_PSW3dog1	PSW3 area setting 1
		<p>Set "PSW3 area setting" 1 and 2 to specify the area where the position switch 3 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
#12876	aux_PSW3dog2	PSW3 area setting 2
		<p>Set "PSW3 area setting" 1 and 2 to specify the area where the position switch 3 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
#12877	aux_PSW4dog1	PSW4 area setting 1
		<p>Set "PSW4 area setting" 1 and 2 to specify the area where the position switch 4 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
#12878	aux_PSW4dog2	PSW4 area setting 2
		<p>Set "PSW4 area setting" 1 and 2 to specify the area where the position switch 4 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>

15 Machine Parameters

15.25 PLC Axis Indexing Parameters

#12879	aux_PSW5dog1	PSW5 area setting 1
		<p>Set "PSW5 area setting" 1 and 2 to specify the area where the position switch 5 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
#12880	aux_PSW5dog2	PSW5 area setting 2
		<p>Set "PSW5 area setting" 1 and 2 to specify the area where the position switch 5 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
#12881	aux_PSW6dog1	PSW6 area setting 1
		<p>Set "PSW6 area setting" 1 and 2 to specify the area where the position switch 6 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
#12882	aux_PSW6dog2	PSW6 area setting 2
		<p>Set "PSW6 area setting" 1 and 2 to specify the area where the position switch 6 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
#12883	aux_PSW7dog1	PSW7 area setting 1
		<p>Set "PSW7 area setting" 1 and 2 to specify the area where the position switch 7 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
#12884	aux_PSW7dog2	PSW7 area setting 2
		<p>Set "PSW7 area setting" 1 and 2 to specify the area where the position switch 7 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>

15 Machine Parameters

15.25 PLC Axis Indexing Parameters

#12885	aux_PSW8dog1	PSW8 area setting 1
		<p>Set "PSW8 area setting" 1 and 2 to specify the area where the position switch 8 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
#12886	aux_PSW8dog2	PSW8 area setting 2
		<p>Set "PSW8 area setting" 1 and 2 to specify the area where the position switch 8 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
#12887	aux_PSW9dog1	PSW9 area setting 1
		<p>Set "PSW9 area setting" 1 and 2 to specify the area where the position switch 9 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
#12888	aux_PSW9dog2	PSW9 area setting 2
		<p>Set "PSW9 area setting" 1 and 2 to specify the area where the position switch 9 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
#12889	aux_PSW10dog1	PSW10 area setting 1
		<p>Set "PSW10 area setting" 1 and 2 to specify the area where the position switch 10 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
#12890	aux_PSW10dog2	PSW10 area setting 2
		<p>Set "PSW10 area setting" 1 and 2 to specify the area where the position switch 10 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>

15 Machine Parameters

15.25 PLC Axis Indexing Parameters

#12891	aux_PSW11dog1	PSW11 area setting 1
		<p>Set "PSW11 area setting" 1 and 2 to specify the area where the position switch 11 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
#12892	aux_PSW11dog2	PSW11 area setting 2
		<p>Set "PSW11 area setting" 1 and 2 to specify the area where the position switch 11 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
#12893	aux_PSW12dog1	PSW12 area setting 1
		<p>Set "PSW12 area setting" 1 and 2 to specify the area where the position switch 12 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
#12894	aux_PSW12dog2	PSW12 area setting 2
		<p>Set "PSW12 area setting" 1 and 2 to specify the area where the position switch 12 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
#12895	aux_PSW13dog1	PSW13 area setting 1
		<p>Set "PSW13 area setting" 1 and 2 to specify the area where the position switch 13 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
#12896	aux_PSW13dog2	PSW13 area setting 2
		<p>Set "PSW13 area setting" 1 and 2 to specify the area where the position switch 13 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>

15 Machine Parameters

15.25 PLC Axis Indexing Parameters

#12897	aux_PSW14dog1	PSW14 area setting 1
		<p>Set "PSW14 area setting" 1 and 2 to specify the area where the position switch 14 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
#12898	aux_PSW14dog2	PSW14 area setting 2
		<p>Set "PSW14 area setting" 1 and 2 to specify the area where the position switch 14 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
#12899	aux_PSW15dog1	PSW15 area setting 1
		<p>Set "PSW15 area setting" 1 and 2 to specify the area where the position switch 15 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
#12900	aux_PSW15dog2	PSW15 area setting 2
		<p>Set "PSW15 area setting" 1 and 2 to specify the area where the position switch 15 will turn ON when the machine is positioned.</p> <p>Whether the value of setting 1 is larger than setting 2 (or vice versa) does not affect the position switch operation.</p> <p>For rotary axes, the output turns ON in the area excluding 0.000 degree.</p> <p>---Setting range---</p> <p>-99999.999 to 99999.999 (° or mm)</p>
#12910	aux_push	Stopper amount
		<p>Set the command stroke of the stopper operation in the stopper positioning.</p> <p>---Setting range---</p> <p>0.000 to 359.999(° or mm)</p>
#12911	aux_pusht1	Stopper standby time
		<p>Set the standby time from the stopper starting coordinate positioning to the stopper operation start in the stopper positioning.</p> <p>---Setting range---</p> <p>0 to 9999 (ms)</p>
#12912	aux_pusht2	Stopper torque release time
		<p>Set the time from the completion of the stopper operation to the changeover of the stopper torque in the stopper positioning.</p> <p>---Setting range---</p> <p>0 to 9999(ms)</p>
#12913	aux_pusht3	Set position signal output delay time
		<p>Set the time from the completion of the stopper operation to the output of the "automatic set position reached" (JSTA), "set position reached" (JST) or "near set position" (NEAR) signal in the stopper positioning.</p> <p>---Setting range---</p> <p>0 to 9999(ms)</p>

15.26 Machine Type Parameters

(PR)	#12621	machine type	Select machine type (For L system only)
		Select the type of lathe: horizontal or vertical.	
		0: Horizontal-type lathe	
		1: Vertical-type lathe	
(PR)	#12622	turret move dir	Select turret move direction (For L system only)
		Select the linear axis direction to move the turret along for each part system.	
		♦Horizontal-type lathe (right-handed)	
		1: Front upper position	
		2: Front lower position	
		3: Rear upper position	
		4: Rear lower position	
		♦Horizontal-type lathe (left-handed)	
		11: Front upper position	
		12: Front lower position	
		13: Rear upper position	
		14: Rear lower position	
		♦Vertical-type lathe (right-handed)	
		21: Front left position	
		22: Front right position	
		♦Vertical-type lathe (left-handed)	
		31: Front left position	
		32: Front right position	
		(Note) Upper/lower position of horizontal-type lathe and right/left position of vertical-type lathe are the names indicating the turret position with general machine configuration.	
		Select a number corresponding to the actual machine configuration and the axis direction to this parameter.	
		Axis configuration follows the base axis I, J, K (parameters #1026 to #1028).	
(PR)	#12623	tool rot ax para	Select tool rotation axis parameters (For L system only)
		Select which of the following parameters to use as tool rotation axis-related parameters: Rotary axis configuration parameters or 3D check parameters.	
		0: Rotary axis configuration parameters	
		1: 3D check parameters	
(PR)	#12624	tool rot ax name	Tool rotation axis name (For L system only)
		Specify the name of tool rotation axis using the 2nd axis name.	
		---Setting range---	
		Two alphanumeric characters (A to Z and 1 to 9)	
(PR)	#12625	tool rot ax type	Select tool rotation axis (For L system only)
		Select about which axis the tool rotation axis rotates.	
		(Note) When "#12624 tool rot ax name" (Tool rotation axis name) is not set, this parameter is disabled.	
		If "0: Disable" is selected when "#12624 tool rot ax name" is set, this parameter is treated as "2: J axis".	
		0: Disable	
		1: I axis	
		2: J axis	
		3: K axis	

15 Machine Parameters

15.26 Machine Type Parameters

(PR)	#12626	tool rot dir	Tool rotation axis direction (For L system only)
		Select the tool rotation axis direction. (Note) When "#12624 tool rot ax name" is not set, this parameter is disabled. 0: Right-handed system 1: Left-handed system	
(PR)	#12627	main sp no	Front spindle No. (For L system only)
		Specify the spindle No. of the front side work spindle. When this parameter is set to 0, the spindle No. is treated as 1. ---Setting range--- 0 to the number of spindles	
(PR)	#12628	sub sp no	Rear spindle No. (For L system only)
		Specify the spindle No. of the rear side work spindle. If there is no rear-side work spindle, set this parameter to 0. ---Setting range--- 0 to the number of spindles	
(PR)	#12629	main sp rot dir	Front spindle rotation direction (For L system only)
		Specify the rotation direction of the front side work spindle. 0: Right-handed system 1: Left-handed system	
(PR)	#12630	sub sp rot dir	Rear spindle rotation direction (For L system only)
		Specify the rotation direction of the rear side work spindle. 0: Right-handed system 1: Left-handed system	
(PR)	#12631	main chuck close M	Front chuck close M code (For L system only)
		Specify the M code allocated to the front chuck closing. ---Setting range--- 0 to 99999999	
(PR)	#12632	sub chuck close M	Back chuck close M code (For L system only)
		Specify the M code allocated to the back chuck closing. ---Setting range--- 0 to 99999999	
(PR)	#12633	main chuck pos X	Front chuck position X (For L system only)
		Specify the position from the machine zero point in the X axis direction of front chuck. ---Setting range--- -99999.999 to 99999.999 (mm)	
(PR)	#12634	main chuck pos Y	Front chuck position Y (For L system only)
		Specify the position from the machine zero point in the Y axis direction of front chuck. ---Setting range--- -99999.999 to 99999.999 (mm)	
(PR)	#12635	main chuck pos Z	Front chuck position Z (For L system only)
		Specify the position from the machine zero point in the Z axis direction of front chuck. ---Setting range--- -99999.999 to 99999.999 (mm)	
(PR)	#12636	sub chuck pos X	Back chuck position X (For L system only)
		Specify the position from the machine zero point in the X axis direction of back chuck. ---Setting range--- -99999.999 to 99999.999 (mm)	

15 Machine Parameters

15.26 Machine Type Parameters

(PR)	#12637	sub chuck pos Y	Back chuck position Y (For L system only)
Specify the position from the machine zero point in the Y axis direction of back chuck.			
---Setting range---			
-99999.999 to 99999.999 (mm)			
(PR)	#12638	sub chuck pos Z	Back chuck position Z (For L system only)
Specify the position from the machine zero point in the Z axis direction of back chuck.			
---Setting range---			
-99999.999 to 99999.999 (mm)			
(PR)	#12639	main chuck ax name	Front chuck moving axis name (For L system only)
Specify the name of the axis to move the front chuck with 2nd axis name.			
---Setting range---			
Two digits between A to Z and 1 to 9			
(PR)	#12640	sub chuck ax name	Back chuck moving axis name (For L system only)
Specify the name of the axis to move the back chuck with 2nd axis name.			
---Setting range---			
Two digits between A to Z and 1 to 9			
(PR)	#12650	table center posH	Horizontal axis table center position (For M system only)
Set the center position of the table in the horizontal axis direction using the machine position.			
---Setting range---			
-99999.999 to 99999.999 (mm)			
(PR)	#12651	table center posV	Vertical axis table center position (For M system only)
Set the center position of the table in the vertical axis direction using the machine position.			
---Setting range---			
-99999.999 to 99999.999 (mm)			
(PR)	#12652	table center posT	Height axis table center position (For M system only)
Set the center position of the table in the height axis direction using the machine position.			
---Setting range---			
-99999.999 to 99999.999 (mm)			

15.27 Machining Time Parameters

#42801+2(n-1)	M[n] Code	M code for calculating machining time
Specify the M code for calculating the machining time. (n=1 to 50)		
---Setting range---		
0 to 99999999		
#42802+2(n-1)	M[n] ExeTime	Execution time of M code for calculating machining time
Specify the execution time of the M code. (n=1 to 50)		
---Setting range---		
0 to 60000 (ms)		
#42901+2(n-1)	M[50+n] Code	M code for calculating machining time (for each part system)
Specify the M code for calculating the machining time.		
Set the M code that takes different time for each part system. (n=1 to 10)		
---Setting range---		
0 to 99999999		
#42902+2(n-1)	M[50+n] ExeTime	Execution time of M code for calculating machine time (for each part system)
Specify the execution time of the M code.		
Different values can be set for each part system. (n=1 to 10)		
---Setting range---		
0 to 60000 (ms)		
#42931+2(n-1)	M2[n] Code	2nd miscellaneous function code for calculating machining time
Specify the 2nd miscellaneous function code for calculating the machining time. (n=1 to 10)		
---Setting range---		
0 to 99999999		
#42932+2(n-1)	M2[n] ExeTime	Execution time of 2nd m. function code for calculating machining time
Specify the execution time of the 2nd miscellaneous function code. (n=1 to 10)		
---Setting range---		
0 to 60000 (ms)		
#42951	T Code ExeTime	Execution time of T code for calculating machining time
Specify the execution time of the T code for each part system.		
---Setting range---		
0 to 60000 (ms)		
#42952	M Code StdExeTime	Standard execution time of M code for calculating machining time
Specify the average execution time of the M code for which individual setting is not performed.		
---Setting range---		
0 to 60000 (ms)		
#42953	M2 Code StdExeTime	Standard execution time of 2nd m. function code for calculating machine time
Specify the average execution time of the 2nd miscellaneous function code for which individual setting is not performed.		
---Setting range---		
0 to 60000 (ms)		

15 Machine Parameters

15.27 Machining Time Parameters

#42961	S Code ExeTime 1	S code execution time for machining time calculation (1st spindle)
Specify the S code execution time of the 1st spindle.		
---Setting range---		
0 to 60000 (ms)		
#42962	S Code ExeTime 2	S code execution time for machining time calculation (2nd spindle)
Specify the S code execution time of the 2nd spindle.		
---Setting range---		
0 to 60000 (ms)		
#42963	S Code ExeTime 3	S code execution time for machining time calculation (3rd spindle)
Specify the S code execution time of the 3rd spindle.		
---Setting range---		
0 to 60000 (ms)		
#42964	S Code ExeTime 4	S code execution time for machining time calculation (4th spindle)
Specify the S code execution time of the 4th spindle.		
---Setting range---		
0 to 60000 (ms)		
#42965	S Code ExeTime 5	S code execution time for machining time calculation (5th spindle)
Specify the S code execution time of the 5th spindle.		
---Setting range---		
0 to 60000 (ms)		
#42966	S Code ExeTime 6	S code execution time for machining time calculation (6th spindle)
Specify the S code execution time of the 6th spindle.		
---Setting range---		
0 to 60000 (ms)		
#42967	S Code ExeTime 7	S code execution time for machining time calculation (7th spindle)
Specify the S code execution time of the 7th spindle.		
---Setting range---		
0 to 60000 (ms)		
#42968	S Code ExeTime 8	S code execution time for machining time calculation (8th spindle)
Specify the S code execution time of the 8th spindle.		
---Setting range---		
0 to 60000 (ms)		

15 Machine Parameters

15.28 Safety Common Parameters

15.28 Safety Common Parameters

(PR)	#51001	SIO_Enable	Enable safety related I/O observation
Select whether to enable the safety related I/O observation.			
0: Disable			
1: Enable			
(PR)	#51002	SLS_Enable	Enable SLS observation
Select whether to enable the safely limited speed observation.			
0: Disable			
1: Enable			
(PR)	#51003	SLP_Enable	Enable SLP observation
Select whether to enable the safely limited position observation.			
0: Disable			
1: Enable			
(PR)	#51004	SSM_Enable	Enable Safe speed monitor
Select whether to enable the safe speed monitor.			
0: Disable			
1: Enable			
(PR)	#51005	SCA_Enable	Enable safe cam
Select whether to enable the safe cam.			
0: Disable			
1: Enable			
(PR)	#51006	SOS_Enable	Enable Safe operating stop
Select whether to enable the safe operating stop.			
0: Disable			
1: Enable			
(*) When SS2 is executed, SOS is activated irrespective of this parameter.			
(PR)	#51007	SS1_Enable	Enable Safe stop 1
Select whether to enable the safe stop 1.			
0: Disable			
1: Enable			
(*) Irrespective of this parameter, when a smart safety observation error is detected, SS1 may be activated depending on the setting of "#51102 SF_Stoptype".			
(PR)	#51008	SS2_Enable	Enable Safe stop 2
Select whether to enable the safe stop 2.			
0: Disable			
1: Enable			
(PR)	#51009	STO_Enable	Enable Safe torque off
Select whether to enable the safe torque off.			
0: Disable			
1: Enable			
(*) Irrespective of this parameter, when a smart safety observation error is detected, STO may be activated depending on the setting of "#51102 SF_Stoptype".			
(PR)	#51010	SBC_Enable	Safe brake control enabled
Select whether to enable the safe brake control.			
0: Disable			
1: Enable			

15 Machine Parameters

15.28 Safety Common Parameters

(PR)	#51011	SBT_INT	SBT interval
			<p>Set the time that elapses before the next SBT incomplete signal (SBTNFEXm / SBTNFMOM) turns ON after completing the brake test.</p> <p>When set "0", the interval will be 8 hours.</p> <p>---Setting range---</p> <p>0 to 255 hours</p>
(PR)	#51012	CRSCHK_TOL	Cross-check status inconsistency tolerable time
			<p>Set the tolerable time for inconsistency between CPUs status. (When the status is inconsistent for more than tolerable time, the alarm occurs and the motor power shuts OFF.)</p> <p>When set "0", the inconsistency tolerable time is 100 ms.</p> <p>---Setting range---</p> <p>0 to 5000 (ms)</p>
	#51013	SF_PSWD	Safe password
			<p>Set the safety password.</p> <p>Setting: 7 or 8 uppercase alphanumeric characters</p> <p>If no password is set, turn ON the machine parameter setup mode to set the safety parameters.</p> <p>---Setting range---</p> <p>7 or 8 uppercase alphanumeric characters</p>
(PR)	#51015	safe_drv_test	Drive safety function easy test mode
			<p>Select whether to enable the simple test mode in which the drive safety function operation can be checked without connecting any smart safety observation-capable drive unit.</p> <p>0: Disable the drive safety function simple test mode</p> <p>1: Enable the drive safety function simple test mode</p>
(PR)	#51017	SLAD_Step	Maximum number of steps in safety ladder
			<p>Specify the maximum number of storable steps for safety sequence.</p> <p>The maximum number of executable steps will be double the maximum number of storable steps.</p> <p>0: 6144 steps</p> <p>1 to 32: (Setting value) K steps</p> <p>---Setting range---</p> <p>0 (default)</p> <p>1 to 32 (K steps)</p>

15 Machine Parameters

15.29 Safety Axis Parameters

15.29 Safety Axis Parameters

(PR)	#51101	SF_Disable	Disable smart safety observation
<p>Exclude the axis from the smart safety observation target.</p> <p>0: Enable smart safety observation 1: Disable smart safety observation</p> <p>(Note) The settings of "#51101 SF_Disable" and "#51301 SF_SDisable" must be the same within a multi-hybrid drive unit.</p>			
(PR)	#51102	SF_Stoptype	Stop method at error
<p>Select which of the safe stop methods to use when an error is detected in the smart safety observation.</p> <p>0: STO 1: SS1</p>			
(PR)	#51103-51106	SLS_Speed1-4	SLS speed tolerance 1-4
<p>Specify the upper limits of machine-end speed determined as safe for each of SLS speed tolerances 1 to 4. If the SLS detection delay time has elapsed with the command/FB speed exceeding the safely-limited speed while SLS is ON, a safe stop (SS1 or STO) is executed. The safely-limited speed to be applied to SLS is calculated using the following equation.</p> <p>Safely-limited speed = SLS speed tolerance x SLS speed override / 100</p> <p>---Setting range---</p> <p>0 to 999999 (mm/min or °/min)</p>			
(PR)	#51107-51122	SLS_Override1-16	SLS speed override 1-16
<p>Specify the speed overrides 1 to 16 with respect to SLS speed tolerances 1 to 4. For details refer to SLS speed tolerances 1 to 4.</p> <p>---Setting range---</p> <p>0 to 100 (%)</p>			
(PR)	#51123	SLS_Clamp	SLS speed clamp ratio
<p>Specify the speed clamp ratio that is applied while SLS is ON. Set the ratio to about 80 to 90%. While SLS is ON, the command speed is clamped at the following speed:</p> <p>Clamp speed = Safely-limited speed x SLS speed clamp ratio / 100</p> <p>(Safely-limited speed = SLS speed tolerance x SLS speed override / 100)</p> <p>---Setting range---</p> <p>0 to 100 (%)</p>			
	#51124	SLS_T1	SLS detection delay time
<p>Specify a period of time to detect a speed error while SLS is ON. A safe stop (SS1 or STO) is executed if the period of time set in this parameter has elapsed with the command/FB speed exceeding the safely-limited speed.</p> <p>---Setting range---</p> <p>0 to 9999 (ms)</p>			
	#51125	SLS_T2	SLS deceleration observation time
<p>Specify a period of time to detect a deceleration error that is caused due to change of the safely-limited speed at the start of or during SLS. If you have changed the safely-limited speed at the start of or during SLS, and the time set in this parameter has elapsed with the command/FB speed exceeding the safely-limited speed, a safe stop (SS1 or STO) is executed. When set to "0", the detection time is treated as 200(ms).</p> <p>---Setting range---</p> <p>0 to 99999 (ms)</p>			

15 Machine Parameters

15.29 Safety Axis Parameters

(PR)	#51126+2(n-1)	SLP_PositionPn	SLP position tolerance n (+)
		<p>"n" represents the SLP position tolerance No. (n=1 to 4)</p> <p>Specify the upper and lower limits of machine position, which is determined as safe, for each of SLP position tolerances 1(+) to 4(+). If the SLP detection delay time has elapsed while SLP is ON with the command/FB position outside the SLP position tolerance range, a safe stop (SS1 or STO) is executed.</p> <p>*SLP is not available for a rotation-type rotary axis.</p> <p>---Setting range---</p> <p>-99999.999 to +99999.999 (mm)</p>	
(PR)	#51127+2(n-1)	SLP_PositionMn	SLP position tolerance n (-)
		<p>"n" represents the SLP position tolerance No. (n=1 to 4)</p> <p>Specify the upper and lower limits of machine position, which is determined as safe, for each of SLP position tolerances 1(-) to 4(-). If the SLP detection delay time has elapsed while SLP is ON with the command/FB position outside the SLP position tolerance range, a safe stop (SS1 or STO) is executed.</p> <p>*SLP is not available for a rotation-type rotary axis.</p> <p>---Setting range---</p> <p>-99999.999 to +99999.999 (mm)</p>	
#51134	SLP_T1	SLP detection delay time	
		<p>Specify a period of time to detect a machine position error while SLP is ON. If the time set in this parameter has elapsed with the command/FB position outside the SLP position tolerance range, a safe stop (SS1 or STO) is executed.</p> <p>---Setting range---</p> <p>0 to 9999 (ms)</p>	
(PR)	#51135-51138	SSM_Speed1-4	SSM speed 1-4
		<p>Specify the upper limits of machine-end speed determined as safe for each of SSM speeds 1 to 4. If the command/FB speed is at the safe speed or lower while SSM is ON, the Under SSM safe speed signal turns ON. If the command/FB speed exceeds the safe speed, the Under SSM safe speed signal turns OFF. The safe speed to be applied to SSM is calculated using the following equation.</p> <p>(When the Under SSM safe speed signal is ON)</p> <p>Safe speed = SSM speed</p> <p>(When the Under SSM safe speed signal is OFF)</p> <p>Safe speed = SSM speed - SSM hysteresis width</p> <p>---Setting range---</p> <p>0 to 999999 (mm/min or °/min)</p>	
#51139-51142	SSM_Hysteresis1-4	SSM hysteresis width 1-4	
		<p>Specify the hysteresis widths that correspond to SSM speeds 1 to 4. For details refer to SSM speeds 1 to 4.</p> <p>---Setting range---</p> <p>0 to 999999 (mm/min or °/min)</p>	
(PR)	#51143+2(n-1)	SCA_PositionPn	SCA position n (+)
		<p>"n" represents the SCA position No. (n=1 to 16)</p> <p>Specify the upper and lower limits of machine position determined as safe for each of SCA positions 1(+) to 16(+). If the command/FB position is in the SCA safe position or smaller while SCA is ON, the Safe cam position signal turns OFF. If the position has exceeded the SCA safe position, the Safe cam position signal turns ON. The SCA safe position is calculated using the following equation.</p> <p>(When the Safe cam position signal is ON)</p> <p>SCA safe position = SCA position (+) – SCA hysteresis width</p> <p>(When the Safe cam position signal is OFF)</p> <p>SCA safe position = SCA position (+)</p> <p>---Setting range---</p> <p>-99999.999 to +99999.999 (mm)</p>	

15 Machine Parameters

15.29 Safety Axis Parameters

(PR)	#51144+2(n-1)	SCA_PositionMn	SCA position n (-)
		<p>"n" represents the SCA position No. (n=1 to 16)</p> <p>Specify the upper and lower limits of machine position determined as safe for each of SCA positions 1(-) to 16(-). If the command/FB position is in the SCA safe position or smaller while SCA is ON, the Safe cam position signal turns OFF. If the position has exceeded the SCA safe position, the Safe cam position signal turns ON. The SCA safe position is calculated using the following equation.</p> <p>(When the Safe cam position signal is ON) SCA safe position = SCA position (-) – SCA hysteresis width</p> <p>(When the Safe cam position signal is OFF) SCA safe position = SCA position (-)</p> <p>---Setting range---</p> <p>-99999.999 to +99999.999 (mm)</p>	
	#51175	SCA_Hysteresis	SCA hysteresis width
		<p>Specify the hysteresis widths that correspond to SCA positions 1 to 16. For details refer to SCA positions 1(+/-) to 16(+/-).</p> <p>---Setting range---</p> <p>0 to 99999.999 (mm)</p>	
(PR)	#51176	SOS_Speed	SOS stop speed
		<p>Specify the upper limit of machine-end speed determined as a safe operating stop.</p> <ul style="list-style-type: none"> •If the SOS_V detection delay time has elapsed with the command/FB speed exceeding the speed of this parameter while SOS is ON, a safe stop (SS1 or STO) is executed. •The point of time at which the command/FB speed drops to that of this parameter or lower while SS1/SS2 is ON is treated as a standstill. <p>*When this parameter is set to 0, "SOS speed error" may occur even though the axis is at a standstill.</p> <p>---Setting range---</p> <p>0 to 9999 (mm/min or °/min)</p>	
	#51177	SOS_T1	SOS_V detection delay time
		<p>Specify a period of time to detect a speed error while SOS is ON. If the period of time set in this parameter has elapsed with the command/FB speed exceeding the SOS stop speed while SOS is ON, a safe stop (SS1 or STO) is executed.</p> <p>---Setting range---</p> <p>0 to 9999 (ms)</p>	
(PR)	#51178	SOS_Droop	SOS position deviation tolerance
		<p>Specify the upper limit of machine-end position deviation determined as a safe operating stop. If the SOS_PD detection delay time has elapsed with the position deviation (difference between the command and FB positions) exceeding that of this parameter while SOS is ON, a safe stop (SS1 or STO) is executed.</p> <p>*When this parameter is set to 0, "SOS position deviation error" may occur even though the axis is at a standstill.</p> <p>---Setting range---</p> <p>0 to 9999.999 (mm or °)</p>	
	#51179	SOS_T2	SOS_PD detection delay time
		<p>Specify a period of time to detect a position deviation error while SOS is ON. If a period of time set in this parameter has elapsed with the position deviation (difference between the command and FB positions) exceeding the SOS position deviation tolerance while SOS is ON, a safe stop (SS1 or STO) is executed.</p> <p>---Setting range---</p> <p>0 to 9999 (ms)</p>	
(PR)	#51180	SOS_PositionM	SOS travel distance tolerance (-)
		<p>Specify the upper limit of machine-end travel distance (minus side) determined as a safe operating stop. If the SOS_P detection delay time has elapsed with the command/FB travel distance in the minus direction exceeding that of this parameter while SOS is ON, a safe stop (SS1 or STO) is executed.</p> <p>*When this parameter is set to 0, "SOS travel distance error" may occur even though the axis is at a standstill.</p> <p>---Setting range---</p> <p>0 to 9999.999 (mm or °)</p>	

15 Machine Parameters

15.29 Safety Axis Parameters

(PR)	#51181	SOS_PositionP	SOS travel distance tolerance (+)
		Specify the upper limit of machine-end travel distance (plus side) determined as a safe operating stop. If the SOS_P detection delay time has elapsed with the command/FB travel distance in the plus direction exceeding that of this parameter while SOS is ON, a safe stop (SS1 or STO) is executed.	
		*When this parameter is set to 0, "SOS travel distance error" may occur even though the axis is at a standstill.	
		---Setting range---	
		0 to 9999.999 (mm or °)	
	#51182	SOS_T3	SOS_P detection delay time
		Specify a period of time to detect a travel distance error while SOS is ON. If the period of time set in this parameter has elapsed with the command/FB travel distance exceeding the SOS travel distance tolerance (+/-) while SOS is ON, a safe stop (SS1 or STO) is executed.	
		---Setting range---	
		0 to 9999 (ms)	
	#51183	SS1_T1	SS1 deceleration observation time
		Specify a period of time to detect a deceleration error while SS1 is ON. If the time set in this parameter has elapsed with the command/FB speed exceeding the SOS stop speed, STO is activated.	
		---Setting range---	
		0 to 99999 (ms)	
	#51184	SS2_T1	SS2 deceleration observation time
		Specify a period of time to detect a deceleration error while SS2 is ON. If the time set in this parameter has elapsed with the command/FB speed exceeding the SOS stop speed, STO is activated.	
		---Setting range---	
		0 to 99999 (ms)	
(PR)	#51185	STO_EXEWT	Waiting time before STO execution
		Specify a period of time to wait from when the drive unit receives an STO request from the NC until when STO is actually executed. Set this time so that the brake is activated within this period of time. When set to "0", the STO execution standby time is treated as 200 ms.	
		---Setting range---	
		0 to 20000 (ms)	
(PR)	#51186	SBTEX_Enable	External brake SBT enabled
		0: Disable	
		1: Enable	
(PR)	#51187	SBTMO_Enable	Motor brake SBT enabled
		0: Disable	
		1: Enable	
	#51191	SBT_ILIM	SBT current limit value
		Set the current limit value in the brake test in proportion to the stall current. When set to "0", the alarm occurs at the start of the brake test. (The test does not start.)	
		---Setting range---	
		0 to 100 (%)	
(PR)	#51192	SBT_CMDWT	SBT command wait time
		Set the wait time of output of movement command for brake test from NC since receiving SBT starting signal (SBTSTEXm / SBTSTMOM). When set to "0", the commanded wait time is 400 ms.	
		---Setting range---	
		0 to 30000 (ms)	
(PR)	#51193	SBT_FD	SBT command movement amount
		Set the movement amount to command to the test target axis at the time of brake test. When set to "0", the alarm occurs at the start of the brake test. (The test does not start.)	
		---Setting range---	
		-99999.999 to 99999.999 (mm or °)	

15 Machine Parameters

15.29 Safety Axis Parameters

(PR)	#51194	SBT_FDRATE	SBT command speed
		Set the command speed to command to the test target axis at the time of brake test. When set to "0", the alarm occurs at the start of the brake test. (The test does not start.)	
		---Setting range---	
		0 to 1000000 (mm/min or °/min)	
(PR)	#51195	SBT_OBTIM	SBT observation time
		Set the time to continue the observation of axis movement amount after the output of movement command for test at the time of brake test. When set to "0", the observation time is 1000 ms.	
		---Setting range---	
		0 to 30000 (ms)	
(PR)	#51196	SBT_TOL	SBT tolerable movement amount
		Set the tolerable movement amount of the test target axis at the time of brake test. (The alarm occurs if the movement amount during the test exceeds this parameter value.) When set "0", the tolerable movement amount is 100 mm (or °).	
		---Setting range---	
		0 to 99999.999 (mm or °)	
(PR)	#51197	SLP/SCA_FDTOL	SLP/SCA tolerable movement amount during power OFF
		Sets the tolerable value of the difference (error amount) between [saved position at power shut OFF] and [restored position at power ON] in SLP/SCA encoder diagnosis during power OFF. When this above difference exceeds the tolerable value, the system starts in STO status. When set "0", the tolerable value is as in below formula.	
		Tolerable movement amount = SV018(PIT) * 0.9	
		---Setting range---	
		0 to 99999.999 (mm)	
(PR)	#51198	MIRtAbsSEnc_FDChk	SLP/SCA encoder diagnosis during power OFF application for Multi revolution safety encoder
		Enables the encoder diagnosis during power OFF to use SLP/SCA for the axes connected with Multi revolution safety encoder.	
		0: Disable the encoder diagnosis during power OFF to use SLP/SCA for the axes connected with Multi revolution safety encoder	
		1: Enable the encoder diagnosis during power OFF to use SLP/SCA for the axes connected with Multi revolution safety encoder	
		* As for the axes not connected with Multi revolution safety encoder, the above diagnosis will be enabled regardless of the setting value of this parameter.	
		* The above diagnosis will not be executed when SLP/SCA are disabled. (Both SLP_Enable and SCA_Enable are 0.)	
#51199	SF_PDCHK_TOL	Servo axis position deviation diagnosis tolerable value	
		Sets the tolerable value of the position deviation (the difference between the commanded position generated inside NC and the feedback position received from drive unit) in the position deviation diagnosis. When the position deviation exceeds the tolerable value, the Safe stop (SS1/STO) will be carried out. When "0" is set, the tolerable value is as in below formula.	
		Tolerable value = SV018(PIT) * 2.0	
		---Setting range---	
		0 to 32767 (mm or °)	

15 Machine Parameters

15.29 Safety Axis Parameters

(PR)	#51200	SFSPEC1	Safety specification 1
			<p>Specify the Safety axis's specification by turning ON the corresponding bit. Input the hexadecimal value for this parameter.</p> <p>bit0-2: Not used</p> <p>bit3: Motor brake connection status</p> <p>0: Motor brake connected</p> <p>1: Motor brake not connected</p> <p>bit4-F: Not used</p> <p>* If the settings of encoder type (bit0, bit1) are different from the actually connected ones, the servo alarm 4D is output.</p> <p>---Setting range---</p> <p>0x0000 to 0xFFFF</p>
(PR)	#51201	SENCTYP	Safety encoder type
			<p>For a safety encoder-connected axis, set the safety encoder type. When the Multi revolution part is connected to the safety encoder that is outside the certification of safety standards, and in SLP/SCA enabled, SLP/SCA encoder diagnosis during power OFF will be carried out regardless of the setting value of #51198 MlRtAbsSEnc_FDChk.</p> <p>0: Safety encoder that is outside the safety certification for Multi revolution</p> <p>1: Safety encoder that is certified with safety standards for Multi revolution</p>
(PR)	#51202	SEMG_STO_WT	STO delay time for safety external emergency stop
			<p>Specify a length of time it takes to complete deceleration stop when safety external emergency stop is implemented.</p> <p>When not executing deceleration stop, set the parameter to "0".</p> <p>When executing deceleration stop, subtract "#51185 STO_EXEWT" from "#2256 SV056" and set the difference in the parameter.</p> <p>---Setting range---</p> <p>0 to 20000 (ms)</p>

15 Machine Parameters

15.30 Safety Spindle Parameters

15.30 Safety Spindle Parameters

(PR)	#51301	SF_SDisable	Disable smart safety observation
<p>Exclude the axis from the smart safety observation target.</p> <p>0: Enable smart safety observation</p> <p>1: Disable smart safety observation</p> <p>(Note) The settings of "#51101 SF_Disable" and "#51301 SF_SDisable" must be the same within a multi-hybrid drive unit.</p>			
(PR)	#51302	SF_SSstoptype	Stop method at error
<p>Select which of the safe stop methods to use when an error is detected in the smart safety observation.</p> <p>0: STO</p> <p>1: SS1</p>			
(PR)	#51303- 51306	SLS_SSspeed1-4	SLS speed tolerance 1-4
<p>Specify the upper limits of machine-end speed determined as safe for each of SLS speed tolerances 1 to 4. If the SLS detection delay time has elapsed with the command/FB speed exceeding the safely-limited speed while SLS is ON, a safe stop (SS1 or STO) is executed. The safely-limited speed to be applied to SLS is calculated using the following equation.</p> <p>Safely-limited speed = SLS speed tolerance x SLS speed override / 100</p> <p>---Setting range---</p> <p>0 to 999999.9 (r/min)</p>			
(PR)	#51307- 51322	SLS_SOverride1-16	SLS speed override 1-16
<p>Specify the speed overrides 1 to 16 with respect to SLS speed tolerances 1 to 4. For details refer to SLS speed tolerances 1 to 4.</p> <p>---Setting range---</p> <p>0 to 100 (%)</p>			
(PR)	#51323	SLS_Sclamp	SLS speed clamp ratio
<p>Specify the speed clamp ratio that is applied while SLS is ON. Set the ratio to about 80 to 90%. While SLS is ON, the command speed is clamped at the following speed:</p> <p>Clamp speed = Safely-limited speed x SLS speed clamp ratio / 100</p> <p>(Safely-limited speed = SLS speed tolerance x SLS speed override / 100)</p> <p>---Setting range---</p> <p>0 to 100 (%)</p>			
	#51324	SLS_ST1	SLS detection delay time
<p>Specify a period of time to detect a speed error while SLS is ON. A safe stop (SS1 or STO) is executed if the period of time set in this parameter has elapsed with the command/FB speed exceeding the safely-limited speed.</p> <p>---Setting range---</p> <p>0 to 9999 (ms)</p>			
	#51325	SLS_ST2	SLS deceleration observation time
<p>Specify a period of time to detect a deceleration error that is caused due to change of the safely-limited speed at the start of or during SLS. If you have changed the safely-limited speed at the start of or during SLS, and the time set in this parameter has elapsed with the command/FB speed exceeding the safely-limited speed, a safe stop (SS1 or STO) is executed. When set to "0", the detection time is treated as 200(ms).</p> <p>---Setting range---</p> <p>0 to 99999 (ms)</p>			

15 Machine Parameters

15.30 Safety Spindle Parameters

(PR)	#51326-51329	SSM_SSspeed1-4	SSM speed 1-4
		<p>Specify the upper limits of machine-end speed determined as safe for each of SSM speeds 1 to 4. If the command/FB speed is at the safe speed or lower while SSM is ON, the Under SSM safe speed signal turns ON. If the command/FB speed exceeds the safe speed, the Under SSM safe speed signal turns OFF. The safe speed to be applied to SSM is calculated using the following equation.</p> <p>(When the Under SSM safe speed signal is ON) Safe speed = SSM speed</p> <p>(When the Under SSM safe speed signal is OFF) Safe speed = SSM speed - SSM hysteresis width</p> <p>---Setting range---</p> <p>0 to 999999.9 (r/min)</p>	
	#51330-51333	SSM_SHysteresis1-4	SSM hysteresis width 1-4
		<p>Specify the hysteresis widths that correspond to SSM speeds 1 to 4. For details refer to SSM speeds 1 to 4.</p> <p>---Setting range---</p> <p>0 to 999999.9 (r/min)</p>	
(PR)	#51334	SOS_SSspeed	SOS stop speed
		<p>Specify the upper limit of machine-end speed determined as a safe operating stop.</p> <ul style="list-style-type: none"> •If the SOS_V detection delay time has elapsed with the command/FB speed exceeding that of this parameter while SOS is ON, a safe stop (SS1 or STO) is executed. •The point of time at which the command/FB speed drops to that of this parameter or lower while SS1/SS2 is ON is treated as a standstill. <p>*When this parameter is set to 0, "SOS speed error" may occur even though the spindle is at a standstill.</p> <p>---Setting range---</p> <p>0 to 9999.9 (r/min)</p>	
	#51335	SOS_ST1	SOS_V detection delay time
		<p>Specify a period of time to detect a speed error while SOS is ON. If the period of time set in this parameter has elapsed with the command/FB speed exceeding the SOS stop speed while SOS is ON, a safe stop (SS1 or STO) is executed.</p> <p>---Setting range---</p> <p>0 to 9999 (ms)</p>	
(PR)	#51336	SOS_SDroop	SOS position deviation tolerance
		<p>Specify the upper limit of machine-end position deviation determined as a safe operating stop. If the SOS_PD detection delay time has elapsed with the position deviation (difference between the command and FB positions) exceeding that of this parameter while SOS is ON, a safe stop (SS1 or STO) is executed.</p> <p>*When this parameter is set to 0, "SOS position deviation error" may occur even though the spindle is at a standstill.</p> <p>---Setting range---</p> <p>0 to 9999 (°)</p>	
	#51337	SOS_ST2	SOS_PD detection delay time
		<p>Specify a period of time to detect a position deviation error while SOS is ON. If a period of time set in this parameter has elapsed with the position deviation (difference between the command and FB positions) exceeding the SOS position deviation tolerance while SOS is ON, a safe stop (SS1 or STO) is executed.</p> <p>---Setting range---</p> <p>0 to 9999 (ms)</p>	
(PR)	#51338	SOS_SPositionM	SOS travel distance tolerance (-)
		<p>Specify the upper limit of machine-end travel distance (minus side) determined as a safe operating stop. If the SOS_P detection delay time has elapsed with the command/FB travel distance in the minus direction exceeding that of this parameter while SOS is ON, a safe stop (SS1 or STO) is executed.</p> <p>*When this parameter is set to 0, "SOS travel distance error" may occur even though the spindle is at a standstill.</p> <p>---Setting range---</p> <p>0 to 9999 (°)</p>	

15 Machine Parameters

15.30 Safety Spindle Parameters

(PR)	#51339	SOS_SPositionP	SOS travel distance tolerance (+)
Specify the upper limit of machine-end travel distance (plus side) determined as a safe operating stop. If the SOS_P detection delay time has elapsed with the command/FB travel distance in the plus direction exceeding that of this parameter while SOS is ON, a safe stop (SS1 or STO) is executed.			
*When this parameter is set to 0, "SOS travel distance error" may occur even though the spindle is at a standstill.			
---Setting range---			
0 to 9999 (°)			
	#51340	SOS_ST3	SOS_P detection delay time
Specify a period of time to detect a travel distance error while SOS is ON. If the period of time set in this parameter has elapsed with the command/FB travel distance exceeding the SOS travel distance tolerance (+/-) while SOS is ON, a safe stop (SS1 or STO) is executed.			
---Setting range---			
0 to 9999 (ms)			
	#51341	SS1_ST1	SS1 deceleration observation time
Specify a period of time to detect a deceleration error while SS1 is ON. If the time set in this parameter has elapsed with the command/FB speed exceeding the SOS stop speed, STO is activated.			
---Setting range---			
0 to 99999 (ms)			
	#51342	SS2_ST1	SS2 deceleration observation time
Specify a period of time to detect a deceleration error while SS2 is ON. If the time set in this parameter has elapsed with the command/FB speed exceeding the SOS stop speed, STO is activated.			
---Setting range---			
0 to 99999 (ms)			
(PR)	#51343	STO_SEXEW	Waiting time before STO execution
Specify a period of time to wait from when the drive unit receives an STO request from the NC until when STO is actually executed. Set this time so that the brake is activated within this period of time. When set to "0", the STO execution standby time is treated as 200 ms.			
---Setting range---			
0 to 20000 (ms)			
	#51344	SF_PDCHK_ST1	Spindle position deviation diagnosis waiting time
Set the waiting time for starting the position deviation diagnosis at Spindle non-interpolation mode. The diagnosis of the position deviation at Spindle non-interpolation mode starts after the commanded speed becomes consistent and after the time set by this parameter passes. It stops while the command speed is changing. When set to "0", the Spindle position deviation diagnosis waiting time is 20000 ms.			
---Setting range---			
0 to 30000 (ms)			
	#51345	SF_PDCHK_STOL	Spindle position deviation diagnosis tolerable value
Sets the tolerable value of the position deviation (the difference between the commanded position generated inside NC and the feedback position received from drive unit) in the position deviation diagnosis. When the position deviation exceeds the tolerable value, the Safe stop (SS1/STO) will be carried out. When set to "0", the tolerable value is 1080°.			
---Setting range---			
0 to 32767 (°)			
(PR)	#51347	SEMG_STO_SWT	STO delay time for safety external emergency stop
Specify a length of time it takes to complete deceleration stop when safety external emergency stop is implemented.			
When not executing deceleration stop, set the parameter to "0".			
When executing deceleration stop, subtract "#51343 STO_SEXEW" from "#13056 SP056" and set the difference in the parameter.			
---Setting range---			
0 to 29900 (ms)			

15.31 Safety I/O Assignment Parameters

(PR)	#51501+10(n-1)	RIO CH No. #n	Target channel number #n
		Specify the channel No. to which the nth safety I/O unit is connected. (n = 1 to 8) (*) When set to "0", the RIO assignment parameters of the nth station are all disabled.	
		---Setting range---	
		0 to 4	
(PR)	#51502+10(n-1)	RIO Station No. #n	Target station number #n
		Specify the station No. of the nth safety I/O unit. (n=1 to 8) * Set this parameter to the same value as of the rotary switch on the safety I/O unit to which the device is assigned.	
		---Setting range---	
		0 to 63	
(PR)	#51503+10(n-1)	DI dev name #n	DI device name #n
		Specify the name of the DI assignment devices of the nth safety I/O unit. (n=1 to 8) * When set to "0", the name is left blank.	
		---Setting range---	
		0, X, ZR	
(PR)	#51504+10(n-1)	DI dev No. #n	DI device number #n
		Specify the head device No. of DI assignment devices of the nth safety I/O unit. (n=1 to 8) Device X: hexadecimal and on a 32-point basis (a multiple of 32) Device ZR: decimal and on a 2-point basis (an even number) * This parameter changes to "0" if you change the device name "DI dev name #n". * Specify "DI dev name #n" ahead of this parameter.	
		---Setting range---	
		X: 0 to 1E0 (hexadecimal) ZR: 0 to 62 (decimal)	
(PR)	#51505+10(n-1)	DO dev name #n	DO device name #n
		Specify the name of the DO assignment devices of the nth safety I/O unit. (n=1 to 8) * When set to "0", the name is left blank.	
		---Setting range---	
		0, Y, ZR	
(PR)	#51506+10(n-1)	DO dev No. #n	DO device number #n
		Specify the head device No. of the DO assignment devices of the nth safety I/O unit. (n=1 to 8) Device Y: hexadecimal and on a 32-point basis (a multiple of 32) Device ZR: decimal and on a 2-point basis (an even number) * The setting of this parameter changes to "0" if you change the device name of "DO dev name #n". * Specify "DO dev name #n" ahead of this parameter.	
		---Setting range---	
		Y: 0 to 1E0 (hexadecimal) ZR: 64 to 126 (decimal)	
(PR)	#51582	EMG_Dev1_ch	Emergency stop signal 1 channel No.
		Specify the No. of I/O channel to connect the safety I/O unit that receives the emergency stop signal. When set to "0", the designation of emergency stop signal device by EMG_Dev1 is disabled, irrespective of the settings of EMG_Dev1_stn and EMG_Dev1_bit.	
		---Setting range---	
		0 to 4	

15 Machine Parameters

15.31 Safety I/O Assignment Parameters

(PR)	#51583	EMG_Dev1_stn	Emergency stop signal 1 station No.
Specify the No. of station to connect the safety I/O unit that receives the emergency stop signal.			
---Setting range---			
0 to 63			
(PR)	#51584	EMG_Dev1_bit	Emergency stop signal 1 bit No.
Specify the bit No. of the safety I/O unit that receives the emergency stop signal.			
---Setting range---			
0 to 7			
(PR)	#51585	EMG_Dev2_ch	Emergency stop signal 2 channel No.
Specify the No. of I/O channel to connect the safety I/O unit that receives the emergency stop signal. When set to "0", the designation of emergency stop signal device by EMG_Dev2 is disabled, irrespective of the settings of EMG_Dev2_stn and EMG_Dev2_bit.			
---Setting range---			
0 to 4			
(PR)	#51586	EMG_Dev2_stn	Emergency stop signal 2 station No.
Specify the No. of station to connect the safety I/O unit that receives the emergency stop signal.			
---Setting range---			
0 to 63			
(PR)	#51587	EMG_Dev2_bit	Emergency stop signal 2 bit No.
Specify the bit No. of the safety I/O unit that receives the emergency stop signal.			
---Setting range---			
0 to 7			
(PR)	#51591	SIO_DIDelay	Allowed input signal compare time
Specify the allowed time of inconsistency between the PLC1 and PLC2 side input signals. Specify this in increments of 10 (ms). When set to "0", the allowed safety signal compare time is 300 (ms).			
---Setting range---			
0 to 500 (10 ms)			
(PR)	#51592	SIO_DODelay	Allowed output signal compare time
Specify the allowed time of inconsistency between the PLC1 and PLC2 side output signals. Specify this in increments of 10 (ms). When set to "0", the allowed safety signal compare time is 300 (ms).			
---Setting range---			
0 to 50 (10 ms)			
(PR)	#51593	SIO_DOErrtype	DO control method at diagnostic error
Select the DO control method and PLC status of when a safety signal observation error occurs.			
0: PLC is set in RUN state and DO is controlled through user safety sequence			
1: PLC is set in STOP state and all DOs are OFF.			
(PR)	#51594	SIO_DODelay2	Allowed output signal compare time 2
Specify the allowed time of inconsistency between the PLC1 and PLC2 side output signals. Specify this in increments of 10 (ms). When set to "0", the allowed safety signal compare time is 300 (ms).			
Set tolerable time more than 300 (ms), when an output signal is controlled with 100 (ms) timer.			
---Setting range---			
0 to 500 (10 ms)			

15.32 EtherNet/IP Parameters

15.32.1 EtherNet/IP Parameters Scanner 1

(Note) Numeric portion of "N001" included in each parameter name varies depending on the parameter No.

#80000+20(n-1)	N001 Device Number	Scanner function Implicit Message: device No.
	Specify the No. of the device that is assigned to node. (n=1 to 64)	
	---Setting range---	
	1 to 128	
#80001+20(n-1)	N001 Position No.	Scanner function Implicit Message: position No.
	Specify the position No. that is assigned to node. (n=1 to 64)	
	---Setting range---	
	0 to 63	
#80002+20(n-1)	N001 Project No.	Scanner function Implicit Message: PLC project No.
	Specify the PLC project No. that is assigned to node. (n=1 to 64)	
	This number is set as the project No. of PLC device to which the node input/output/connection status is assigned.	
	---Setting range---	
	1 to 6	
#80003+20(n-1)	N001 in dev name	Scanner function Implicit Message: PLC device name (IN (T->O))
	Specify the name of PLC device to which Implicit Message input data is transferred. (n=1 to 64)	
	Example) X	
	---Setting range---	
	X, M, L, SB, B, SW, D, R, W	
#80004+20(n-1)	N001 in dev No.	Scanner function Implicit Message: PLC device top No. (IN (T->O))
	Specify the top No. of PLC device to which Implicit Message input data is transferred. (n=1 to 64)	
	If you specify bit devices, set them in increments of 16 points.	
	Example) 100	
	---Setting range---	
	X: 0 to 5F0	
	M: 0 to 61424	
	L: 0 to 32752	
	SB: 0 to 7FF0	
	B: 0 to EFF0	
	SW: 0 to 7FFF	
	D: 0 to 32767	
	W: 0 to 7FFF	
	R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	
#80005+20(n-1)	N001 in dev size	Scanner function Implicit Message: PLC device size (IN (T->O))
	Specify the size (bytes) of Implicit Message input data that is transferred to PLC device. (n=1 to 64)	
	Example) 1	
	---Setting range---	
	0 to 509 (bytes)	
	* Up to 5000 bytes in total for all nodes	

15 Machine Parameters

15.32 EtherNet/IP Parameters

#80006+20(n-1)	N001 out dev name	Scanner function Implicit Message: PLC device name (OUT (O->T))
Specify the name of PLC device to which Implicit Message output data is transferred. (n=1 to 64) Example) Y ---Setting range--- Y, M, L, SB, B, SW, D, R, W		
#80007+20(n-1)	N001 out dev No.	Scanner function Implicit Message: PLC device top No. (OUT (O->T))
Specify the top No. of PLC device to which Implicit Message output data is transferred. (n=1 to 64) If you specify bit devices, set them in increments of 16 points. Example) 100 ---Setting range--- Y: 0 to 5F0 M: 0 to 61424 L: 0 to 32752 SB: 0 to 7FF0 B: 0 to EFF0 SW: 0 to 7FFF D: 0 to 32767 W: 0 to 7FFF R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899		
#80008+20(n-1)	N001 out dev size	Scanner function Implicit Message: PLC device size (OUT (O->T))
Specify the size (bytes) of Implicit Message output data that is transferred to PLC device. (n=1 to 64) Example) 1 ---Setting range--- 0 to 505 (bytes) * Up to 5000 bytes in total for all nodes		
#80009+20(n-1)	N001 sts dev name	Scanner function Implicit Message: connection status assign PLC device name
Specify the name of PLC device to which connection status of the device assigned to node is transferred. (n=1 to 64) Example) M ---Setting range--- M, L, SB, B, SW, D, R, W		
#80010+20(n-1)	N001 sts dev No.	Scanner function Implicit Message: connection status assign PLC device No.
Specify the top No. of PLC device to which connection status of the device assigned to node is transferred. (n=1 to 64) 6 bytes of data starting from the specified device No. are occupied. Example) 1024 ---Setting range--- M: 0 to 61424 L: 0 to 32752 SB: 0 to 7FF0 B: 0 to EFF0 SW: 0 to 7FFF D: 0 to 32767 W: 0 to 7FFF R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899		

15 Machine Parameters

15.32 EtherNet/IP Parameters

#80011+20(n-1)	N001 High in size	High-speed refresh area size (IN (T->O))
		<p>This parameter specifies the high-speed refresh input area size for the node. (n = 1 to 64)</p> <p>When the setting is greater than that of PLC device size (IN (T->O)) of the same node, an alarm will be issued.</p> <p>When the total size of the high-speed refresh input areas for all the nodes and all the areas is greater than 8 (bytes), an alarm will be issued.</p> <p>---Setting range---</p> <p>0 to 8</p> <p>(*) Up to 8 (bytes) in total for all nodes</p>
#80012+20(n-1)	N001 High out size	High-speed refresh area size (OUT (O->T))
		<p>This parameter specifies the high-speed refresh output area size for the node. (n = 1 to 64)</p> <p>When the setting is greater than that of PLC device size (OUT (O->T)) of the same node, an alarm will be issued.</p> <p>When the total size of the high-speed refresh output areas for all the nodes and all the areas is greater than 8 (bytes), an alarm will be issued.</p> <p>---Setting range---</p> <p>0 to 8</p> <p>(*) Up to 8 (bytes) in total for all nodes</p>
#81565	PLC Stop Output	Setting of output at PLC STOP
		<p>Select which data is sent to the hardware connected when the NC enters the PLC STOP mode, the set PLC device value or the cleared data (the data cleared to "0").</p> <p>0: Send the PLC device value</p> <p>1: Send the data cleared to "0"</p>

15 Machine Parameters

15.32 EtherNet/IP Parameters

15.32.2 EtherNet/IP Parameters Scanner 2

(Note) Numeric portion of "CH01" included in each parameter name varies depending on the parameter No.

#81280+10(c-1)	CH01 Project No.	Scanner function Explicit Message: PLC project No.
Specify the PLC project No. that is assigned to node. (c=1 to 16) This number is set as the project No. of PLC device to which the node input/output/control structure is assigned. ---Setting range--- 1 to 6		
#81281+10(c-1)	CH01 ctrl dev name	Scanner function Explicit Message: control structure assign PLC device name
Specify the name of PLC device to which "Explicit Message control structure" is assigned. (c=1 to 16) Example) M ---Setting range--- M, L, SB, B, SW, D, R, W		
#81282+10(c-1)	CH01 ctrl dev No.	Scanner function Explicit Message: ctrl structure assign PLC device top No.
Specify the top No. of PLC device to which "Explicit Message control structure" is assigned. (c=1 to 16) If you specify bit devices, set them in increments of 16 points. Example) 2048 ---Setting range--- M: 0 to 61424 L: 0 to 32752 SB: 0 to 7FF0 B: 0 to EFF0 SW: 0 to 7FFF D: 0 to 32767 W: 0 to 7FFF R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899		

15.32.3 EtherNet/IP Parameters Adapter 1

(Note) Numeric portion of "A1" included in each parameter name varies depending on the parameter No.

#81440+20(a-1)	Imp A1 Proj No.	Adapter function Implicit Message: PLC project No.
	Specify the PLC project No. that is assigned to Adapter Implicit (IN/OUT) area. (a=1 to 6) This number is set as the project No. of PLC device for input/output to/from Adapter Implicit (IN/OUT) area.	
	---Setting range--- 1 to 6	
#81441+20(a-1)	Imp A1in offset	Adapter function Implicit Message: IN area top offset
	Specify the offset (bytes) from the head of Adapter Implicit (IN) area. (a=1 to 6) The data starting from the specified offset is sent from Adapter Implicit (IN) area to PLC device. Example) 100	
	---Setting range--- 0 to 499 (bytes)	
#81442+20(a-1)	Imp A1in dev name	Adapter function Implicit Message: PLC device name (IN)
	Specify the name of PLC device to which Adapter Implicit (IN) area data is transferred. (a=1 to 6) Example) X	
	---Setting range--- X, M, L, SB, B, SW, D, R, W	
#81443+20(a-1)	Imp A1in dev No.	Adapter function Implicit Message: PLC device top No. (IN)
	Specify the top No. of PLC device to which Adapter Implicit (IN) area data is transferred. (a=1 to 6) If you specify bit devices, set them in increments of 16 points. Example) 200	
	---Setting range--- X: 0 to 5F0 M: 0 to 61424 L: 0 to 32752 SB: 0 to 7FF0 B: 0 to EFF0 SW: 0 to 7FFF D: 0 to 32767 W: 0 to 7FFF R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	
#81444+20(a-1)	Imp A1in dev size	Adapter function Implicit Message: PLC device size (IN)
	Specify the size (bytes) of Adapter Implicit (IN) area data that is transferred to PLC device. (a=1 to 6) Example) 1	
	---Setting range--- 0 to 500 (bytes) * Up to 500 bytes in total for all areas	
#81445+20(a-1)	Imp A1out offset	Adapter function Implicit Message: OUT area top offset
	Specify the offset (bytes) from the head of Adapter Implicit (OUT) area. (a=1 to 6) The PLC device data starting from the specified offset is sent to Adapter Implicit (OUT) area. Example) 100	
	---Setting range--- 0 to 499 (bytes)	

15 Machine Parameters

15.32 EtherNet/IP Parameters

#81446+20(a-1)	Imp A1out dev name	Adapter function Implicit Message: PLC device name (OUT)
	Specify the name of PLC device that is sent to Adapter Implicit (OUT) area. (a=1 to 6) Example) Y ---Setting range--- Y, M, L, SB, B, SW, D, R, W	
#81447+20(a-1)	Imp A1out dev No.	Adapter function Implicit Message: PLC device top No. (OUT)
	Specify the top No. of PLC device that is sent to Adapter Implicit (OUT) area. (a=1 to 6) If you specify bit devices, set them in increments of 16 points. Example) 200 ---Setting range--- Y: 0 to 5F0 M: 0 to 61424 L: 0 to 32752 SB: 0 to 7FF0 B: 0 to EFF0 SW: 0 to 7FFF D: 0 to 32767 W: 0 to 7FFF R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	
#81448+20(a-1)	Imp A1out dev size	Adapter function Implicit Message: PLC device size (OUT)
	Specify the size (bytes) of PLC device that is sent to Adapter Implicit (OUT) area. (a=1 to 6) Example) 1 ---Setting range--- 0 to 500 (bytes) * Up to 500 bytes in total for all areas	
#81449+20(a-1)	Imp A1High in size	High-speed refresh area size (IN)
	This parameter specifies the size of the high-speed refresh area in the I/O (IN) area. (a = 1 to 6) When the setting is greater than that of PLC device size (IN) of the same area, an alarm will be issued. When the total size of the high-speed refresh input areas for all the nodes and all the areas is greater than 8 (bytes), an alarm will be issued. ---Setting range--- 0 to 8 (*) Up to 8 (bytes) in total for all areas	
#81450+20(a-1)	Imp A1High outsize	High-speed refresh area size (OUT)
	This parameter specifies the size of the high-speed refresh area in the I/O (OUT) area. (a = 1 to 6) When the setting is greater than that of PLC device size (OUT) of the same area, an alarm will be issued. When the total size of the high-speed refresh output areas for all the nodes and all the areas is greater than 8 (bytes), an alarm will be issued. ---Setting range--- 0 to 8 (*) Up to 8 (bytes) in total for all areas	
#81560	Imp sts Proj No.	Connection status assigned PLC project No.
	Specify the No. of PLC project to which connection status is transferred. ---Setting range--- 1 to 6	

15 Machine Parameters

15.32 EtherNet/IP Parameters

#81561	Impsts dev name	Connection status assigned PLC device name
	Specify the name of PLC device to which connection status is transferred. Example) M ---Setting range--- M, L, SB, B, SW, D, R, W	
#81562	Imp sts dev No.	Connection status assigned PLC device top No.
	Specify the top No. of PLC device to which connection status is transferred. 6 bytes of data starting from the specified device No. are occupied. ---Setting range--- M: 0 to 61424 L: 0 to 32752 SB: 0 to 7FF0 B: 0 to EFF0 SW: 0 to 7FFF D: 0 to 32767 W: 0 to 7FFF R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	

15 Machine Parameters

15.32 EtherNet/IP Parameters

15.32.4 EtherNet/IP Parameters Adapter 2

(Note) Numeric portion of "A1" included in each parameter name varies depending on the parameter No.

#81570+20(a-1)	Exp A1 Proj No.	Adapter function Explicit Message: PLC project No.
Specify the PLC project No. that is assigned to Adapter Explicit (IN/OUT) area. (a=1 to 6) This number is set as the project No. of PLC device for input/output to/from Adapter Explicit (IN/OUT) area. ---Setting range--- 1 to 6		
#81571+20(a-1)	Exp A1in offset	Adapter function Explicit Message: IN area top offset
Specify the offset (bytes) from the head of Adapter Explicit (IN) area. (a=1 to 6) The data starting from the specified offset is sent from Adapter Explicit (IN) area to PLC device. Example) 100 ---Setting range--- 0 to 1388		
#81572+20(a-1)	Exp A1in dev name	Adapter function Explicit Message: PLC device name (IN)
Specify the name of PLC device to which Adapter Explicit (IN) area data is transferred. (a=1 to 6) Example) M ---Setting range--- M, L, SB, B, SW, D, R, W		
#81573+20(a-1)	Exp A1in dev No.	Adapter function Explicit Message: PLC device top No. (IN)
Specify the top No. of PLC device to which Adapter Explicit (IN) area data is transferred. (a=1 to 6) If you specify bit devices, set them in increments of 16 points. Example) 512 ---Setting range--- M: 0 to 61424 L: 0 to 32752 SB: 0 to 7FF0 B: 0 to EFFF SW: 0 to 7FFF D: 0 to 32767 W: 0 to 7FFF R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899		
#81574+20(a-1)	Exp A1in dev size	Adapter function Explicit Message: PLC device size (IN)
Specify the size (bytes) of Adapter Explicit (IN) area data that is transferred to PLC device. (a=1 to 6) Example) 1 ---Setting range--- 0 to 1389 (bytes) * Up to 1389 bytes in total for all areas		
#81575+20(a-1)	Exp A1out offset	Adapter function Explicit Message: OUT area top offset
Specify the offset (bytes) from the head of Adapter Explicit (OUT) area. (a=1 to 6) The PLC device data starting from the specified offset is sent to Adapter Explicit (OUT) area. Example) 100 ---Setting range--- 0 to 1388		

15 Machine Parameters

15.32 EtherNet/IP Parameters

#81576+20(a-1)	Exp A1out dev name	Adapter function Explicit Message: PLC device name (OUT)
	Specify the name of PLC device that is sent to Adapter Explicit (OUT) area. (a=1 to 6) Example) B ---Setting range--- M, L, SB, B, SW, D, R, W	
#81577+20(a-1)	Exp A1out dev No.	Adapter function Explicit Message: PLC device top No. (OUT)
	Specify the top No. of PLC device that is sent to Adapter Explicit (OUT) area. (a=1 to 6) Example) 200 ---Setting range--- M: 0 to 61424 L: 0 to 32752 SB: 0 to 7FF0 B: 0 to EFFF SW: 0 to 7FFF D: 0 to 32767 W: 0 to 7FFF R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	
#81578+20(a-1)	Exp A1out dev size	Adapter function Explicit Message: PLC device size (OUT)
	Specify the size (bytes) of PLC device that is sent to Adapter Explicit (OUT) area. (a=1 to 6) Example) 1 ---Setting range--- 0 to 1389 (bytes) * Up to 1389 bytes in total for all areas	

15 Machine Parameters

15.33 CC-Link IE Field Parameters

15.33 CC-Link IE Field Parameters

15.33.1 CC-Link IE Field Network 1

(Note) Numeric portion of "N01" included in each parameter name varies depending on the parameter No.

Example: #82060+10(k-1) "#1 N01 Link-d name" (k = 1 to 64)

(PR)	#82000	#1 Slot No.	Selection of parameter application slot
			<p>Select the slot of the CC-Link IE field network expansion unit to which you apply the CCIEF common parameters #82000 to #82695.</p> <p>(Note) If you select the same slot as of "#82700 #2 Slot No.", the parameters #82000 to #82695 are applied to the slot with higher priority.</p> <p>---Setting range---</p> <p>0: No setting (Disable)</p> <p>1: EXT3</p> <p>2: EXT4</p> <p>(*) For M80V/M800VS</p> <p>1: EXT1</p> <p>2: EXT2</p>
(PR)	#82001	#1 Network Type	Network type
			<p>Specify the station type of the CC-Link IE field network expansion unit.</p> <p>0: Master station</p> <p>1: Local station</p>
(PR)	#82002	#1 Network No.	Network No.
			<p>Specify the network No. of the CC-Link IE field network expansion unit.</p> <p>---Setting range---</p> <p>0 to 239</p> <p>0: No setting</p>
	#82003	#1 Total Stations	Total number of device stations
			<p>Specify the number of stations other than master stations.</p> <p>If the NC acts as a local station, set "0" in the parameter.</p> <p>♦If you set a reserved station, include it in the count.</p> <p>♦If you set a submaster station, include it in the count.</p> <p>---Setting range---</p> <p>0 to 64</p> <p>0: No setting</p>
(PR)	#82004	#1 Station No.	Station No. (local station)
			<p>Specify the station No. of the CC-Link IE field network expansion unit.</p> <p>For a master station, the station No. is 0, irrespective of the parameter.</p> <p>* If the NC acts as a master station, the maximum value of the station No. which can be set to the slave station is "64". If the NC acts as a master station and also the NC is connected as a local station, set "64" or less to the station No.</p> <p>---Setting range---</p> <p>0 to 120</p>
(PR)	#82005	#1 Mode	Communication mode
			<p>Specify the communication mode.</p> <p>0: Online mode</p> <p>1: Offline mode</p> <p>2: H/W test mode</p>

15 Machine Parameters

15.33 CC-Link IE Field Parameters

	#82006	#1 DLink Fault St.	Data link error station setting
			<p>Select whether to hold or clear the input data from the device station where a data link error occurred.</p> <p>0: Clear</p> <p>1: Hold</p>
	#82007	#1 PLC Stop Output	Output setting at PLC STOP
			<p>Select whether to hold or clear the cyclic data output when the PLC is put in STOP status.</p> <p>0: Output</p> <p>1: Clear</p>
	#82008	#1 Loopback Func	Loopback function setting
			<p>Select whether or not to use the loopback function.</p> <p>When ring topology is selected as the method of connecting with other stations, select "1" (Use).</p> <p>For the other connection methods, select "0" (Not use).</p> <p>If the NC acts as a local station, set "0" in the parameter.</p> <p>If the NC acts as a local station, it operates according to the loopback function setting of master station.</p> <p>0: Not use</p> <p>1: Use</p>
	#82009	#1 Assure Blk Data	Block data assurance per station
			<p>Select whether or not to assure data integrity on a station basis in link refresh of the CC-Link IE field network expansion unit.</p> <p>If the NC acts as a local station, set "0" in the parameter.</p> <p>If the NC acts as a local station, it operates according to the station-based block assurance setting of master station.</p> <p>0: Not assure</p> <p>1: Assure</p>
(PR)	#82011	#1 SubM sel para	Selection of submaster station's parameters
			<p>Set this parameter for a submaster station.</p> <p>This parameter allows you to select parameters to be applied to a device station for the number and allocation of link devices.</p> <p>Select either the parameters of master station or those of local station.</p> <p>0: Apply the parameters of master station</p> <p>1: Apply the parameters of local station</p>
	#82040	#1 SB Link-d size	Number of SB link devices
			<p>Specify the number of SB link devices for link refresh.</p> <p>Set the number in increments of 16.</p> <p>---Setting range---</p> <p>0 to 512</p>
	#82041	#1 SB Link-d DNo.	Start device No. of SB link devices
			<p>Specify the start device No. of SB link devices that perform link refresh.</p> <p>Set the number in increments of 16.</p> <p>---Setting range---</p> <p>0 to 1F0 (hexadecimal)</p>
	#82042	#1 Refr-d PNo.(SB)	Refresh device project No. for SB link device
			<p>Specify the project No. of PLC devices that perform link refresh with the SB link devices.</p> <p>---Setting range---</p> <p>0 to 6</p> <p>0: No setting</p>

15 Machine Parameters

15.33 CC-Link IE Field Parameters

#82043	#1 Refr-d name(SB)	Refresh device name for SB link device
	Specify the name of PLC devices that perform link refresh with the SB link devices.	
	---Setting range---	
	0, M, L, B, D, W, R, SB	
	0: No setting	
#82044	#1 Refr-d DNo.(SB)	Refresh device start device No. for SB link device
	Specify the start device No. of PLC devices that perform link refresh with the SB link devices.	
	If you specify bit devices, set them in increments of 16 points.	
	---Setting range---	
	M: 0 to 61424	
	L: 0 to 32752	
	B: 0 to EFF0	
	D: 0 to 32767	
	W: 0 to 7FFF	
	SB: 0 to 7FF0	
	R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	
#82050	#1 SW Link-d size	Number of SW link devices
	Specify the number of SW link devices for link refresh.	
	Set the number in increments of 4.	
	---Setting range---	
	0 to 512	
#82051	#1 SW Link-d DNo.	Start device No. of SW link devices
	Specify the start device No. of SW link devices that perform link refresh.	
	Set the number in increments of 4.	
	---Setting range---	
	0 to 1FC (hexadecimal)	
#82052	#1 Refr-d PNo.(SW)	Refresh device project No. for SW link device
	Specify the project No. of PLC devices that perform link refresh with the SW link devices.	
	---Setting range---	
	0 to 6	
	0: No setting	
#82053	#1 Refr-d name(SW)	Refresh device name for SW link device
	Specify the name of PLC devices that perform link refresh with the SW link devices.	
	---Setting range---	
	0, M, L, B, D, W, R, SW	
	0: No setting	
#82054	#1 Refr-d DNo.(SW)	Refresh device start device No. for SW link device
	Specify the start device No. of PLC devices that perform link refresh with the SW link devices.	
	If you specify bit devices, set them in increments of 16 points.	
	---Setting range---	
	M: 0 to 61424	
	L: 0 to 32752	
	B: 0 to EFF0	
	D: 0 to 32767	
	W: 0 to 7FFF	
	SW: 0 to 7FF0	
	R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	

15 Machine Parameters

15.33 CC-Link IE Field Parameters

#82060+10(k-1)	#1 N01 Link-d name	Link device name
	Specify the link device name. (k=1 to 64)	
	---Setting range---	
	0, RX, RY, RWr, RWw	
	0: No setting	
#82061+10(k-1)	#1 N01 Link-d size	Number of link devices
	Specify the number of link devices. (k=1 to 64)	
	If you designate RX/Ry, set the number in increments of 16.	
	If you designate RWr/RWw, set the number in increments of 4.	
	---Setting range---	
	RX, RY: 0 to 16384	
	RWr, RWw: 0 to 8192	
#82062+10(k-1)	#1 N01 Link-d DNo.	Link device start device No.
	Specify the start device number of the link devices. (k=1 to 64)	
	If you designate RX/Ry, set the number in increments of 16.	
	If you designate RWr/RWw, set the number in increments of 4.	
	---Setting range---	
	RX, RY: 0 to 3FF0	
	RWr, RWw: 0 to 1FFC (hexadecimal)	
#82063+10(k-1)	#1 N01 Refr-d PNo.	Refresh device project No.
	Specify the project No. of PLC devices that perform link refresh with the link devices. (k=1 to 64)	
	---Setting range---	
	0 to 6	
	0: No setting	
#82064+10(k-1)	#1 N01 Refr-d name	Refresh device name
	Specify the name of PLC devices that perform link refresh with the link devices. (k=1 to 64)	
	---Setting range---	
	RX: 0, X, M, L, B, D, W, R	
	RY: 0, Y, M, L, B, D, W, R	
	RWr, RWw: 0, M, L, B, D, W, R	
	0: No setting	
#82065+10(k-1)	#1 N01 Refr-d DNo.	Refresh device start device No.
	Specify the start device No. of PLC devices that perform link refresh with the link devices. (k=1 to 64)	
	If you specify bit devices, set them in increments of 16 points.	
	---Setting range---	
	X: 0 to 5F0	
	Y: 0 to 5F0	
	M: 0 to 61424	
	L: 0 to 32752	
	B: 0 to EFF0	
	D: 0 to 32767	
	W: 0 to 7FFF	
	R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	

15 Machine Parameters

15.33 CC-Link IE Field Parameters

15.33.2 CC-Link IE Field Network 2

(Note) Numeric portion of "N01" included in each parameter name varies depending on the parameter No.

Example: #82760+10(k-1) "#2 N01 Link-d name" (k = 1 to 64)

(PR)	#82700	#2 Slot No.	Selection of parameter application slot
			Select the slot of the CC-Link IE field network expansion unit to which you apply the CCIEF common parameters #82700 to #83395. (Note) If you select the same slot as of "#82000 #1 Slot No.", the parameters #82000 to #82695 are applied to the slot with higher priority. ---Setting range--- 0: No setting (Disable) 1: EXT3 2: EXT4 (*) For M80V/M800VS 1: EXT1 2: EXT2
(PR)	#82701	#2 Network Type	Network type
			Specify the station type of the CC-Link IE field network expansion unit. ---Setting range--- 0: Master station 1: Local station
(PR)	#82702	#2 Network No.	Network No.
			Specify the network No. of the CC-Link IE field network expansion unit. ---Setting range--- 0 to 239 0: No setting
	#82703	#2 Total Stations	Total number of device stations
			Specify the number of stations other than master stations. If the NC acts as a local station, set "0" in the parameter. •If you set a reserved station, include it in the count. •If you set a submaster station, include it in the count. ---Setting range--- 0 to 64 0: No setting
(PR)	#82704	#2 Station No.	Station No. (local station)
			Specify the station No. of the CC-Link IE field network expansion unit. For a master station, the station No. is 0, irrespective of the parameter. * If the NC acts as a master station, the maximum value of the station No. which can be set to the slave station is "64". If the NC acts as a master station and also the NC is connected as a local station, set "64" or less to the station No. ---Setting range--- 0 to 120
(PR)	#82705	#2 Mode	Communication mode
			Specify the communication mode. 0: Online mode 1: Offline mode 2: H/W test mode

15 Machine Parameters

15.33 CC-Link IE Field Parameters

#82706	#2 DLink Fault St.	Data link error station setting
		Select whether to hold or clear the input data from the device station where a data link error occurred. 0: Clear 1: Hold
#82707	#2 PLC Stop Output	Output setting at PLC STOP
		Select whether to hold or clear the cyclic data output when the PLC is put in STOP status. 0: Clear 1: Hold
#82708	#2 Loopback Func	Loopback function setting
		Select whether or not to use the loopback function. When ring topology is selected as the method of connecting with other stations, select "1" (Use). For the other connection methods, select "0" (Not use). If the NC acts as a local station, set "0" in the parameter. If the NC acts as a local station, it operates according to the loopback function setting of master station. 0: Not use 1: Use
#82709	#2 Assure Blk Data	Block data assurance per station
		Select whether or not to assure data integrity on a station basis in link refresh of the CC-Link IE field network expansion unit. If the NC acts as a local station, set "0" in the parameter. If the NC acts as a local station, it operates according to the station-based block assurance setting of master station. 0: Not assure 1: Assure
(PR) #82711	#2 SubM sel para	Selection of submaster station's parameters
		Set this parameter for a submaster station. This parameter allows you to select parameters to be applied to a device station for the number and allocation of link devices. Select either the parameters of master station or those of local station. 0: Apply the parameters of master station 1: Apply the parameters of local station
#82740	#2 SB Link-d size	Number of SB link devices
		Specify the number of SB link devices for link refresh. Set the number in increments of 16. ---Setting range--- 0 to 512
#82741	#2 SB Link-d DNo.	Start device No. of SB link devices
		Specify the start device No. of SB link devices that perform link refresh. Set the number in increments of 16. ---Setting range--- 0 to 1F0 (hexadecimal)
#82742	#2 Refr-d PNo.(SB)	Refresh device project No. for SB link device
		Specify the project No. of PLC devices that perform link refresh with the SB link devices. ---Setting range--- 0 to 6 0: No setting

15 Machine Parameters

15.33 CC-Link IE Field Parameters

#82743	#2 Refr-d name(SB)	Refresh device name for SB link device
	Specify the name of PLC devices that perform link refresh with the SB link devices.	
	---Setting range---	
	0, M, L, B, D, W, R, SB	
	0: No setting	
#82744	#2 Refr-d DNo.(SB)	Refresh device start device No. for SB link device
	Specify the start device No. of PLC devices that perform link refresh with the SB link devices.	
	If you specify bit devices, set them in increments of 16 points.	
	---Setting range---	
	M: 0 to 61424	
	L: 0 to 32752	
	B: 0 to EFF0	
	D: 0 to 32767	
	W: 0 to 7FFF	
	SB: 0 to 7FF0	
	R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	
#82750	#2 SW Link-d size	Number of SW link devices
	Specify the number of SW link devices for link refresh.	
	Set the number in increments of 4.	
	---Setting range---	
	0 to 512	
#82751	#2 SW Link-d DNo.	Start device No. of SW link devices
	Specify the start device No. of SW link devices that perform link refresh.	
	Set the number in increments of 4.	
	---Setting range---	
	0 to 1FC (hexadecimal)	
#82752	#2 Refr-d PNo.(SW)	Refresh device project No. for SW link device
	Specify the project No. of PLC devices that perform link refresh with the SW link devices.	
	---Setting range---	
	0 to 6	
	0: No setting	
#82753	#2 Refr-d name(SW)	Refresh device name for SW link device
	Specify the name of PLC devices that perform link refresh with the SW link devices.	
	---Setting range---	
	0, M, L, B, D, W, R, SW	
	0: No setting	
#82754	#2 Refr-d DNo.(SW)	Refresh device start device No. for SW link device
	Specify the start device No. of PLC devices that perform link refresh with the SW link devices.	
	If you specify bit devices, set them in increments of 16 points.	
	---Setting range---	
	M: 0 to 61424	
	L: 0 to 32752	
	B: 0 to EFF0	
	D: 0 to 32767	
	W: 0 to 7FFF	
	SW: 0 to 7FF0	
	R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	

15 Machine Parameters

15.33 CC-Link IE Field Parameters

#82760+10(k-1)	#2 N01 Link-d name	Link device name
	Specify the link device name. (k=1 to 64)	
	---Setting range---	
	0, RX, RY, RWr, RWw	
	0: No setting	
#82761+10(k-1)	#2 N01 Link-d size	Number of link devices
	Specify the number of link devices. (k=1 to 64)	
	If you designate RX/RY, set the number in increments of 16.	
	If you designate RWr/RWw, set the number in increments of 4.	
	---Setting range---	
	RX, RY: 0 to 16384	
	RWr, RWw: 0 to 8192	
#82762+10(k-1)	#2 N01 Link-d DNo.	Link device start device No.
	Specify the start device number of the link devices. (k=1 to 64)	
	If you designate RX/RY, set the number in increments of 16.	
	If you designate RWr/RWw, set the number in increments of 4.	
	---Setting range---	
	RX, RY: 0 to 3FF0	
	RWr, RWw: 0 to 1FFC (hexadecimal)	
#82763+10(k-1)	#2 N01 Refr-d PNo.	Refresh device project No.
	Specify the project No. of PLC devices that perform link refresh with the link devices. (k=1 to 64)	
	---Setting range---	
	0 to 6	
	0: No setting	
#82764+10(k-1)	#2 N01 Refr-d name	Refresh device name
	Specify the name of PLC devices that perform link refresh with the link devices. (k=1 to 64)	
	---Setting range---	
	RX: 0, X, M, L, B, D, W, R	
	RY: 0, Y, M, L, B, D, W, R	
	RWr, RWw: 0, M, L, B, D, W, R	
	0: No setting	
#82765+10(k-1)	#2 N01 Refr-d DNo.	Refresh device start device No.
	Specify the start device No. of PLC devices that perform link refresh with the link devices. (k=1 to 64)	
	If you specify bit devices, set them in increments of 16 points.	
	---Setting range---	
	X: 0 to 5F0	
	Y: 0 to 5F0	
	M: 0 to 61424	
	L: 0 to 32752	
	B: 0 to EFF0	
	D: 0 to 32767	
	W: 0 to 7FFF	
	R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	

15 Machine Parameters

15.33 CC-Link IE Field Parameters

15.33.3 CC-Link IE Field Master Parameters

(Note) Numeric portion of "CN01" included in each parameter name varies depending on the parameter No.

Example: #83400+10(n-1) "CN01 Station No." (n = 1 to 64)

#83400+10(n-1)	CN01 Station No.	Station No. (device station)
	Specify the station No. of device or submaster station connected to the network. (n = 1 to 64) There is no need to number the stations sequentially. (duplication is not acceptable)	
	---Setting range---	
	0 to 64	
	0: No setting	
#83401+10(n-1)	CN01 Station Type	Station type (device station)
	Specify the station type for device stations. (n=1 to 64) Set the same station type as that of the units that are actually connected to the network.	
	---Setting range---	
	0: No setting	
	1: Remote I/O station	
	2: Remote device station	
	3: Intelligent device station	
	4: Local station	
	5: Submaster station	
#83402+10(n-1)	CN01 RX/Ry size	Number of RX/Ry link devices
	Specify the number of RX/Ry link devices that perform link refresh with device stations. (n=1 to 64) Set the number in increments of 16.	
	---Setting range---	
	Local, intelligent device or submaster station: 0 to 2048	
	Remote device station: 0 to 128	
	Remote I/O station: 0 to 64	
#83403+10(n-1)	CN01 RX/Ry DNo.	Start device No. of RX/Ry link devices
	Specify the start device No. of RX/Ry link devices that perform link refresh with device stations. (n=1 to 64) Set the number in increments of 16.	
	---Setting range---	
	0 to 3FF0 (hexadecimal)	
#83404+10(n-1)	CN01 RWr/RWw size	Number of RWr/RWw link devices
	Specify the number of RWr/RWw link devices that perform link refresh with device stations. (n=1 to 64) Set the number in increments of 4.	
	---Setting range---	
	Local, intelligent device or submaster station: 0 to 1024	
	Remote device station: 0 to 64	
	Remote I/O station: Setting is disabled (fixed to 0)	
#83405+10(n-1)	CN01 RWr/RWw DNo.	Start device No. of RWr/RWw link devices
	Specify the start device No. of RWr/RWw link devices that perform link refresh with device stations. (n=1 to 64) Set the number in increments of 4.	
	---Setting range---	
	0 to 1FFC (hexadecimal)	

15 Machine Parameters

15.33 CC-Link IE Field Parameters

#83406+10(n-1)	CN01 Set rsvd sts	Reserved/Error invalid station setting
Designate the station as reserved station or error invalid station. (n=1 to 64)		
---Setting range---		
0: No setting		
1: Reserved station		
2: Error invalid station		

15 Machine Parameters

15.33 CC-Link IE Field Parameters

15.33.4 CC-Link IE Field Network Basic

(Note) Numeric portion of "N01" included in each parameter name varies depending on the parameter No.

Example: #85020+20(n-1) "N01 Occupied St." (n = 1 to 4)

(PR)	#85000	Enable CCIEF Basic	Enable the CC-Link IE Field Network Basic communication.
		Select whether to enable the CC-Link IE Field Network Basic communication. 0: Disabled 1: Enabled	
(PR)	#85001	Station Type	CC-Link IE Field Network Basic communication: Station type
		Select whether the local station acts as a master or a remote. When operating it as a master station, set the parameters #85010 to #85092. When operating it as a remote, set the parameters #85180 to #85189. 0: Master station 1: Remote station	
(PR)	#85002	Err Switch	Select the behavior when an error occurs in the CC-Link IE Field Network Basic communication.
		Select whether to execute emergency stop or indicate a warning when an error occurs in the CC-Link IE Field Network Basic communication. 0: Emergency stop 1: Warning indication	
	#85003	DLink Fault St.	CC-Link IE Field Network Basic communication: Data link error station
		Select whether to clear the input data (RX for master, RY for remote) or retain the last value when a data link error occurs. 0: Clear 1: Hold	
	#85004	PLC Stop Output	CC-Link IE Field Network Basic communication: Output at PLC STOP
		Select whether to retain or clear the output data (RY for master, RX for remote) when the PLC is put in STOP status. 0: Output 1: Clear	
	#85010	Total Remotes	CC-Link IE Field Network Basic comm. (master): Number of connected devices
		Specify the number of remote devices that are connected to the CC-Link IE Field Network Basic communication (master). ---Setting range--- 0 to 4 (0: No setting)	
	#85012	Timeout Value	Timeout for the CC-Link IE Field Network Basic communication (master)
		Specify the length of timeout for cyclic communication in milliseconds. ---Setting range--- 0 or 20 to 65535 (0: 100ms)	
	#85013	Timeout Count	CC-Link IE Field Network Basic communication (master): Timeout count
		Specify the number of timeouts for cyclic communication. If the number of consecutive timeouts exceeds the setting, the remote is disconnected. ---Setting range--- 0, 3, 5, 10 (0: 3 times)	

15 Machine Parameters

15.33 CC-Link IE Field Parameters

#85020+20(n-1)	N01 Occupied St.	Number of occupied stations
	<p>Specify the number of stations occupied by the remote device. (n = 1 to 4)</p> <p>Up to 4 stations can be occupied by one remote device.</p> <p>Example: When the 1st device occupies four stations, stations occupied by the 2nd device start from the 5th station.</p> <p>1st device occupying four stations (1st to 4th stations)</p> <p>2nd device occupying one station (5th station)</p> <p>---Setting range---</p> <p>0 to 4 (0: No setting)</p>	
#85022+20(n-1)	N01 Set rsvd St.	Reserved station setting
	<p>Select whether to set the remote device as reserved station. (n = 1 to 4)</p> <p>When set as reserved station, communication with the remote device is not performed.</p> <p>This enables you to reserve the stations that are to be used in the future.</p> <p>Example: When the 1st device occupies four reserved stations, stations occupied by the 2nd device start from the 5th station. Communication is not performed for the 1st to 4th stations.</p> <p>1st device (reserved station) occupying four stations (1st to 4th stations) (Communication is not performed)</p> <p>2nd device occupying one station (5th station)</p> <p>---Setting range---</p> <p>0: No setting</p> <p>1: Reserved station</p>	
#85023+20(n-1)	N01 IP Address	IP address
	<p>Specify the IP address of the remote device. (n = 1 to 4)</p> <p>Set the remote's IP address in the same network as the parameter "#1926 Global IP address". It is not possible to communication with a device on a different network.</p> <p>---Setting range---</p> <p>0.0.0.0,0.0.0.1 to 223.255.255.254 (0.0.0.0: No setting)</p>	
#85024+20(n-1)	N01 Refr-d PNo.	Refresh device project No.
	<p>Specify the project No. of PLC devices for which link refresh is performed with the link devices of the remote device. (n = 1 to 4)</p> <p>---Setting range---</p> <p>0 to 6 (0: No setting)</p>	
#85025+20(n-1)	N01 Refr-d to RX	Refresh device name (RX)
	<p>Specify the name of PLC devices for which link refresh is performed with the link devices "RX" of the remote device. (n = 1 to 4)</p> <p>Link refresh-enabled devices</p> <p>X, M, L, B, D, W and R</p> <p>---Setting range---</p> <p>0, X, M, L, B, D, W or R (0: No setting)</p>	
#85026+20(n-1)	N01 Refr-No to RX	Starting refresh device No. (RX)
	<p>Specify the starting device No. of PLC devices for which link refresh is performed with the link devices "RX" of the remote device. (n = 1 to 4)</p> <p>If you specify bit devices, set them in increments of 16 points.</p> <p>---Setting range---</p> <p>X: 0 to 5F0</p> <p>M: 0 to 61424</p> <p>L: 0 to 32752</p> <p>B: 0 to EFF0</p> <p>D: 0 to 32767</p> <p>W: 0 to 7FFF</p> <p>R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899</p>	

15 Machine Parameters

15.33 CC-Link IE Field Parameters

#85027+20(n-1)	N01 Refr-d to RY	Refresh device name (RY)
	Specify the name of PLC devices for which link refresh is performed with the link devices "RY" of the remote device. (n = 1 to 4)	
	Link refresh-enabled devices	
	Y, M, L, B, D, W and R	
	---Setting range---	
	0, Y, M, L, B, D, W or R (0: No setting)	
#85028+20(n-1)	N01 Refr-No to RY	Starting refresh device No. (RY)
	Specify the starting device No. of PLC devices for which link refresh is performed with the link devices "RY" of the remote device. (n = 1 to 4)	
	If you specify bit devices, set them in increments of 16 points.	
	---Setting range---	
	Y: 0 to 5F0	
	M: 0 to 61424	
	L: 0 to 32752	
	B: 0 to EFF0	
	D: 0 to 32767	
	W: 0 to 7FFF	
	R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	
#85029+20(n-1)	N01 Refr-d to RWr	Refresh device name (RWr)
	Specify the name of PLC devices for which link refresh is performed with the link devices "RWr" of the remote device. (n = 1 to 4)	
	Link refresh-enabled devices	
	M, L, B, D, W and R	
	---Setting range---	
	0, M, L, B, D, W or R (0: No setting)	
#85030+20(n-1)	N01 Refr-No to RWr	Starting refresh device No. (RWr)
	Specify the starting device No. of PLC devices for which link refresh is performed with the link devices "RWr" of the remote device. (n = 1 to 4)	
	If you specify bit devices, set them in increments of 16 points.	
	---Setting range---	
	M: 0 to 61424	
	L: 0 to 32752	
	B: 0 to EFF0	
	D: 0 to 32767	
	W: 0 to 7FFF	
	R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	
#85031+20(n-1)	N01 Refr-d to RWw	Refresh device name (RWw)
	Specify the name of PLC devices for which link refresh is performed with the link devices "RWw" of the remote device. (n = 1 to 4)	
	Link refresh-enabled devices	
	M, L, B, D, W and R	
	---Setting range---	
	0, M, L, B, D, W or R (0: No setting)	

15 Machine Parameters

15.33 CC-Link IE Field Parameters

#85032+20(n-1)	N01 Refr-No to RWw	Starting refresh device No. (RWw)
	Specify the starting device No. of PLC devices for which link refresh is performed with the link devices "RWw" of the remote device. (n = 1 to 4) If you specify bit devices, set them in increments of 16 points. ---Setting range--- M: 0 to 61424 L: 0 to 32752 B: 0 to EFF0 D: 0 to 32767 W: 0 to 7FFF R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	
#85180	R Occupied St.	CC-Link IE Field Network Basic comm. (remote): Number of occupied stations
	Specify the number of stations occupied for the CC-Link IE Field Network Basic communication (remote). Up to 4 stations can be occupied. ---Setting range--- 0 to 4 (0: No setting)	
#85181	R Refr-d PNo.	Remote function: Refresh device project No.
	Specify the project No. of PLC devices for which link refresh is performed with the link devices of CC-Link IE Field Network Basic communication (remote). ---Setting range--- 0 to 6 (0: No setting)	
#85182	R Refr-d to RX	Remote function: Refresh device name (RX)
	Specify the name of PLC devices for which link refresh is performed with the link devices "RX" of CC-Link IE Field Network Basic communication (remote). Link refresh-enabled devices Y, M, L, B, D, W and R ---Setting range--- 0, Y, M, L, B, D, W or R (0: No setting)	
#85183	R Refr-No to RX	Remote function: Starting refresh device No. (RX)
	Specify the starting device No. of PLC devices for which link refresh is performed with the link devices "RX" of CC-Link IE Field Network Basic communication (remote). If you specify bit devices, set them in increments of 16 points. ---Setting range--- Y: 0 to 5F0 M: 0 to 61424 L: 0 to 32752 B: 0 to EFF0 D: 0 to 32767 W: 0 to 7FFF R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	
#85184	R Refr-d to RY	Remote function: Refresh device name (RY)
	Specify the name of PLC devices for which link refresh is performed with the link devices "RY" of CC-Link IE Field Network Basic communication (remote). Link refresh-enabled devices X, M, L, B, D, W and R ---Setting range--- 0, X, M, L, B, D, W or R (0: No setting)	

15 Machine Parameters

15.33 CC-Link IE Field Parameters

#85185	R Refr-No to RY	Remote function: Starting refresh device No. (RY)
	Specify the starting device No. of PLC devices for which link refresh is performed with the link devices "RY" of CC-Link IE Field Network Basic communication (remote). If you specify bit devices, set them in increments of 16 points.	
	---Setting range---	
	X: 0 to 5F0	
	M: 0 to 61424	
	L: 0 to 32752	
	B: 0 to EFF0	
	D: 0 to 32767	
	W: 0 to 7FFF	
	R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	
#85186	R Refr-d to RWr	Remote function: Refresh device name (RWr)
	Specify the name of PLC devices for which link refresh is performed with the link devices "RWr" of CC-Link IE Field Network Basic communication (remote). Link refresh-enabled devices M, L, B, D, W and R	
	---Setting range---	
	0, M, L, B, D, W or R (0: No setting)	
#85187	R Refr-No to RWr	Remote function: Starting refresh device No. (RWr)
	Specify the starting device No. of PLC devices for which link refresh is performed with the link devices "RWr" of CC-Link IE Field Network Basic communication (remote). If you specify bit devices, set them in increments of 16 points.	
	---Setting range---	
	M: 0 to 61424	
	L: 0 to 32752	
	B: 0 to EFF0	
	D: 0 to 32767	
	W: 0 to 7FFF	
	R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	
#85188	R Refr-d to RWw	Remote function: Refresh device name (RWw)
	Specify the name of PLC devices for which link refresh is performed with the link devices "RWw" of CC-Link IE Field Network Basic communication (remote). Link refresh-enabled devices M, L, B, D, W and R	
	---Setting range---	
	0, M, L, B, D, W or R (0: No setting)	
#85189	R Refr-No to RWw	Remote function: Starting refresh device No. (RWw)
	Specify the starting device No. of PLC devices for which link refresh is performed with the link devices "RWw" of CC-Link IE Field Network Basic communication (remote). If you specify bit devices, set them in increments of 16 points.	
	---Setting range---	
	M: 0 to 61424	
	L: 0 to 32752	
	B: 0 to EFF0	
	D: 0 to 32767	
	W: 0 to 7FFF	
	R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	

15 Machine Parameters

15.34 CC-Link IE TSN (Remote station) Parameters

15.34 CC-Link IE TSN (Remote station) Parameters

#88300	DLink Fault	Data link setting at error
	Select whether to hold or clear the cyclic data input of the CC-Link IE TSN remote module received from the master station when the data link of the CC-Link IE TSN remote module becomes abnormal. 0: Clear 1: Hold	
#88301	PLC Stop Output	Output setting at PLC STOP
	Select whether to hold or clear the cyclic data output sent from CC-Link IE TSN remote module when the PLC is put in STOP state. 0: Hold 1: Clear	
(PR) #88302	Link speed	Link speed
	Specify the link speed of the CC-Link IE TSN Remote module. For CC-Link IE TSN remote module, the link speed is not fixed. The link is established after the autonegotiation. 0: 1 Gbps Full Duplex 1: 100 Mbps Full Duplex	
#88310	SB Link-d size	Number of SB link devices
	Specify the number of SB link devices for link refresh. Specify this parameter with the number in increments of 16 points. This parameter is only valid for CC-Link IE TSN remote modules. ---Setting range--- 0 to 512	
#88311	SB Link-d DNo.	Start device No. of SB link device
	Specify the start device No. of SB link devices that perform link refresh. Enter this parameter in hexadecimal with the number in increments of 16 points. This parameter is only valid for CC-Link IE TSN remote modules. ---Setting range--- 0 to 1F0 (HEX)	
#88312	Refr-d PNo.(SB)	Refresh device project No. of SB link device
	Specify the project No. of PLC devices that perform link refresh with the SB link devices. Enter a value that fits within the [Maximum Project No.] of the multi-project parameter. Enter "1" when the multi-project is disabled. Set "0" when SB link devices do not perform link refresh. This parameter is only valid for CC-Link IE TSN remote modules. ---Setting range--- 0 to 6 0: No setting	
#88313	Refr-d name(SB)	Refresh device name of SB link device
	Specify the name of PLC devices that perform link refresh with the SB link devices. Set "0" when SB link devices do not perform link refresh. This parameter is only valid for CC-Link IE TSN remote modules. ---Setting range--- 0, M, L, B, D, W, R, SB 0: No setting	

15 Machine Parameters

15.34 CC-Link IE TSN (Remote station) Parameters

#88314	Refr-d DNo.(SB)	Refresh device start device No. of SB link device
	<p>Specify the start device No. of PLC devices that perform link refresh with the SB link devices.</p> <p>If you specify bit devices, set this parameter in increments of 16 points.</p> <p>This parameter is only valid for CC-Link IE TSN remote modules.</p> <p>---Setting range---</p> <p>M: 0 to 61424</p> <p>L: 0 to 32752</p> <p>B: 0 to EFF0</p> <p>D: 0 to 32767</p> <p>W: 0 to 7FFF</p> <p>SB: 0 to 7FF0</p> <p>R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899</p>	
#88320	SW Link-d size	Number of SW link devices
	<p>Specify the number of SW link devices for link refresh.</p> <p>Specify this parameter with the number in increments of 4 points.</p> <p>This parameter is only valid for CC-Link IE TSN remote modules.</p> <p>---Setting range---</p> <p>0 to 512</p>	
#88321	SW Link-d DNo.	Start device No. of SW link device
	<p>Specify the start device No. of SW link devices that perform link refresh.</p> <p>Enter this parameter in hexadecimal with the number in increments of 4 points.</p> <p>This parameter is only valid for CC-Link IE TSN remote modules.</p> <p>---Setting range---</p> <p>0 to 1FC (HEX)</p>	
#88322	Refr-d PNo.(SW)	Refresh device project No. of SW link device
	<p>Specify the project No. of PLC devices that perform link refresh with the SW link devices.</p> <p>Enter a value that fits within the [Maximum Project No.] of the multi-project parameter.</p> <p>Enter "1" when the multi-project is disabled.</p> <p>Set "0" when SW link devices do not perform link refresh.</p> <p>This parameter is only valid for CC-Link IE TSN remote modules.</p> <p>---Setting range---</p> <p>0 to 6</p> <p>0: No setting</p>	
#88323	Refr-d name(SW)	Refresh device name of SW link device
	<p>Specify the name of PLC devices that perform link refresh with the SW link devices.</p> <p>Set "0" when SW link devices do not perform link refresh.</p> <p>This parameter is only valid for CC-Link IE TSN remote modules.</p> <p>---Setting range---</p> <p>0, M, L, B, D, W, R, SW</p> <p>0: No setting</p>	

15 Machine Parameters

15.34 CC-Link IE TSN (Remote station) Parameters

#88324	Refr-d DNo.(SW)	Refresh device start device No. of SW link device
	<p>Specify the start device No. of PLC devices that perform link refresh with the SW link devices.</p> <p>If you specify bit devices, set this parameter in increments of 16 points.</p> <p>This parameter is only valid for CC-Link IE TSN remote modules.</p> <p>---Setting range---</p> <p>M: 0 to 61424</p> <p>L: 0 to 32752</p> <p>B: 0 to EFF0</p> <p>D: 0 to 32767</p> <p>W: 0 to 7FFF</p> <p>SW: 0 to 7FFF</p> <p>R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899</p>	
#88330	RX Link-d size	Number of RX link devices
	<p>Specify the number of RX link devices for link refresh.</p> <p>Specify this parameter with the number in increments of 16 points.</p> <p>This parameter is only valid for CC-Link IE TSN remote modules.</p> <p>---Setting range---</p> <p>0 to 2048</p>	
#88331	Refr-d PNo.(RX)	Refresh device project No. of RX link device
	<p>Specify the project No. of PLC devices that perform link refresh with the RX link devices.</p> <p>Enter a value that fits within the [Maximum Project No.] of the multi-project parameter.</p> <p>Enter "1" when the multi-project is disabled.</p> <p>Set "0" when RX link devices do not perform link refresh.</p> <p>This parameter is only valid for CC-Link IE TSN remote modules.</p> <p>---Setting range---</p> <p>0 to 6</p> <p>0: No setting</p>	
#88332	Refr-d name(RX)	Refresh device name of RX link device
	<p>Specify the name of PLC devices that perform link refresh with the RX link devices.</p> <p>Set "0" when RX link devices do not perform link refresh.</p> <p>This parameter is only valid for CC-Link IE TSN remote modules.</p> <p>---Setting range---</p> <p>0, Y, M, L, B, D, W, R</p> <p>0: No setting</p>	
#88333	Refr-d DNo.(RX)	Refresh device start device No. of RX link device
	<p>Specify the start device No. of PLC devices that perform link refresh with the RX link devices.</p> <p>If you specify bit devices, set this parameter in increments of 16 points.</p> <p>This parameter is only valid for CC-Link IE TSN remote modules.</p> <p>---Setting range---</p> <p>Y: 0 to 5F0</p> <p>M: 0 to 61424</p> <p>L: 0 to 32752</p> <p>B: 0 to EFF0</p> <p>D: 0 to 32767</p> <p>W: 0 to 7FFF</p> <p>R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899</p>	

15 Machine Parameters

15.34 CC-Link IE TSN (Remote station) Parameters

#88340	RY Link-d size	Number of RY link devices
	Specify the number of RY link devices for link refresh. Specify this parameter with the number in increments of 16 points. This parameter is only valid for CC-Link IE TSN remote modules. ---Setting range--- 0 to 2048	
#88341	Refr-d PNo.(RY)	Refresh device project No. of RY link device
	Specify the project No. of PLC devices that perform link refresh with the RY link devices. Enter a value that fits within the [Maximum Project No.] of the multi-project parameter. Enter "1" when the multi-project is disabled. Set "0" when RY link devices do not perform link refresh. This parameter is only valid for CC-Link IE TSN remote modules. ---Setting range--- 0 to 6 0: No setting	
#88342	Refr-d name(RY)	Refresh device name of RY link device
	Specify the name of PLC devices that perform link refresh with the RY link devices. Set "0" when RY link devices do not perform link refresh. This parameter is only valid for CC-Link IE TSN remote modules. ---Setting range--- 0, X, M, L, B, D, W, R 0: No setting	
#88343	Refr-d DNo.(RY)	Refresh device start device No. of RY link device
	Specify the start device No. of PLC devices that perform link refresh with the RY link devices. If you specify bit devices, set this parameter in increments of 16 points. This parameter is only valid for CC-Link IE TSN remote modules. ---Setting range--- X: 0 to 5F0 M: 0 to 61424 L: 0 to 32752 B: 0 to EFF0 D: 0 to 32767 W: 0 to 7FFF R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	
#88350	RWr Link-d size	Number of RWr link devices
	Specify the number of RWr link devices for link refresh. Specify this parameter with the number in increments of 4 points. This parameter is only valid for CC-Link IE TSN remote modules. ---Setting range--- 0 to 512	
#88351	Refr-d PNo.(RWr)	Refresh device project No. of RWr link device
	Specify the project No. of PLC devices that perform link refresh with the RWr link devices. Enter a value that fits within the [Maximum Project No.] of the multi-project parameter. Enter "1" when the multi-project is disabled. Set "0" when RWr link devices do not perform link refresh. This parameter is only valid for CC-Link IE TSN remote modules. ---Setting range--- 0 to 6 0: No setting	

15 Machine Parameters

15.34 CC-Link IE TSN (Remote station) Parameters

#88352	Refr-d name(RWr)	Refresh device name of RWr link device
	Specify the name of PLC devices that perform link refresh with the RWr link devices. Set "0" when RWr link devices do not perform link refresh. This parameter is only valid for CC-Link IE TSN remote modules. ---Setting range--- 0, M, L, B, D, W, R 0: No setting	
#88353	Refr-d DNo.(RWr)	Refresh device start device No. of RWr link device
	Specify the start device No. of PLC devices that perform link refresh with the RWr link devices. If you specify bit devices, set this parameter in increments of 16 points. This parameter is only valid for CC-Link IE TSN remote modules. ---Setting range--- M: 0 to 61424 L: 0 to 32752 B: 0 to EFFF D: 0 to 32767 W: 0 to 7FFF R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	
#88360	RWw Link-d size	Number of link devices of RWw link device
	Specify the number of RWw link devices for link refresh. Specify this parameter with the number in increments of 4 points. This parameter is only valid for CC-Link IE TSN remote modules. ---Setting range--- 0 to 512	
#88361	Refr-d PNo.(RWw)	Refresh device project No. of RWw link device
	Specify the project No. of PLC devices that perform link refresh with the RWw link devices. Enter a value that fits within the [Maximum Project No.] of the multi-project parameter. Enter "1" when the multi-project is disabled. Set "0" when RWw link devices do not perform link refresh. This parameter is only valid for CC-Link IE TSN remote modules. ---Setting range--- 0 to 6 0: No setting	
#88362	Refr-d name(RWw)	Refresh device name of RWw link device
	Specify the name of PLC devices that perform link refresh with the RWw link devices. Set "0" when RWw link devices do not perform link refresh. This parameter is only valid for CC-Link IE TSN remote modules. ---Setting range--- 0, M, L, B, D, W, R 0: No setting	

15 Machine Parameters

15.34 CC-Link IE TSN (Remote station) Parameters

#88363	Refr-d DNo.(RWw)	Refresh device start device No. of RWw link device
	Specify the start device No. of PLC devices that perform link refresh with the RWw link devices. If you specify bit devices, set this parameter in increments of 16 points. This parameter is only valid for CC-Link IE TSN remote modules.	
	---Setting range---	
	M: 0 to 61424	
	L: 0 to 32752	
	B: 0 to EFF0	
	D: 0 to 32767	
	W: 0 to 7FFF	
	R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	

15.35 PROFIBUS-DP Parameters

(PR)	#57000+4(n-1)	#n I/O reg	PROFIBUS I/O area
			<p>Select whether to allocate the devices to PX or PY of PROFIBUS-DP. (n=1 to 64)</p> <p>(Note) If 0 is set, the PROFIBUS allocation parameters of the n-th set are all disabled.</p> <p>0: Disable</p> <p>1: PX</p> <p>2: PY</p>
(PR)	#57001+4(n-1)	#n sect No.	PROFIBUS section number
			<p>Select the section of PROFIBUS-DP I/O data (PX/PY) to which the devices are allocated. (n=1 to 64)</p> <p>---Setting range---</p> <p>0 to 31</p>
(PR)	#57002+4(n-1)	#n dev name	PROFIBUS device name
			<p>Select the device that is allocated to the section of PROFIBUS-DP I/O data(PX/PY). (n=1 to 64)</p> <p>(Note) The setting range varies according to the value of "#n I/O reg".</p> <p>---Setting range---</p> <p>X, Y, M, L, B, D, R or W</p> <p>When "#n I/O reg" is "1", "Y" is out of the setting range.</p> <p>When "#n I/O reg" is "2", "X" is out of the setting range.</p>
(PR)	#57003+4(n-1)	#n dev No.	PROFIBUS device number
			<p>Select the 32 bytes of devices to which PROFIBUS-DP I/O data is allocated. Specify the starting device number. (n=1 to 64)</p> <p>* If the set value is out of the following ranges, an alarm occurs at the start of NC.</p> <p>Hexadecimal setting:</p> <p>X: 0 to 1C0, 300 to 500</p> <p>Y: 0 to 1C0, 300 to 500</p> <p>B: 0 to DF00</p> <p>W: 0 to 2FF0</p> <p>Decimal setting:</p> <p>M: 0 to 61184</p> <p>L: 0 to 768</p> <p>D: 0 to 4080</p> <p>R: 8300 to 9884, 18300 to 19884, 28300 to 29884</p> <p>(Note) Due to the multi-project function, if the number of the first project points is smaller than the default value, the range becomes narrower corresponding to the number of the first project points.</p> <p>---Setting range---</p> <p>The setting range varies according to the value of "#n dev name".</p> <p>X, Y, B, W: 0 to FFFF</p> <p>M, L, D, R: 0 to 65535</p>
#57300	PLC Stop Output	Setting of output at PLC STOP	
		<p>When the PLC of the NC unit is in the STOP state or error state, select the value to send to the slave device, either the value of the PLC device allocated by NC parameters or the value cleared to "0".</p> <p>0: Send the PLC device value</p> <p>1: Send the data cleared to "0"</p>	

15.36 FL-net Parameters

#88000	Node name	Node name
	Specify the node name for the NC to be used in FL-net communication. This parameter is used for response of message transmission. The communication is possible even when the node name is unspecified.	
	---Setting range--- Up to 10 characters in length, containing alphanumeric characters and symbols 0: No setting	
#88001	Token Wdog Time	Token watchdog time
	Specify the length of token watchdog time. Set the value in increments of 1 ms.	
	This parameter has the following 2 uses.	
	(1) Monitoring local node When a token cannot be issued within the token watchdog time set by this parameter and a time-out occurs, "token watchdog time error flag" in "local node management information" is turned to "1" (ON). When the time-out is counted for 3 consecutive times, the node is released from the network and the system alarm (Z103) occurs. When a time-out occurs, set the larger value than current value to this parameter.	
	(2) Monitoring other node Check the release of the other nodes based on token watchdog time for each node, and the token is to be re-issued.	
	Calculate the token watchdog time with the following formula. [Calculation method] Token watchdog time = (Total number of cyclic frames for local nodes + 2) × 2.0 ms + (Total number of cyclic frames for local nodes + 2) × the allowable minimum frame interval time	
	(*) The maximum data size for 1 packet is 1024 bytes.	
	---Setting range--- 1 to 255 (ms)	
#88002	Min. Frame Time	Minimum permissible frame interval
	Specify the allowable minimum frame interval time. The minimum frame interval time is ensured the time from the end of a frame to the subsequent frame to be sent.	
	This parameter has the following 2 uses.	
	(1) Time until any frame is sending from local node after the local node address token was received (2) Transmission interval for cyclic frames or message frames	
	Note that this does not apply between the token frame and the preceding cyclic frame. The largest value of the allowable minimum frame interval time within the network is used for all devices. When any restriction is needed for the configuration of devices or communication path, set "1" or larger value to this parameter. Set "0" when no restriction is needed.	
	---Setting range--- 0: No setting 1 to 9: 1 (ms) 10 to 19: 2 (ms) 20 to 29: 3 (ms) 30 to 39: 4 (ms) 40 to 49: 5 (ms) 50: 6 (ms)	

15 Machine Parameters

15.36 FL-net Parameters

#88003	PLC Stop Output	Setting of output at PLC STOP
	Select which data is sent to the hardware connected when the NC enters the PLC STOP mode, the set PLC device value or the cleared data (the data cleared to "0"). 0: Send the PLC device value 1: Send the data cleared to "0"	
#88010	CyC1 My Addr	Start address in local node area of common memory area 1
	Specify the start address (word) in the local node area of the common memory area 1. The sum of the start address and its size cannot exceed 200 (HEX). ---Setting range--- 0 to 1FF (word) (hexadecimal)	
#88011	CyC1 My Size	Size of local node area in common memory area 1
	Specify the size (word) of the local node area of the common memory area 1. When "0" is set, the data will not be transmitted. The sum of the start address and its size cannot exceed 200 (HEX). ---Setting range--- 0 to 512 (words)	
#88012	CyC1 My Proj. No.	PLC project number for local node area in common memory area 1
	Specify the project number of PLC device to be assigned to the local node area of the common memory area 1. ---Setting range--- 1 to 6 0: No setting	
#88013	CyC1 My dev name	PLC device name for local node area in common memory area 1
	Specify the PLC device name to be assigned to the local node area of the common memory area 1. (Example) Y When the setting of this parameter is changed, the value of "#88014 CyC1 My dev No." is cleared to "0". ---Setting range--- Y, M, L, SB, B, SW, D, R, W 0: No setting	
#88014	CyC1 My dev No.	Start number of PLC device for local node area in common memory area 1
	Specify the start number of PLC device to be assigned to the local node area of the common memory area 1. If you specify bit devices, set them with numbers divisible by 16 (in increments of 16 points). (Example) 100 ---Setting range--- Y: 0 to 5F0 M: 0 to 61424 L: 0 to 32752 SB: 0 to 7FF0 B: 0 to EFF0 SW: 0 to 7FFF D: 0 to 32767 W: 0 to 7FFF R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	

15 Machine Parameters

15.36 FL-net Parameters

#88020	CyC1 A1 Addr	Start address in other node area 1 of common memory area 1
Specify the start address (word) in the other node area 1 of the common memory area 1. The sum of the start address and its size cannot exceed 200 (HEX). ---Setting range--- 0 to 1FF (word) (hexadecimal)		
#88021	CyC1 A1 Size	Size of other node area 1 in common memory area 1
Specify the size (word) of the other node area 1 of the common memory area 1. When "0" is set, the data will not be transmitted. The sum of the start address and its size cannot exceed 200 (HEX). ---Setting range--- 0 to 512 (words)		
#88022	CyC1 A1 Proj. No.	PLC project number for other node area 1 in common memory area 1
Specify the project number of PLC device to be assigned to the other node area 1 of the common memory area 1. ---Setting range--- 1 to 6 0: No setting		
#88023	CyC1 A1 dev name	PLC device name for other node area 1 in common memory area 1
Specify the PLC device name to be assigned to the other node area 1 of the common memory area 1. (Example) X When the setting of this parameter is changed, the value of "#88024 CyC1 A1 dev No." is cleared to "0". ---Setting range--- X, M, L, SB, B, SW, D, R, W 0: No setting		
#88024	CyC1 A1 dev No.	Start number of PLC device for other node area 1 in common memory area 1
Specify the start number of PLC device to be assigned to the other node area 1 of the common memory area 1. If you specify bit devices, set them with numbers divisible by 16 (in increments of 16 points). (Example) 100 ---Setting range--- X: 0 to 5F0 M: 0 to 61424 L: 0 to 32752 SB: 0 to 7FF0 B: 0 to EFF0 SW: 0 to 7FFF D: 0 to 32767 W: 0 to 7FFF R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899		
#88030	CyC1 A2 Addr	Start address in other node area 2 of common memory area 1
Specify the start address (word) in the other node area 2 of the common memory area 1. The sum of the start address and its size cannot exceed 200 (HEX). ---Setting range--- 0 to 1FF (word) (hexadecimal)		

15 Machine Parameters

15.36 FL-net Parameters

#88031	CyC1 A2 Size	Size of other node area 2 in common memory area 1
	Specify the size (word) of the other node area 2 of the common memory area 1. When "0" is set, the data will not be transmitted. The sum of the start address and its size cannot exceed 200 (HEX). ---Setting range--- 0 to 512 (words)	
#88032	CyC1 A2 Proj. No.	PLC project number for other node area 2 in common memory area 1
	Specify the project number of PLC device to be assigned to the other node area 2 of the common memory area 1. ---Setting range--- 1 to 6 0: No setting	
#88033	CyC1 A2 dev name	PLC device name for other node area 2 in common memory area 1
	Specify the PLC device name to be assigned to the other node area 2 of the common memory area 1. (Example) X When the setting of this parameter is changed, the value of "#88034 CyC1 A2 dev No." is cleared to "0". ---Setting range--- X, M, L, SB, B, SW, D, R, W 0: No setting	
#88034	CyC1 A2 dev No.	Start number of PLC device for other node area 2 in common memory area 1
	Specify the start number of PLC device to be assigned to the other node area 2 of the common memory area 1. If you specify bit devices, set them with numbers divisible by 16 (in increments of 16 points). (Example) 100 ---Setting range--- X: 0 to 5F0 M: 0 to 61424 L: 0 to 32752 SB: 0 to 7FF0 B: 0 to EFF0 SW: 0 to 7FFF D: 0 to 32767 W: 0 to 7FFF R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	
#88040	CyC2 My Addr	Start address in local node area of common memory area 2
	Specify the start address (word) in the local node area of the common memory area 2. The sum of the start address and its size cannot exceed 2000 (HEX). ---Setting range--- 0 to 1FFF (word) (hexadecimal)	
#88041	CyC2 My Size	Size of local node area in common memory area 2
	Specify the size (word) of the local node area of the common memory area 2. When "0" is set, the data will not be transmitted. The sum of the start address and its size cannot exceed 2000 (HEX). ---Setting range--- 0 to 8192 (words)	

15 Machine Parameters

15.36 FL-net Parameters

#88042	CyC2 My Proj. No.	PLC project number for local node area in common memory area 2
Specify the project number of PLC device to be assigned to the local node area of the common memory area 2.		
---Setting range---		
1 to 6		
0: No setting		
#88043	CyC2 My dev name	PLC device name for local node area in common memory area 2
Specify the PLC device name to be assigned to the local node area of the common memory area 2.		
(Example) Y		
When the setting of this parameter is changed, the value of "#88044 CyC2 My dev No." is cleared to "0".		
---Setting range---		
Y, M, L, SB, B, SW, D, R, W		
0: No setting		
#88044	CyC2 My dev No.	Start number of PLC device for local node area in common memory area 2
Specify the start number of PLC device to be assigned to the local node area of the common memory area 2.		
If you specify bit devices, set them with numbers divisible by 16 (in increments of 16 points).		
(Example) 100		
---Setting range---		
Y: 0 to 5F0		
M: 0 to 61424		
L: 0 to 32752		
SB: 0 to 7FF0		
B: 0 to EFF0		
SW: 0 to 7FFF		
D: 0 to 32767		
W: 0 to 7FFF		
R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899		
#88050	CyC2 A1 Addr	Start address in other node area 1 of common memory area 2
Specify the start address (word) in the other node area 1 of the common memory area 2.		
The sum of the start address and its size cannot exceed 2000 (HEX).		
---Setting range---		
0 to 1FFF (word) (hexadecimal)		
#88051	CyC2 A1 Size	Size of other node area 1 in common memory area 2
Specify the size (word) of the other node area 1 of the common memory area 2.		
When "0" is set, the data will not be transmitted.		
The sum of the start address and its size cannot exceed 2000 (HEX).		
---Setting range---		
0 to 8192 (words)		
#88052	CyC2 A1 Proj. No.	PLC project number for other node area 1 in common memory area 2
Specify the project number of PLC device to be assigned to the other node area 1 of the common memory area 2.		
---Setting range---		
1 to 6		
0: No setting		

15 Machine Parameters

15.36 FL-net Parameters

#88053	CyC2 A1 dev name	PLC device name for other node area 1 in common memory area 2
	<p>Specify the PLC device name to be assigned to the other node area 1 of the common memory area 2. (Example) X</p> <p>When the setting of this parameter is changed, the value of "#88054 CyC2 A1 dev No." is cleared to "0".</p> <p>---Setting range---</p> <p>X, M, L, SB, B, SW, D, R, W</p> <p>0: No setting</p>	
#88054	CyC2 A1 dev No.	Start number of PLC device for other node area 1 in common memory area 2
	<p>Specify the start number of PLC device to be assigned to the other node area 1 of the common memory area 2.</p> <p>If you specify bit devices, set them with numbers divisible by 16 (in increments of 16 points). (Example) 100</p> <p>---Setting range---</p> <p>X: 0 to 5F0 M: 0 to 61424 L: 0 to 32752 SB: 0 to 7FF0 B: 0 to EFF0 SW: 0 to 7FFF D: 0 to 32767 W: 0 to 7FFF R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899</p>	
#88060	CyC2 A2 Addr	Start address in other node area 2 of common memory area 2
	<p>Specify the start address (word) in the other node area 2 of the common memory area 2.</p> <p>The sum of the start address and its size cannot exceed 2000 (HEX).</p> <p>---Setting range---</p> <p>0 to 1FFF (word) (hexadecimal)</p>	
#88061	CyC2 A2 Size	Size of other node area 2 in common memory area 2
	<p>Specify the size (word) of the other node area 2 of the common memory area 2.</p> <p>When "0" is set, the data will not be transmitted.</p> <p>The sum of the start address and its size cannot exceed 2000 (HEX).</p> <p>---Setting range---</p> <p>0 to 8192 (words)</p>	
#88062	CyC2 A2 Proj. No.	PLC project number for other node area 2 in common memory area 2
	<p>Specify the project number of PLC device to be assigned to the other node area 2 of the common memory area 2.</p> <p>---Setting range---</p> <p>1 to 6</p> <p>0: No setting</p>	
#88063	CyC2 A2 dev name	PLC device name for other node area 2 in common memory area 2
	<p>Specify the PLC device name to be assigned to the other node area 2 of the common memory area 2. (Example) X</p> <p>When the setting of this parameter is changed, the value of "#88064 CyC2 A2 dev No." is cleared to "0".</p> <p>---Setting range---</p> <p>X, M, L, SB, B, SW, D, R, W</p> <p>0: No setting</p>	

15 Machine Parameters

15.36 FL-net Parameters

#88064	CyC2 A2 dev No.	Start number of PLC device for other node area 2 in common memory area 2
	Specify the start number of PLC device to be assigned to the other node area 2 of the common memory area 2. If you specify bit devices, set them with numbers divisible by 16 (in increments of 16 points). (Example) 100 ---Setting range--- X: 0 to 5F0 M: 0 to 61424 L: 0 to 32752 SB: 0 to 7FF0 B: 0 to EFF0 SW: 0 to 7FFF D: 0 to 32767 W: 0 to 7FFF R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	
#88070	My sts Proj. No.	PLC project number for Local node management information
	Specify the project number of the PLC device that stores the local node management information. ---Setting range--- 1 to 6 0: No setting	
#88071	My sts dev name	PLC device name for Local node management information
	Specify the name of the PLC device that stores the Local node management information. (Example) M When the setting of this parameter is changed, the value of "#88072 My sts dev No." is cleared to "0". ---Setting range--- M, L, SB, B, SW, D, R, W 0: No setting	
#88072	My sts dev No.	PLC device number for Local node management information
	Specify the number of the PLC device that stores the Local node management information. If you specify bit devices, set them with numbers divisible by 16 (in increments of 16 points). The eight bytes of area starting from the specified device are occupied. (Example) 1024 ---Setting range--- M: 0 to 61424 L: 0 to 32752 SB: 0 to 7FF0 B: 0 to EFF0 SW: 0 to 7FFF D: 0 to 32767 W: 0 to 7FFF R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	
#88080	N List Proj. No.	PLC project number for List of participating nodes
	Specify the project number of the PLC device that stores the list of participating nodes. ---Setting range--- 1 to 6 0: No setting	

15 Machine Parameters

15.36 FL-net Parameters

#88081	N List dev name	PLC device name for List of participating nodes
	Specify the name of the PLC device that stores the List of participating nodes. (Example) M When the setting of this parameter is changed, the value of "#88082 N List dev No." is cleared to "0".	
	---Setting range--- M, L, SB, B, SW, D, R, W 0: No setting	
#88082	N List dev No.	PLC device number for List of participating nodes
	Specify the number of the PLC device that stores the List of participating nodes. If you specify bit devices, set them with numbers divisible by 16 (in increments of 16 points). The 32 bytes of area starting from the specified device are occupied. (Example) 1024	
	---Setting range--- M: 0 to 61424 L: 0 to 32752 SB: 0 to 7FF0 B: 0 to EFFF SW: 0 to 7FFF D: 0 to 32767 W: 0 to 7FFF R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	
#88090	Warnig Proj. No.	PLC project number for WARNING information
	Specify the project number of the PLC device that stores the WARNING information.	
	---Setting range--- 1 to 6 0: No setting	
#88091	Warnig dev name	PLC device name for WARNING information
	Specify the name of the PLC device that stores the WARNING information. (Example) M When the setting of this parameter is changed, the value of "#88092 Warning dev No." is cleared to "0".	
	---Setting range--- M, L, SB, B, SW, D, R, W 0: No setting	
#88092	Warnig dev No.	PLC device number for WARNING information
	Specify the number of the PLC device that stores the WARNING information. If you specify bit devices, set them with numbers divisible by 16 (in increments of 16 points). The 32 bytes of area starting from the specified device are occupied. (Example) 1024	
	---Setting range--- M: 0 to 61424 L: 0 to 32752 SB: 0 to 7FF0 B: 0 to EFFF SW: 0 to 7FFF D: 0 to 32767 W: 0 to 7FFF R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	

15 Machine Parameters

15.36 FL-net Parameters

#88100	Alarm Proj. No.	PLC project number for ALARM information
	Specify the project number of the PLC device that stores the ALARM information.	
	---Setting range---	
	1 to 6	
	0: No setting	
#88101	Alarm dev name	PLC device name for ALARM information
	Specify the name of the PLC device that stores the ALARM information.	
	(Example) M	
	When the setting of this parameter is changed, the value of "#88102 Alarm dev No." is cleared to "0".	
	---Setting range---	
	M, L, SB, B, SW, D, R, W	
	0: No setting	
#88102	Alarm dev No.	PLC device number for ALARM information
	Specify the number of the PLC device that stores the ALARM information.	
	If you specify bit devices, set them with numbers divisible by 16 (in increments of 16 points).	
	The 32 bytes of area starting from the specified device are occupied.	
	(Example) 1024	
	---Setting range---	
	M: 0 to 61424	
	L: 0 to 32752	
	SB: 0 to 7FF0	
	B: 0 to EFFF	
	SW: 0 to 7FFF	
	D: 0 to 32767	
	W: 0 to 7FFF	
	R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899	
#88110	Run Stop Proj. No.	PLC project number for RUN/STOP information
	Specify the project number of the PLC device that stores the RUN/STOP information.	
	---Setting range---	
	1 to 6	
	0: No setting	
#88111	Run Stop dev name	PLC device name for RUN/STOP information
	Specify the name of the PLC device that stores the RUN/STOP information.	
	(Example) M	
	When the setting of this parameter is changed, the value of "#88112 Run Stop dev No." is cleared to "0".	
	---Setting range---	
	M, L, SB, B, SW, D, R, W	
	0: No setting	

15 Machine Parameters

15.36 FL-net Parameters

#88112	Run Stop dev No.	PLC device number for RUN/STOP information
	<p>Specify the number of the PLC device that stores the RUN/STOP information.</p> <p>If you specify bit devices, set them with numbers divisible by 16 (in increments of 16 points).</p> <p>The 32 bytes of area starting from the specified device are occupied.</p> <p>(Example) 1024</p> <p>---Setting range---</p> <p>M: 0 to 61424</p> <p>L: 0 to 32752</p> <p>SB: 0 to 7FF0</p> <p>B: 0 to EFF0</p> <p>SW: 0 to 7FFF</p> <p>D: 0 to 32767</p> <p>W: 0 to 7FFF</p> <p>R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899</p>	
#88120	CM Comp. Proj. No.	PLC project number for info. of Completion of common memory setting
	<p>Specify the project number of the PLC device that stores the information of completion of common memory setting.</p> <p>---Setting range---</p> <p>1 to 6</p> <p>0: No setting</p>	
#88121	CM Comp. dev name	PLC device name for information of Completion of common memory setting
	<p>Specify the name of the PLC device that stores the information of Completion of common memory setting.</p> <p>(Example) M</p> <p>When the setting of this parameter is changed, the value of "#88122 CM Comp. dev No." is cleared to "0".</p> <p>---Setting range---</p> <p>M, L, SB, B, SW, D, R, W</p> <p>0: No setting</p>	
#88122	CM Comp. dev No.	PLC device number for information of Completion of common memory setting
	<p>Specify the number of the PLC device that stores the information of completion of common memory setting.</p> <p>If you specify bit devices, set them with numbers divisible by 16 (in increments of 16 points).</p> <p>The eight bytes of area starting from the specified device are occupied.</p> <p>(Example) 1024</p> <p>---Setting range---</p> <p>M: 0 to 61424</p> <p>L: 0 to 32752</p> <p>SB: 0 to 7FF0</p> <p>B: 0 to EFF0</p> <p>SW: 0 to 7FFF</p> <p>D: 0 to 32767</p> <p>W: 0 to 7FFF</p> <p>R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899</p>	
#88130	CM Valid Proj. No.	PLC project number for information of Common memory data valid
	<p>Specify the project number of the PLC device that stores the information of common memory data valid.</p> <p>---Setting range---</p> <p>1 to 6</p> <p>0: No setting</p>	

15 Machine Parameters

15.36 FL-net Parameters

#88131	CM Valid dev name	PLC device name for information of Common memory data valid
	<p>Specify the name of the PLC device that stores the information of Common memory data valid. (Example) M</p> <p>When the setting of this parameter is changed, the value of "#88132 CM Valid dev No." is cleared to "0".</p> <p>---Setting range---</p> <p>M, L, SB, B, SW, D, R, W</p> <p>0: No setting</p>	
#88132	CM Valid dev No.	PLC device number for information of Common memory data valid
	<p>Specify the number of the PLC device that stores the information of common memory data valid. If you specify bit devices, set them with numbers divisible by 16 (in increments of 16 points). The 32 bytes of area starting from the specified device are occupied. (Example) 1024</p> <p>---Setting range---</p> <p>M: 0 to 61424 L: 0 to 32752 SB: 0 to 7FF0 B: 0 to EFFF SW: 0 to 7FFF D: 0 to 32767 W: 0 to 7FFF R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899</p>	
#88140	Net sts Proj. No.	PLC project number for Network management information
	<p>Specify the project number of the PLC device that stores the network management information.</p> <p>---Setting range---</p> <p>1 to 6</p> <p>0: No setting</p>	
#88141	Net sts dev name	PLC device name for Network management information
	<p>Specify the name of the PLC device that stores the Network management information. (Example) M</p> <p>When the setting of this parameter is changed, the value of "#88142 Net sts dev No." is cleared to "0".</p> <p>---Setting range---</p> <p>M, L, SB, B, SW, D, R, W</p> <p>0: No setting</p>	
#88142	Net sts dev No.	PLC device number for Network management information
	<p>Specify the number of the PLC device that stores the Network management information. If you specify bit devices, set them with numbers divisible by 16 (in increments of 16 points). The four bytes of area starting from the specified device are occupied. (Example) 1024</p> <p>---Setting range---</p> <p>M: 0 to 61424 L: 0 to 32752 SB: 0 to 7FF0 B: 0 to EFFF SW: 0 to 7FFF D: 0 to 32767 W: 0 to 7FFF R: 8300 to 9799, 9800 to 9899, 18300 to 19799, 19800 to 19899, 28300 to 29799, 29800 to 29899</p>	

15.37 Laser Parameters

(PR)	#90001	lsr_unit_type	Laser oscillator type
		Specify the type of laser oscillator to be connected. 0: No laser I/F unit connected 1: Type1 2: Type2	
(PR)	#90002	lsr_unit_write	Laser I/F unit firmware write
		Specify "1" when writing the firmware for the laser oscillator specified using #90001 to the laser I/F unit. The firmware is written to the laser I/F unit at NC power on, and #90002 is set to "0" when writing has completed. ---Setting range--- 0/1	
(PR)	#90003	lsr_dio_dev1	Laser digital I/O 1
		Specify the number of the R register to be used in digital input 1 to the laser oscillator. The output from the laser oscillator is stored in that R register number + 1. When not using this parameter, set to "0". If a number not within the user area is specified, a setting error is output. User area: 8300 to 9898, 18300 to 19898, 28300 to 29898 ---Setting range--- 0, 8300 to 9898, 18300 to 19898, 28300 to 29898	
(PR)	#90004	lsr_dio_dev2	Laser digital I/O 2
		Specify the number of the R register to be used in digital input 2 to the laser oscillator. The output from the laser oscillator is stored in that R register number + 1. When not using this parameter, set to "0". If a number not within the user area is specified, a setting error is output. User area: 8300 to 9898, 18300 to 19898, 28300 to 29898 ---Setting range--- 0, 8300 to 9898, 18300 to 19898, 28300 to 29898	
	#90005	lsr_max_stop_t	Maximum stop time with beam ON
		Specify the time period during which the axis can be stopped while laser beam is ON without raising safety problems. If set to zero, 20 (s) applies. ---Setting range--- 0 to 20 (s)	
(PR)	#90006	lsrRated_output	Rated power
		Set the rated power of the laser oscillator. When "0" is set, laser is not output. ---Setting range--- 0 to 50000 (W)	
(PR)	#90007	lsrRated_AbsV	Rated voltage
		Set the rated voltage of the laser oscillator. When "0" is set, laser is not output. ---Setting range--- 0.000 to 10.000 (V)	
	#90008	lsr_fb_gain	Gain adjustment value for laser power feedback
		Set the gain adjustment value for laser power feedback. When "0" is set, the laser power feedback value is displayed without gain adjustment. ---Setting range--- 0.00 to 200.00 (%)	

15 Machine Parameters

15.37 Laser Parameters

	#90009	lsr_fb_ofs	Offset adjustment value for laser power feedback
			Set the offset adjustment value for laser power feedback. When "0" is set, the laser power feedback value is displayed without offset. ---Setting range--- -32768 to 32767 (W)
(PR)	#90010	lsr_fb_rated_o_p	FB rated power
			Set the rated power of the laser oscillator for feedback. When "0" is set, the value of parameter "#90006 lsr_rated_output" is used. ---Setting range--- 0 to 50000 (W)
(PR)	#90011	lsr_fb_rated_AbsV	FB rated voltage
			Set the rated voltage of the laser oscillator for feedback. When "0" is set, the value of parameter "#90007 lsr_rated_AbsV" is used. ---Setting range--- 0.000 to 10.000 (V)
	#90021	lsr_PWR_limit	Maximum laser power
			Specify the maximum power to the laser oscillator. ---Setting range--- 0 to 50000 (W)
	#90022	lsr_FRQ_limit	Maximum frequency
			Specify the maximum frequency to the laser oscillator. ---Setting range--- 0 to 9999 (Hz)
	#90023	lsr_M_beam_on	Beam ON M code
			Specify the M code number used to turn on laser beam. When set to zero, no M code can be used to turn on laser beam. ---Setting range--- 0, 200 to 99999999
	#90024	lsr_M_beam_off	Beam OFF M code
			Specify the M code number used to turn off laser beam. When set to zero, no M code can be used to turn off laser beam. ---Setting range--- 0, 200 to 99999999
	#90025	lsr_f_laser_syn	Time constant for laser command synchronization
			Specify the time constant used as a time lag between the time that a command for changing the processing condition is issued and the time that the change takes effect. Adjust this parameter when axis movement and change in beam status do not coincide. ---Setting range--- 0 to 100 (ms)
	#90026	lsr_tr1	Time constant for laser command rising
			Specify the time constant for changing the processing condition when the processing condition (laser output, frequency, duty) is set to a value greater than the current one. ---Setting range--- 0 to 100 (ms)
	#90027	lsr_tr2	Time constant for laser command falling
			Specify the time constant for changing the processing condition when the processing condition (laser output, frequency, duty) is set to a value smaller than the current one. ---Setting range--- 0 to 100 (ms)

15 Machine Parameters

15.37 Laser Parameters

(PR)	#90041	lsr_cond_M	M code for laser processing condition selection
			<p>Specify the M code number used to select preset laser processing conditions.</p> <p>A processing condition is selected according to the specified number as follows when this M code is executed.</p> <p>Set value + 0: Processing condition 1</p> <p>Set value + 1: Processing condition 2</p> <p>Set value + 2: Processing condition 3</p> <p>Set value + 3: Processing condition 4</p> <p>:</p> <p>Set value + 29: Processing condition 30</p> <p>When set to zero, no M code can be used to select processing conditions.</p> <p>---Setting range---</p> <p>0, 200 to 99999000</p>
(PR)	#90042	lsr_cond_M_num	Number of M codes for laser processing condition selection
			<p>Specify the number of M codes used to select laser processing conditions.</p> <p>When set to zero, 30 applies.</p> <p>---Setting range---</p> <p>0 to 30</p>
(PR)	#90043	lsr_cond_out_Rreg	R register number for laser processing condition output
			<p>Specify the R register number to which to output beam focus, nozzle height, gas pressure, and gas type in the laser processing condition.</p> <p>The processing condition values are output as follows according to the specified number.</p> <p>Set value + 0: Beam focus (L)</p> <p>Set value + 1: Beam focus (H)</p> <p>Set value + 2: Nozzle height (L)</p> <p>Set value + 3: Nozzle height (H)</p> <p>Set value + 4: Gas pressure (L)</p> <p>Set value + 5: Gas pressure (H)</p> <p>Set value + 6: Gas type</p> <p>When not using this parameter, set to "0".</p> <p>Be sure to specify an even number.</p> <p>If one of the following is specified, this parameter cannot be set.</p> <ul style="list-style-type: none"> •Odd number •A device that conflicts with parameter "#90003 lsr_dio_dev1" (Laser digital I/O 1) or "#90004 lsr_dio_dev2" (Laser digital I/O 2) •A number not within the user area <p>---Setting range---</p> <p>0, 8300 to 9892, 18300 to 19892, 28300 to 29892</p>
	#90061	lsr_DR_varid	DR control ON
			<p>Specify whether to enable the DR control function.</p> <p>0: Disable</p> <p>1: Enable</p>
	#90062	lsr_PWR_DR_start	Laser power to start DR control
			<p>Specify the laser power at which DR control is started.</p> <p>---Setting range---</p> <p>0 to 50000 (W)</p>
	#90063	lsr_FRQ_DR_start	Frequency to start DR control
			<p>Specify the frequency at which DR control is started.</p> <p>---Setting range---</p> <p>0 to 9999 (Hz)</p>

15 Machine Parameters

15.37 Laser Parameters

#90064	lsr_DUTY_DR_start	Duty to start DR control
Specify the duty at which DR control is started.		
---Setting range---		
0.0 to 100.0 (%)		
#90065	lsr_PWR_DR_lowlmt	Minimum laser power in DR control
Specify the minimum laser power during DR control.		
---Setting range---		
0 to 50000 (W)		
#90066	lsr_FRQ_DR_lowlmt	Minimum frequency in DR control
Specify the minimum frequency during DR control.		
---Setting range---		
0 to 9999 (Hz)		
#90067	lsr_DUTY_DR_lowlmt	Minimum duty in DR control
Specify the minimum duty during DR control.		
---Setting range---		
0.0 to 100.0 (%)		
#90068	lsr_f_laser_DR_syn	Time constant for laser command synchronization in DR control
Specify the time constant used as a time lag between the time that the specified speed is changed and the time that the processing condition changes when DR control is enabled.		
Adjust this parameter when axis movement and change in beam status do not coincide.		
---Setting range---		
0 to 100 (ms)		
#90069	lsr_DR_tr1	Time constant for laser command rising in DR control
Specify the time constant for changing the processing condition when the processing condition (laser output, frequency, duty) for DR control is changed to a value greater than the current one.		
---Setting range---		
0 to 100 (ms)		
#90070	lsr_DR_tr2	Time constant for laser command falling in DR control
Specify the time constant for changing the processing condition when the processing condition (laser output, frequency, duty) for DR control is changed to a value smaller than the current one.		
---Setting range---		
0 to 100 (ms)		
#90091	lsr_M_fcut_on	F-CUT ON M code
Specify the M code number used to turn on F-CUT.		
When set to zero, no M code can be used to turn on F-CUT.		
---Setting range---		
0, 200 to 99999999		
#90092	lsr_M_fcut_off	F-CUT OFF M code
Specify the M code number used to turn off F-CUT.		
When set to zero, no M code can be used to turn off F-CUT.		
---Setting range---		
0, 200 to 99999999		
#90093	lsr_fcut_on_tr1	F-CUT beam ON correction time 1
Specify the correction time for the timing to turn on laser beam while F-CUT is active.		
---Setting range---		
0 to 10000 (μs)		

15 Machine Parameters

15.37 Laser Parameters

#90094		lsr_fcut_off_tr1	F-CUT beam OFF correction time 1
Specify the correction time for the timing to turn off laser beam while F-CUT is active.			
---Setting range---			
0 to 10000 (μs)			
#90095		lsr_fcut_cmp_spd1	Speed to switch correction for beam ON/OFF in F-CUT 1
Set the cutting feed rate at which to switch the correction time for the timing to turn on/off laser beam while F-CUT is active.			
When the cutting feed rate is higher than the set value or when the set value is "0", "#90093 lsr_fcut_on_tr1" (F-CUT beam ON correction time 1) and "#90094 lsr_fcut_off_tr1" (F-CUT beam OFF correction time 1) are used as the correction time for the timing to turn on/off laser beam.			
When the cutting feed rate is equal to or lower than the set value, "#90096 lsr_fcut_on_tr2" (F-CUT beam ON correction time 2) and "#90097 lsr_fcut_off_tr2" (F-CUT beam OFF correction time 2) are used as the correction time for the timing to turn on/off laser beam.			
---Setting range---			
0 to 1000000 (mm/min)			
#90096		lsr_fcut_on_tr2	F-CUT beam ON correction time 2
Specify the correction time for the timing to turn on laser beam while F-CUT is active.			
---Setting range---			
0 to 10000 (μs)			
#90097		lsr_fcut_off_tr2	F-CUT beam OFF correction time 2
Specify the correction time for the timing to turn off laser beam while F-CUT is active.			
---Setting range---			
0 to 10000 (μs)			
#90101		lsr_high_ctrl	Height control
Specify whether to enable the height control function.			
0: Disable			
1: Enable			
When using DIO to enable and disable height control, set this parameter to "0".			
(PR)	#90102	lsr_high_ax	Height control axis
Specify the axis to which height control is applied using an axis number in the part system.			
The axis number is an NC axis number excluding spindles and PLC axes.			
When "0" is set, height control is not applied.			
---Setting range---			
0 to the number of control axes			
#90103		lsr_high_sen_ofs	Height control Sensor offset
Set the position of the sensor relative to the tip of the nozzle.			
Enter a positive value when the sensor measurement position is farther away from the workpiece than the tip of the nozzle.			
Enter a negative value when the sensor measurement position is closer to the workpiece than the tip of the nozzle.			
---Setting range---			
-99.9 to 99.9 (mm)			
(PR)	#90104	lsr_high_itf_sen	Height control_Head interference sensor signal
Set the sensor signal that inputs the detected interference by the laser head during height control.			
The sensor signal is shared with the skip signal.			
When "0" is set, the detection of interference by the laser head during height control is disabled.			
---Setting range---			
0 to 8			

15 Machine Parameters

15.37 Laser Parameters

#90105	lsr_M_HEvac_on	Height control_Fast retraction control ON M code
Set the M code number for enabling the fast retraction control for height control. If "0" is set, M code will be unavailable. ---Setting range--- 0, 200 to 99999999		
#90106	lsr_M_HEvac_off	Height control_Fast retraction control OFF M code
Set the M code number for disabling the fast retraction control for height control. If "0" is set, M code will be unavailable. ---Setting range--- 0, 200 to 99999999		
#90107	lsr_HEvac_rise_lim	Height control_Fast retraction control lift upper limit
Set the upper limit of lift to be applied during fast retraction control in height control. If "0" is set, the position where approach is started will be the upper limit of lift. ---Setting range--- 0 to 999999.999 (mm)		
#90111	lsr_op_calibrate	Power calibration
Enable laser power calibration. 0: Disable laser power calibration 1: Enable laser power calibration		
#90121+2(n-1)	lsr_calib_cmd_01-30	Laser power command value
Set the laser power command value for laser power calibration. (n = 1 to 30) <ul style="list-style-type: none"> Do not specify the same value more than once for "#90121 lsr_calib_cmd_01" through "#90179 lsr_calib_cmd_30". Do not specify "0" for the parameters that come between "#90121 lsr_calib_cmd_01" and "#90179 lsr_calib_cmd_30". Set the values of "#90121 lsr_calib_cmd_01" to "#90179 lsr_calib_cmd_30" in ascending order. Set a value smaller than or equal to "#90006 lsr Rated output" (Rated power) for "#90121 lsr_calib_cmd_01" through "#90179 lsr_calib_cmd_30". ---Setting range--- 0 to 50000 (W)		
#90122+2(n-1)	lsr_calib_meas_01-30	Laser power measured value
Set the result of laser power measurement for laser power command value. (n = 1 to 30) ---Setting range--- 0 to 50000 (W)		

15 Machine Parameters

15.38 NC Axis Switch Parameters

15.38 NC Axis Switch Parameters

#71001- 71256	SV001-SV256	NC axis switch parameters
The description and setting range for these parameters are the same as Servo parameters "#2201 SV001" to "#2456 SV256". Refer to "15.7 Servo Parameters" for details.		
#71257	Hotaxname	NC axis name change
Specify by two characters the name of the axis to be changed in NC axis switchover.		
The first character must be a letter because it is used as a command address. The second character must be a number.		
---Setting range---		
2-character string consisting of A to Z followed by 1 to 9 (When "0" is set, change is not reflected.)		

15 Machine Parameters

15.39 Spindle Switch Parameters

15.39 Spindle Switch Parameters#71501-
71740

SP001-SP240

Spindle switch parameters

The description and setting range for these parameters are the same as Spindle parameters "#13001 SP001" to "#13240 SP240". Refer to "15.9 Spindle Parameters" for details.

Revision History

Date of revision	Manual No.	Revision details
Jul. 2021	IB(NA)1501623-A	First edition created.
Mar. 2022	IB(NA)1501623-B	<p>The descriptions were revised corresponding to S/W version A3 of Mitsubishi Electric CNC M800V/M80V series.</p> <p>The following chapter was added.</p> <ul style="list-style-type: none"> - 16.36 Laser Parameters <p>The following chapters were revised.</p> <ul style="list-style-type: none"> - 1 Operation Errors (M) - 4 MCP Alarms (Y) - 5 System Alarms (Z) - 6 Absolute Position Detection System Alarms (Z7*) - 12 Program Errors (P) - 15 User Parameters - 16 Machine Parameters <p>Other mistakes were corrected.</p>
Mar. 2023	IB(NA)1501623-C	<p>The descriptions were revised corresponding to S/W version A7 of Mitsubishi Electric CNC M800V/M80V series.</p> <p>The following chapters were revised.</p> <ul style="list-style-type: none"> - 1 Operation Errors (M) - 5 System Alarms (Z) - 10 User PLC Alarms (U) - 12 Program Errors (P) - 14 User Parameters - 15 Machine Parameters <p>Other mistakes were corrected.</p>
Jul. 2023	IB(NA)1501623-D	<p>The descriptions were revised corresponding to S/W version A8 of Mitsubishi Electric CNC M800V/M80V series.</p> <p>The following chapters were added.</p> <ul style="list-style-type: none"> - 15.37 NC Axis Switch Parameters - 15.38 Spindle Switch Parameters <p>The following chapters were revised.</p> <ul style="list-style-type: none"> - 1 Operation Errors (M) - 5 System Alarms (Z) - 14 User Parameters - 15 Machine Parameters <p>Other mistakes were corrected.</p>

Date of revision	Manual No.	Revision details
Nov. 2023	IB(NA)1501623-E	<p>The descriptions were revised corresponding to S/W version A9 of Mitsubishi Electric CNC M800V/M80V series.</p> <p>The following chapter was added.</p> <ul style="list-style-type: none"> - 15.34 CC-Link IE TSN (Remote station) Parameters <p>The following chapters were revised.</p> <ul style="list-style-type: none"> - 1 Operation Errors (M) - 4 MCP Alarms (Y) - 5 System Alarms (Z) - 12 Program Errors (P) - 14 User Parameters - 15 Machine Parameters <p>Other mistakes were corrected.</p>
Apr. 2024	IB(NA)1501623-F	<p>The descriptions were revised corresponding to S/W version AA of Mitsubishi Electric CNC M800V/M80V series.</p> <p>The following chapters were revised.</p> <ul style="list-style-type: none"> - 1 Operation Errors (M) - 2 Stop Codes (T) - 4 MCP Alarms (Y) - 5 System Alarms (Z) - 9 Computer Link Errors (L) - 10 User PLC Alarms (U) - 12 Program Errors (P) - 14 User Parameters - 15 Machine Parameters <p>Other mistakes were corrected.</p>
Oct. 2024	IB(NA)1501623-G	<p>The descriptions were revised corresponding to S/W version B0 of Mitsubishi Electric CNC M800V/M80V series.</p> <p>The following chapters were revised.</p> <ul style="list-style-type: none"> - 1 Operation Errors (M) - 2 Stop Codes (T) - 4 MCP Alarms (Y) - 5 System Alarms (Z) - 12 Program Errors (P) - 14 User Parameters - 15 Machine Parameters <p>Other mistakes were corrected.</p>

Global Service Network

AMERICA

MITSUBISHI ELECTRIC AUTOMATION INC. (AMERICA FA CENTER)

HQ and Central Region Service Center (Chicago)

500 CORPORATE WOODS PARKWAY, VERNON HILLS, ILLINOIS 60061, U.S.A.
TEL: +1-847-478-2500 / FAX: +1-847-478-2650

Minneapolis, MN Service Satellite
Detroit, MI Service Satellite
Grand Rapids, MI Service Satellite
Cleveland, OH Service Satellite
St. Louis, MO Service Satellite
Indianapolis, IN Service Satellite

South/East Region Service Center (Georgia)

1845 SATELLITE BOULEVARD STE. 450, DULUTH, GEORGIA 30097, U.S.A.
TEL +1-678-258-4529 / FAX +1-678-258-4519

Charleston, SC Service Satellite
Charlotte, NC Service Satellite
Raleigh, NC Service Satellite
Dallas, TX Service Satellite
Houston, TX Service Satellite
Hartford, CT Service Satellite
Knoxville, TN Service Satellite
Nashville, TN Service Satellite
Huntsville, AL Satellite
Pittsburg, PA Service Satellite
Tampa, FL Service Satellite
Miami, FL Satellite
Lafayette, LA Service Satellite
Allentown, PA Satellite

Western Region Service Center (California)

5900-B KATELLA AVE. - 5900-A KATELLA AVE. CYPRESS, CALIFORNIA 90630, U.S.A.
TEL: +1-714-699-2625 / FAX: +1-847-478-2650

San Francisco, CA Satellite
Seattle, WA Service Satellite
Denver, CO Service Satellite

Canada Region Service Center (Toronto)

4299 14TH AVENUE MARKHAM, ONTARIO L3R 0J2, CANADA
TEL: +1-905-475-7728 / FAX: +1-905-475-7935

Edmonton, AB Service Satellite
Montreal, QC Service Satellite

Mexico Region Service Center (Queretaro)

Parque Tecnológico Innovación Querétaro, Lateral Carretera Estatal 431, Km 2+200, Lote 91 Modulos 1 y 2
Hacienda la Machorra, CP 76246, El Marqués, Querétaro, México
TEL: +52-442-153-6050

Monterrey, NL Service Satellite
Mexico City, DF Service Satellite

BRAZIL

MITSUBISHI ELECTRIC DO BRASIL COMÉRCIO E SERVIÇOS LTDA.

Votorantim Office

AV. GISELE CONSTANTINO,1578, PARQUE BELA VISTA, VOTORANTIM-SP, BRAZIL CEP:18.110-650
TEL: +55-15-3023-9000

Blumenau, Santa Catarina Office

EUROPE

MITSUBISHI ELECTRIC EUROPE B.V.

European Service Headquarters (Dusseldorf, GERMANY)

Mitsubishi-Electric-Platz 1 40882 RATINGEN, GERMANY
TEL: +49-2102-486-5000 / FAX: +49-2102-486-5910

South Germany Service Center (Stuttgart)

SCHELMENWASENSTRASSE 16-20, 70567 STUTTGART, GERMANY
TEL: + 49-711-770598-123 / FAX: +49-711-770598-141

France Service Center (Paris)

2 RUE DE L'UNION, 92565 RUEIL-MALMAISON CEDEX, FRANCE
TEL: +33-1-41-02-83-13 / FAX: +33-1-49-01-07-25

France Service Satellite (Lyon)

240, ALLEE JACQUES MONOD 69800 SAINT PRIEST FRANCE
TEL: +33-1-41-02-83-13 / FAX: +33-1-49-01-07-25

Italy Service Center (Milan)

VIA ENERGY PARK 14, VIMERCATE 20871 (MB) ITALY
TEL: +39-039-6053-342 / FAX: +39-039-6053-206

Italy Service Satellite (Padova)

VIA G. SAVELLI, 24 - 35129 PADOVA, ITALY
TEL: +39-039-6053-342 / FAX: +39-039-6053-206

U.K. Service Center

TRAVELLERS LANE, HATFIELD, HERTFORDSHIRE, AL10 8XB, U.K.
TEL: +44-1707-288-780 / FAX: +44-1707-278-695

Spain Service Center

CTRA. RUBI, 76-80 8174 SAINT CUGAT DEL VALLES, BARCELONA, SPAIN
TEL: +34-935-65-2236 / FAX: +34-935-89-1579

Poland Service Center

UL.KRAKOWSKA 50, 32-083 BALICE, POLAND
TEL: +48-12-347-6500 / FAX: +48-12-630-4701

Hungary Service Center

MITSUBISHI ELECTRIC EUROPE B.V. HUNGARIAN BRANCH
BUDAÖRS OFFICE PARK, SZABADSÁG ÚT 117., 2040 BUDAÖRS, HUNGARY
TEL: +36-70-433-2263

Turkey Service Center

MITSUBISHI ELECTRIC TURKEY ELEKTRİK ÜRÜNLERİ A.Ş

SERIFALI MAHALLESİ KALE SOKAK. NO.41 34775
UMRANIYE, ISTANBUL, TURKEY
TEL: +90-216-969-2500 / FAX: +90-216-661-44-47

Czech Republic Service Center

MITSUBISHI ELECTRIC EUROPE B.V. PRAGUE OFFICE

Pekafská 621/7, 155 00 PRAHA 5, CZECH REPUBLIC
TEL: +420-734-402-587

Sweden Service Center

HAMMARBACKEN 14, P.O.BOX 750 SE-19127, SOLLENTUNA, SWEDEN
TEL: +46-8-6251200 / FAX: +46-8-6251014

Bulgaria Service Center

AKHNATON Ltd. (Service Partner)

4 ANDREJ LJAPCHEV BLVD. POB 21, BG-1756 SOFIA, BULGARIA
TEL: +359-2-8176009 / FAX: +359-2-9744061

Ukraine Service Center (Kiev)

CSC Automation Ltd. (Service Partner)

4 B. YEVHENA SVERSTYUKA STR., 02002 KIEV, UKRAINE
TEL: +380-44-494-3344 / FAX: +380-44-494-3366

South Africa Service Center

Adroit Technologies (Service Partner)

20 WATERFORD OFFICE PARK, WATERFORD DRIVE, CNR OF WITKOPPEN ROAD,
FOURWAYS JOHANNESBURG SOUTH AFRICA
TEL: +27-11-658-8100 / FAX: +27-11-658-8101

ASEAN	CHINA
MITSUBISHI ELECTRIC ASIA PTE. LTD. (ASEAN FA CENTER) Singapore Service Center 307 ALEXANDRA ROAD MITSUBISHI ELECTRIC BUILDING SINGAPORE 159943 TEL: +65-6473-2308 / FAX: +65-6476-7439	MITSUBISHI ELECTRIC AUTOMATION (CHINA) LTD. (CHINA FA CENTER) CNC Call Center TEL: +86-400-921-5130 Shanghai Service Center NO.1386 HONG QIAO ROAD, CHANG NING QU, SHANGHAI 200336, CHINA TEL: +86-21-2322-3030 / FAX: +86-21-2322-3000*8422 Qingdao Service Center Suzhou Service Center Wuhan Service Center Ningbo Service Center Hefei Service Center Beijing Service Center Tianjin Service Center Xian Service Center Dalian Service Center Chengdu Service Center
PHILIPPINES	Shenzhen Service Center LEVEL8, GALAXY WORLD TOWER B, 1 YABAO ROAD, LONGGANG DISTRICT, SHENZHEN 518129, CHINA TEL: +86-755-2399-8272 / FAX: +86-755-8229-3686 Dongguan Service Center Xiamen Service Center
MELCO FACTORY AUTOMATION PHILIPPINES INC. Head Office 128 LOPEZ RIZAL STREET, BRGY., HIGHWAY HILLS, MANDALUYONG CITY , MM PHILIPPINES 1550 TEL: +63-2-8256-8042 / FAX: +632-8637-2294	KOREA
Philippines Service Center KM.23 WEST SERVICE ROAD SSH, CUPANG, MUNTINLUPA CITY, PHILIPPINES TEL: +63-2-8807-0420 / FAX: +63-2-8842-5202	MITSUBISHI ELECTRIC AUTOMATION KOREA CO., LTD. (KOREA FA CENTER) Korea Seoul Service Center 8F GANGSEO HANGANG XI-TOWER A, 401 YANGCHEON-RO, GANGSEO-GU, SEOUL 07528 KOREA TEL: +82-2-3660-9631 / FAX: +82-2-3664-8668 Korea Daegu Service Center 2F KT BLDG. 8, HOGUK-RO, BUK-GU, DAEGU 41518, KOREA TEL: +82-53-382-7401 / FAX: +82-53-382-7412 Korea Changwon Technical Center #205, 888, CHANGWON-DAERO, SEONGSAN-GU, CHANGWON-SI, GYEONGSANGNAM-DO, 51532, KOREA TEL: +82-55-261-5559 / FAX: +82-55-261-5558
VIETNAM	TAIWAN
MITSUBISHI ELECTRIC VIETNAM CO., LTD. Vietnam Ho Chi Minh Service Center 11TH & 12TH FLOOR, VIETTEL TOWER B, 285 CACH MANG THANG 8 STREET, WARD 12, DISTRICT 10, HO CHI MINH CITY, VIETNAM TEL: +84-28-3910-5945 / FAX: +84-28-3910-5947 Vietnam Hanoi Service Center 14TH FLOOR, CAPITAL TOWER, 109 TRAN HUNG DAO STREET, CUA NAM WARD, HOAN KIEM DISTRICT, HA NOI CITY, VIETNAM TEL: +84-24-3937-8075 / FAX: +84-24-3937-8076	MITSUBISHI ELECTRIC TAIWAN CO., LTD. (TAIWAN FA CENTER) Taiwan Taichung Service Center NO. 8-1, GONGYEQU 16TH RD., XITUN DIST., TAICHUNG CITY 40768 , TAIWAN TEL: +886-4-2359-0688 / FAX: +886-4-2359-0689 Taiwan Taipei Service Center 11F, NO.88, SEC.6, ZHONGSHAN N. RD., SHILIN DIST., TAIPEI CITY 11155, TAIWAN TEL: +886-2-2833-5430 / FAX: +886-2-2833-5433 Taiwan Tainan Service Center 11F-1, NO.30, ZHONGZHENG S. RD., YONGKANG DIST., TAINAN CITY 71067, TAIWAN TEL: +886-6-252-5030 / FAX: +886-6-252-5031
INDONESIA	OCEANIA
PT. MITSUBISHI ELECTRIC INDONESIA Indonesia Service Center (Cikarang) JL. KENARI RAYA BLOK G2-07A, DELTA SILICON 5, LIPPO CIKARANG - BEKASI 17550, INDONESIA TEL: +62-21-2961-7797 / FAX: +62-21-2961-7794 Malaysia Service Center (Kuala Lumpur Service Center) LOT 11, JALAN 219, P.O BOX 1036, 46860 PETALING JAYA, SELANGOR DARUL EHSAN, MALAYSIA TEL: +60-3-7626-5032 Johor Bahru Service Center 9, Jalan Perjiran 4/6, Bandar Dato Onn, 81100 Johor. TEL: 07-3642250 / 2256 Pulau Pinang Service Center 25-G, Pusat Perniagaan Perdana Jaya, Jalan Permatang Rawa, 14000 Bukit Mertajam, Pulau Pinang TEL: +60-4-510-1838 / Fax: +60-4-510-1835	MITSUBISHI ELECTRIC AUSTRALIA PTY. LTD. Oceania Service Center 348 VICTORIA ROAD, RYDALMERE, N.S.W. 2116 AUSTRALIA TEL: +61-2-9684-7269/ FAX: +61-2-9684-7245
MALAYSIA	
MITSUBISHI ELECTRIC SALES MALAYSIA SDN. BHD. Malaysia Service Center (Kuala Lumpur Service Center) LOT 11, JALAN 219, P.O BOX 1036, 46860 PETALING JAYA, SELANGOR DARUL EHSAN, MALAYSIA TEL: +60-3-7626-5032 Johor Bahru Service Center 9, Jalan Perjiran 4/6, Bandar Dato Onn, 81100 Johor. TEL: 07-3642250 / 2256 Pulau Pinang Service Center 25-G, Pusat Perniagaan Perdana Jaya, Jalan Permatang Rawa, 14000 Bukit Mertajam, Pulau Pinang TEL: +60-4-510-1838 / Fax: +60-4-510-1835	
THAILAND	
MITSUBISHI ELECTRIC FACTORY AUTOMATION (THAILAND) CO., LTD. Thailand Service Center (Bangkok) 101, TRUE DIGITAL PARK OFFICE, 5TH FLOOR, SUKHUMVIT ROAD, BANGCHAK, PHRA KHANONG, BANGKOK, 10260 THAILAND TEL: +66-2-092-8600 / FAX: +66-2-043-1231-33	
INDIA	
MITSUBISHI ELECTRIC INDIA PVT., LTD. Service Head office and South India Service Center (Bangalore) CNC eXPerience Park, PLOT NO. 57/A, PEENYA PHASE 3, PEENYA INDUSTRIAL AREA, BANGALORE 560058, KARNATAKA, INDIA TEL : +91-80-4655-2121 Chennai Service Satellite Coimbatore Service Satellite Hyderabad Service Satellite North India Service Center (Gurgaon) PLOT 517, GROUND FLOOR, UDYOG VIHAR PHASE-III, GURUGRAM 122008, HARYANA, INDIA TEL : +91-124-463-0300 Ludhiana Service Satellite Panthnagar Service Satellite Delhi Service Satellite Jamshedpur Service Satellite Manesar Service Satellite West India Service Center (Pune) ICC-Devi GAURAV TECHNOLOGY PARK, UNIT NO.402, FOURTH FLOOR, NORTH WING, SURVEY NUMBER 191-192 (P), NEXT to INDIAN CARD CLOTHING COMPANY Ltd, OPP. VALLABH NAGAR, PIMPRI, PUNE- 411 018, MAHARASHTRA, INDIA TEL : +91-20-6819-2274 Kolhapur Service Satellite Aurangabad Service Satellite Mumbai Service Satellite West India Service Center (Ahmedabad) 204-209, 2ND FLOOR, 31FIVE, CORPORATE ROAD PRAHLADNAGAR, AHMEDABAD -380015, GUJARAT, INDIA TEL : + 91-79-6777-7888 Rajkot Service Satellite	

Notice

Every effort has been made to keep up with software and hardware revisions in the contents described in this manual. However, please understand that in some unavoidable cases simultaneous revision is not possible. Please contact your Mitsubishi Electric dealer with any questions or comments regarding the use of this product.

Duplication Prohibited

This manual may not be reproduced in any form, in part or in whole, without written permission from Mitsubishi Electric Corporation.

COPYRIGHT 2021-2024 MITSUBISHI ELECTRIC CORPORATION ALL RIGHTS RESERVED

MITSUBISHI ELECTRIC CORPORATION

HEAD OFFICE : TOKYO BLDG.,2-7-3 MARUNOUCHI,CHIYODA-KU,TOKYO 100-8310,JAPAN

MODEL	M800V/M80V Series
MODEL CODE	100-754
Manual No.	IB-1501623